PHASE II ENVIRONMENTAL SITE ASSESSMENT AND REMEDIAL EXCAVATION REPORT

125 State Street
Santa Barbara, California

Prepared for:

The City of Santa Barbara

Prepared by:

Rincon Consultants, Inc.
July 15, 2010

Rincon Consultants, Inc.
790 East Santa Clara Street
Ventura, California 93001

805 641 1000
FAX 641 1072

info@rinconconsultants.com
www.rinconconsultants.com

July 15, 2010
Project 08-25430

Cenen Aparicio
City of Santa Barbara
Public Works Department
PO Box 1990
Santa Barbara, California 93102

Phase II Environmental Site Assessment and Remedial Excavation Report
125 State Street
Santa Barbara, California

Dear Mr. Aparicio:

On behalf of the City of Santa Barbara Redevelopment Agency (RDA), Rincon Consultants, Inc. conducted this Phase II Environmental Site Assessment (ESA) and remedial excavation at the property located at 125 State Street, Santa Barbara, California. Total lead, soluble lead, total extractable petroleum hydrocarbons (TEPH) in the oil range (TPHo) and in the diesel range (TPHd), and polynuclear aromatics (PNAs) have been detected at concentrations exceeding both the County of Santa Barbara Fire Prevention Division (FPD) Investigation Levels and exceeding cleanup goals proposed in the Remedial Action Plan (RAP) for the subject property dated September 25, 2009. This Phase II ESA and remedial excavation were conducted in accordance with the September 25, 2009, Phase II ESA Work Plan and RAP and the specifications of City of Santa Barbara Bid 4951. The work was also completed in accordance with City of Santa Barbara permit numbers BLD2010-00759, PBW2010-00694, and PBW2010-00604 and the Air Pollution Control District exemption permit 13404.

If you have any questions, or if we can be of any future assistance, please do not hesitate to contact us.

Sincerely,
RINCON CONSULTANTS, INC.

Shawn Decker, MESM, LEED AP
Project Manager, Environmental Services

Walter Hamann, PG, CEG, REA II
Vice President, Environmental Services

REGISTERED GEOLOGIST
WALTER L. HAMANN
CERTIFIED ENGINEERING GEOLOGIST
STATE OF CALIFORNIA

Table of Contents

Phase II Environmental Site Assessment and Remedial Excavation
125 State Street
Santa Barbara, California

EXECUTIVE SUMMARY 4
Phase II ESA *5*
Remedial Excavation *8*
INTRODUCTION 11
PHYSICAL SETTING 12
Topography *12*
Geology and Hydrogeology *13*
PROJECT HISTORY 14
PROPOSED REMEDIATION CLEANUP GOALS 19
REMEDIAL METHOD 21

PHASE II ESA 22

PURPOSE AND SCOPE 22
METHODOLOGY 23
Site Characterization *23*
Boring Locations *23*
Drilling and Soil Sampling *24*
Laboratory Analysis *25*
RESULTS 26
Soil Sampling *26*
DISCUSSION 27
Soil Sampling and Analysis *27*
CONTAMINATION EXTENT 31
Lead and Soluble Lead *31*
TEPH *32*
PNAs *32*
PHASE II ESA CONCLUSION 32

REMEDIAL EXCAVATION 33

PURPOSE AND SCOPE 33
METHODOLOGY 34
Remedial Excavation *34*
Mobilization *35*
Excavation *35*
Backfill *37*
Transportation and Disposal *37*
Confirmation Sampling *38*
Laboratory Analysis *39*
RESULTS 39
Soil Sampling *39*

Groundwater Sampling *40*
DISCUSSION 41
Soil Sampling and Analysis *41*
Groundwater *46*
Backfill *46*
CONCLUSIONS 47
RECOMMENDATIONS 48
LIMITATIONS 49

Figures

Figure 1 – Vicinity Map
Figure 2 – Site Map

Phase II Environmental Site Assessment Figures

Figure 3 – Boring Locations Map
Figure 4 –STLC Lead Concentrations in Soil Samples Collected 3 Feet Below Grade Map
Figure 5 –STLC Lead Concentrations in Soil Samples Collected 4 Feet Below Grade Map
Figure 6 –STLC Lead Concentrations in Soil Samples Collected 5 Feet Below Grade Map
Figure 7 –TEPH Concentrations Map

Remedial Excavation Figures

Figure 8 – Excavation Area and Confirmation / Verification Sample Location Map
Figure 9 – Confirmation Sampling Total Lead Concentration Map
Figure 10 – Confirmation Sampling STLC Lead Concentration Map
Figure 11 – Verification Sampling TEPH Concentration Map
Figure 12 – Site Photos
Figure 13 – Site Photos

Tables

Table 1 – Phase II ESA Soil Analytical Results, Lead
Table 2 – Phase II ESA Soil Analytical Results, TEPH
Table 3 – Phase II ESA Soil Analytical Results, PNAs
Table 4 – Confirmation Soil Analytical Results, Lead
Table 5 – Confirmation Soil Analytical Results, TEPH
Table 6 – Confirmation Soil Analytical Results, PNAs
Table 7 – Groundwater Analytical Results, Dissolved Lead
Table 8 – Backfill Analytical Results, Metals, pH, Asbestos, and Pesticides

Appendices

Appendix 1 – Boring Logs
Appendix 2 – Phase II ESA Analytical Reports
Appendix 3 – Permits
Appendix 4 – Tree Inventory and Tree Protection Plan
Appendix 5 – Confirmation Soil Sampling Plan
Appendix 6 – Confirmation Sampling Analytical Reports
Appendix 7 – Disposal Manifests
Appendix 8 – Compaction Test Report

Executive Summary

This report presents the results of a Phase II Environmental Site Assessment (ESA) and remedial excavation conducted by Rincon Consultants, Inc. on behalf of the City of Santa Barbara Redevelopment Agency (RDA) at the property located at 125 State Street, Santa Barbara, California (Figure 1, Vicinity Map). The subject property consists of a 21,967 square foot (0.5 acre) property and a 403 square foot property. The subject property is identified by Assessor Parcel Numbers (APN) 033-075-012 and -014 and a portion of APN 033-010-012 (Figure 2, Site Map). The subject property is currently vacant land with the exception of a small structure known as the Signalman's building on the northern property boundary. The subject property is covered by discontinuous asphalt, generally buried by approximately 0.5 feet of soil. The subject property is located between State Street and Kimberly Avenue. Access to the subject property is available from a gate on Kimberly Avenue and from a footpath on State Street.

The Phase II ESA and remedial excavation were completed in accordance with the September 25, 2009, Phase II Environmental Site Assessment Work Plan and Remedial Action Plan (RAP) for the subject property and the specifications of City of Santa Barbara Bid 4951. The remedial excavation was also completed in accordance with City of Santa Barbara permit numbers BLD2010-00759, PBW2010-00694, and PBW2010-00604 and the Air Pollution Control District exemption permit 13404.

The purpose of the Phase II ESA was to delineate constituents detected in soil samples collected during previous environmental site assessments. During the current assessment, soil samples were collected to delineate lead, total extractable petroleum hydrocarbons (TEPH), and polynuclear aromatics (PNAs) in the soil at the subject property. The findings of the Phase II ESAs completed at the subject property were used to develop a remedial strategy for the subject property (July 15, 2009, Feasibility Study). A remedial excavation was conducted at the subject property to remove soil impacted with lead, TEPH, and PNA concentrations exceeding cleanup goals for the subject property. The current assessment and remedial excavation were not performed under the regulatory oversight of any government agency. However, the sampling protocol followed the methods required by the Santa Barbara County Fire Department, Fire Prevention Division (FPD).

The September 25, 2009, Phase II ESA Work Plan and RAP included the following cleanup goals for the subject property:

- Total Lead- 400 milligrams per kilogram (mg/kg)
- Soluble Threshold Limit Concentration (STLC) Lead- 5 milligrams per liter (mg/L)
- Total Petroleum Hydrocarbons (TPH)- 100 mg/kg*
- The PNA Benzo(a)pyrene- 210 micrograms per kilogram (μg/kg)

* The cleanup goal for TPH was set at the FPD Investigation Level for TPH of 100 mg/kg. A more appropriate cleanup goal for the heavy range hydrocarbons detected at the subject

property is the San Francisco Regional Water Quality Control Board (SFRWQCB) Soil Screening Level (ESL) for direct exposure to TPH in soil at residential sites of 1,800 mg/kg.

Phase II ESA

On February 11, 2010, fifteen borings were advanced with a Geoprobe drill rig on the subject property by HydroGeoSpectrum of Los Angeles, California, under the direction of Rincon. Soil samples were obtained at 0.5, 3, 4, 5, and 8 feet below grade. Soil sampling depths and boring termination depths varied depending on the target constituent. Boring locations were chosen based on contaminant concentrations detected during the previous Phase II ESAs conducted at the subject property. The locations of the borings are depicted on Figure 3. Select soil samples were analyzed for total lead by EPA Method 6000/7000, TEPH (diesel and oil range organics) by EPA Method 8015M, and PNAs by EPA Method 3550B. Select soil samples were also analyzed for soluble threshold limit concentration (STLC) lead by EPA Method 6000/7000 and for toxicity characteristic leaching procedure (TCLP) lead by EPA Method 6000/7000.

No obvious soil discoloration or odors were noted and non-detect photoionization detector (PID) readings were measured in the soil samples collected from the borings. Asphalt existed in areas of the site at the surface or at approximately 0.5 feet below grade. The soil encountered in the borings was comprised primarily of poorly graded brown sand and silt mixtures to approximately 3 feet below grade with varying amounts of clay encountered at depths greater than 3 feet below grade. Groundwater was not encountered in the borings.

A summary of the soil sampling analytical results is included in Tables 1, 2, and 3. Copies of the analytical reports and chain of custody documentation are included in Appendix 2. The following compares the detected concentrations of lead, TEPH, and PNAs to cleanup goals for the subject property. The cleanup goals are described in the Proposed Remediation Cleanup Goals section of this report and the detected concentrations of lead, TEPH, and PNAs are presented in more detail and compared to other regulatory action levels later in the Phase II ESA section of this report.

Lead

A purpose of this assessment was to delineate total lead concentrations to below the cleanup goal for total lead of 400 mg/kg in the soil at the subject property. Total lead was detected at concentrations ranging from 6.1 to 1,200 mg/kg, in the 14 soil samples analyzed for total lead. Total lead was detected at concentrations exceeding 400 mg/kg in 3 of the 14 soil samples analyzed for total lead. Total lead was detected at concentrations of 1,200 mg/kg, 960 mg/kg, and 400 mg/kg in soil samples B69-3 (soil sample collected from boring 69 at 3 feet below grade), B70-3, and B71-5. Borings B69, B70, and B71 are located near the southern corner of the subject property. Boring B69 is located adjacent to a concrete pad near the southwestern property boundary and borings B70 and B71 are located adjacent to the southeastern property boundary near the southern corner of the subject property. Total lead was detected during previous assessments at concentrations exceeding 400 mg/kg in

soil samples B33-05 (620 mg/kg), B42-2 (615 mg/kg), and B53-0.5 (639 mg/kg). Boring B33 is located adjacent to the southeastern property boundary, adjacent to the State Street Hotel structure, boring B42 is located adjacent to the southeastern property boundary closer to the southern corner of the subject property, and boring B53 is located near the southern corner of the subject property.

The Phase II ESA delineated the vertical extent of total lead to concentrations below 400 mg/kg at the subject property, with the exception of vertical delineation at the location of boring B71. Total lead was detected at a concentration of 400 mg/kg in the soil sample collected from boring B71 at 5 feet below grade. No deeper soil samples were collected from that boring.

The Phase II ESA delineated the lateral extent of total lead to concentrations below 400 mg/kg within the subject property boundary. However, the southeastern and southwestern extent of total lead concentrations is not laterally delineated past the southeastern and southwestern subject property lines. No soil samples were collected from outside the subject property lines.

In addition, the levels of lead were compared to TTLC levels adopted by the Department of Toxic Substances Control (DTSC). The TTLC levels are used to determine whether soil would be classified as a hazardous or non-hazardous waste for disposal purposes. Total lead was detected at a concentration exceeding the TTLC threshold for lead of 1,000 mg/kg in the soil sample collected from boring B69 at 3 feet below grade (1,200 mg/kg).

Soluble Lead

A purpose of this assessment was to delineate STLC lead concentrations to below the cleanup goal for the subject property. The cleanup goal for STLC lead at the subject property is the STLC for lead of 5 mg/L. Similar to total lead at the subject property, data from the Phase II ESAs completed at the subject property delineate the vertical extent of STLC lead to 5 mg/L with the exception of boring B71. STLC lead was detected at a concentration of 21 mg/L in the soil sample collected from 5 feet below grade in boring B71.

The Phase II ESA delineated the lateral extent of STLC lead to concentrations below 5 mg/L within the subject property boundary. STLC lead was detected at concentrations exceeding 5 mg/L in the borings (B25, B28, B33, B37, B42, B48, B54, B60, B70 and B71) located adjacent to the southeastern property boundary and in boring B57 located adjacent to the southwestern property boundary. No soil samples were collected from outside the subject property boundaries.

STLC lead was detected at concentrations exceeding 5 mg/L in 6 of the 11 soil samples analyzed for STLC lead. Soil samples containing STLC lead concentrations exceeding 5 mg/L warrant TCLP lead analysis. None of the soil samples analyzed for TCLP lead exceeded the threshold for TCLP lead of 5 mg/L. Based on the detected concentrations of

STLC lead above 5 mg/L and the detected concentrations of TCLP lead below 5 mg/L the soil produced during the Phase II ESA was disposed as a Non-RCRA hazardous waste. In addition, the lead analytical data from the Phase II ESA was used to profile the soil for the remedial excavation as a Non-RCRA hazardous waste.

TEPH

TEPH was detected in 12 of the 20 soil samples analyzed for TEPH during the Phase II ESA. Two of the 12 detections exceeded the ESL for TPH of 1,800 mg/kg (the cleanup goal for the subject property). TEPH was detected in the soil samples collected form 0.5 feet below grade in borings B61 and B67, at concentrations of 2,889 mg/kg and 3,146 mg/kg. The TEPH detected in the soil samples is predominately in the oil range (C_{23} to C_{40}).

Seven of the 12 TEPH detections were above the FPD Investigation Level of 100 mg/kg. The lateral extent of TEPH concentrations in the shallow soil (0.5 feet below grade) is not delineated to the FPD Investigation Level for TPH of 100 mg/kg at the subject property. The vertical extent of TEPH to 100 mg/kg is delineated at the subject property and the lateral extent of TEPH to 100 mg/kg is delineated in the soil deeper than 0.5 feet below grade. Borings advanced adjacent to the northwestern property boundary contained TEPH concentrations exceeding 100 mg/kg. No soil samples were collected from outside the subject property boundaries. It is possible that TEPH concentrations exceeding 100 mg/kg exist in the soil to the northwest of the subject property.

PNAs

The PNAs acenaphthylene, anthracene, benzo(a)anthracene, benzo(a)pyrene, benzo(b)flouranthene, benzo(ghi)perylene, benzo(k)fluoranthene, chrysene, dibenz(a,h)anthracene, flouranthene, indeno(1,2,3-cd)pyrene, phenanthrene, and pyrene were detected at concentrations above the method detection limit in 11 of the 16 soil samples analyzed for PNAs. The detected concentrations of PNAs were compared to United States Environmental Protection Agency (USEPA) Soil Screening Levels (SLs) for PNAs at residential (SL-R) and at industrial (SL-I) sites. Benzo(a)pyrene is the only PNA that has been detected above the SL-I (the cleanup goal for the subject property). Benzo(a)pyrene was detected at a concentration of 250 μg/kg in soil sample B67-0.5 which slightly exceeds the SL-I for benzo(a)pyrene of 210 μg/kg. Benzo(a)pyrene was also detected during the April 2009 Phase II ESA at a concentration of 603 μg/kg in soil sample B12-0.5.

The following PNAs were detected during the current Phase II ESA at concentrations exceeding their respective SL-R:

- Benz(a)anthracene, benzo(a)pyrene, benzo(b)flouranthene, dibenz(a,h)anthracene, and indeno(1,2,3-cd)pyrene.
- Soil samples B61-0.5, B61-5, B62-5, B66-0.5, B67-0.5, and B67-3.

The Phase II ESAs completed at the subject property adequately delineate total lead, STLC lead, TPH, and PNA concentrations in the soil at the subject property to cleanup goals. The findings of the Phase II ESAs were used to develop and implement the remedial strategy described in the remedial excavation section of this report.

Remedial Excavation

Between May 3 and 17, 2010, areas of the subject property were excavated utilizing a CAT 325 CL Excavator and a CAT 950 Loader. A 2,000 gallon water truck equipped with a fire hose was utilized for dust control. Remedial Transportation Services of Bakersfield, California excavated the soil under the direction of Rincon Consultants, Inc. The excavation was overseen by the City of Santa Barbara Environmental Specialist and the third party oversight of TRAK Environmental.

The preliminary excavation boundary was based on the findings of the Phase II ESAs conducted at the subject property. Based on field evidence of contamination and on the analytical results of confirmation soil samples collected from the excavation sidewalls and bottom the excavation was extended to the dimensions depicted in Figure 8. Field evidence of contamination included burned and unburned railroad related debris, encountered between approximately 2 and 6 feet below grade near the southern corner of the subject property and near the southwestern subject property line. The excavation was temporarily stopped in this area so that the onsite archaeologist could investigate the debris for historical artifacts. It appears that the railroad dumped used and broken items in this area of the subject property during the stop at the adjacent train station. There may have also been some dumping from the former resident of the existing Signalman's Building on the subject property.

Excavated soil was segregated and temporarily stockpiled on Visqueen. Once there was enough stockpiled soil to allow for continuous loading, the soil was loaded into 25 ton end dump trucks. The following quantities of soil were transported offsite to the following two facilities:

- A total of **97.9 tons** of non-hazardous soil was disposed at the Clean Harbors Chiquita Canyon Landfill located at 29201 Henry Mayo Drive, Castaic, California.

- A total of **1,463 tons** of California hazardous soil was disposed at the Clean Harbors Buttonwillow Landfill located at 2500 West Lokern Road, Buttonwillow, California.

The non-hazardous soil was from the TEPH and PNA impacted area, located near the northern corner of the subject property. The California hazardous soil was from the lead impacted areas, primarily located along the southeastern and southwestern property lines and in the area of a subsurface concrete pad formerly utilized as a foundation for an above ground water tank.

Lead

The cleanup goal for total lead in the soil at the subject property is set at the SL for total lead in soil of 400 mg/kg. Total lead was detected at concentrations exceeding 400 mg/kg in 4 of the 106 confirmation soil samples analyzed for total lead. Total lead was detected at concentrations exceeding 400 mg/kg in excavation sidewall confirmation soil samples CS8 (470 mg/kg), CS11 (1,900 mg/kg), CS31 (1,400 mg/kg), and CS35 (440 mg/kg). Total lead was not detected above 400 mg/kg in any of the excavation bottom confirmation soil samples. The excavation was extended to either the property line or until lead concentrations were below cleanup goals. The excavation was constrained by the southeastern and southwestern property lines. No soil samples have been collected from outside the limits of the subject property.

Total lead concentrations detected in the confirmation soil samples collected from the final excavation extent on the subject property were generally within the reported background levels for lead in soil in California of 12.4 mg/kg to 97.1 mg/kg (5 of the confirmation samples contained lead concentrations at slightly higher concentrations of between 100 mg/kg and 120 mg/kg). In our experience regulatory agencies do not require the cleanup of soil to below background concentrations.

Fourteen of the 67 confirmation soil samples collected from the final excavation extent on the subject property contained lead concentrations exceeding the FPD Investigation Level for lead in soil of 50 mg/kg and 7 of the 7 confirmation soil samples collected from the final excavation extent at the southeastern and southwestern subject property line contained lead concentrations exceeding the FPD Investigation Level for lead in soil of 50 mg/kg.

In addition, the levels of lead were compared to TTLC levels adopted by the DTSC. The TTLC levels are used to determine whether soil would be classified as a hazardous or non-hazardous waste for disposal purposes. Total lead was detected in confirmation soil samples CS11 and CS31 at concentrations of 1,900 mg/kg and 1,400 mg/kg. None of the other confirmation soil samples contained total lead concentrations exceeding the TTLC level of 1,000 mg/kg. All of the soil disposed from the lead impacted area was disposed as a California hazardous waste.

Soluble Lead

A total of 52 confirmation soil samples contained total lead at a concentration exceeding 50 mg/kg. A total lead concentration exceeding 50 mg/kg warrants STLC analysis. Soil containing an STLC concentration above 5 mg/L is considered to be a California hazardous waste. The highest STLC lead concentration detected in the confirmation soil samples was 49 mg/L (CS59). The excavation was extended until confirmation soil samples did not contain STLC lead concentrations exceeding 5 mg/L or to the property line. With the exception of the confirmation soil samples collected from the excavation sidewalls at the southeastern and southwestern property boundaries, none of the confirmation soil samples collected from the final excavation extent contained STLC lead concentrations exceeding 5

mg/L.

Eleven of the confirmation soil samples collected during the remedial excavation were analyzed for TCLP lead. The 11 confirmation soil samples analyzed for TCLP lead were comprised of the 2 confirmation soil samples containing the highest concentrations of STLC lead and the confirmation soil samples containing STLC lead concentrations above 5 mg/L that were collected from the southeastern and southwestern excavation sidewalls. TCLP lead was detected at concentrations of 4.9 mg/L and 1.8 mg/L in confirmation soil samples CS35 (STLC lead 42 mg/L) and CS59 (STLC lead 49 mg/L). TCLP lead was detected at concentrations ranging from 0.74 mg/L to 2.5 mg/L in the confirmation soil samples collected from the southeastern and southwestern excavation sidewalls at the subject property boundary. None of the soil samples analyzed for TCLP lead exceeded the TCLP lead threshold of 5 mg/L. The confirmation sampling STLC lead and TCLP lead analytical data confirm the profiling of the soil as a California hazardous waste (the soil was originally profiled as a California hazardous waste with the STLC lead and TCLP lead analytical data from the Phase II ESA).

TEPH

None of the confirmation soil samples contained TEPH concentrations exceeding the ESL for TPH of 1,800 mg/kg.

TPHd was detected slightly above the FPD Investigation Level for TPH of 100 mg/kg in confirmation soil sample VS10, at a concentration of 110 mg/kg. TPHo was detected at a concentration exceeding the FPD Investigation Level for TPH of 100 mg/kg in 6 of the 12 confirmation samples analyzed for TEPH. TPHo was detected at concentrations slightly exceeding 100 mg/kg in confirmation soil samples VS2 (170 mg/kg), VS4 (170 mg/kg), VS5 (120 mg/kg), and VS6 (110 mg/kg). TPHo was detected slightly higher in confirmation soil samples VS10 (990 mg/kg) and VS12 (340 mg/kg). TPHo is a heavy range hydrocarbon with a carbon chain of C_{23} to C_{40}. Heavy range hydrocarbons such as TPHo are mainly insoluble and immobile.

PNAs

Six of the confirmation soil samples were analyzed for PNAs and PNAs were detected above the method detection limit in 5 of the 6 soil samples analyzed for PNAs. None of the detected concentrations of PNAs exceeded the site cleanup goals for PNAs. The site cleanup goals for PNAs are set at the SL for PNAs at commercial and industrial sites. The PNAs acenaphthylene, anthracene, benzo(a)anthracene, benzo(a)pyrene, benzo(b)flouranthene, benzo(ghi)perylene, benzo(k)fluoranthene, chrysene, dibenz(a,h)anthracene, flouranthene, indeno(1,2,3-cd)pyrene, phenanthrene, and pyrene were detected at concentrations above the method detection limit in 5 of the 6 soil samples analyzed for PNAs. The PNA benzo(a)pyrene was detected at concentrations exceeding the SL-R for benzo(a)pyrene in confirmation soil samples VS2 (45 μg/kg), VS5 (19 μg/kg),

VS7 (20 μg/kg), VS9 (19 μg/kg), and VS12 (27 μg/kg). None of the other PNAs detected in the 5 soil samples exceeded the SL-R.

The remedial excavation removed soil containing lead, TEPH, and PNA concentrations exceeding cleanup goals. We believe that if the subject property were accepted for review by the FPD that the FPD would grant environmental closure for the subject property based on the following:

- Confirmation soil samples collected from the final excavation extent on the subject property contain lead concentrations below the cleanup goal of 400 mg/kg and are within or very slightly exceed background concentrations for lead in soil in California of 12.4 mg/kg to 97.1 mg/kg. Note that the soil samples collected from the final excavation extent at the southeastern and southwestern property lines contain higher lead concentrations.

- Soluble lead concentrations detected in the confirmation soil samples collected from the soil remaining on the subject property are below the cleanup goal for STLC lead of 5 mg/L.

- TEPH concentrations detected in the confirmation soil samples are below the ESL for TPH of 1,800 mg/kg.

- TEPH concentrations detected in the confirmation soil samples were primarily in the oil range (TPHo). Heavy range hydrocarbons are mainly insoluble and immobile.

- PNA concentrations detected in the confirmation soil samples are below the SL-I for PNAs.

- There are tentative plans to redevelop the site with a children's museum. It is our understanding that the site will likely be paved with concrete or asphalt and such a structure will likely be slab on grade. Limited exposed soil is expected under the current site design.

- TPH and dissolved lead have not been detected in the groundwater at the subject property.

Introduction

On behalf of the City of Santa Barbara Redevelopment Agency (RDA), Rincon Consultants, Inc. conducted a Phase II Environmental Site Assessment (ESA) and used the results of the Phase II ESA to complete a remedial excavation of the property located at 125 State Street, Santa Barbara, California (Figure 1). The subject property consists of a 21,967 square foot

(0.5 acre) parcel and a 403 square foot parcel (Figure 2). The subject property is identified as APNs 033-075-012 and -014 and a portion of APN 033-010-012. The subject property is currently developed with a small structure known as the Signalman's Building which was used by the railroad company as part of its railroad operations. The majority of the subject property is vacant land covered by discontinuous areas of asphalt that may be buried by up to 6 inches of soil. Access to the subject property is available from a walkway on State Street and a gate on Kimberly Avenue. The subject property is bound by Kimberly Avenue to the southwest, the railroad right of way/easement to the northwest, State Street to the northeast, and a hotel and restaurant to the southeast.

Total lead, soluble lead, total extractable petroleum hydrocarbons (TEPH) in the diesel range (TPHd) and in the oil range (TPHo), and polynuclear aromatics (PNAs) have been detected at concentrations exceeding the County of Santa Barbara Fire Prevention Division (FPD) Investigation Levels in the soil at the subject property. There are tentative plans to redevelop the subject property with a children's museum pending environmental review. The remedial excavation described in this report removed lead, TEPH, and PNA impacted soil from the subject property in accordance with the September 25, 2009, Phase II Environmental Site Assessment Work Plan and Remedial Action Plan, the specifications of City of Santa Barbara Bid 4951, encroachment permits from the City of Santa Barbara, and an exemption permit with the Air Pollution Control District (APCD).

The following sections describe the physical setting, provide an overview of the project history, describe the pre-remediation contamination extent, the contaminant concentration cleanup goals for the subject property, and the remedial strategy. The remainder of the report is divided into two sections, the first section describes the Phase II ESA completed at the subject property and the second section describes the remedial excavation completed at the subject property. The sampling and analytical testing methods, the results of the sampling and testing program, and conclusions and recommendations are described for the Phase II ESA and for the remedial excavation.

Physical Setting

Topography

The current USGS topographic map of the Santa Barbara Quadrangle (1952, photorevised 1988) indicates that the site is situated at an elevation of approximately 13 feet above Mean Sea Level with essentially flat topography. Topography in the general area gently slopes to the south towards the Pacific Ocean.

Geology and Hydrogeology

Site Geology

The subject property is located within the western edge of the Transverse Ranges Geomorphic Province, which is characterized by east-west trending faults, folds, and mountain ranges. Mountain ranges in the Transverse Ranges are comprised of rocks that are progressively older from the west to east. Rocks within the Transverse Range include Precambrian metamorphic and igneous rocks that comprise the core of the San Gabriel and Santa Monica Mountains. These rocks are overlain by Miocene aged marine sediments of the Pico, Monterey, Repetto, and other formations. East-west trending folds and faults are predominating in this area. Valleys, faults, and downwarps separate the mountain ranges in this area. Mid to late Pleistocene faulting uplifted the area, resulting in the present-day landforms.

The subject property is located on the gently sloping Santa Barbara Coastal Plain, which is comprised of recent-aged alluvium, deposited along raised marine terraces. These alluvial deposits were derived from older sedimentary deposits within the Santa Ynez Mountains north of the site, and overlie the Quaternary aged Santa Barbara Formation.

Mountain ranges within this province include the Santa Ynez, Santa Susana, Topatopa, San Gabriel, Sierra Pelona, and San Bernadino Mountains. Sedimentary basins include the Santa Clara River, Big Tujunga Canyon, San Gabriel River, and Los Angeles River. The Pacific Ocean is located approximately 1,000 feet to the south of the subject property.

Geologic environments represented in the rocks found in the Transverse Ranges includes periods of non-marine deposits (Saugus, Mint Canyon, Sespe formations), marine deposits (Pico, Repetto, Monterey, San Fransisquito), volcanics (Conejo Volcanic series), and metamorphic or igneous rocks (Lowe Grandiorite, Pelona Schist, Mendenhall Gneiss). Important faults within this province include the San Andreas, San Gabriel, Red Mountain, Cucamonga, Raymond Hill, San Fernando, and Ventura faults. Many historical earthquakes have been documented along these and other faults. No mapped faults are shown on the Santa Barbara Quadrangle geologic map (Dibblee, 1986) as crossing the subject property. The inferred trace of the potentially active Mesa Fault is located approximately one mile to the southwest of the subject property.

According to the USGS Geologic Map of the Santa Barbara Quadrangle (Thomas Dibblee, Jr., 1986), the subject property is underlain by Quaternary-aged unconsolidated floodplain deposits of silt, sand, and gravel. The soil encountered in the remedial excavation and in borings advanced during environmental assessment work at the subject property was comprised primarily of poorly graded brown sand and silt mixtures to approximately 3 feet below grade, with varying amounts of clay encountered at depths greater than 3 feet below grade.

Regional Groundwater Occurrence and Quality

The project site is located within the Santa Barbara Hydrologic sub-area of the South Coast Hydrologic Unit commonly known as the Santa Barbara Groundwater Basin. During the current May 2010 remedial excavation, groundwater was encountered at approximately 8 feet below grade. Between August 11 and 13, 2008, TRAK Environmental encountered groundwater in borings drilled on the subject property at a depth of approximately 9 to 10 feet below grade.

Mission Creek is located approximately 140 feet to the southwest of the subject property.

The reported regional groundwater flow in the shallow zone is toward the ocean (south to southeast), however, the groundwater flow direction in the site vicinity has ranged from northwest to northeast in 1993, east in 1995, and north to northeast in 1996. The groundwater flow direction in the site vicinity is affected by a continuous and permanent groundwater dewatering operation associated with the State Street underpass beneath Highway 101.

Project History

The subject property has not been accepted for oversight by the FPD. However, the environmental work performed by Rincon at the subject property is in general conformance with FPD protocol. If the subject property were accepted by the FPD, oversight would be through the FPD Site Mitigation Unit (SMU) Program. The SMU Program provides regulatory oversight for the assessment and remediation of all unauthorized hazardous materials releases other than Leaking Underground Fuel Tank Program sites. The assessment and remediation of the subject property was conducted voluntarily.

The subject property is in a primarily commercial and residential area of the City of Santa Barbara. Commercial businesses, vacant buildings, and unfinished commercial lots front State Street near the subject property. The railroad runs parallel to the northwestern subject property line and a railroad station is located on the opposite side of the railroad tracks from the subject property, to the northwest. Residential and commercial land uses exist to the west of the subject property. Commercial and light industrial land uses exist to the east of the subject property. Commercial land uses exist to the south and north of the subject property. The Pacific Ocean is located approximately 1,200 feet to the south of the subject property.

The following environmental documents have been prepared for the subject property:

- Applied Environmental Technologies, Inc., *Preliminary Environmental Site Assessment and Limited Subsurface Investigation, Assessor Parcel Numbers 033-010-002-6, 033-010-003-4, and 033-010-009-2,* Santa Barbara, California, October 1992.
- Rincon Consultants, Inc., *Phase I Environmental Site Assessment,* 125 State Street, Santa Barbara, California, May 12, 2008.
- TRAK Environmental, *Phase II ESA, Report of Geophysical Survey, Soil and Groundwater Sampling,* 125 State Street, Santa Barbara, California, September 26, 2008.
- TRAK Environmental, *Inspection Report for Possible Asbestos and Lead Based Paint, Signalman's Building,* 125 State Street, Santa Barbara, California, September 26, 2008.
- Rincon Consultants, Inc., *Site Assessment and Feasibility Study Work Plan,* 125 State Street, Santa Barbara, California, February 9, 2009.
- Rincon Consultants, Inc., *Phase II Environmental Site Assessment,* 125 State Street, Santa Barbara, California, July 15, 2009.
- Rincon Consultants, Inc., *Phase II Environmental Site Assessment Work Plan and Remedial Action Plan,* 125 State Street, Santa Barbara, California, September 25, 2009.

The October 1992 report prepared by Applied Environmental Technologies, Inc. (AET) describes AET's assessment of several properties. This review only describes AET's findings for the subject property. On October 19, 1992, AET installed 2 nested soil gas probes consisting of 2 probes at each location for a total of 4 soil gas probes on the subject property. The soil gas probes were installed to depths of 5 and 9 feet below grade. Volatile organic compounds (VOCs) were not detected in the soil gas probes. On October 22, 1992, AET excavated a test pit on the subject property to determine the nature of magnetic anomalies detected on the subject property by a magnetic survey. A 3 foot thick concrete pad was encountered in the test pit at approximately 1.5 feet below grade. Reportedly the concrete pad was utilized to support a large aboveground water tank which historically serviced the railroad yard.

AET reports that contamination was detected on the south side of the railroad tracks during an excavation for the installation of a storm drain. The AET report does not indicate the location of the storm drain, if this area was on the subject property, what type of contamination was detected, and at what depth the contamination was detected.

Rincon Consultants, Inc. completed a Phase I Environmental Site Assessment (ESA) Report for the subject property dated May 12, 2008. Historical sources reviewed as part of the Phase I indicate that the subject property was developed with a residential structure and a structure used as a public store from at least 1892 to 1901, was vacant land from at least 1907 to 1928, developed with the Signalman's Building in 1930, developed with a storage structure near the northwestern corner of the subject property in the 1930-1950 Sanborn map, developed with a small structure adjacent to Kimberly Avenue and a dirt parking lot across the extent of the property from at least 1966 to 1975, and the subject property appears to be vacant with the exception of the Signalman's Building from 1982 to the present. According to the environmental documents reviewed, an automobile sales lot existed on the subject property from at least 1962 to the late 1970s.

TRAK completed a Phase II ESA Report for the subject property dated September 26, 2008. On August 25, 2008, TRAK drilled 9 borings and collected soil and groundwater samples from the subject property. The September 2008 report also describes a geophysical survey completed by TRAK of the subject property. Groundwater was encountered in 7 of the borings at depths ranging from 9.3 to 9.9 feet below grade. Select soil samples were analyzed for total petroleum hydrocarbons (TPH) full carbon chain, VOCs including oxygenates, chlorinated herbicides, and Title 22 metals. TPH and VOCs were not detected in the groundwater samples at concentrations exceeding the laboratory practical quantitation limits. Chlorinated herbicides, VOCs, and TPH as gasoline range organics (TPHg) and as diesel range organics (TPHd) were not detected at concentrations exceeding the laboratory practical quantitation limits in the soil samples analyzed for these constituents. TPH as oil range organics (TPHo) was detected in 4 of the 16 soil samples analyzed for TPH. TPHo was detected at concentrations of 568 and 61.8 milligrams per kilogram (mg/kg) in the soil samples collected from 0.5 and 3 feet below grade in soil boring B4, drilled adjacent the railroad tracks on the northwestern subject property boundary. TPHo was detected at concentrations of 68.9 and 50.2 mg/kg in the 0.5 foot samples collected from borings B1 and B2. TPHo was not detected in the 3 foot samples collected from borings B1 and B2. Based on the soil boring locations and the analytical results it appears that TPH impacted soil is limited to the northwestern property boundary adjacent to the railroad tracks.

Varying concentrations of metals were detected in the 16 soil samples analyzed for total metals during the TRAK Phase II ESA. Arsenic was detected at concentrations ranging from 2.81 to 8.31 mg/kg which exceeds the SL for arsenic at residential sites of 0.39 mg/kg. Background concentrations of arsenic found in California soils range from 0.59 to 11.0 mg/kg (Bradford et al., March 1996). The USEPA states that generally they do not require cleanup below natural background levels. In light of this fact and in our experience regulatory agencies typically consider the use of local or regional background concentrations as the threshold concentration. The detected concentrations of arsenic (2.81 to 8.31 mg/kg) in soil samples collected during the TRAK Phase II ESA are below or within the range of normal background concentrations of arsenic found in California soils (0.59 to 11.0 mg/kg).

Lead was detected in 3 of the 16 soil samples at concentrations exceeding the FPD Investigation Level for lead of 50 mg/kg. Lead was detected in the soil samples collected

from 0.5 feet below grade in borings B6, B8, and B9 at total lead concentrations of 228, 84.4, and 85.7 mg/kg and soluble threshold limit concentration STLC lead concentrations of 14.3, 3.38, and 4.50 milligrams per liter (mg/L). One of the STLC lead concentrations exceeds the STLC for lead of 5 mg/L. Soil that is to be disposed as a waste material containing soluble lead concentrations over 5 mg/L is required to be disposed as a California hazardous waste. The soil sampling analytical results for TPH, total lead, and STLC lead from the TRAK Phase II ESA are included in Tables 1 and 2 of this report.

Based on the results of the Phase II ESA completed by TRAK and presented in the September 2008 report a work plan was developed by Rincon to further delineate total lead and TPH concentrations detected in soil samples obtained from the subject property. Additionally, the Rincon work plan proposed a scope of work for the assessment of semi-volatile organic compounds (SVOCs) including polynuclear aromatics (PNAs) at the subject property. The work proposed in the work plan was completed by Rincon and described in the July 15, 2009, Phase II ESA Report. The following summarizes the findings of the July 2009 Phase II ESA Report:

TPH in Soil

TPH was detected at a concentration exceeding the FPD Investigation Level for TPH of 100 milligrams per kilogram (mg/kg) in all of the soil borings drilled during the July 2009 Phase II ESA (ten borings were drilled to assess TPH during the assessment). The borings designed to assess TPH at the subject property were drilled in the vicinity of boring B4 drilled by TRAK during a previous assessment and along the western property boundary bordering the railroad tracks. TPH was detected at a concentration exceeding 100 mg/kg in 17 of the 25 soil samples analyzed for TPH. The TPH detected in the soil samples was predominately in the oil range (C_{24} to C_{36+}). Soil samples were collected from depths between 0.5 and 5 feet below grade. Refusal was met in borings B10, B11, B14, and B15 at depths ranging from 2 to 4 feet below grade.

Total Lead and Soluble Lead in Soil

Total lead was detected at concentrations ranging from 9.9 to 639 mg/kg in the 74 soil samples analyzed for total lead during the July 2009 Phase II ESA. Total lead was detected in 42 of the soil samples at concentrations exceeding 50 mg/kg and warranted STLC analysis. STLC lead was detected in 39 of the 42 soil samples analyzed for STLC lead. The STLC lead concentrations ranged from 0.58 to 82.7 milligrams per liter (mg/L). STLC lead was detected in 17 of the soil samples at concentrations exceeding 5 mg/L. The soil samples with STLC lead concentrations exceeding 5 mg/L were analyzed for toxicity characteristic leaching procedure (TCLP) lead. TCLP lead was detected at low concentrations of 0.946 and 1.05 mg/L in 2 of the 17 soil samples analyzed for TCLP lead and not detected in 15 of the 17 soil samples analyzed for TCLP lead. The analytical results for total lead, STLC lead, and TCLP lead in soil are included in Table 1.

The analytical results can be compared to the following:

- Typical background concentrations of lead in the soil in California range from 12.4 to 97.1 mg/kg, with the mean reported at 23.9 mg/kg (Kearney, Background Concentrations of Trace and Major Elements in California Soils, University of California, 1996).
- The FPD Investigation Level for total lead in soil is 50 mg/kg.
- The generic Soil Screening Level (SL) reported by the United States Environmental Protection Agency (USEPA) is 400 mg/kg.
- Total threshold limit concentration (TTLC) of 1,000 mg/kg.
- The STLC lead threshold is 5 mg/L.
- The TCLP lead threshold is 5 mg/L.

TTLC levels adopted by the State of California Department of Toxic Substances Control (DTSC) are used to determine whether soil would be classified as a California hazardous or non-hazardous waste for disposal purposes. The lead concentrations reported in the July 2009 Phase II ESA Report did not exceed the TTLC level for lead of 1,000 mg/kg. The STLC lead concentration exceeded the STLC for lead of 5 mg/L in 17 of the soil samples and none of the TCLP lead concentrations exceeded the TCLP for lead of 5 mg/L. If the soil is to be disposed, the soil in the area of the soil samples with STLC lead concentrations exceeding 5 mg/L is considered to be a California hazardous waste. Because the TCLP threshold was not exceeded, the soil would not be classified as a federal RCRA hazardous waste.

In addition, the lead concentrations were compared to SLs set by the USEPA for lead in soil at residential sites of 400 mg/kg. The USEPA does not have a SL for lead at industrial sites. Three soil samples contained lead concentrations exceeding 400 mg/kg. Soil sample B33-0.5 (the soil sample collected from boring B33 at a depth of 0.5 feet below grade), B42-2, and B53-0.5 contained lead concentrations of 620, 615, and 639 mg/kg.

Forty-three borings were drilled in a grid pattern across the subject property during the July 2009 Phase II ESA and 9 borings were drilled during the TRAK Phase II ESA. Based on the analytical results, the extent of total lead in the soil beneath the subject property at concentrations exceeding the SL for lead of 400 mg/kg is determined with the exception of boring B42. The soil sample collected from boring B42 at 2 feet below grade contained a total lead concentration of 615 mg/kg. Based on the analytical results of the July 2009 Phase II ESA, the extent of STLC lead concentrations were not vertically delineated at the locations of borings B35, B48, B52, B54, and B60. The February 2010 Phase II ESA was conducted to further delineate the lead concentrations. The February 2010 Phase II ESA is described below in the Phase II ESA section of this report.

SVOCs and PNAs in the Soil

The PNAs benzo(a)anthracene, benzo(a)pyrene, benzo(b)flouranthene, dibenz(a,h)anthracene, and indeno(1,2,3-cd)pyrene were detected at concentrations

exceeding soil screening levels for residential sites in 7 of the 16 soil samples analyzed for PNAs. The PNA benzo(a)pyrene was detected at a concentration exceeding soil screening levels for industrial sites in 1 of the 16 soil samples analyzed for PNAs. Based on the analytical results of the July 2009 Phase II ESA, the vertical extent of benzo(a)pyrene was not determined in boring B11 and the vertical extent of benzo(a)pyrene and dibenz(a,h)anthracene is not determined in boring B12. The February 2010 Phase II ESA was conducted to further delineate the PNA concentrations. The February 2010 Phase II ESA is described below in the Phase II ESA section of this report.

The September 25, 2009, Phase II ESA Work Plan and Remedial Action Plan describes a scope of work to further delineate lead, TPH, and PNA concentrations at the subject property and the remedial action plan (RAP) uses the existing contaminant data to develop a remedial strategy for the subject property. The RAP describes the scope of work to conduct a remedial excavation at the subject property. This report describes the findings of the Phase II ESA and remedial excavation conducted in accordance with the September 25, 2009, Phase II ESA Work Plan and Remedial Action Plan.

Proposed Remediation Cleanup Goals

It is our understanding that the subject property may potentially be developed with a children's museum pending environmental review. The use of the subject property as a museum would be considered to be a commercial use. Further, we understand that the site will likely be paved with concrete or asphalt and such a structure will likely be slab on grade. Limited exposed soil is expected under the current site design. Under this use and design scenario, relevant cleanup goals should be set at levels used for commercial/industrial sites.

The subject property is within the jurisdictional area of the Central Coast Regional Water Quality Control Board (CCRWQCB). The CCRWQCB regulates groundwater quality in Santa Barbara County. The Santa Barbara County Fire Department, Fire Prevention Division (FPD) provides regulatory oversight within the County of Santa Barbara for the assessment and mitigation of unauthorized hazardous and non-hazardous material releases into the environment. The FPD works in conjunction with the CCRWQCB. The goal of the FPD is to protect human health, water resources, and the environment from unauthorized releases by providing oversight in accordance with the California Health and Safety Code, California Fire Code and California Code of Regulations (FPD, Leaking Underground Fuel Tank & Site Mitigation Unit Manual, January 2007).

The Phase II ESA and remedial excavation described in this report followed the protocol of the FPD and the cleanup goals for the subject property are set at conservative cleanup goals used by the FPD. We believe that if the site is accepted into the SMU program by the FPD, that the cleanup goals proposed in the RAP will meet the FPD's requirements for an industrial site closure. However, we cannot guarantee that the FPD will accept the

assessment and cleanup levels proposed here. The FPD has the authority to establish the requirements of any site assessment or cleanup at its own discretion.

In our experience cleanup goals used by the FPD are site specific. The FPD states in their manual that cleanup goals for soil are divided into two cleanup criteria: protective of groundwater and protective of health. Cleanup goals for total lead, soluble lead, and PNAs detected at the subject property are usually set using health based cleanup objectives, and cleanup goals for TPH are usually set using Investigation Levels set by the FPD to be protective of groundwater. To be protective of groundwater, cleanup goals are based on the Maximum Contaminant Levels (MCLs) for drinking water set by the United States Environmental Protection Agency (USEPA) or the Department of Public Health (DPH) Action Levels of the compound in groundwater multiplied by an attenuation factor. The FPD uses an attenuation factor of 10 for chlorinated solvents and fuel oxygenates and typically uses an attenuation factor of 100 for other compounds. Health related cleanup goals are set using the EPA Region 9 Preliminary Remediation Goals (PRGs).

In 2008 the PRGs were updated. The USEPA has developed generic Screening Levels (SLs) for chemical contaminants at residential (R) and industrial (I) sites in soil, air, and tap water (USEPA, 2008). The SLs are not cleanup standards. The generic SLs are meant to assist in the development of site specific PRGs. Cleanup to residential PRGs allows for unrestricted land use and cleanup to industrial PRGs may require a deed notification and possible land use restriction. In the case of the subject property and its proposed use as a children's museum we believe use of the generic SL for industrial sites is the appropriate cleanup level.

The use of the FPD Investigation Level of 100 mg/kg as a cleanup level is site specific. In our experience the FPD has used Soil Screening Levels (ESL) developed by the San Francisco Bay Regional Water Quality Control Board (RWQCB) as cleanup levels for TPH in soil. The San Francisco Bay RWQCB ESL for direct exposure to TPH in soil at residential sites is 1,800 mg/kg (Table K-1, HQ=1 of the RWQCB document Screening for Environmental Concerns at Sites with Contaminated Soil and Groundwater, revised May 2008). The hydrocarbons detected in the soil at the subject property are predominantly in the motor oil range (TPHo). Heavy range hydrocarbons are relatively immobile and insoluble. TPH was not detected in groundwater samples collected from the subject property by TRAK during the 2008 Phase II ESA. Further, it is our understanding that the site will be surfaced with asphalt or concrete and there will not be any direct exposure to soil. We believe that the ESL for direct exposure to TPH in soil at residential sites of 1,800 mg/kg is a more appropriate cleanup goal at the subject property than the FPD Investigation Level for TPH in soil of 100 mg/kg.

The following cleanup goals are proposed for the constituents that we have identified at this site:

Chemical	Cleanup Goal		Highest Level Detected Onsite
Lead[1]			
Total Lead	400 mg/kg		1,900 mg/kg
Soluble Lead	5 mg/L		82.7 mg/L
TPH[2]			
TPH	1,800 mg/kg		3,146 mg/kg
PNAs[3]			
	Residential	Industrial	
Benzo(a)anthracene	150 μg/kg	2,100 μg/kg	509 μg/kg
Benzo(a)pyrene	15 μg/kg	210 μg/kg	603 μg/kg
Benzo(b)flouranthene	150 μg/kg	2,100 μg/kg	1,090 μg/kg
Dibenz(a,h)anthracene	15 μg/kg	210 μg/kg	117J μg/kg
Indeno(1,2,3-cd)pyrene	150 μg/kg	2,100 μg/kg	464 μg/kg

1. The cleanup goal for total lead is set at the generic SL for total lead in the soil at residential sites of 400 mg/kg. There is no generic SL for total lead at industrial sites. The cleanup goal for soluble lead is set at the STLC level for soluble lead of 5 mg/L.
2. The cleanup goal for TPH proposed in the RAP was set at the FPD Investigation Level for TPH of 100 mg/kg. A more appropriate cleanup goal for TPH in the soil at the subject property is the ESL for TPH of 1,800 mg/kg.
3. The cleanup goals for PNAs are set at the generic SLs for PNAs at industrial sites that are listed in the table above. The residential SLs for PNAs are also listed in the table for comparison purposes.

Remedial Method

In the July 15, 2009, Phase II ESA Report prepared by Rincon for the subject property a feasibility study was prepared to determine the most appropriate remedial option for the subject property. The conclusion of the study was that a remedial excavation is the most cost effective and timely remedial option for the subject property. There are currently no structures in the proposed excavation areas and the subject property is not currently being used.

PHASE II ESA

Purpose and Scope

The purpose of this assessment was to adequately delineate the lateral and vertical extent of lead, TEPH, and PNA concentrations detected in the soil at the subject property and to use the analytical data to conduct a remedial excavation at the subject property.

Our scope of work included the following:

- Prepare a health and safety plan for the subject property. The plan contains information on chemical and physical hazards, personal protective equipment, decontamination procedures, personnel responsibilities, and emergency response protocols.

- Notify the City of Santa Barbara and the City of Santa Barbara Redevelopment Agency of the work schedule a minimum of 72 hours prior to the start of field work.

- Premark boring locations and contact Underground Service Alert (USA) to mark areas where underground public utilities might be located in the drilling area. Review the geophysical survey completed by TRAK for the locations of subsurface magnetic anomalies and review the utility locations indicated on the City of Santa Barbara Public Works Map for the subject property.

- Utilize a Geoprobe drill rig to advance 15 borings in areas of the site where lead, TEPH, and PNAs are not delineated to cleanup goals and FPD Investigation Levels.
  - 6 borings were drilled to assess total lead and soluble lead concentrations.
    - Soil samples were collected from the lead delineating borings at 3, 4, and 5 feet below grade.
  - 10 borings were drilled to assess TEPH and PNA concentrations.
    - Soil samples were collected from the TEPH and PNA delineating borings at 0.5, 3, 5, and 8 feet below grade.
  - Classify the soil per the Unified Soil Classification System.
  - Note any discoloration or odors and PID readings indicative of contamination in the soil.

- Soil Sample Analysis
  - Select soil samples collected from the 6 lead delineating borings were analyzed for the following:
    - Total lead by EPA Method 6000/7000
    - STLC lead by EPA Method 6000/7000
    - TCLP lead by EPA Method 6000/7000

- Select soil samples collected from the 10 TPH and PNA delineating borings were analyzed for the following:
    - TEPH by EPA Method 8015M
    - PNAs by EPA Method 8270C

- Use the analytical results to determine the extent of a remedial excavation described in the Remedial Excavation section of this report. In addition, the analytical results were used in the preparation of a Confirmation Soil Sampling Plan that is included as Appendix 5 of this report.

- Prepare this report documenting our findings.

Methodology

Site Characterization

The soil characterization included collecting and analyzing soil samples from areas of the subject property where total lead, STLC lead, TEPH, and PNA concentrations were not delineated to site cleanup goals and FPD Investigation Levels. The purpose of the assessment was to delineate the contaminant concentrations in the soil matrix at the subject property. The primary goal was to delineate the contamination to cleanup goals and the secondary purpose was to delineate the contamination to FPD Investigation Levels. The borings were advanced utilizing a Geoprobe drill rig. The scope of work was completed in accordance with the soil characterization guidelines of the FPD (Appendices C and D of the Leaking Underground Fuel Tank & Site Mitigation Manual, January 2007).

Boring Locations

Borings were drilled in locations where lead, TEPH, and PNAs were not delineated to concentrations below FPD Investigation Levels and cleanup goals for this site. The locations were determined by our review of the analytical results described in the September 26, 2008, Phase II ESA Report and the analytical results described in the July 15, 2009, Phase II ESA Report.

Total lead:

- **One boring** was drilled to delineate total lead. Total lead was not vertically delineated to concentrations below the SL for total lead of 400 mg/kg (the cleanup goal for the subject property) at the location of boring B42.
    - Boring B73 was drilled to 5 feet below grade at the location of boring B42.

Soluble lead:

- **Five borings** were drilled to delineate STLC lead. STLC lead was not vertically delineated to concentrations below 5 mg/L (the cleanup goal for the subject property) at the locations of borings B35, B48, B52, B54, and B60.
    - Borings B68, B72, B69, B71, and B70 were drilled to 5 feet below grade at the locations of borings B35, B48, B52, B54, and B60.

TEPH:

- **Nine borings** were drilled to delineate TEPH. TEPH was not delineated to concentrations below the FPD Investigation Level for TPH of 100 mg/kg at the locations of borings B4 and borings B10 through B19.
    - Borings B61 through B67 were drilled to 8 feet below grade at the locations of borings B4 and borings B10 through B19.

PNAs:

- The previous Phase II ESA adequately delineated PNAs in the soil to concentrations below industrial SLs. No borings were drilled during the current Phase II ESA targeting PNAs. Select soil samples were analyzed from the borings targeting TEPH to delineate PNAs to residential SLs.

Drilling and Soil Sampling

On February 11, 2010, fifteen borings were advanced with a Geoprobe drill rig on the subject property by HydroGeoSpectrum of Los Angeles, California, under the direction of Rincon. The borings were advanced through unsurfaced and discontinuous asphalted areas of the subject property where contaminant concentrations were not delineated to FPD Investigation Levels. Soil samples were obtained from 3, 4, and 5 feet below grade in the lead delineating borings and soil samples were obtained from 0.5, 3, 5, and 8 feet below grade in the TEPH and PNA delineating borings. None of the borings met refusal. Groundwater was not encountered in the borings.

The Geoprobe borings were advanced by hydraulically driving a 2 inch diameter rod into the ground. When the target sampling depth is reached, a soil sampler is attached to the end of the rod. The soil sampler consists of a one-inch diameter tube containing a four foot long acetate sleeve liner. By advancing this sampler into the soil, soil is forced into the opening of the sampling tube and a sample is obtained. Once the sampler is filled, it is retrieved and the acetate liner is removed. The designated sampling section (6-inch) length is cut and retained for laboratory analysis. The acetate sleeve holding the soil sample is labeled, sealed with Teflon, and stored in a cooler chilled to 4 degrees Celsius. The samples were couriered to a state certified analytical laboratory using chain-of-custody protocol.

Soil within the remainder of the acetate sleeve is used for soil classification using the Unified Soil Classification System and to screen for VOCs using a photoionization detector (PID). The acetate sleeve containing the soil was capped and allowed time for VOCs to volatilize. The acetate sleeve was then opened and the PID probe tip was placed within one-eighth inch of the soil. At the start of each day of soil sample collection, the PID was calibrated to an isobutylene standard. The PID data were recorded on the soil boring logs (Appendix 1).

Upon completion of the sampling program, all borings were backfilled with bentonite chips. The ground surface was replaced to match the surrounding ground surface. Sampling equipment was decontaminated between use by washing with a non-phosphate detergent solution followed by a potable water rinse. Soil cuttings and decontamination water were stored onsite in a 55-gallon Department of Transportation (DOT) drum.

Fifteen borings were advanced and 54 soil samples were collected during the Geoprobe drilling activities.

Soil sampling was performed under the oversight of a California Professional Geologist.

Laboratory Analysis

The 54 soil samples collected from the borings were transported to Oilfield Environmental Compliance of Santa Maria, California under chain-of-custody documentation.

Soil Sample Analysis

Total Lead: Fourteen soil samples were analyzed for total lead by EPA Method 6000/7000. Initially, the soil samples collected from 3 feet below grade were analyzed (with the exception of boring B73, where the samples collected at 3, 4, and 5 feet below grade were analyzed for total lead). If lead was detected at a concentration exceeding the FPD Investigation Level for lead of 50 mg/kg in the soil sample collected from 3 feet below grade, then the deeper soil sample collected from 4 feet below grade in that boring was analyzed for total lead. If total lead was detected at a concentration exceeding 50 mg/kg in the soil sample collected from 4 feet below grade, then the deeper soil sample collected from 5 feet below grade was analyzed for total lead.

STLC: Eleven soil samples were analyzed for STLC lead by EPA Method 6010B. Soil samples containing total lead concentrations exceeding 50 mg/kg were analyzed for STLC lead.

TCLP: Six soil samples were analyzed for TCLP lead by EPA Method 6010B. Soil samples containing STLC lead concentrations exceeding 5 mg/L were analyzed for TCLP lead.

TEPH: Nineteen soil samples were analyzed for TEPH by EPA Method 8015M. Initially, select soil samples identified by previous assessments were analyzed. In the borings where TEPH was detected at a concentration exceeding the FPD Investigation Level for TPH of 100 mg/kg, the deeper sample from that boring was analyzed for TEPH. TPH as gasoline range organics (TPHg) were not detected during previous Phase II ESAs conducted at the subject property and were not analyzed for during the current Phase II ESA.

PNAs: Sixteen soil samples were analyzed for PNAs by EPA Method 3550B. Deeper soil samples were analyzed when PNAs were detected above regulatory action levels.

MDL: The analytical laboratory is required to report both the method detection limit (MDL) and the practical quantitation limit (PQL) for every sample result. Per 40 CFR, part 136, Appendix B, the MDL is defined as the minimum concentration of a substance that can be measured and reported with 99% confidence that the analyte concentration is greater than zero. The PQL is typically 2 to 10 times the MDL. A detection between the MDL and the PQL is flagged by the laboratory to indicate that the laboratory cannot reliably quantify the detection. Laboratories are required to report all detections and all data qualifiers. All non detections are reported as not detected less than the value of the MDL.

Results

Soil Sampling

No odors were noted and non-detect PID readings were measured in the soil samples collected from the borings. Asphalt exists in areas of the site at the surface or at approximately 0.5 feet below grade. The soil encountered in the borings was comprised primarily of poorly graded brown sand and silt mixtures with varying amounts of gravel and clay. Groundwater was not encountered in the borings.

A summary of the soil sampling analytical results is included in Tables 1, 2, and 3. Copies of the analytical reports and chain of custody documentation are included in Appendix 2.

Lead

Lead concentrations detected in the 14 soil samples analyzed for total lead ranged from 6.1 mg/kg to 1,200 mg/kg. Lead was detected at a concentration exceeding 50 mg/kg in 6 of the 14 soil samples analyzed for total lead. Lead concentrations exceeding 50 mg/kg warrant STLC analysis. Soluble lead was detected in the soil samples at concentrations ranging from 0.12 mg/L to 64 mg/L. Soluble lead was detected at a concentration exceeding 5 mg/L in 6 of the 11 soil samples analyzed for STLC lead. Soluble lead concentrations exceeding 5 mg/L warrant TCLP analysis. TCLP lead was detected in the soil samples at concentrations ranging from 0.035 mg/L to 2.9 mg/L.

TEPH

TPHd was detected above the laboratory method detection limit in 7 of the 20 soil samples analyzed for TEPH. TPHd was detected in the soil samples at concentrations ranging from 4.1J mg/kg to 89J mg/kg.

Note: J is a flag used by the laboratory to indicate that the detection is above the method detection limit and below the practical quantitation limit.

TPHo was detected at concentrations exceeding the laboratory method detection limit in 11 of the 20 soil samples analyzed for TEPH. TPHo was detected in the soil samples at concentrations ranging from 7.8J to 3,100 mg/kg.

PNAs

Varying concentrations of PNAs were detected in the 16 soil samples analyzed for PNAs. The PNAs acenaphthylene, anthracene, benzo(a)anthracene, benzo(a)pyrene, benzo(b)flouranthene, benzo(ghi)perylene, benzo(k)fluoranthene, chrysene, dibenz(a,h)anthracene, flouranthene, indeno(1,2,3-cd)pyrene, phenanthrene, and pyrene were detected at concentrations above the method detection limit in 11 of the 16 soil samples analyzed for PNAs.

Discussion

The Remediation Cleanup Goal section of this report describes the cleanup goals used for the remedial excavation completed at the subject property. The purpose of the Phase II ESA was to collect analytical data to delineate contamination at the subject property to cleanup goals and FPD Investigation Levels. The FPD has not accepted the subject property for oversight. However, the Phase II ESA and remedial excavation was completed in general conformance with FPD protocol.

Soil Sampling and Analysis

Total lead, STLC lead, TEPH, and select PNAs were detected above cleanup goals and FPD Investigation Levels in the soil samples collected during the current Phase II ESA.

Lead

Lead concentrations ranging from 6.1 to 1,200 mg/kg were detected in the 14 soil samples analyzed for total lead. Lead was detected at concentrations exceeding 50 mg/kg in 6 of the 14 soil samples analyzed for total lead. Soluble lead was detected at concentrations exceeding 5 mg/L in 6 of the 11 soil samples analyzed for STLC lead. None of the soil samples analyzed for TCLP lead exceeded the threshold for TCLP lead of 5 mg/L. Similar to other assessments completed at the subject property, the highest concentrations of lead

tended to be in the borings located near the southeastern and southwestern property lines and near an 18 inch flanged fitting located near the center of the subject property and associated with a sub grade concrete pad and former above ground water tank.

The detected concentrations of lead can be compared to the following:

- Typical background concentrations of lead in soil in California range from 12.4 mg/kg to 97.1 mg/kg, with the mean reported at 23.9 mg/kg.
- The FPD Investigation Level for lead in soil is 50 mg/kg.
- The Soil Screening Level (SL) for lead in soil is 400 mg/kg. The SL for lead of 400 mg/kg is the cleanup goal for the subject property.

A purpose of this assessment was to delineate total lead concentrations to below the cleanup goal for the subject property. The cleanup goal for total lead at the subject property is the SL for lead in the soil of 400 mg/kg. The assessments conducted at the subject property delineate the vertical extent of total lead to 400 mg/kg with the exception of boring B71, located adjacent to boring B54 near the southeastern property boundary. Total lead was detected at a concentration of 400 mg/kg in the soil sample collected from 5 feet below grade in boring B71. No deeper soil samples were collected form boring B71.

The lateral extent of total lead is adequately delineated within the limits of the subject property, by the Phase II ESAs conducted at the subject property. The lateral extent of total lead outside the boundaries of the subject property is unknown. Total lead was detected during the current Phase II ESA, at concentrations exceeding 400 mg/kg in four borings (B33, B42, B70, and B71) located adjacent to the southeastern property boundary. No soil samples were collected from outside the subject property boundaries.

Total lead can also be compared to typical background concentrations of lead in soil in California of 12.4 mg/kg to 97.1 mg/kg (Kearny Foundation of Soil Science, Division of Agriculture and Natural Resources, University of California, March 1996). Lead was detected at concentrations ranging from 6.1 to 1,200 mg/kg in the 14 soil samples analyzed for total lead. Total lead was detected at concentrations exceeding background concentrations for lead in soil in California in borings B69, B70, and B71. Total lead was detected within background concentrations for lead in soil in California in borings B68, B72, and B73. Borings B68, B69, and B72 were advanced adjacent to borings B35, BB48, and B42. Borings B35, B48, and B42 were advanced during the prior Phase II ESA and contained total lead concentrations exceeding background concentrations for lead in soil in California.

In addition, the levels of lead were compared to TTLC levels adopted by the DTSC. The TTLC levels are used to determine whether soil would be classified as a hazardous or non-hazardous waste for disposal purposes. Total lead was detected at a concentration of 1,200 mg/kg in the soil sample collected from boring B69 at 3 feet below grade. The TTLC threshold for lead is 1,000 mg/kg. Based on the lead detection in soil sample B69-3 (1,200 mg/kg) the soil from that area would be classified as a California hazardous waste.

Soluble Lead

A purpose of this assessment was to delineate STLC lead concentrations to below the cleanup goal for the subject property. The cleanup goal for STLC lead at the subject property is the STLC for lead of 5 mg/L.

STLC lead was detected at concentrations exceeding 5 mg/L in 6 of the 11 soil samples analyzed for STLC lead. None of the soil samples analyzed for TCLP lead exceeded the threshold for TCLP lead of 5 mg/L. Based on the detected concentrations of STLC lead above 5 mg/L and the detected concentrations of TCLP lead below 5 mg/L, the soil excavated from the subject property was disposed as a Non-RCRA hazardous waste.

Similar to total lead at the subject property, the assessments completed delineate the vertical extent of STLC lead to 5 mg/L with the exception of boring B71. STLC lead was detected at a concentration of 21 mg/L in the soil sample collected from 5 feet below grade in boring B71. No deeper soil samples were collected from boring B71.

The Phase II ESAs have adequately delineated the lateral extent of STLC lead in the soil on the subject property. STLC lead was detected at concentrations exceeding 5 mg/kg in the borings (B25, B28, B33, B37, B42, B48, B54, B60, B70 and B71) located adjacent to the southeastern property boundary and in boring B57 located adjacent to the southwestern property boundary. No soil samples were collected from outside the subject property boundaries.

TEPH

The use of the FPD Investigation Level of 100 mg/kg as a cleanup goal for the subject property is very conservative. In our experience the FPD has used Soil Screening Levels (ESL) developed by the San Francisco Bay Regional Water Quality Control Board (RWQCB) as cleanup levels for TPH in soil. The San Francisco Bay RWQCB ESL for direct exposure to TPH in soil at residential sites is 1,800 mg/kg (Table K-1, HQ=1 of the RWQCB document Screening for Environmental Concerns at Sites with Contaminated Soil and Groundwater, revised May 2008).

The FPD Investigation Level for TPH is for the aggregate of all carbon chains. For sites where the detected concentrations of TPH are in soil less than 50 feet above groundwater the Investigation Level for TPH is 100 mg/kg. The FPD distinguishes the type of hydrocarbons by the following carbon ranges: gasoline range organics are in the carbon 4 (C_4) to C_{12} range, diesel range organics are in the C_{13} to C_{22} range, and oil range organics are in the C_{23} to C_{40} range. TPH as gasoline range organics (TPHg) have not been detected in soil samples collected from the subject property. The current assessment analyzed soil samples for total extractable petroleum hydrocarbons (TEPH), which include diesel range hydrocarbons (TPHd) and oil range hydrocarbons (TPHo).

The TEPH detected during the Phase II ESA was primarily in the oil range. None of the TPHd concentrations detected exceeded the FPD Investigation Level for TPH of 100 mg/kg or the site cleanup goal of 1,800 mg/kg. TPHo was detected at concentrations exceeding both the FPD Investigation Level for TPH of 100 mg/kg and the cleanup goal of 1,800 mg/kg.

TEPH was detected in 12 of the 20 soil samples analyzed for TEPH and 2 of the 12 TEPH detections were above the site cleanup goal for TEPH of 1,800 mg/kg. TEPH was detected at concentrations of 2,889 mg/kg and 3,146 mg/kg in the soil samples collected from borings B61 and B67 at 0.5 feet below grade. The vertical extent of the TEPH concentrations is delineated to 1,800 mg/kg by low concentrations of TEPH detected in the deeper soil samples collected from borings B61 and B67. The lateral extent of TEPH concentrations exceeding 1,800 mg/kg is not delineated in the shallow soil (0.5 feet below grade) to the west and south of boring B67. The lateral extent of TEPH concentrations exceeding 1,800 mg/kg is delineated in the shallow soil (0.5 feet below grade) on the subject property at the location of boring B61. Boring B61 is located adjacent to the northern corner of the subject property. It is unknown if TEPH concentrations exceeding 1,800 mg/kg exist in the soil to the north of boring B61, outside the limits of the subject property. No soil samples were collected from outside the subject property boundaries.

TEPH was detected at concentrations exceeding the FPD Investigation Level for TPH of 100 mg/kg in 7 of the 20 soil samples analyzed for TEPH. The vertical extent of TPH concentrations exceeding 100 mg/kg is delineated on the subject property. The lateral extent of TPH concentrations exceeding 100 mg/kg is not delineated in the shallow soil (0.5 feet below grade) to the east and south of borings B64, B66, and B67. TPH concentrations exceeding 100 mg/kg in the deeper soil is laterally delineated at the subject property. It is unknown if TEPH concentrations exceeding 100 mg/kg exist in the soil to the northeast and northwest of the subject property. No soil samples were collected from outside the subject property boundaries.

TEPH was also detected in borings (B74 and B75) located near the northwestern property boundary to the south of the Signalman's Building, in a boring (B68) located near a sub grade concrete pad located near the center of the subject property, and in a boring (B69) located adjacent to a concrete pad located near the southwestern property boundary. TEPH was detected in 3 of the 8 soil samples collected from borings B68, B69, B74, and B75. TEPH was detected at concentrations of 150 mg/kg, 200 mg/kg, and 440 mg/kg in soil samples B68-0.5, B74-0.5, and B75-0.5. None of the detected concentrations of TEPH in borings B68, B69, B74, and B75 exceed the cleanup goal for TPH of 1,800 mg/kg. The TEPH concentrations are vertically delineated to 100 mg/kg, by deeper soil samples collected from the borings. The lateral extent of the TEPH concentrations in the borings are not laterally delineated to 100 mg/kg in the shallow soil (0.5) at the locations of borings B69, B74, and B75.

PNAs

The PNAs acenaphthylene, anthracene, benzo(a)anthracene, benzo(a)pyrene, benzo(b)flouranthene, benzo(ghi)perylene, benzo(k)fluoranthene, chrysene, dibenz(a,h)anthracene, flouranthene, indeno(1,2,3-cd)pyrene, phenanthrene, and pyrene were detected at concentrations above the method detection limit in 11 of the 16 soil samples analyzed for PNAs. The detected concentrations of PNAs were compared to SLs for PNAs at residential and at industrial sites. The following PNAs were detected at concentrations exceeding the SL-R:

- Benz(a)anthracene, benzo(a)pyrene, benzo(b)flouranthene, dibenz(a,h)anthracene, and indeno(1,2,3-cd)pyrene.
- Soil samples B61-0.5, B61-5, B62-5, B66-0.5, B67-0.5, and B67-3.

The following PNA was detected in one sample (B67-0.5) at a concentration exceeding the SL-I:

- Benzo(a)pyrene

The cleanup goal for PNAs is set at the SL-I. The SL-I for benzo(a)pyrene is 210 μg/kg. Benzo(a)pyrene was detected in soil sample B67-0.5 at a concentration of 250 μg/kg. The vertical extent of benzo(a)pyrene is delineated to the SL-I for benzo(a)pyrene of 210 μg/kg in the borings advance during the Phase II ESA. The lateral extent of benzo(a)pyrene to the SL-I for benzo(a)pyrene of 210 μg/kg is not delineated in the shallow soil (0.5 feet below grade) to the south and west of boring B67.

Contamination Extent

Lead and Soluble Lead

Based on the findings reported in the September 2008 TRAK Phase II ESA and the findings of the Rincon July 2009 and February 2010 Phase II ESAs, total lead and STLC lead impacted soil at concentrations exceeding cleanup goals is mainly limited to the area along the southeastern property boundary bordering an older structure on the adjacent property, known as the State Street Hotel. Total lead and STLC lead impacted soil at concentrations exceeding cleanup goals was also detected in some of the borings (borings B6, B32, B35, B52, B53, and B57) drilled near the center of the site (near a sub grade concrete pad formerly supporting and above ground water tank) and near a concrete pad located near the southwestern property boundary. The lateral extent of total lead and soluble lead impacted soil to thresholds of 50 mg/kg and 5 mg/L have been delineated on the subject property. Total lead and STLC lead concentrations outside the limits of the subject property are unknown. The vertical extent of total lead exceeding 400 mg/kg and of STLC lead exceeding 5 mg/L has not been delineated at the location of boring B71. Figures 4 through

6 depict STLC lead concentrations detected in soil samples obtained during the February 2010 Phase II ESA. The analytical results are summarized in Table 1.

TEPH

Based on the findings of the Phase II ESAs completed at the subject property, TEPH impacted soil at concentrations exceeding the site cleanup goal for TPH of 1,800 mg/kg and the FPD Investigation Level for TPH of 100 mg/kg is primarily in the area near the northwestern property boundary bordering the railroad tracks. The lateral extent of TEPH impacted soil is not delineated to 1,800 mg/kg in the shallow soil at the location of boring B67 and the lateral extent of TEPH impacted soil is not delineated to 100 mg/kg at the location of borings B64, B66, and B67. It is Rincon's opinion that the TPH is the result of asphalt in the soil and the maintenance of the former asphalt parking lot. It is also possible that the TEPH contamination is associated with the former use of the site by the Southern Pacific Railroad and it is possible that railroad crews have sprayed the area adjacent to the railroad tracks with oil for weed control.

PNAs

Based on the findings of the Phase II ESAs, PNA impacted soil at concentrations exceeding cleanup goals for the subject property (SL-Is), is limited to the area near the northwestern property boundary around TRAK boring B4. Benzo(a)pyrene is the only PNA that has been detected at concentrations exceeding the industrial sites SL of 210 μg/kg (borings B12 and B67). No other PNAs were detected in the soil samples at concentrations exceeding industrial site SLs. However, PNAs were detected in borings B10, B11, B12, B13, B14, B61, B62, B66, and B67 at concentrations exceeding residential SLs. These borings are all located in the proposed excavation area for TEPH impacted soil.

Phase II ESA Conclusion

Total lead, STLC lead, TEPH, and PNAs were detected in the soil samples collected during this Phase II ESA at concentrations exceeding the cleanup goals for the subject property and at concentrations exceeding FPD Investigation Levels. The contaminant concentrations are adequately delineated for the remedial excavation.

REMEDIAL EXCAVATION

Purpose and Scope

The purpose of the remedial excavation was to remove soil containing contaminant concentrations exceeding cleanup goals for the subject property.

Our scope of work included the following:

- Prepare a health and safety plan for the subject property. The plan contains information on chemical and physical hazards, personal protective equipment, decontamination procedures, personnel responsibilities, and emergency response protocols.

- Prepare a Tree Inventory and Protection Plan Report.

- Obtain the following permits:
  - Grading Permit from the City of Santa Barbara Community Development, Building & Safety Division.
    - Permit Number BLD2010-00759.
  - Permit exemption from the Santa Barbara County Air Pollution Control District (APCD).
    - APCD Permit Exemption Number 13404.
  - Haul route approval from the City of Santa Barbara Public Works Department.
    - Permit Number PBW2010-00604.
  - Fire hydrant meter from the City of Santa Barbara Public Works Department.
    - Permit Number PBW2010-00694.

- Notify the City of Santa Barbara, the City of Santa Barbara Redevelopment Agency, and the third party oversight hired by the City of Santa Barbara (TRAK Environmental) of the work schedule 2 weeks prior to the start of field work. The City of Santa Barbara notified the adjacent property owners of the field work schedule.

- Premark the excavation areas and contact Underground Service Alert (USA) to mark areas where underground public utilities might be located in the drilling area. Review the geophysical survey completed by TRAK for the locations of subsurface magnetic anomalies and review the utility locations indicated on the City of Santa Barbara Public Works Map for the subject property.

- Excavate 1,463 tons of soil from the lead impacted areas and excavate 97.9 tons from the TEPH and PNA impacted area.

- Dispose 1,463 tons of soil as a Non-RCRA hazardous waste and dispose 97.9 tons of soil as a non-hazardous waste.

- Collect confirmation soil samples at a rate of approximately one sample per every 100 square feet of excavation bottom and sidewall.

- Confirmation Soil Sample Analysis
  - The soil samples collected from the lead impacted areas were analyzed for the following:
    - Total lead by EPA Method 6000/7000
    - STLC lead by EPA Method 6000/7000
    - TCLP lead by EPA Method 6000/7000
  - The soil samples collected from the TEPH and PNA impacted area were analyzed for the following:
    - TEPH by EPA Method 8015M
    - PNAs by EPA Method 8270C

- Expand excavation areas based on the confirmation soil sampling analytical results.

- Backfill with 1,541 cubic yards of clean imported material.

- Conduct compaction testing within 15 feet of structures.

- Place a 4 inch thick layer of mulch over disturbed areas.

- Prepare this report documenting our findings.

Methodology

Remedial Excavation

The remedial excavation included the excavation of soil to depths between 2 and 7.5 feet below grade in the lead impacted areas. The deeper areas of the excavation were in the southern area of the subject property near the southwest and southeast property lines. The excavation in the TEPH and PNA impacted area included the excavation of soil to depths between 1 and 4.5 feet below grade. The TEPH and PNA impacted area was located near the northwestern property border near the northern corner of the subject property.

The remedial excavation was completed in accordance with the September 25, 2009, Phase II ESA Work Plan and RAP and the specifications of City of Santa Barbara Bid 4951. The work was also completed in accordance with the City of Santa Barbara grading permit (BLD2010-00759), fire hydrant permit (PBW2010-00694), and haul route permit (PBW2010-00604) and the Air Pollution Control District exemption permit 13404. The

work was also conducted in general conformance with the guidelines of the FPD (Appendices C and D of the Leaking Underground Fuel Tank & Site Mitigation Manual, January 2007).

Mobilization

A CAT 325 CL Excavator, one CAT 950 Loader, one 2,000 gallon water truck, one portable office trailer, and portable toilets were mobilized to the site on 7 to 9 axle tractor/Lowboy combinations. In addition, trash bins, construction and silt fencing, storm water control devices, and office supplies were mobilized to the site.

An 8 foot tall chain link fence with green mesh and a gate was installed along the perimeter of the subject property. The gate was locked during non-working hours to prevent unauthorized access to the subject property.

Construction fencing was installed to establish tree protection zones under the direction of the Rincon arborist.

Tarps were placed along the side of the structure (the State Street Hotel) on 119 State Street bordering the excavation area on the subject property. The tarps were placed for dust control and at the request of the 119 State Street property owner.

Prior to commencement of the excavation, the areas to be excavated were marked with paint.

Excavation

Between May 3 and 17, 2010, areas of the subject property were excavated utilizing a CAT 325 CL Excavator and a CAT 950 Loader. A 2,000 gallon water truck equipped with a fire hose was utilized for dust control. Remedial Transportation Services (RTS) of Bakersfield, California excavated the soil under the direction of Rincon Consultants, Inc. The excavation was overseen by the City of Santa Barbara Environmental Specialist and the third party oversight of TRAK Environmental. Excavated soil was temporarily stockpiled or loaded directly into 25 ton trucks. The temporary soil stockpile was placed on top of visqueen in an area of the site with limited impact on the excavation activities. Once enough soil was stockpiled to allow continuous loading of soil, RTS under the direction of Rincon, utilized the loader to load the soil into 25 ton end dump trucks for transport to the disposal facility. Soil was segregated by non-hazardous and California hazardous waste.

The excavation boundary was based on the findings of the Phase II ESAs completed at the subject property. Based on the analytical results of confirmation soil samples collected from the excavation sidewalls and bottom, the excavation was extended to the dimensions depicted in Figure 8. Burned debris including bottles, plates, cups, saucers, bones, clams, metal, and other railroad associated debris were encountered between approximately 3 feet below grade and 7 feet below grade in the southern corner of the subject property. The

excavation was temporarily stopped in this area so that the onsite archaeologist could investigate the debris for historical artifacts. A burned but still legible newspaper was discovered at approximately 5 feet below grade near the southwestern property boundary. The newspaper was dated July 1909. It is likely that the debris was dumped in the early 1900s and possibly earlier. The stamp on the plates and dishes indicated that they were originally used by the Southern Pacific Railroad. In addition, burned passenger manifests for the train indicate that the railroad company used the site. The railroad likely used the bottles, plates, dishes, etc. on their passenger train routes. It appears that the railroad dumped used and broken items in this area of the subject property during the stop at the adjacent train station. The presence of the historical Signalman's Building on the subject property and a former water tank associated with the railroad indicate that the 125 State Street property was actively used by the railroad. It is likely that the lead contamination in the onsite soil is at least partially from the burning of debris on the subject property. A soil sample was collected from the burned material and analyzed for total metals by EPA Method 6000/7000 and for PNAs by EPA Method 8270C to ensure that the material was properly profiled for disposal. The analytical results of the soil sample confirmed that the material should be disposed as a California hazardous waste.

The excavation sidewalls were sloped at a minimum ratio of 1 to 1 in areas of the excavation that were greater than 4 feet deep and at a ratio of 2 to 1 adjacent to structures. Based on the Slope Stability Analysis prepared by Penfield & Smith for the Signalman's Building, the proposed sloping was adequate to protect the Signalman's Building. In addition, RTS under the direction of Rincon, used hand tools to expose a three foot section of the footing on the 119 State Street structure bordering the excavation area on the subject property. The footing on the State Street Hotel was verified to be approximately 3 feet below grade.

Two parallel adjacent iron pipes were encountered in the excavation area located near the center of the subject property. The top iron pipe was connected to an 18 inch diameter flanged fitting existing at grade. The top pipe connected to the flanged fitting was 14 inches in diameter and the bottom pipe was 9 inches in diameter. The pipes appear to have been associated with a former above ground water tank on the subject property. The pipes extended from approximately the center of a large sub grade concrete pad, reported to be associated with the former water tank, to the northwestern property boundary. The pipes were observed to exit the northwestern property boundary directly to the northeast of the Signalman's Building. The top pipe was cut near the northwestern property line at a 45 degree angle joint extending the pipe deeper and out of the property towards the nearby railroad lines. The bottom pipe was cut at the northwest property line. Both pipes were abandoned near the property line with concrete slurry. The concrete pad formerly supporting the water tank was left in place. The concrete pad is octagonal in shape and is approximately 38 feet wide and 3 feet thick. The concrete pad is on top of 1.5 foot thick wood that appears to be treated with what might be creosote. The concrete pad is buried by approximately 1.5 feet of soil.

Backfill

Between May 18 and 20, 2010, the loader was utilized to backfill the excavation with clean imported fill material. The fill material was transported to the subject property with end dump trucks from the Santa Barbara Sands quarry located at 345 Ellwood Canyon Road, Goleta, California. The backfill was spread in approximately 1-foot lifts and compacted by wheel-rolling with the excavator and the loader. During backfill activities, the backfill material was kept moist by spraying the backfill material with water from the 2,000 gallon water truck. Compaction testing was performed for backfill areas located within 15 feet of a structure. The maximum density for the backfill material was 107 percent and the optimum moisture was 15 percent. The relative compaction achieved throughout the areas located within 15 feet of structures was between 93.8 percent and 98.3 percent. A total of 15 compaction tests were completed in these areas.

On April 14, 2010, one soil sample was collected from the borrow area at the backfill source, the Santa Barbara Sands facility. The soil sample was collected approximately 2 weeks prior to the start of the excavation to ensure the soil sample would be representative of the backfill material to be used at the site and that the fill material brought to the site is clean. To confirm that the fill material brought to the site remains clean, one soil sample was collected from a randomly selected load of fill material on each day of backfilling. Three soil samples were collected from the fill material brought to the site, between May 18 and May 20, 2010 (one soil sample for each day that backfill material was brought to the site).

Transportation and Disposal

Copies of the records documenting the proper waste disposal are included in Appendix 7.

Concrete and Piping

Concrete from the concrete pad was stockpiled onsite prior to loading into an end dump truck. The concrete was broken into pieces smaller than 3 feet long and rebar was cut away from the concrete. The iron pipe removed from the area of the former water tank was cut into 4 foot long sections. RTS transported the concrete and iron pipe to be recycled offsite.

Soil

Excavated soil was segregated and temporarily stockpiled on Visqueen. Once there was enough stockpiled soil to allow for continuous loading, the soil was loaded into 25 ton end dump trucks. The soil was transported offsite to the following two facilities:

- A total of 97.9 tons of non-hazardous soil was disposed at the Clean Harbors Chiquita Canyon Landfill located at 29201 Henry Mayo Drive, Castaic, California.

- A total of 1,463 tons of California hazardous soil was disposed at the Clean Harbors Buttonwillow Landfill located at 2500 West Lokern Road, Buttonwillow, California.

The non-hazardous soil was from the TEPH and PNA impacted area, located near the northern corner of the subject property. The California hazardous soil was from the lead impacted areas, primarily located along the southeastern and southwestern property lines.

Confirmation Sampling

Soil

Confirmation soil samples were collected to demonstrate the effectiveness of the remedial excavation in removing contaminants existing in the soil at concentrations exceeding site cleanup goals. Confirmation soil samples were collected from the excavation sidewall and bottom at a rate of one sample per every 100 square feet of excavation sidewall and bottom (Figure 8). The rate of confirmation soil sample locations is in accordance with FPD protocol.

Confirmation soil samples were collected directly from the excavation sidewall or bottom. In areas determined to not be safe to enter the excavation the confirmation soil samples were collected from the backhoe bucket. Confirmation soil samples were collected in glass jars provided by the analytical laboratory. The sample containers were labeled, sealed with a Teflon lined lid, and stored in a cooler chilled to 4 degrees Celsius. The samples were couriered directly from the site to a state certified analytical laboratory using chain-of-custody protocol. All sampling was completed under the oversight of a California Professional Geologist.

Soil located directly adjacent to the confirmation soil sample location was collected in a sealable plastic bag. The soil in the plastic bag is used for soil classification using the Unified Soil Classification System and to screen for volatile organic compounds (VOCs) using a photoionization detector (PID). The plastic bag was sealed and allowed time for any VOCs to volatize. The plastic bag was then opened and the PID probe tip was placed within one-eighth inch of the soil. At the start of each day of soil sample collection the PID was calibrated to an isobutylene standard. The PID data were recorded on the daily field sheets. In addition, the soil samples were examined for field evidence of contamination. Field evidence of contamination includes discoloration, odors, and elevated photoionization detector (PID) readings. During the remedial excavation field evidence of contamination included burned material. At the direction of the City of Santa Barbara the excavation was extended until there were either no detected concentrations of contaminants exceeding cleanup goals or to the property line.

Groundwater

A groundwater sample was collected from standing water in a pothole within the excavation pit. The area near the southern corner of the subject property was excavated to

approximately 7 to 7.5 feet below grade. Following the sloping of the excavation area and once it was determined safe to entire the excavation pit, a pothole was dug at the bottom of the deepest area of the excavation pit with a shovel. The pothole was approximately 1 foot wide by 1 foot long and approximately 1 foot deep. Groundwater was encountered in the pothole at approximately 8 feet below grade.

The groundwater sample was collected in an unpreserved plastic container provided by the analytical laboratory. The container was capped, labeled, and stored in a cooler chilled to 4 degrees Celsius, pending delivery to the analytical laboratory. The sample was couriered directly from the site to a state certified analytical laboratory using chain-of-custody protocol. All sampling was completed under the oversight of a California Professional Geologist.

Laboratory Analysis

The confirmation samples were transported to Oilfield Environmental & Compliance of Santa Maria, California under chain-of-custody documentation.

TEPH and PNA Impacted Soil

The 12 confirmation soil samples collected from the area of TEPH and PNA impacted soil were analyzed for TEPH by EPA Method 8015M. Additionally, 6 of the 12 confirmation soil samples collected from the area of TEPH and PNA impacted soil were analyzed for PNAs by EPA Method 3550B.

Lead Impacted Soil

The 106 confirmation soil samples collected from the area of lead impacted soil were analyzed for total lead by EPA Method 6000/7000. The 52 confirmation soil samples containing total lead concentrations exceeding 50 mg/kg were analyzed for STLC lead by EPA Method 6000/7000 and 8 confirmation soil samples containing STLC lead exceeding 5 mg/L were analyzed for TCLP lead by EPA Method 6000/7000.

Results

Soil Sampling

Burned and unburned debris including plates, bowls, cups, bottles, bones, clam shells, metal, and other railroad associated debris were encountered in the excavated areas near the southern corner of the subject property. There was no field evidence of contamination in other areas of the subject property. No odors and soil discoloration were noted and non-detect PID readings were measured in the soil samples collected from other areas of the subject property. The soil encountered in the excavation pit was comprised of primarily poorly graded brown to yellowish brown silt and sand mixtures with increasing amounts of

clay towards groundwater. Groundwater was encountered in the excavation pit at a depth of approximately 8 feet below grade.

A summary of the confirmation soil sampling analytical results is included in Tables 4, 5, 6, and 7. A summary of the backfill analytical results is included in Table 8. A copy of the analytical report is included in Appendix 6.

Lead

Total lead was detected at concentrations ranging from 4.2 mg/kg to 1,900 mg/kg in the 106 confirmation soil samples analyzed for total lead. Lead was detected at a concentration exceeding 50 mg/kg in 52 of the 106 soil samples analyzed for total lead. Lead concentrations exceeding 50 mg/kg warrant STLC analysis. Soluble lead was detected in the 52 soil samples at concentrations ranging from 0.36 mg/L to 49 mg/L. Soluble lead was detected at a concentration exceeding 5 mg/L in 39 of the 52 soil samples analyzed for STLC lead. Select soil samples with STLC lead concentrations exceeding 5 mg/L were analyzed for TCLP lead. TCLP lead was detected in 8 soil samples at concentrations ranging from 0.23 mg/L to 4.9 mg/L.

TEPH

TPHd was detected above the laboratory method detection limit in 2 of the 12 soil samples analyzed for TEPH. TPHd was detected in confirmation soil samples VS10 and VS12 at concentrations of 110 and 11 mg/kg.

TPHo was detected at concentrations exceeding the laboratory method detection limit in all (12) of the soil samples analyzed for TEPH. TPHo was detected in the soil samples at concentrations ranging from 7.7 to 990 mg/kg.

PNAs

Varying concentrations of PNAs were detected in 5 of the 6 soil samples analyzed for PNAs. The PNAs acenaphthylene, anthracene, benzo(a)anthracene, benzo(a)pyrene, benzo(b)flouranthene, benzo(ghi)perylene, benzo(k)fluoranthene, chrysene, dibenz(a,h)anthracene, flouranthene, indeno(1,2,3-cd)pyrene, phenanthrene, and pyrene were detected at concentrations above the method detection limit in 5 of the 6 soil samples analyzed for PNAs.

Groundwater Sampling

Dissolved lead was not detected above the method detection limit in the groundwater sample collected from standing water in a pothole excavated near the southern corner of the subject property.

Discussion

As discussed in the Phase II ESA section of this report, the subject property is under the jurisdiction of the CCRWQCB and the FPD is the local oversight agency for sites within Santa Barbara County. The cleanup goals for the subject property were developed in accordance with the guidelines of the FPD. A description of the cleanup goals is included in the Phase II ESA section of this report and a table summarizing the cleanup goals is presented again here.

Chemical	Cleanup Goal		Highest Level Detected to Date at the Subject Property
Lead			
Total Lead	400 mg/kg		1,900 mg/kg
Soluble Lead	5 mg/L		82.7 mg/L
TPH			
TPH	1,800 mg/kg		3,146 mg/kg
PNAs			
	Residential	Industrial	
Benzo(a)anthracene	150 μg/kg	2,100 μg/kg	509 μg/kg
Benzo(a)pyrene	15 μg/kg	210 μg/kg	603 μg/kg
Benzo(b)flouranthene	150 μg/kg	2,100 μg/kg	1,090 μg/kg
Dibenz(a,h)anthracene	15 μg/kg	210 μg/kg	117J μg/kg
Indeno(1,2,3-cd)pyrene	150 μg/kg	2,100 μg/kg	464 μg/kg

The subject property was not accepted for oversight by the FPD SMU. The City of Santa Barbara contracted with TRAK Environmental to provide third party oversight of the remedial excavation. The City of Santa Barbara Environmental Specialist and a representative of TRAK were onsite during remedial excavation activities and will review the findings of this report.

Soil Sampling and Analysis

The excavation was extended until confirmation soil samples did not contain total lead and STLC lead concentrations exceeding site cleanup goals or to the site property line. A total of 106 confirmation soil samples were collected from the excavation area for lead impacted soil. The excavation was extended based on the total lead concentration and the STLC lead concentration in 31 of the confirmation soil samples. The excavation was not extended at the location of 75 of the confirmation soil samples; 68 of the 75 confirmation soil samples did not contain total lead or STLC lead concentrations exceeding cleanup goals and 7 of the 75 confirmation soil samples were collected from the excavation sidewall at the southeastern and southwestern property lines, where the excavation could not be extended.

TEPH was not detected at concentrations exceeding the cleanup goal for TEPH of 1,800 mg/kg. TEPH was detected at concentrations exceeding the FPD Investigation Level for TPH of 100 mg/kg in 6 of the 12 confirmation soil samples. PNAs were not detected at concentrations exceeding the site cleanup goals (SL-I) for PNAs. The PNA benzo(a)pyrene was detected at concentrations exceeding the SL-R for benzo(a)pyrene of 15 μg/kg in 5 of the 6 soil samples analyzed for PNAs.

Lead

The following number of confirmation soil samples was collected:

- 106 total confirmation soil samples.
- 31 confirmation soil samples were removed by overexcavation.
- 75 confirmation soil samples were collected from the final excavation extent.
    - 7 of the 75 soil samples were collected from the southeast and southwest property lines.
    - 68 of the 75 soil samples were collected from the final excavation extent on the subject property.

Total lead was detected at concentrations ranging from 4.2 to 1,900 mg/kg in the 106 confirmation soil samples analyzed for total lead. As discussed in the Phase II ESA section of this report the total lead concentrations can be compared to the following:

- Typical background concentrations of lead in soil in California range from 12.4 mg/kg to 97.1 mg/kg, with the mean reported at 23.9 mg/kg.
- The FPD Investigation Level for lead in soil is 50 mg/kg.
- The Soil Screening Level (SL) for lead in soil is 400 mg/kg. The SL for lead of 400 mg/kg is also the cleanup goal for the subject property.

The cleanup goal for total lead in the soil at the subject property is set at the SL for total lead in soil of 400 mg/kg. Total lead was detected at concentrations exceeding 400 mg/kg in excavation sidewall confirmation soil samples CS8 (470 mg/kg), CS11 (1,900 mg/kg), CS31 (1,400 mg/kg), and CS35 (440 mg/kg). Total lead was not detected above 400 mg/kg in any of the excavation bottom confirmation soil samples. Confirmations soil samples CS8 and CS11 were collected from the eastern excavation sidewall, adjacent to the State Street Hotel structure, at a depth of 0.5 feet below grade. Confirmation soil samples CS31 and CS35 were collected from the western excavation sidewall, near the southern corner of the subject property, at a depth of 1 foot below grade. Confirmation soil samples CS31 and CS35 were located near an excavated area containing a large quantity of burned and unburned railroad related debris. There was no field evidence of contamination in the area of confirmation soil samples CS8 and CS11. The excavation extent was extended until total lead concentrations were below cleanup goals (400 mg/kg) in all four areas marked by confirmation soil samples CS8, CS11, CS31, and CS35. The excavation in the area of confirmation soil samples CS8

and CS11 was extended to the wall of the State Street Hotel structure. No confirmation soil samples were collected because the sidewall was the foundation of the State Street Hotel structure. Excavation sidewall confirmation samples CS84, CS85, and CS93 were collected from the extended excavation sidewall in the area of confirmation soil samples CS31 and CS35. Total lead was detected at concentrations of 9.1 mg/kg, 5.8 mg/kg, and 9.5 mg/kg in confirmation soil samples CS84, CS85, and CS93. The extended excavation area removed soil impacted by total lead concentrations exceeding cleanup goals (400 mg/kg) at the locations of confirmation soil samples CS8, CS11, CS31, and CS35. Figure 8 depicts the final excavation extent and the confirmation soil sample locations.

The excavation was extended until lead concentrations detected in the confirmation soil samples were below cleanup goals or to the property line. The excavation was extended to the southeastern and to the southwestern property lines. Total lead concentrations detected in the confirmation soil samples collected from the excavation sidewalls at the southwestern and southeastern subject property lines, ranged from 90 mg/kg (CS104) to 380 mg/kg (CS100). The total lead concentrations detected in these sidewall soil samples are below the site cleanup goal for total lead of 400 mg/kg, but above background concentrations for total lead in soil in California (with the exception of sample CS104 with a total lead concentration of 90 mg/kg). Typical background concentrations of lead in soil in California range from 12.4 mg/kg to 97.1 mg/kg, with the mean reported at 23.9 mg/kg (Kearny Foundation of Soil Science, Division of Agriculture and Natural Resources, University of California, March 1996).

Total lead concentrations detected in the confirmation soil samples collected from the final excavation extent on the subject property (not in the confirmation soil samples collected from the southeastern and southwestern subject property lines), ranged from 4.2 mg/kg (CS54) to 120 mg/kg (CS30 and CS72). The total lead concentrations detected in the confirmation soil samples collected from the final excavation extent on the subject property were generally within the reported background levels for lead in soil in California (5 of the confirmation samples contained lead concentrations at slightly higher concentrations of between 100 mg/kg and 120 mg/kg). In our experience regulatory agencies do not require the cleanup of soil to below background concentrations.

Fourteen of the 68 confirmation soil samples collected from the final excavation extent on the subject property contained lead concentrations exceeding the FPD Investigation Level for lead in soil of 50 mg/kg and 7 of the 7 confirmation soil samples collected from the final excavation extent at the subject property line contained lead concentrations exceeding the FPD Investigation Level for lead in soil of 50 mg/kg. The FPD has set Investigation Levels for concentrations of contaminants in soil, soil gas, and groundwater (*Leaking Underground Fuel Tank & Site Mitigation Unit Manual*, dated January 2007). As stated in the Manual: If a contaminant is detected at or above the Investigation Level it may require additional assessment and delineation.

In addition, the levels of lead were compared to TTLC levels adopted by the DTSC. The TTLC levels are used to determine whether soil would be classified as a hazardous or non-

hazardous waste for disposal purposes. Total lead was detected in confirmation soil samples CS11 and CS31 at concentrations of 1,900 mg/kg and 1,400 mg/kg. None of the other confirmation soil samples contained total lead concentrations exceeding the TTLC level of 1,000 mg/kg. All of the soil disposed from the lead impacted area was disposed as a California hazardous waste.

Soluble Lead

As described below, other areas of the excavation were extended based on soluble lead concentrations exceeding cleanup goals for the subject property.

A total of 52 confirmation soil samples contained total lead at a concentration exceeding 50 mg/kg. A total lead concentration exceeding 50 mg/kg warrants STLC analysis. Soil containing an STLC concentration above 5 mg/L is considered to be a California hazardous waste. The highest STLC lead concentration detected in the confirmation soil samples was 49 mg/L (CS59). The excavation was extended until confirmation soil samples did not contain STLC lead concentrations exceeding 5 mg/L or to the property line. With the exception of the confirmation soil samples collected from the excavation sidewalls at the southeast and southwest property lines, none of the confirmation soil samples collected from the final excavation extent contained STLC lead concentrations exceeding 5 mg/L. The table below includes the STLC lead concentrations detected in the 7 confirmation soil samples collected from the southwestern and southeastern property boundaries.

Sample Identification	Depth (feet)	Total Lead (mg/kg)	STLC Lead (mg/L)	TCLP Lead (mg/L)
CS58	1	290	38	0.74
CS98	1	170	12	0.85
CS99	1	210	19	2.5
CS100	2	380	30	1.2
CS101	1.5	270	9.1	0.064
CS102	1.5	180	37	0.024
CS104	2	90	14	0.021

The TCLP analysis determines if a waste is considered to be a federal (RCRA) hazardous waste. If the TCLP lead concentration is above 5 mg/L then the waste is considered to be a RCRA hazardous waste. Soil samples collected during the Phase II ESAs conducted at the subject property, containing STLC lead concentrations exceeding 5 mg/L were analyzed for TCLP lead. None of the TCLP lead concentrations detected during the Phase II ESAs, exceeded the TCLP lead threshold of 5 mg/kg. Based on the analytical results from the Phase II ESAs the soil to be disposed from the lead impacted area was accepted by the Class 1 landfill, Clean Harbors Buttonwillow, as a California hazardous waste.

Eleven of the confirmation soil samples collected during the remedial excavation were analyzed for TCLP lead. The 11 confirmation soil samples analyzed for TCLP lead were comprised of the 2 confirmation soil samples containing the highest concentrations of STLC

lead and the confirmation soil samples containing STLC lead concentrations above 5 mg/L that were collected from the southeastern and southwestern excavation sidewalls. TCLP lead was detected at concentrations of 4.9 mg/L and 1.8 mg/L in confirmation soil samples CS35 (STLC lead 42 mg/L) and CS 59 (STLC lead 49 mg/L). TCLP lead was detected at concentrations ranging from 0.021 mg/L to 2.5 mg/L in the confirmation soil samples (in table above) collected from the southeastern and southwestern excavation sidewalls at the subject property boundary. None of the soil samples analyzed for TCLP lead exceeded the TCLP lead threshold of 5 mg/L.

TEPH

As discussed in the July 15, 2009, Phase II ESA Report prepared by Rincon for the subject property, a more appropriate cleanup goal for the subject property is the SFRWQCB ESL for direct exposure to TPH in soil at residential sites of 1,800 mg/kg (Table K-1, HQ=1 of the RWQCB document Screening for Environmental Concerns at Sites with Contaminated Soil and Groundwater, revised May 2008). None of the detected concentrations of TEPH detected in the confirmation samples, collected from the remedial excavation at the subject property, exceed the ESL for TPH of 1,800 mg/kg. The highest detected concentration of TEPH during the remedial excavation was in confirmation sample VS10 at a concentration of 1,100 mg/kg. Confirmation sample VS10 was collected from the northeastern sidewall of the TPH excavation, at 0.5 feet below grade.

As described in the Phase II ESA section of this report, the FPD Investigation Level for TPH is for the aggregate of all carbon chains. For sites where the detected concentrations of TPH are in soil less than 50 feet above groundwater the Investigation Level for TPH is 100 mg/kg. TPH in the gasoline range has not been detected in soil matrix samples collected from the subject property. Confirmation samples collected during the remedial excavation were analyzed for total extractable petroleum hydrocarbons (TEPH). TEPH are comprised of diesel fuel range hydrocarbons (TPHd) and oil range hydrocarbons (TPHo).

TPHd was detected slightly above the FPD Investigation Level for TPH of 100 mg/kg in confirmation soil sample VS10 at a concentration of 110 mg/kg. TPHo was detected at a concentration exceeding the FPD Investigation Level for TPH of 100 mg/kg in 6 of the 12 confirmation samples analyzed for TEPH. TPHo was detected at concentrations slightly exceeding 100 mg/kg in confirmation soil samples VS2 (170 mg/kg), VS4 (170 mg/kg), VS5 (120 mg/kg), and VS6 (110 mg/kg). TPHo was detected slightly higher in confirmation soil samples VS10 (990 mg/kg) and VS12 (340 mg/kg). TPHo is a heavy range hydrocarbon with a carbon chain of C_{23} to C_{40}. Heavy range hydrocarbons such as TPHo are mainly insoluble and immobile.

PNAs

Six of the confirmation soil samples were analyzed for PNAs and PNAs were detected above the method detection limit in 5 of the 6 soil samples analyzed for PNAs. None of the detected concentrations of PNAs exceeded the site cleanup goals for PNAs. The site cleanup goals for PNAs are set at the SL for PNAs at commercial and industrial sites. The PNAs acenaphthylene, anthracene, benzo(a)anthracene, benzo(a)pyrene, benzo(b)flouranthene, benzo(ghi)perylene, benzo(k)fluoranthene, chrysene, dibenz(a,h)anthracene, flouranthene, indeno(1,2,3-cd)pyrene, phenanthrene, and pyrene were detected at concentrations above the method detection limit in 5 of the 6 soil samples analyzed for PNAs. The PNA benzo(a)pyrene was detected at concentrations exceeding the SL-R for benzo(a)pyrene in confirmation soil samples VS2 (45 μg/kg), VS5 (19 μg/kg), VS7 (20 μg/kg), VS9 (19 μg/kg), and VS12 (27 μg/kg). None of the other PNAs detected in the 5 soil samples exceeded the SL-R.

Groundwater

One groundwater sample was collected during the remedial excavation. The groundwater sample was collected based on the elevated concentrations of lead detected in the confirmation soil samples collected near the southern corner of the subject property and based on the field evidence of lead contamination near the southern corner of the subject property. Dissolved lead was not detected above the method detection limit in the groundwater sample (GW1).

Backfill

The excavation areas were backfilled with clean imported fill material. Prior to backfilling, soil samples were collected in accordance with the Department of Toxic Substances Control (DTSC), *Information Advisory Clean Imported Fill Material,* dated October 2001, to ensure that the fill material is not contaminated. Backfill material for the remedial excavation was obtained from the Santa Barbara Sands quarry located at 345 Ellwood Canyon Road, Goleta, California.

Asbestos was not detected in the 4 samples collected from the backfill material.

pH was detected between 8.24 and 9.25 in the 4 soil samples collected from the backfill material. Based on the pH results, the backfill material is slightly basic.

Varying concentrations of metals were detected in the 4 soil samples collected from the backfill material. Total lead was detected in the backfill samples at very low concentrations ranging from 1.8 mg/kg (Fill2) to 3 mg/kg (Fill4). Arsenic was detected at concentrations ranging from 4.6 (Fill2) to 7.5 mg/kg (Fill4) in the backfill samples. The detected concentrations of arsenic in the backfill samples exceed the SL-R for arsenic of 0.39 mg/kg. Background concentrations of arsenic found in California soils range from 0.59 to 11.0 mg/kg (Kearny Foundation of Soil Science, Division of Agriculture and Natural Resources,

University of California, March 1996). The USEPA states that generally they do not require cleanup below natural background levels. In light of this fact and in our experience regulatory agencies typically consider the use of local or regional background concentrations as the threshold concentration. In addition, arsenic was detected at concentrations ranging from 2.81 mg/kg to 8.31 mg/kg, in soil samples collected during a Phase II ESA completed in August and September of 2008 at the subject property. Therefore, the detected concentrations of arsenic in the backfill samples (4.9 mg/kg, 4.6 mg/kg, 6.7 mg/kg, and 7.5 mg/kg) are within reported background concentrations for arsenic in the soil in California and are in line with background concentrations of arsenic detected on the subject property (2008 Phase II ESA soil sampling analytical results for arsenic). No other metals were detected at concentrations exceeding action levels.

Mulch

Following the completion of the backfill activities, a 4 inch thick layer of mulch was placed over all disturbed areas of the site. As indicated on the Santa Barbara County Waste Reduction Program website (http://www.lessismore.org/Programs/mulch.html), the mulch is generated by residents and commercial businesses in the County of Santa Barbara. According to the Santa Barbara County website:

> A Quality Assurance/Control (QA/QC) Program ensures the production of a clean product that may be safely applied to ornamentals, fruit trees, and vegetable gardens. Through their franchise agreements with the County, private solid waste hauling companies are responsible for ensuring that residentially collected green waste has a low level of contaminants. Painted and treated plywood and creosoted woods are removed prior to grinding, and electromagnets recover ferrous metals. Processed mulch cures for two to three days to generate enough heat to destroy some weed seeds. There will be a small percentage (one to four percent by volume) of inert and film plastics, which are virtually impossible to remove without expensive equipment. In the event that processed mulch becomes contaminated before distribution, it is used internally. To date, the County has not received any complaints or anecdotal evidence that use of its mulch has resulted in any damage to plants or caused human health problems.

The mulch was delivered to the site by Santa Barbara County in 20 ton end dump semi-trucks. The mulch was spread by RTS with the loader and with hand tools.

Conclusions

Total lead was not detected above the cleanup goal for total lead of 400 mg/kg in any of the confirmation soil samples collected from the final excavation extent. STLC lead was not detected above the cleanup goal for STLC lead of 5 mg/L in any of the confirmation soil samples collected from the unconstrained excavation extent. STLC lead was detected at concentrations ranging from 9.1 mg/L to 38 mg/L in the confirmation samples collected

from the southeastern and southwestern excavation sidewalls at the property boundary. The excavation was not extended beyond the subject property boundary and no soil samples have been collected from outside the subject property boundary.

Dissolved lead was not detected above the laboratory method detection limit in a groundwater sample collected from standing water in a pothole excavated near the southern corner of the subject property.

TEPH was not detected above the ESL for TPH of 1,800 mg/kg in any of the confirmation soil samples collected from the final excavation extent. TPHo concentrations ranged from 7.7 mg/kg to 990 mg/kg in the confirmation soil samples and TPHd was detected in 2 confirmation soil samples at concentrations of 110 mg/kg (VS10) and 11 mg/kg (VS12). Six of the confirmation soil samples contained TEPH concentrations exceeding the FPD Investigation Level for TPH of 100 mg/kg.

PNAs were not detected above the cleanup goals (SL-I) for PNAs in any of the confirmation soil samples collected from the final excavation extent. The PNA benzo(a)pyrene was detected at concentrations above the SL-R for benzo(a)pyrene of 15 μg/kg, in 5 of the 6 confirmation soil samples analyzed for PNAs. The benzo(a)pyrene concentrations detected in the confirmation soil samples ranged from 19 μg/kg to 27 μg/kg.

Recommendations

The remedial excavation has removed soil impacted with lead, TEPH, and PNA concentrations exceeding site cleanup goals. It is our belief that the contamination can be primarily attributed to the use of the property by the Southern Pacific Railroad. Based on the large amount of burned and unburned railroad related debris, it appears that the railroad company dumped broken and used items at the subject property. Other potential sources of the lead contamination include aerially deposited lead from the former use of the site as a used car lot and parking lot (and from adjacent streets) and lead from paint flaking from the old State Street Hotel structure. Other potential sources for the TEPH contamination are the asphalt and potential spraying for weed control by the railroad. The PNAs are likely the result of burned debris. We believe that if the site were accepted for oversight by the FPD that it would receive environmental closure based on the following:

- Confirmation soil samples collected from the final excavation extent on the subject property contain lead concentrations below the cleanup goal of 400 mg/kg and are within or very slightly exceed background concentrations for lead in soil in California of 12.4 mg/kg to 97.1 mg/kg. Note that the soil samples collected from the final excavation extent at the southeastern and southwestern property lines contain higher lead concentrations.

- Soluble lead concentrations detected in the confirmation soil samples collected from the soil remaining on the subject property are below the cleanup goal for STLC lead of 5 mg/L.

- TEPH concentrations detected in the confirmation soil samples are below the ESL for TPH of 1,800 mg/kg.

- TEPH concentrations detected in the confirmation soil samples were primarily in the oil range (TPHo). Heavy range hydrocarbons are mainly insoluble and immobile.

- PNA concentrations detected in the confirmation soil samples are below the SL-I for PNAs.

- There are tentative plans to redevelop the site with a children's museum. It is our understanding that the site will likely be paved with concrete or asphalt and such a structure will likely be slab on grade. Limited exposed soil is expected under the current site design.

- TPH and dissolved lead have not been detected in the groundwater at the subject property.

LIMITATIONS

This report has been prepared for and is intended for the exclusive use of the City of Santa Barbara. The contents of this report should not be relied upon by any other party without the written consent of Rincon Consultants, Inc.

Our conclusions regarding the subject property are based on the results of a limited subsurface sampling program. The results of this evaluation are qualified by the fact that only limited sampling and analytical testing was conducted during this assessment.

This scope was not intended to completely establish the quantities and distribution of contaminants present at the subject property or to determine the cost to remediate the subject property. The concentrations of contaminants measured at any given location may not be representative of conditions at other locations. Further, conditions may change at any particular location as a function of time in response to natural conditions, chemical reactions and other events. Conclusions regarding the condition of the subject property do not represent a warranty that all areas within the subject property are similar to those sampled.

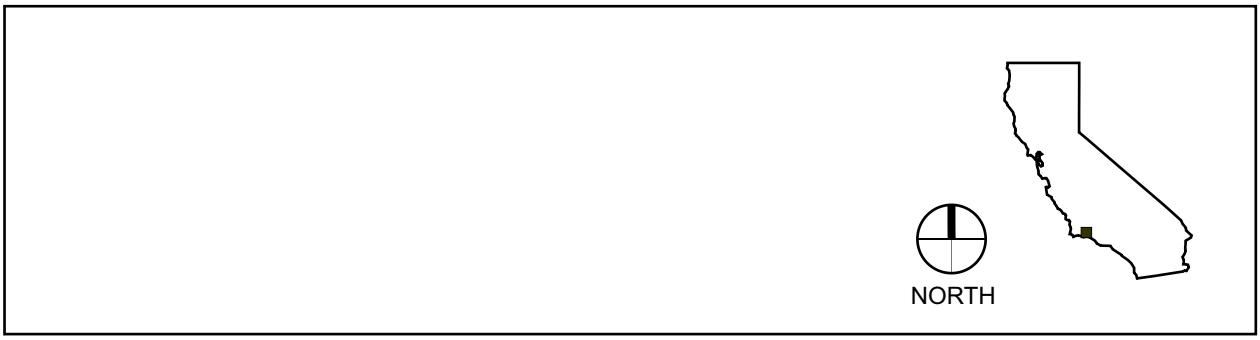

Vicinity Map

Figure 1

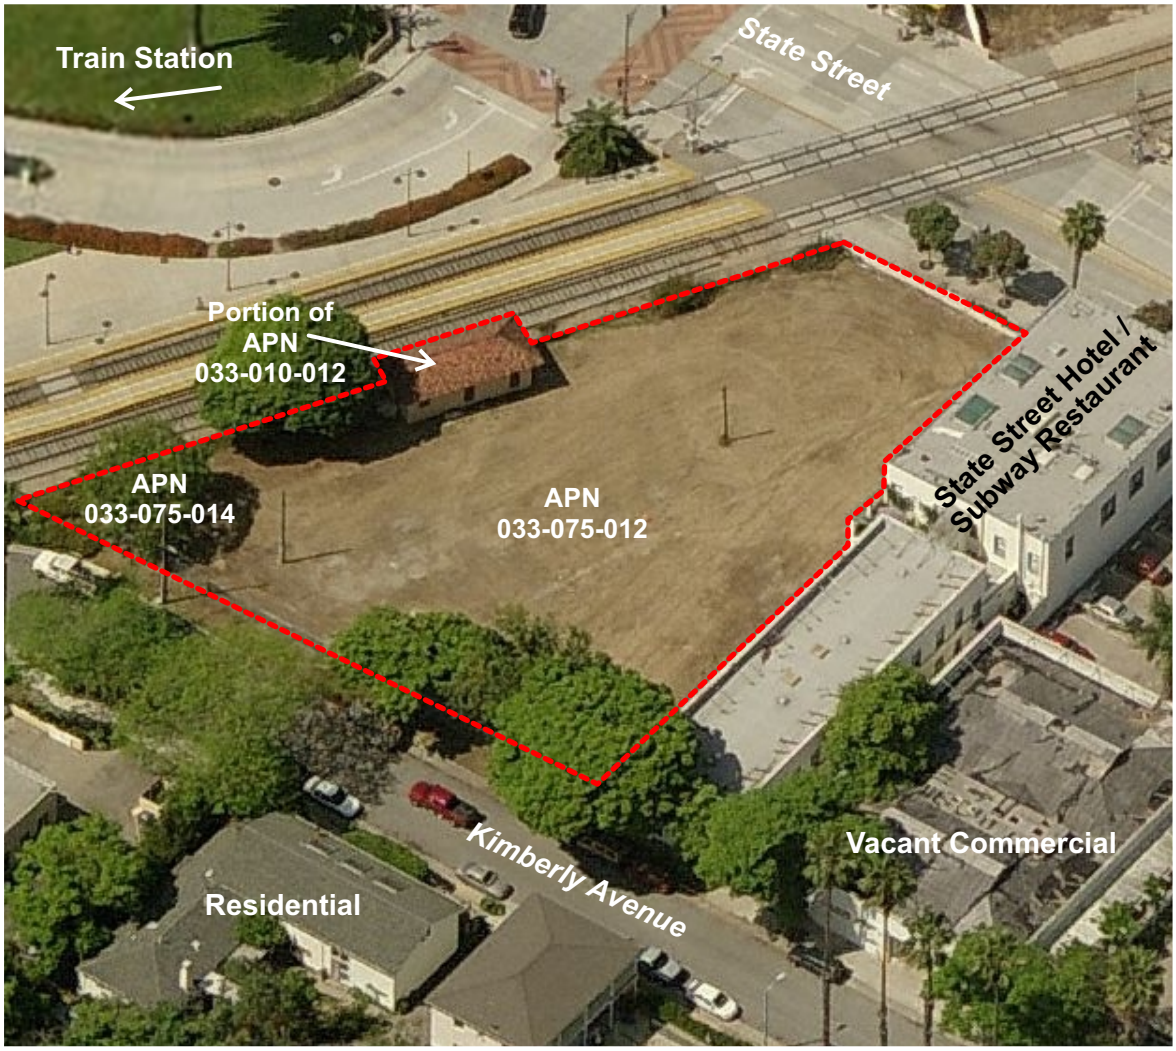

Subject Property Boundary

0 40 80
Approximate Scale in Feet

North

Site Map

Figure 2

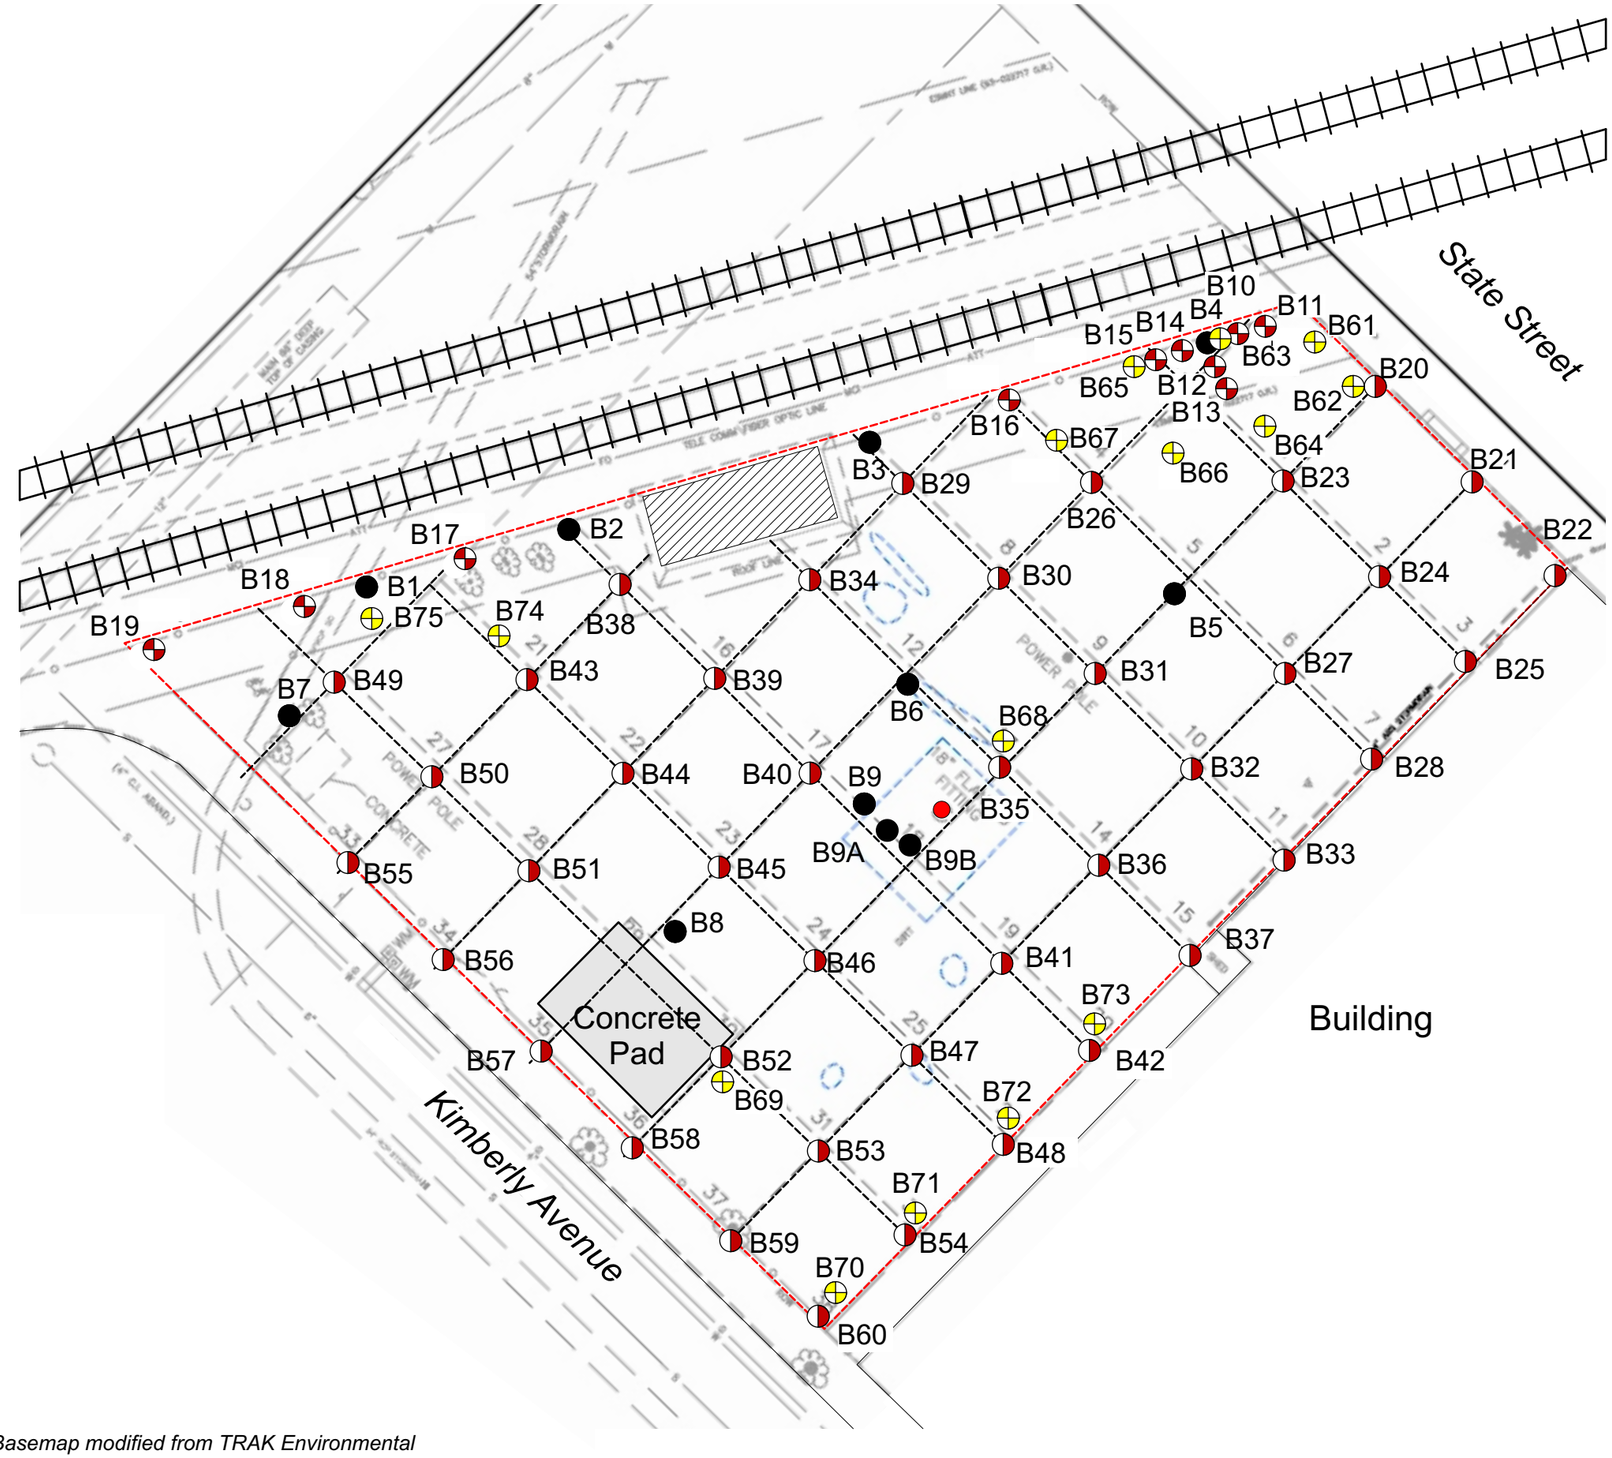

Basemap modified from TRAK Environmental

Legend

- Subject Property Boundary
- Signalman's Building
- Location of 18 inch Flanged Fitting
- B5 — Boring drilled by TRAK on August 25, 2008
- B11 — TPH Boring Location- April 21 and 22, 2009
- B22 — Lead Sampling Grid Boring Location- April 21 and 22, 2009
- B62 — Boring Location- February 11, 2010

0 30 60

Scale in feet

North

rincon

Boring Locations Map

125 State Street
Santa Barbara, California

Figure 3

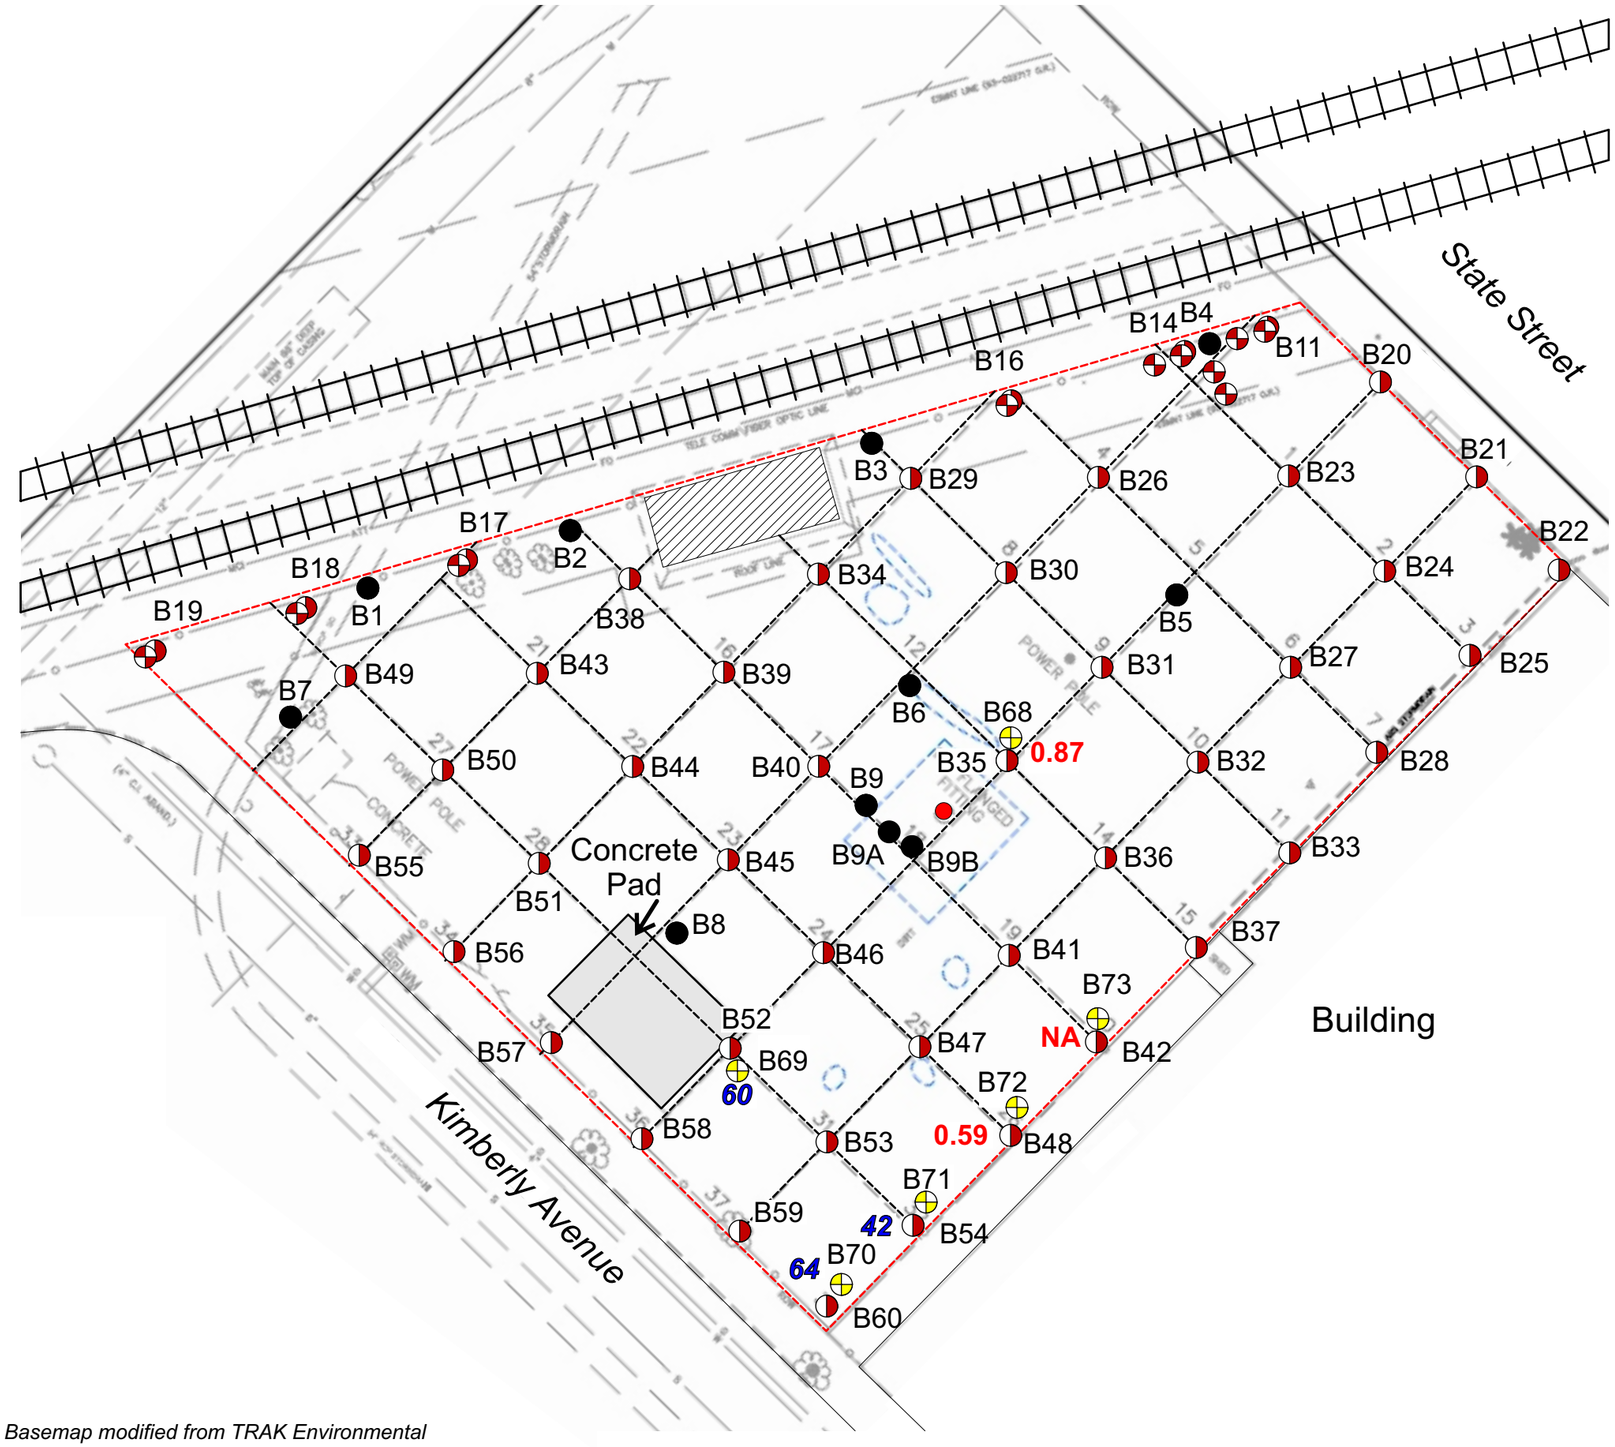

Basemap modified from TRAK Environmental

Legend

- Subject Property Boundary
- Signalman's Building
- Location of 18 inch Flanged Fitting
- B5 Boring drilled by TRAK on August 25, 2008
- B11 TPH Boring Location- April 21 and 22, 2009
- B22 Lead Sampling Grid Boring Location- April 21 and 22, 2009
- B62 Boring Location- February 11, 2010
- 1.48 STLC Lead Concentration in milligrams per liter (mg/L)
- *8.22* STLC lead concentrations exceeding the STLC for lead of 5 mg/L are outlined and in *italics.*
- STLC Soluble Threshold Limit Concentration
- NA Not Analyzed

0 30 60
Scale in feet

North

rincon

STLC Lead Concentrations in Soil Samples Collected 3 Feet Below Grade Map

125 State Street
Santa Barbara, California

Figure 4

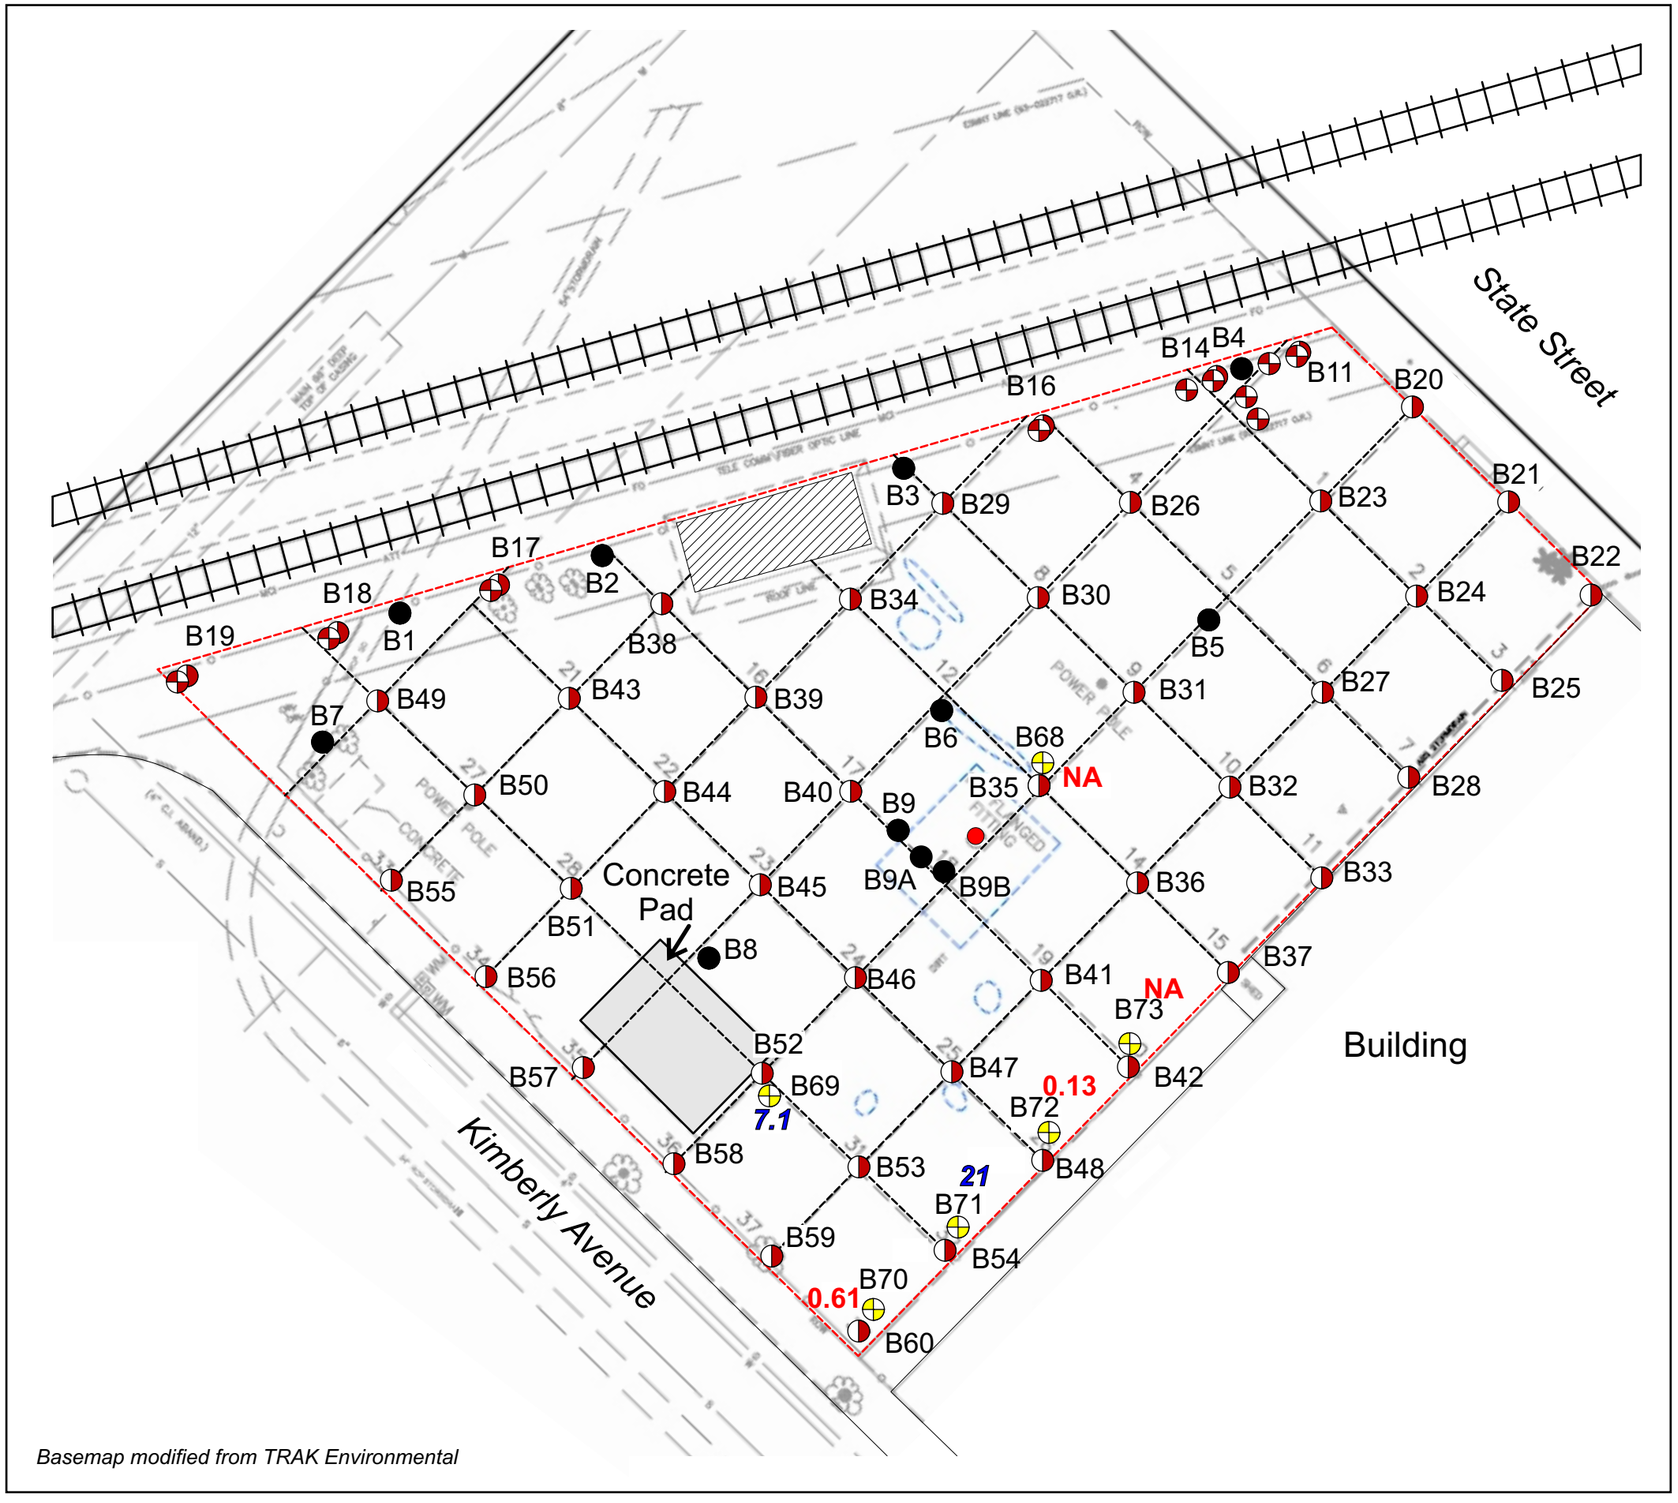

Basemap modified from TRAK Environmental

Legend

	Subject Property Boundary
	Signalman's Building
	Location of 18 inch Flanged Fitting
B5	Boring drilled by TRAK on August 25, 2008
B11	TPH Boring Location- April 21 and 22, 2009
B22	Lead Sampling Grid Boring Location- April 21 and 22, 2009
B62	Boring Location- February 11, 2010
1.48	STLC Lead Concentration in milligrams per liter (mg/L)
8.22	STLC lead concentrations exceeding the STLC for lead of 5 mg/L are outlined and in *italics.*
STLC	Soluble Threshold Limit Concentration
NA	Not Analyzed

0 30 60

Scale in feet

North

rincon

STLC Lead Concentrations in Soil Samples Collected 4 Feet Below Grade Map

125 State Street
Santa Barbara, California

Figure 5

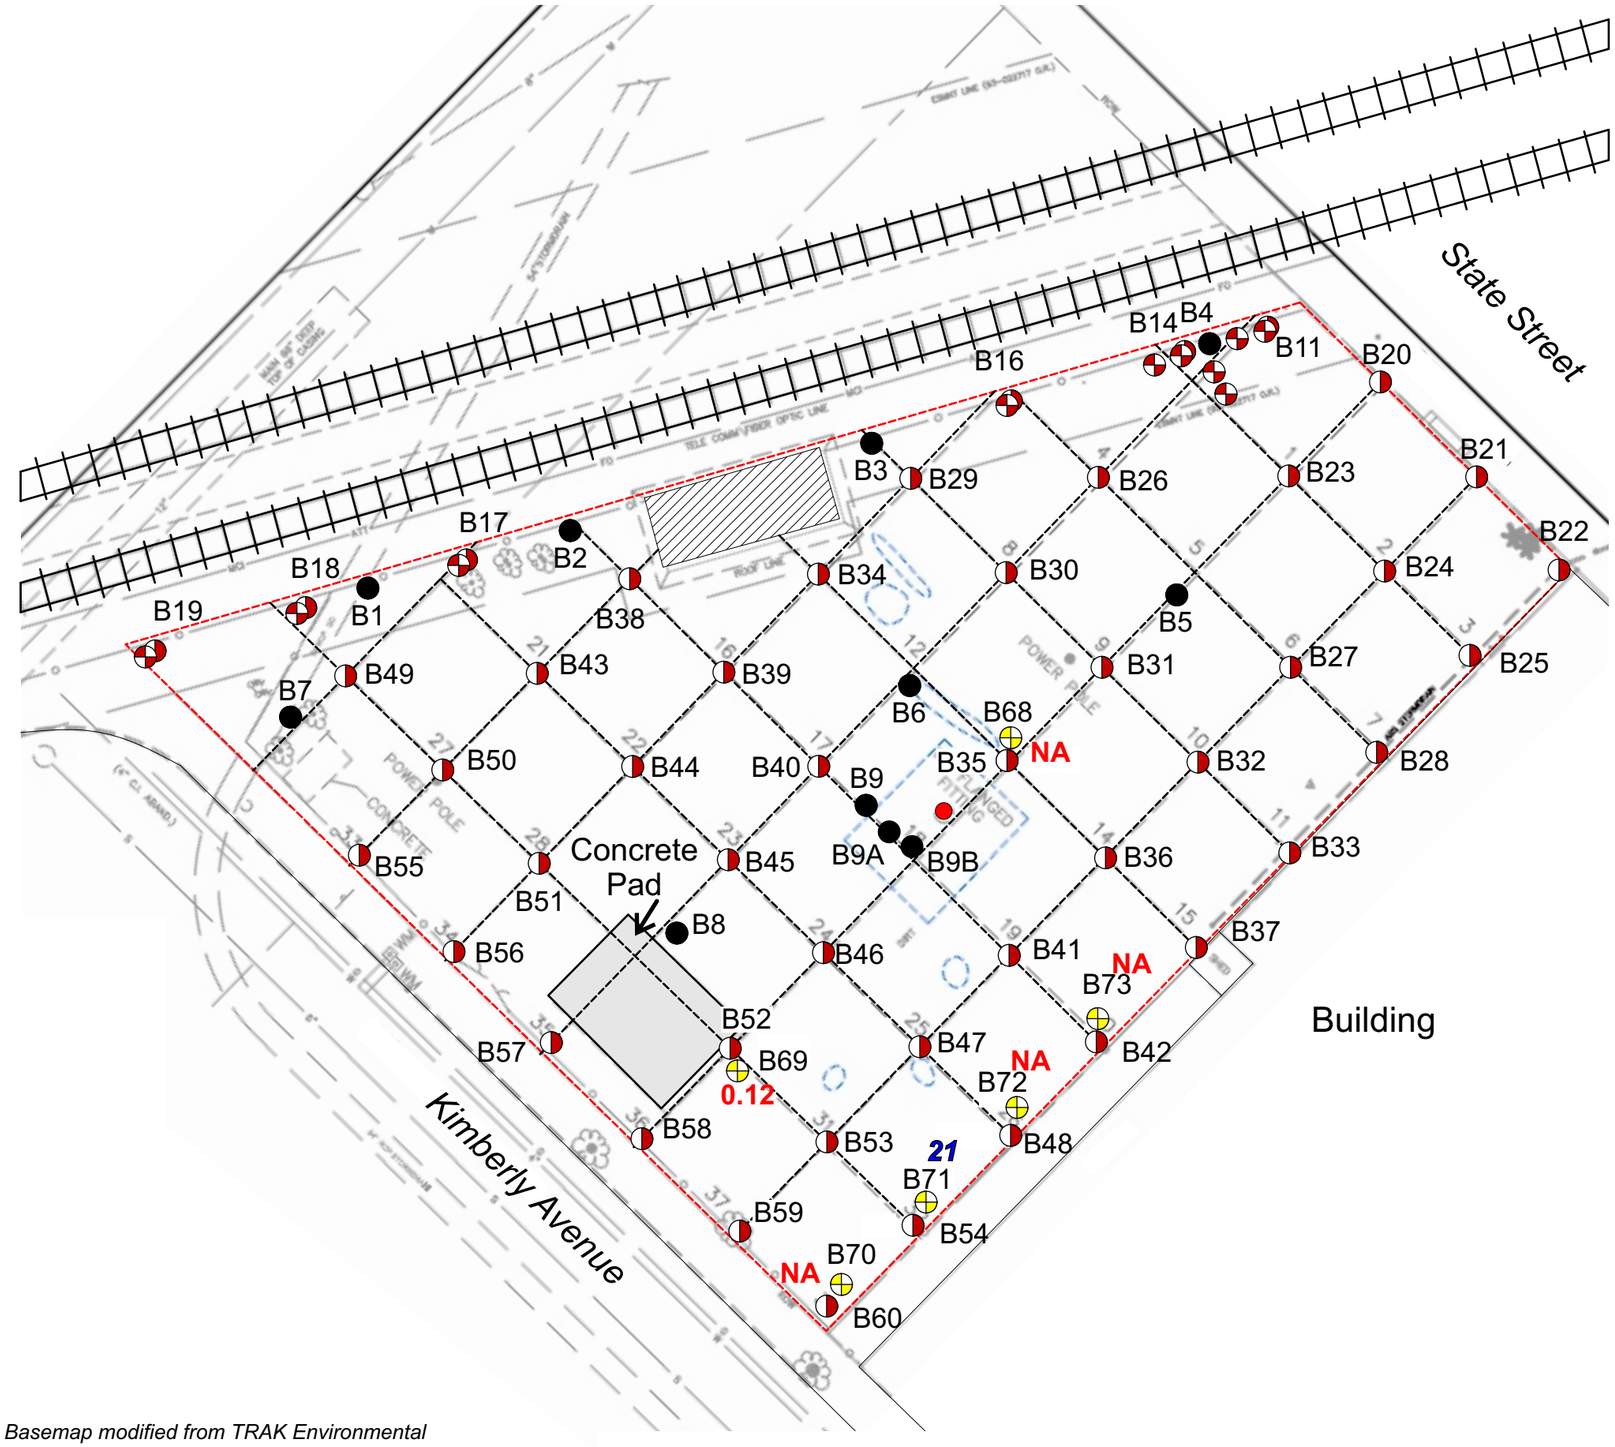

Basemap modified from TRAK Environmental

Legend

- Subject Property Boundary
- Signalman's Building
- Location of 18 inch Flanged Fitting
- B5 Boring drilled by TRAK on August 25, 2008
- B11 TPH Boring Location- April 21 and 22, 2009
- B22 Lead Sampling Grid Boring Location- April 21 and 22, 2009
- B62 Boring Location- February 11, 2010
- 1.48 STLC Lead Concentration in milligrams per liter (mg/L)
- ***8.22*** STLC lead concentrations exceeding the STLC for lead of 5 mg/L are outlined and in *italics.*
- STLC Soluble Threshold Limit Concentration
- NA Not Analyzed

0 30 60
Scale in feet

North

rincon

STLC Lead Concentrations in Soil Samples Collected 5 Feet Below Grade Map

125 State Street
Santa Barbara, California

Figure 6

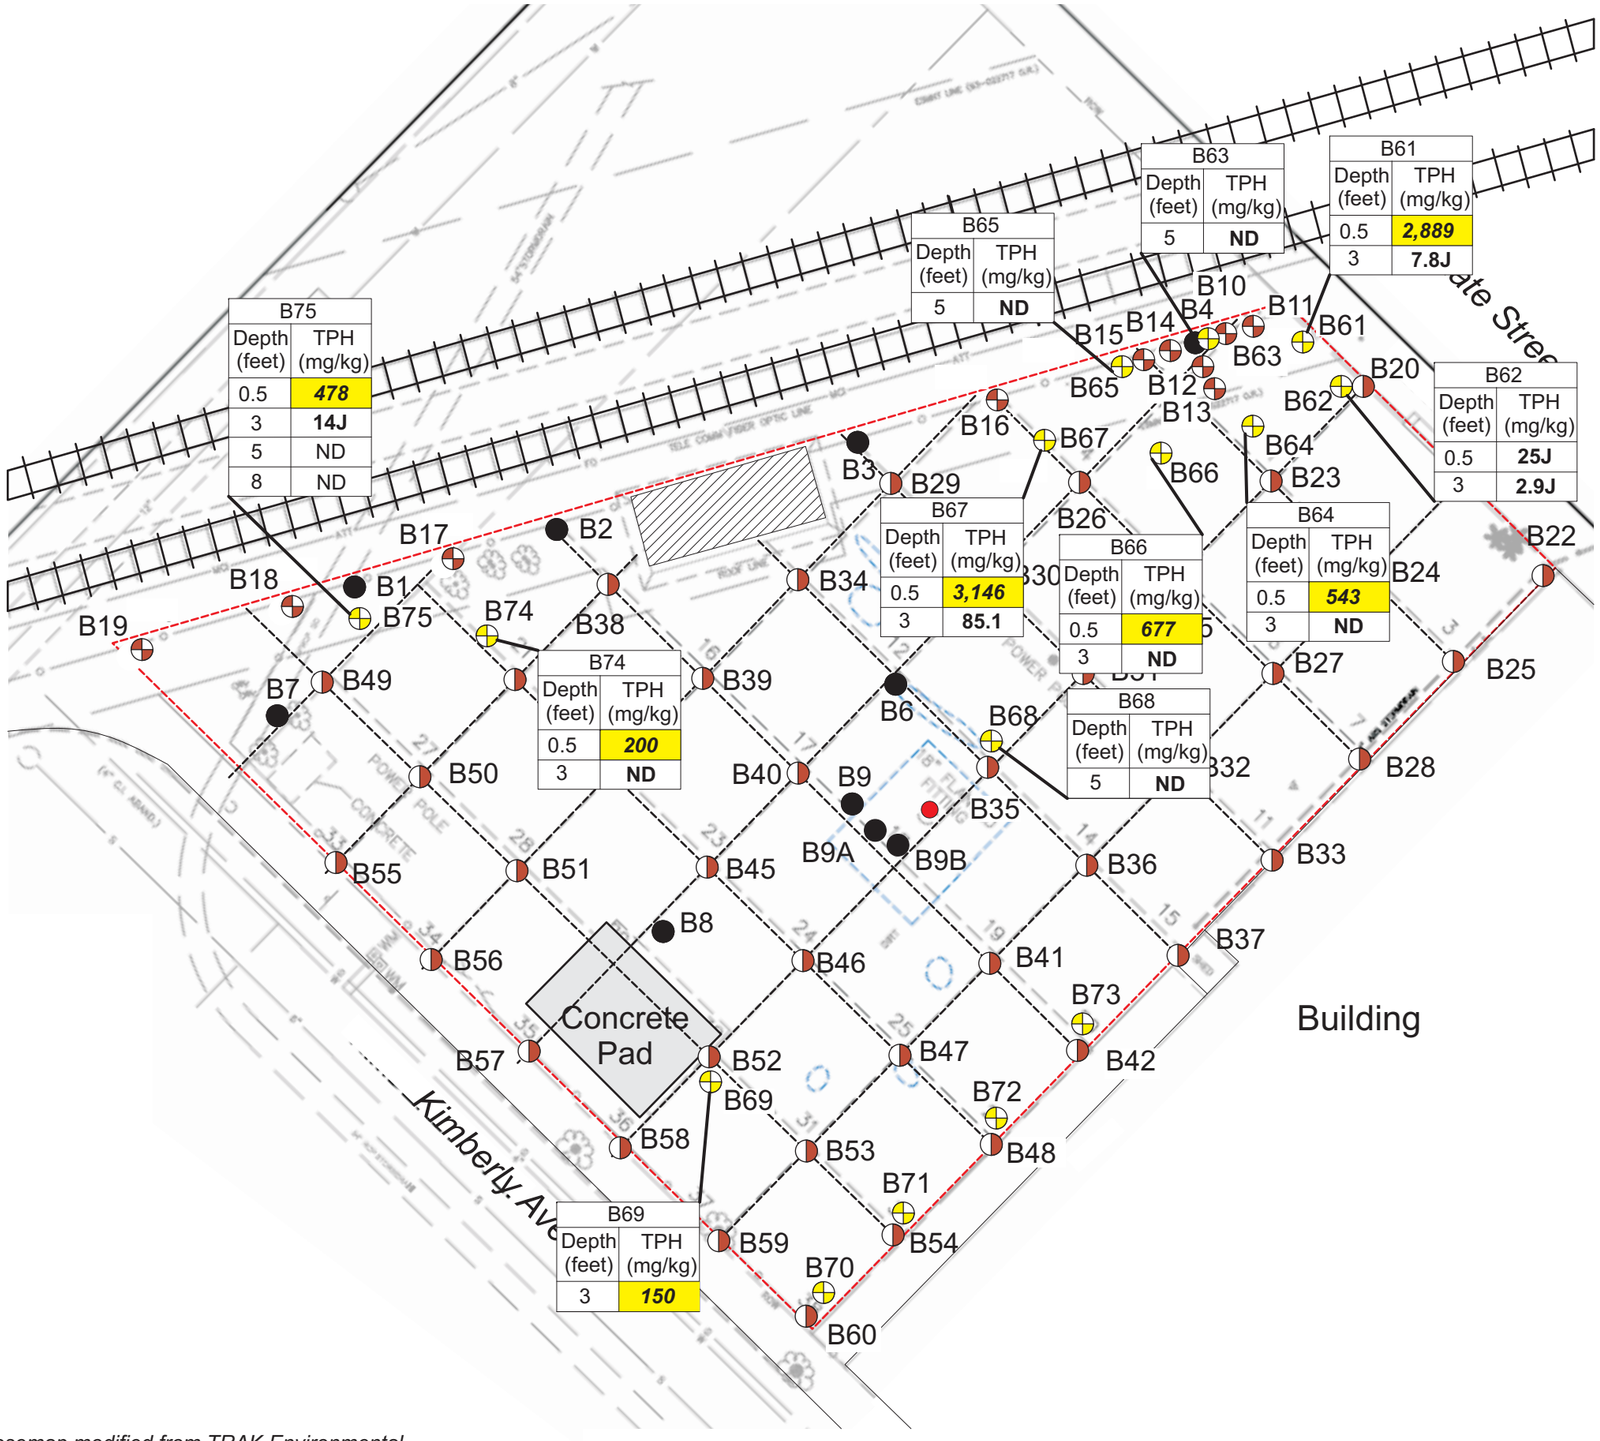

Basemap modified from TRAK Environmental

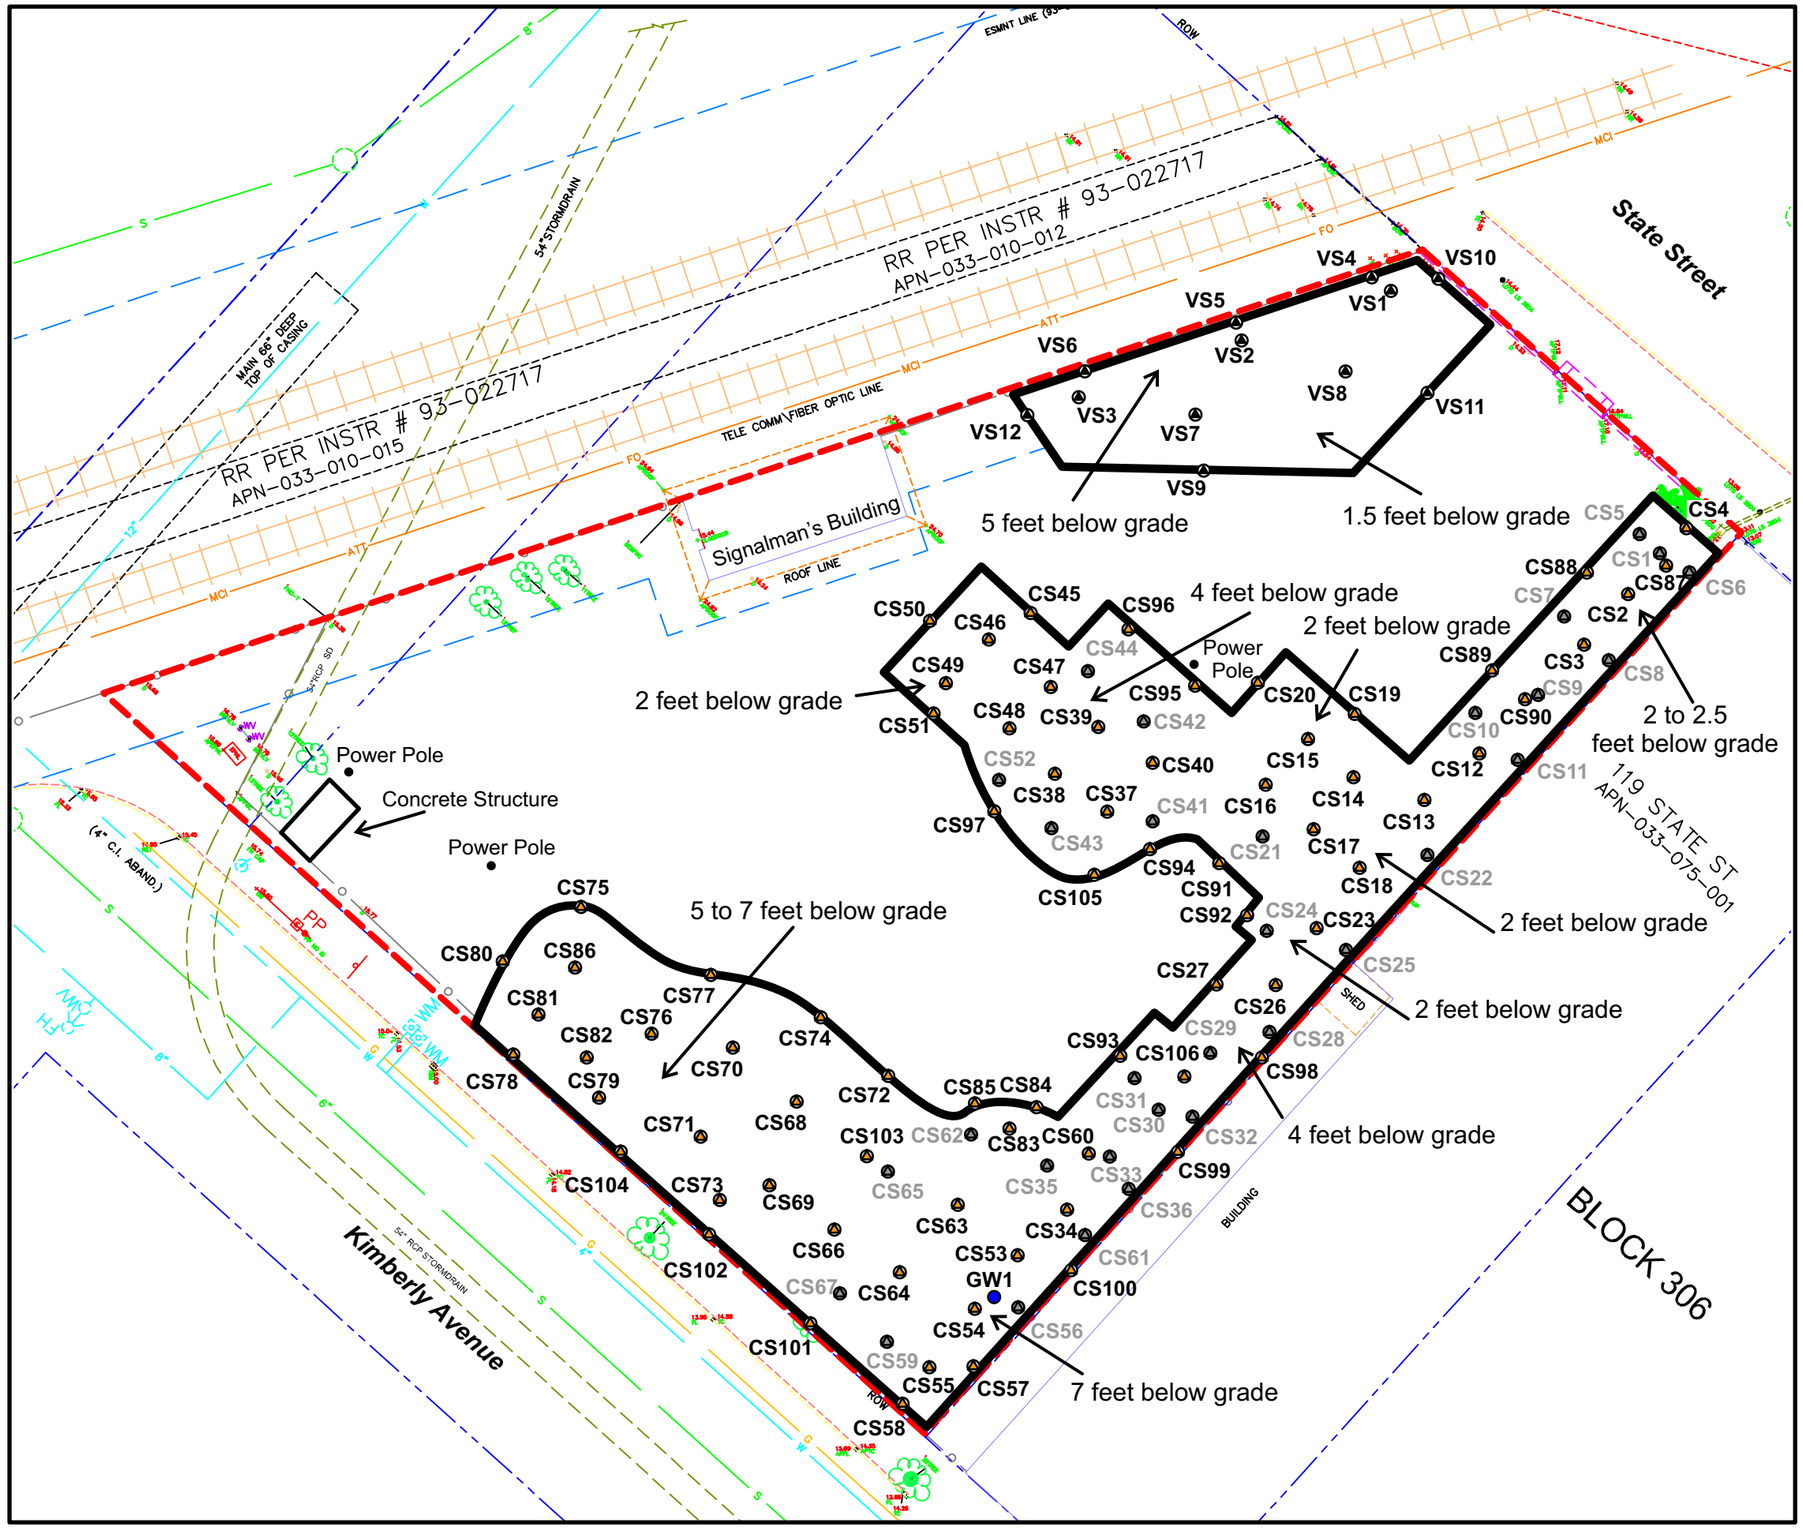

Legend

	Subject Property Boundary
	Excavation Extent
CS1	Confirmation Soil Sample Location- lead impacted soil
CS1	Over-excavated Confirmation Soil Sample Location- lead impacted soil
VS10	Verification Soil Sample Location- TPH and PNA impacted soil
GW1	Groundwater Sample Location
TPH	Total Petroleum Hydrocarbons
PNA	Polynuclear Aromatics

Note: The excavation area was extended based on constituent concentrations exceeding site cleanup goals.

0 25 50
Scale in feet

North

rincon

Excavation Area and Confirmation/Verification Sample Location Map

125 State Street
Santa Barbara, California

Figure 8

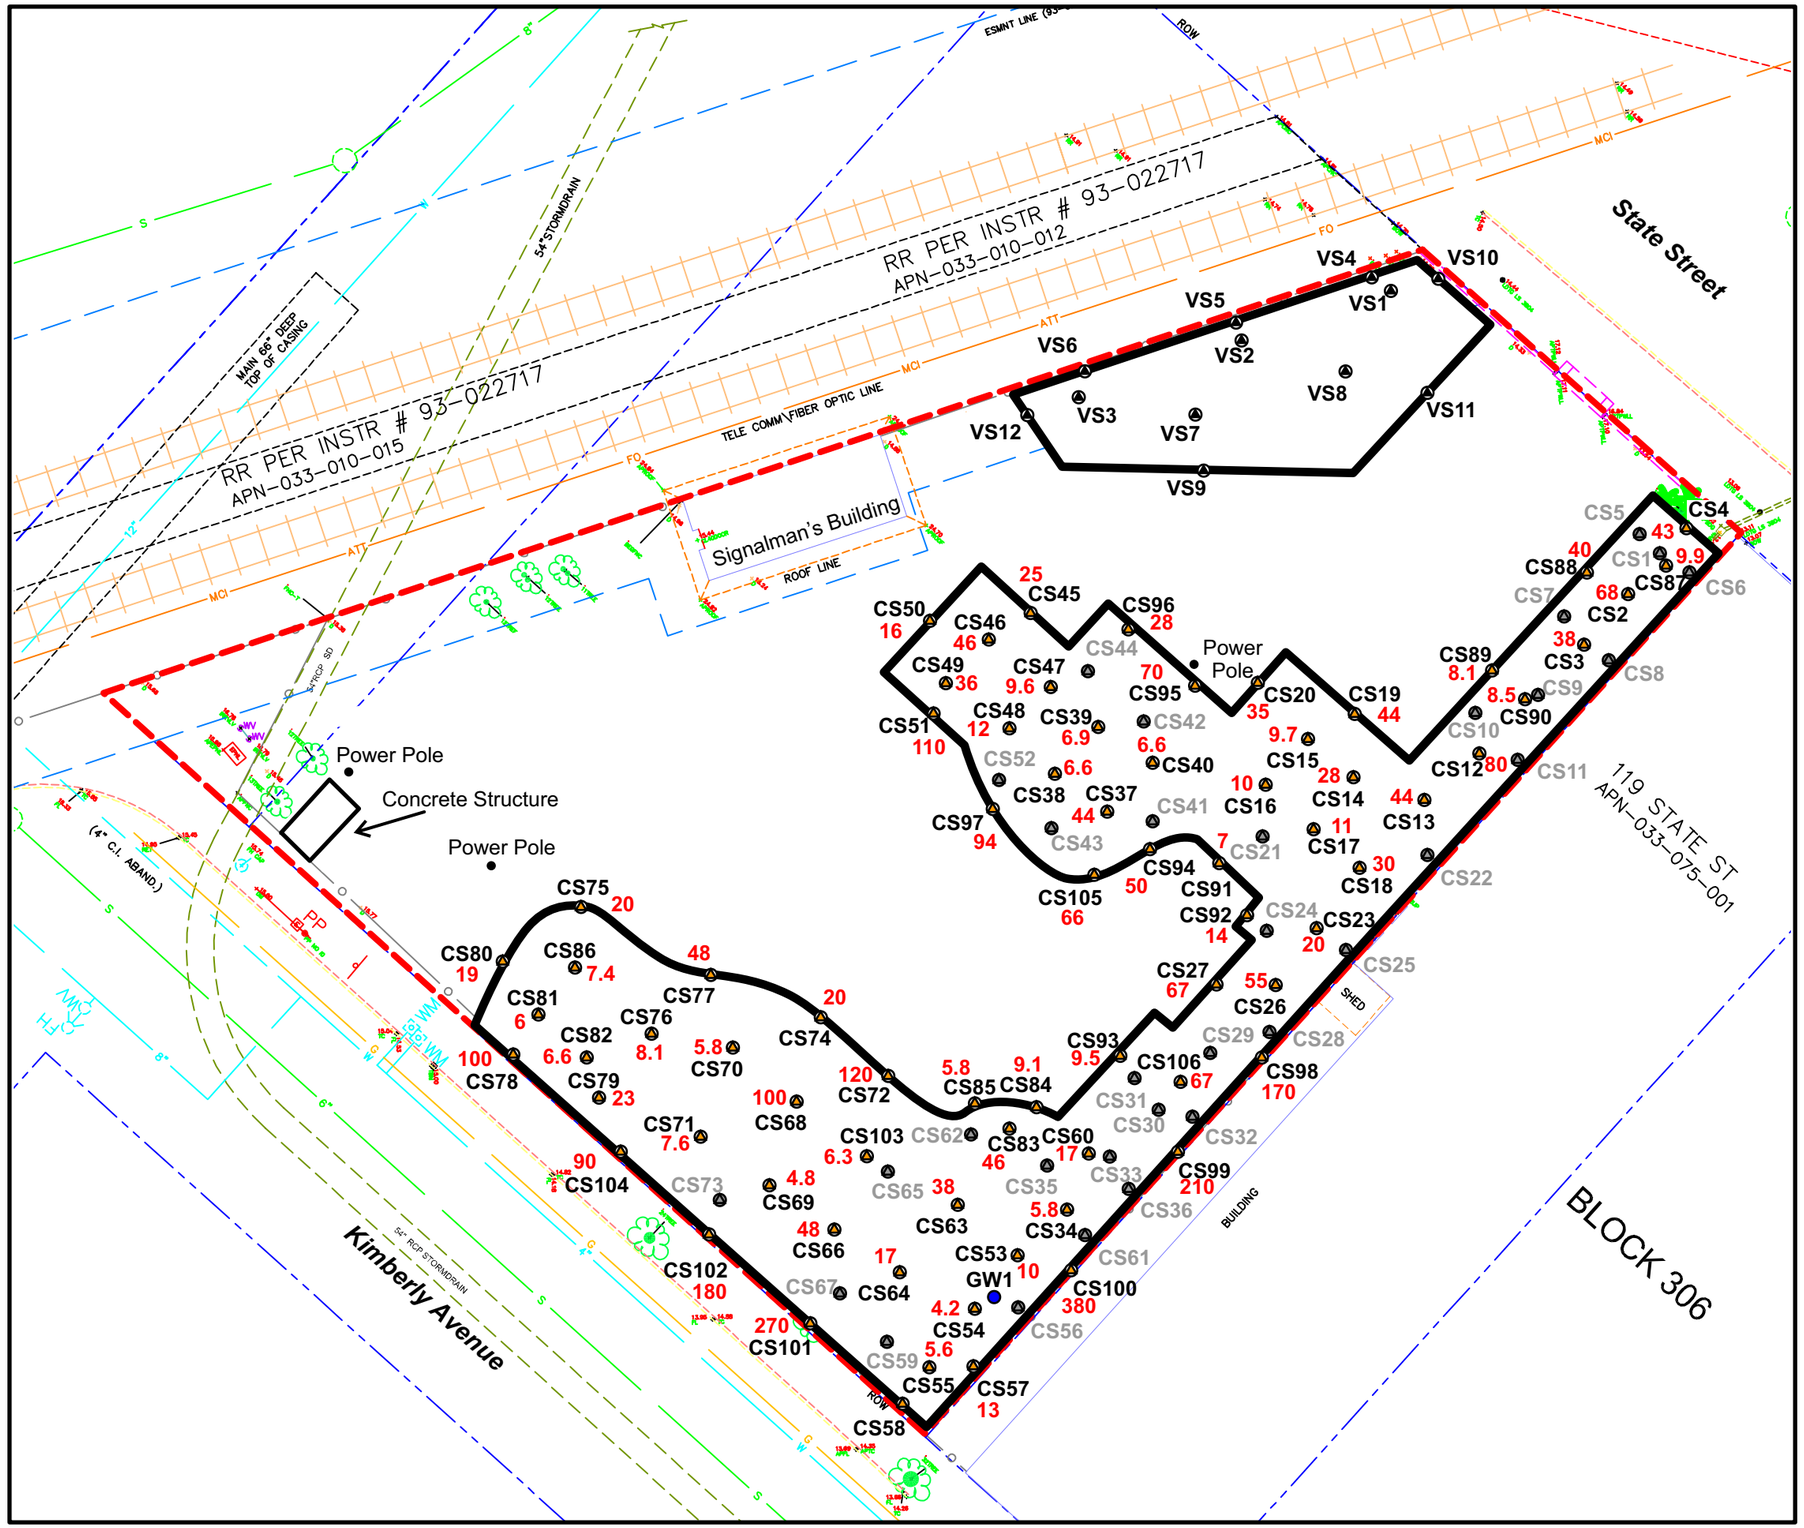

Legend

- Subject Property Boundary
- Excavation Extent
- CS1 — Confirmation Soil Sample Location- lead impacted soil
- CS1 — Over-excavated Confirmation Soil Sample Location- lead impacted soil
- VS10 — Verification Soil Sample Location- TPH and PNA impacted soil
- GW1 — Groundwater Sample Location
- TPH — Total Petroleum Hydrocarbons
- PNA — Polynuclear Aromatics
- 40 — Total lead concentration in milligrams per kilogram (mg/kg)

Cleanup goal for total lead = 400 mg/kg

Total lead analytical results only depicted for confirmation samples collected from the final excavation extent. Greyed confirmation soil sample locations were removed by excavation.

Soil samples containing total lead exceeding 50 mg/kg were analyzed for STLC lead. Complete results are available in Table 4.

Confirmation soil samples collected between May 3 and 17, 2010.

0 25 50
Scale in feet

North

rincon

Confirmation Sampling
Total Lead Concentration Map

125 State Street
Santa Barbara, California

Figure 9

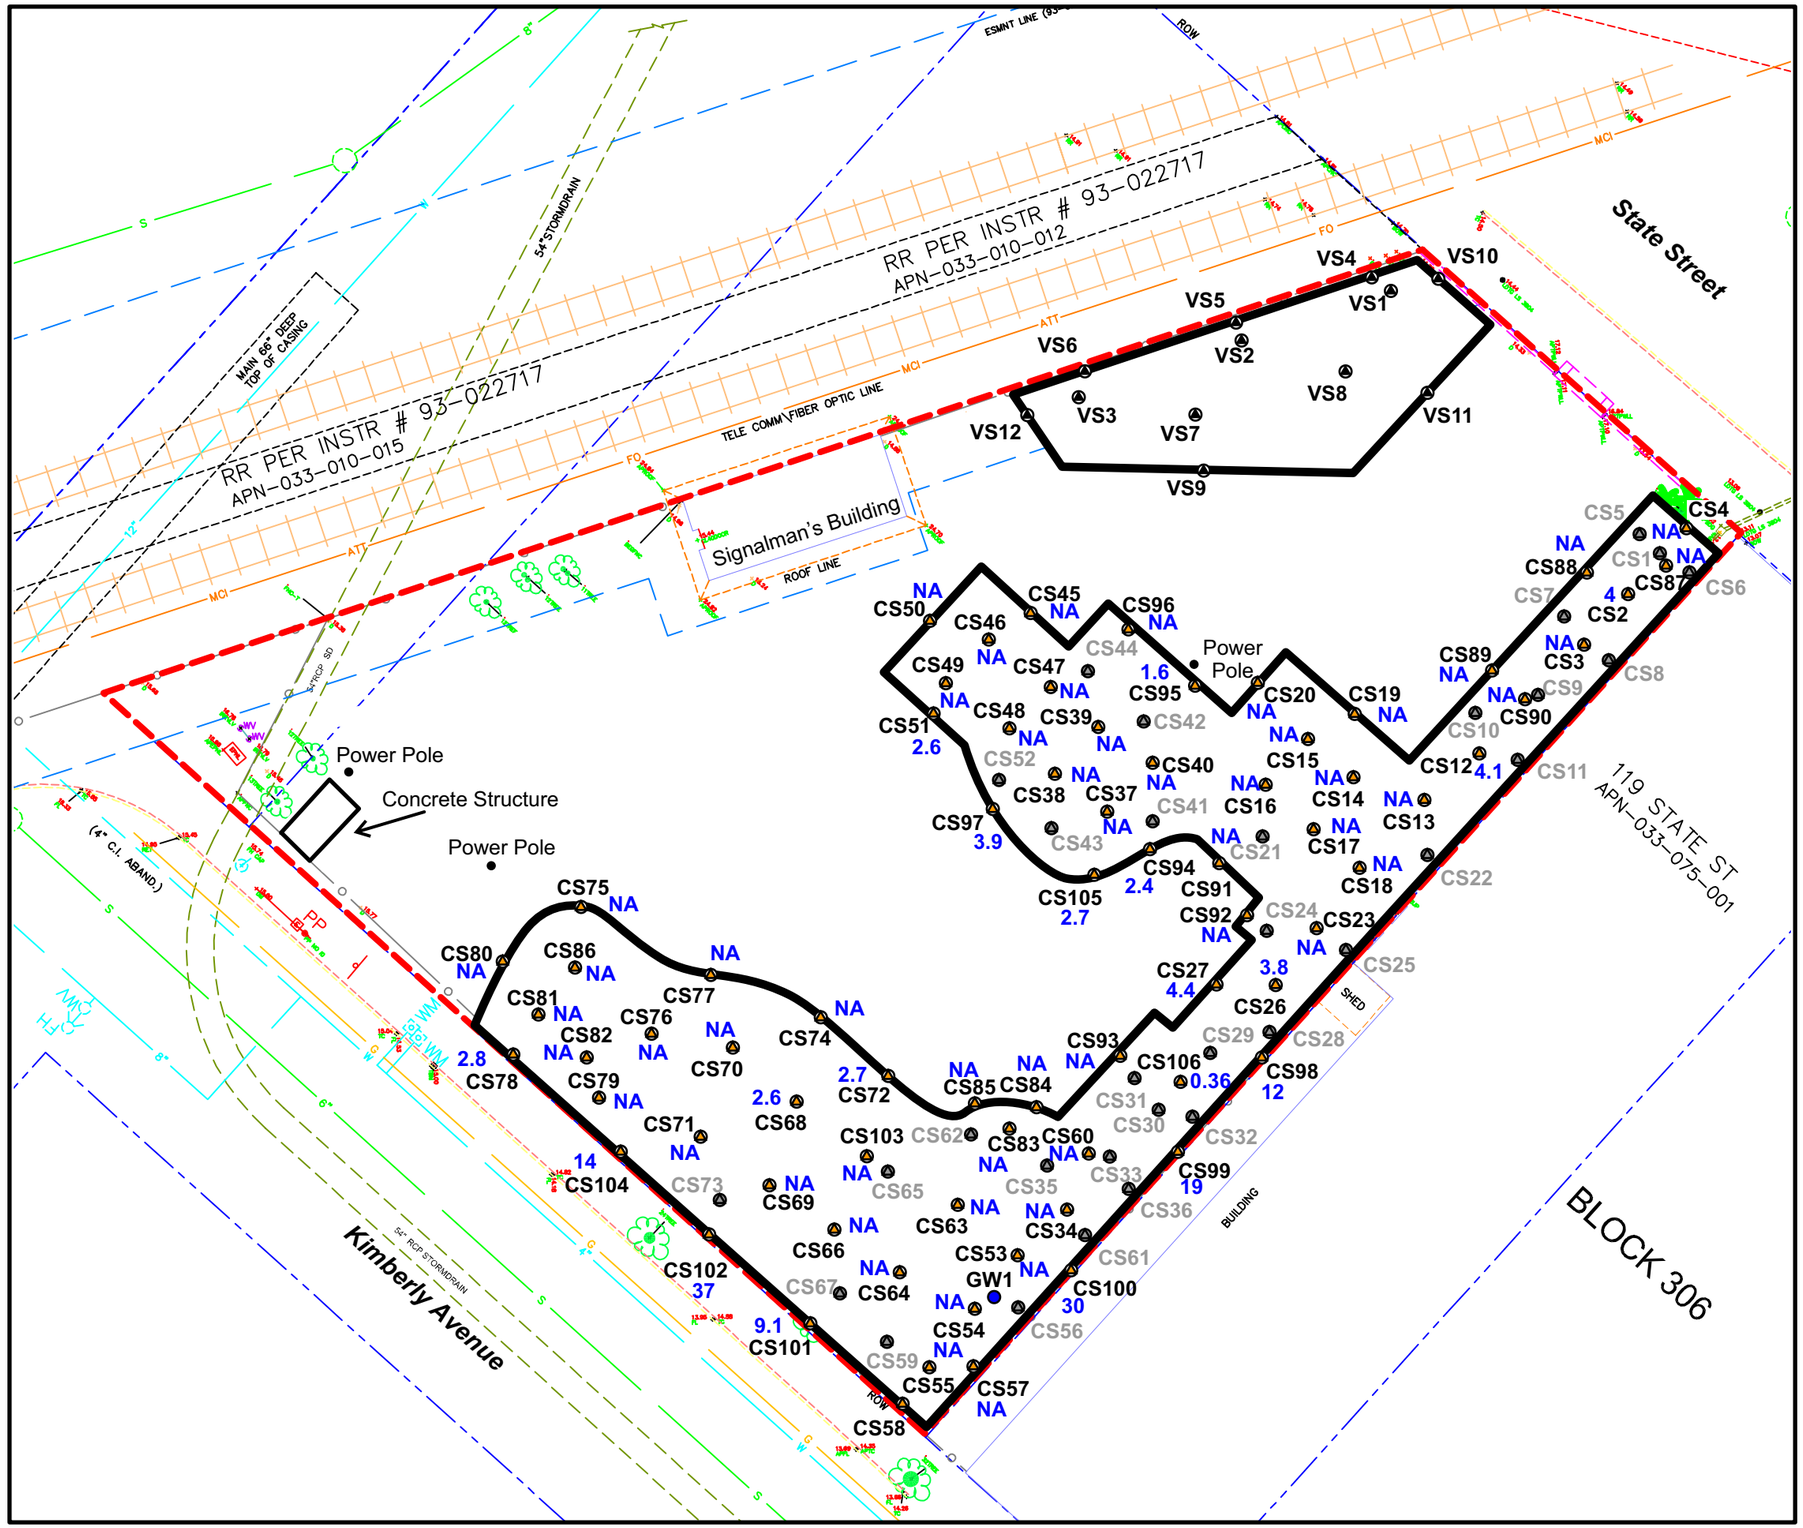

Legend

- Subject Property Boundary
- Excavation Extent
- CS1 — Confirmation Soil Sample Location- lead impacted soil
- CS1 — Over-excavated Confirmation Soil Sample Location- lead impacted soil
- VS10 — Verification Soil Sample Location- TPH and PNA impacted soil
- GW1 — Groundwater Sample Location
- STLC — Soluble Threshold Limit Concentration
- TPH — Total Petroleum Hydrocarbons
- PNA — Polynuclear Aromatics
- 40 — STLC lead concentration in milligrams per liter (mg/L)
- NA — Not Analyzed

Cleanup goal for STLC lead = 5 mg/L

STLC lead analytical results only depicted for confirmation samples collected from the final excavation extent. Greyed confirmation soil sample locations were removed by excavation.

Complete results are available in Table 4.

Confirmation soil samples collected between May 3 and 17, 2010.

0 25 50
Scale in feet

North

rincon

Confirmation Sampling
STLC Lead Concentration Map

125 State Street
Santa Barbara, California

Figure 10

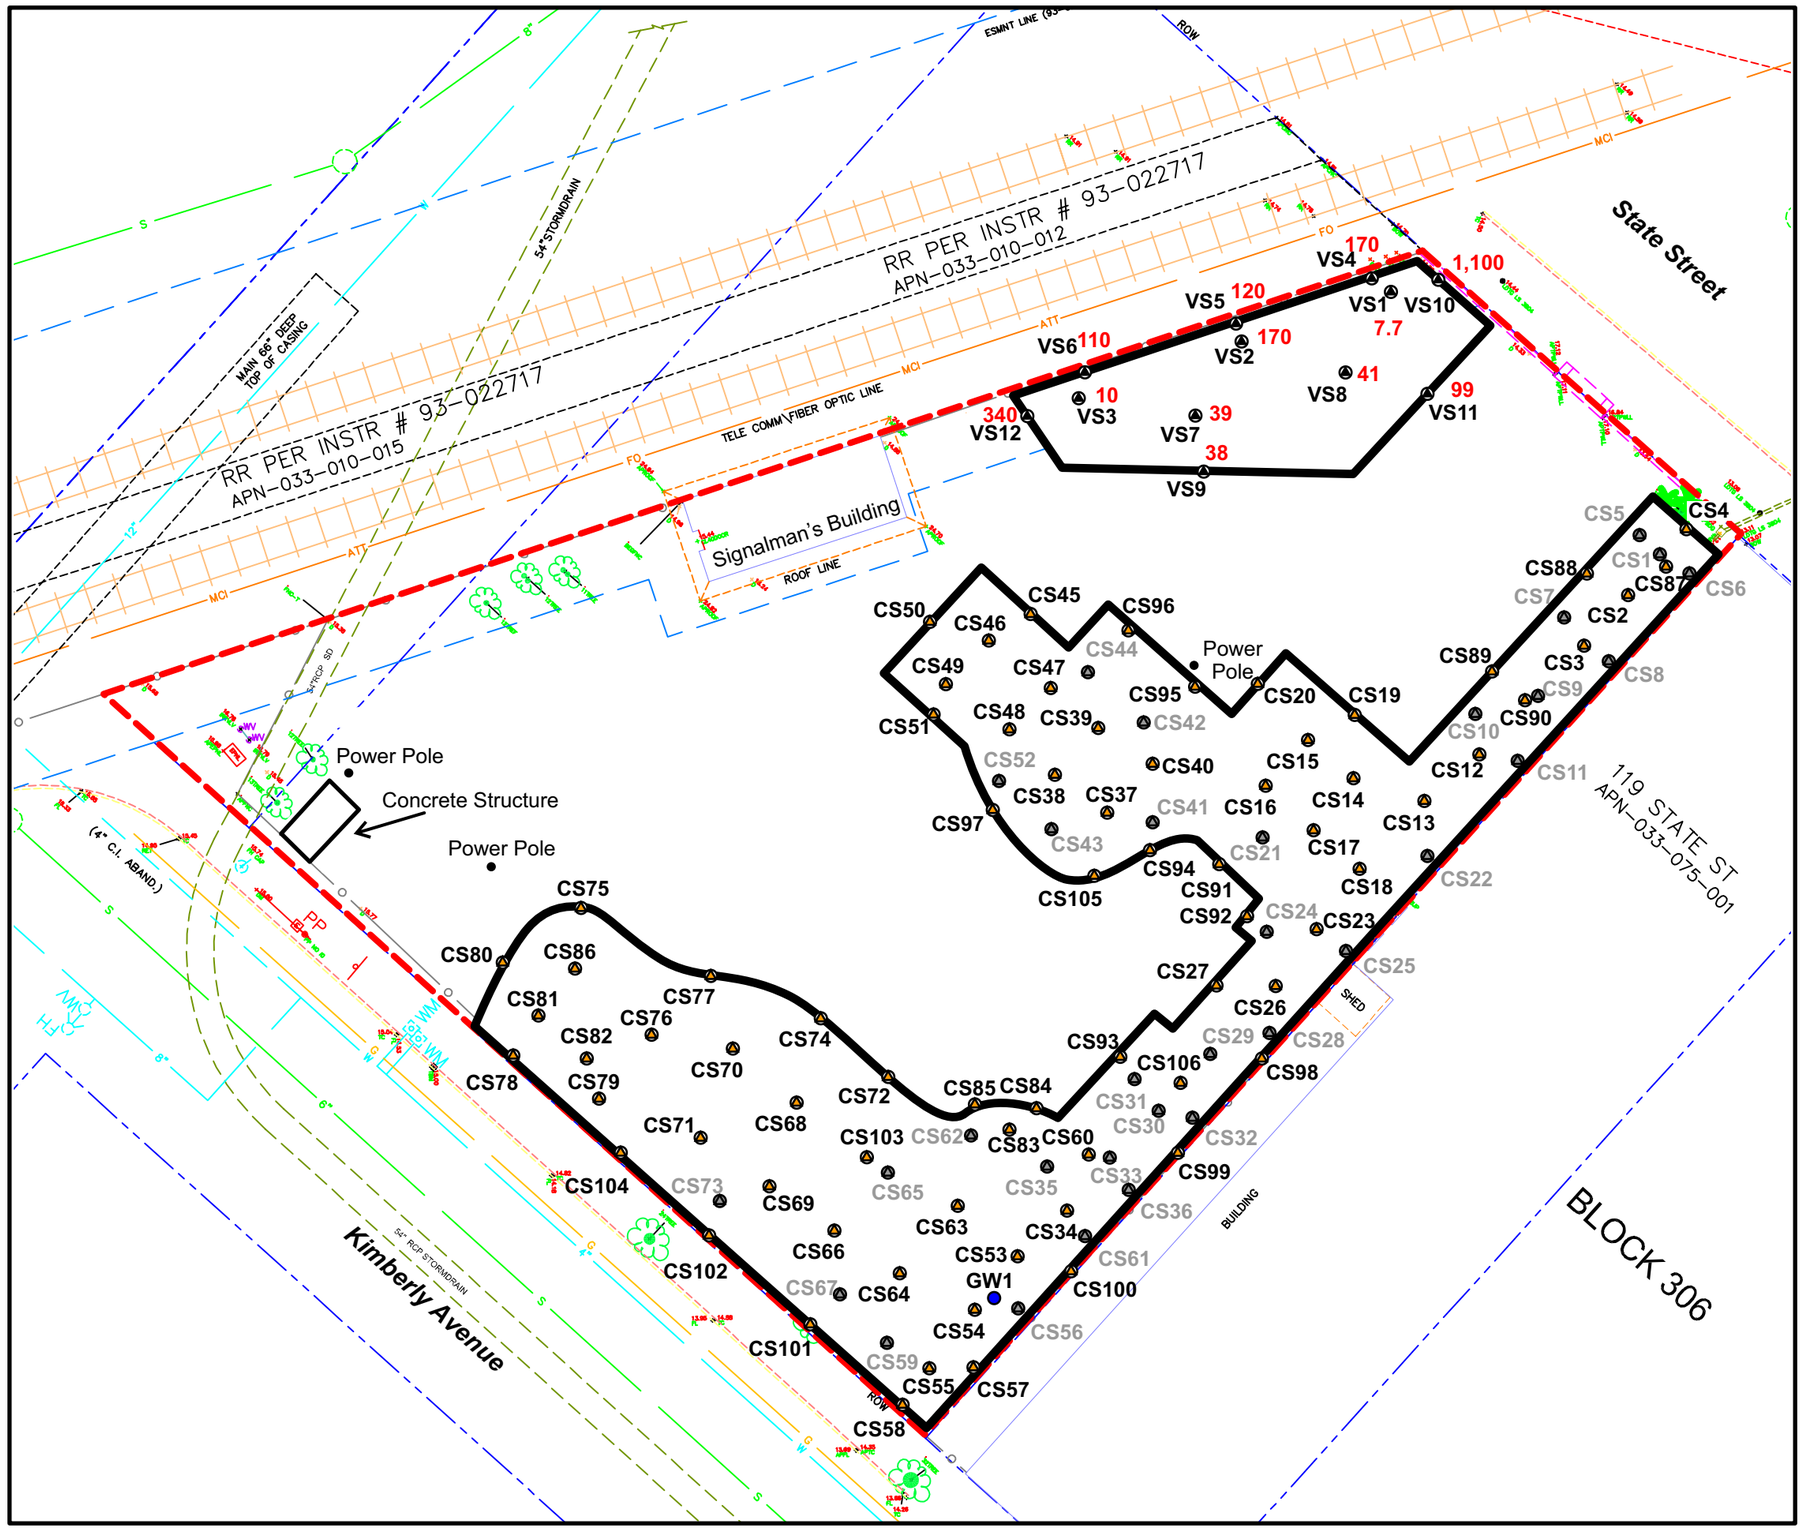

Legend

- Subject Property Boundary
- Excavation Extent
- CS1 — Confirmation Soil Sample Location- lead impacted soil
- CS1 — Over-excavated Confirmation Soil Sample Location- lead impacted soil
- VS10 — Verification Soil Sample Location- TPH and PNA impacted soil
- GW1 — Groundwater Sample Location
- TPH — Total Petroleum Hydrocarbons
- PNA — Polynuclear Aromatics
- 7.7 — Total extractable petroleum hydrocarbon (TEPH) concentration in milligrams per kilogram (mg/kg)

Cleanup goal for TEPH = 1,800 mg/kg

Confirmation soil samples collected on May 17, 2010.

0 25 50
Scale in feet

North

rincon

Confirmation Sampling
TEPH Concentration Map

125 State Street
Santa Barbara, California

Figure 11

Photograph 1 - View of the excavator loading soil into the loader at the northeast corner of the site. Photo is looking southeast.

Photograph 2 - View of excavated area in northeast corner of site. Photo is looking northeast. The final excavation was extended in this area.

Photograph 3 - View of excavation area adjacent to southeast site boundary. Photo is looking southwest. Final excavation was extended in this area.

Photograph 4 - View of excavation sidewall in north-eastern area of site.

Photograph 5 - View of excavation area in southern corner of site. Photo is looking southwest. The final excavation was extended in this area.

Photograph 6 - View of bottles, plates, cups, and other railroad related debris collected from the southern area of the excavation.

Photograph 7 - View of a plate with the Southern Pacific Company stamped on the bottom. The plate was recovered from the southern area of the excavation.

Photograph 8 - View of the excavation bottom in the southern corner of the site. Photo is looking northeast. Groundwater is depicted at the excavation bottom.

Photograph 9 - View of the concrete pad being broken and removed near the southwest site boundary. Photo is looking east.

Photograph 10 - View of the soil beneath the concrete pad.

Photograph 11 - View of railroad related debris in the soil beneath the former concrete pad.

rincon

Site Photographs

125 State Street
Santa Barbara, California

Figure 12

Photograph 12 - View of railroad related debris from the southern excavation area.

Photograph 13 - View of pipes leading from a fitting located on top of a sub-grade concrete pad near the center of the site. Photo is looking southeast.

Photograph 14 - View of cut and broken piping from a sub-grade concrete pad to the northwest site boundary. Photo is looking northwest.

Photograph 15 - View of wood beneath the sub-grade concrete pad.

Photograph 16 - View of the final excavation extent in the southern area of the site. Photo is looking south.

Photograph 17- View of a pothole excavated by shovel in the southern excavation area. Standing groundwater is depicted in the pothole. A groundwater sample was collected from the standing water.

Photograph 18 - View of over-excavation to the property line at the southwest site boundary. Photo is looking northwest.

Photograph 19 - View of backfill being delivered to the site. Photo is looking east.

Photograph 20 - View of compacted backfill. Photo is looking northeast.

Photograph 21 - View of an approximately 4 inch thick layer of mulch covering the disturbed site area. Photo is looking southeast.

Photograph 22 - View of a 4 inch thick layer of mulch covering the disturbed site area. Photo is looking north.

rincon — Site Photographs	
125 State Street Santa Barbara, California	Figure 13

Table 1 - Soil Analytical Results - Lead
125 State Street, Santa Barbara, California

Sample Identification	Depth (feet)	Lead (mg/kg)	STLC (mg/L)	TCLP (mg/L)
Soil Samples Collected by Trak Environmental on August 11, 2008				
B1	0.5	**9.33**	NA	NA
	5	**8.58**	NA	NA
B2	0.5	**38.1**	NA	NA
	5	**6.42**	NA	NA
B3	0.5	**22.9**	NA	NA
	3	**9.36**	NA	NA
B4	0.5	**47.7**	NA	NA
B5	0.5	**28.4**	NA	NA
	5	**7.78**	NA	NA
B6	0.5	**228**	**14.3**	NA
	3	**16.6**	NA	NA
	5	**5.7**	NA	NA
B7	5	**6.33**	NA	NA
B8	0.5	**84.4**	**3.38**	NA
	5	**18.8**	NA	NA
B9	0.5	**85.7**	**4.5**	NA
Soil Samples Collected by Rincon Consultants, Inc. between April 21 and 22, 2009				
B11	0.5	**62.2**	**1.48**	NA
	3	**59**	**1.82**	NA
B14	0.5	**15.8**	NA	NA
B16	0.5	**10.1**	NA	NA
B17	0.5	**19.4**	NA	NA
B18	0.5	**27.7**	NA	NA
B19	0.5	**25.3**	NA	NA
B20	0.5	**25.9**	NA	NA
B21	0.5	**65.1**	**4.42**	NA
	2	**29**	NA	NA
B22	0.5	**53.5**	**1.59**	NA
	2	**31.8**	NA	NA
B23	0.5	**16.5**	NA	NA
B24	0.5	**23.1**	NA	NA
B25	0.5	**147**	**8.22**	<0.5
	2	**114**	**3.58**	NA
B26	0.5	**86.6**	**0.58**	NA
	2	**48.8**	NA	NA
B27	0.5	**11.9**	NA	NA
B28	0.5	**187**	**7.18**	**1.05**
	2	**42.3**	NA	NA
B29	0.5	**26.9**	NA	NA
B30	0.5	**19.4**	NA	NA
B31	0.5	**23.4**	NA	NA
B32	0.5	**66.5**	**5.52**	<0.5
	2	**9.9**	NA	NA
B33	0.5	**620**	**22.4**	<0.5
	2	**12.8**	NA	NA
B34	0.5	**145**	**4.58**	NA
	2	**82.7**	**2.95**	NA
B35	0.5	**101**	**3.16**	NA
	2	**224**	**82.7**	**0.946**
B36	0.5	**124**	**2.93**	NA
	2	**22.9**	NA	NA
B37	0.5	**164**	**6.39**	<0.5
	2	**44.7**	NA	NA
B38	0.5	**33.4**	NA	NA
B39	0.5	**31.3**	NA	NA
B40	0.5	**43.8**	NA	NA
B41	0.5	**43.8**	NA	NA
B42	0.5	**324**	**10.2**	<0.5
	2	**615**	**2.16**	NA
B43	0.5	**154**	**4.62**	NA
	2	**82**	<0.5	NA
B44	0.5	**133**	**3.1**	NA
	2	**31.2**	NA	NA
B45	0.5	**26.1**	NA	NA
B46	0.5	**99.7**	<0.5	NA
	2	**34.4**	NA	NA
B47	0.5	**19**	NA	NA
B48	0.5	**112**	**15.2**	<0.5
	2	**224**	**9.96**	<0.5
B49	0.5	**44.4**	NA	NA
B50	0.5	**89.9**	**2.35**	NA
	2	**23.6**	NA	NA
B51	0.5	**55**	**3.37**	NA
	2	**69.5**	**2.66**	NA
B52	0.5	**233**	**5.7**	<0.5
	2	**150**	**13**	<0.5
B53	0.5	**639**	**5.49**	<0.5
	2	**17**	NA	NA
B54	0.5	**299**	**15.6**	<0.5
	2	**183**	**7.01**	<0.5
B55	0.5	**51.1**	**1.04**	NA
	2	**41.9**	NA	NA
B56	0.5	**200**	**4.4**	NA
	2	**123**	**0.62**	NA
B57	0.5	**141**	**5.19**	<0.5
	2	**48.2**	NA	NA
B58	0.5	**54**	**1.41**	NA
	2	**145**	<0.5	NA
B59	0.5	**71.5**	**2.28**	NA
	2	**112**	**2.5**	NA
B60	0.5	**63.7**	**27**	<0.5
	2	**101**	**46.8**	<0.5
Soil Samples Collected by Rincon Consultants, Inc. on February 11, 2010				
B68	3	**14**	**0.87**	NA
B69	3	**1,200**	**60**	**1.4**
	4	**160**	**7.1**	**0.035**
	5	**5.3**	**0.12**	NA
B70	3	**960**	**64**	**2.9**
	4	**32**	**0.61**	NA
B71	3	**270**	**42**	**0.86**
	4	**280**	**21**	**0.51**
	5	**400**	**21**	**0.36**
B72	3	**20**	**0.59**	NA
	4	**6.7**	**0.13**	NA
B73	3	**35**	NA	NA
	4	**6.1**	NA	NA
	5	**6.9**	NA	NA
	FPD IL	50	5	--
	TTLC	1,000	--	--
	STLC	--	5	--
	TCLP	--	--	5
	SL-R	400	--	--
	Background Concentration	12.4 to 97.1	--	--

-- Not listed
NA - Not Analyzed
< - Not detected above laboratory method detection limit
mg/kg - milligrams per kilogram
mg/L - milligrams per liter
TTLC - Total Threshold Limit Concentration
STLC - Soluble Threshold Limit Concentration
TCLP - Toxicity Characteristic Leaching Procedure
SL - United States Environmental Protection Agency Screening Levels for Chemical Contaminants at residential (R) and industrial (I) sites (July 2008)
Background Concentration - Kearney, Background Concentrations of Trace and Major Elements in California Soils, University of California, 1996
FPD IL - County of Santa Barbara Fire Prevention Division Investigation Level
Concentrations detected above the laboratory method detection limit are in **bold**
Concentrations detected above the FPD IL are highlighted
Soil samples collected in 2008 and 2009 were analyzed by American Scientific Laborator
Soil samples collected in 2010 were analyzed by Oilfield Environmental & Compliance, Ir

Analysis:

Total Lead by EPA Method 6000/7000
STLC Lead by EPA Method 6000/7000
TCLP Lead by EPA Method 6000/7000

Table 2 - Soil Analytical Results - TPH
125 State Street, Santa Barbara, California
results in milligrams per kilogram (mg/kg)

Sample Designation	Sample Depth (feet)	TPH GRO C2-C11+	TPH DRO C8-C24	TPH ORO C24-C36+	TPH C2-C36+
*Soil Samples Collected by Trak Environmental on August 11, 2008**					
B1	0.5	<0.5	<10	**68.9**	**68.9**
	5	<0.5	<10	<50	ND
B2	0.5	<0.5	<10	**50.2**	**50.2**
	5	<0.5	<10	<50	ND
B3	0.5	<0.5	<10	<50	ND
	5	<0.5	<10	<50	ND
B4	0.5	<0.5	<10	**568**	**568**
	3	<0.5	<10	**61.8**	**61.8**
B5	0.5	<0.5	<10	<50	ND
	5	<0.5	<10	<50	ND
B6	0.5	<0.5	<10	<50	ND
	5	<0.5	<10	<50	ND
B7	5	<0.5	<10	<50	ND
B8	0.5	<0.5	<10	<50	ND
	5	<0.5	<10	<50	ND
B9	0.5	<0.5	<10	<50	ND
Soil Samples Collected by Rincon Consultants, Inc. between April 21 and 22, 2009					
B4 Delineating Borings					
B10	0.5	<0.2	<1	**290**	**290**
	3	<0.2	<1	**332**	**332**
B11	0.5	<0.2	**6.35J**	**57.5**	**63.85**
	3	<0.2	<1	**321**	**321**
	4	NA	**22.2**	**129**	**151.2**
B12	0.5	<0.2	<1	**448**	**448**
	3	<0.2	<1	**61.9**	**61.9**
B13	0.5	<0.2	<1	**1,180**	**1,180**
	3	<0.2	<1	**72.3**	**72.3**
B14	0.5	<0.2	<1	**25.4J**	**25.4J**
	2	<0.2	<1	**493**	**493**
B15	0.5	<0.2	<1	**655**	**655**
	3	<0.2	<1	**385**	**385**
Railroad Tracks					
B16	0.5	<0.2	<1	**33.9J**	**33.9J**
	3	<0.2	<1	**152**	**152**
	5	NA	<1	<17	ND
B17	0.5	<0.2	**1.31J**	**109**	**110.31**
	3	<0.2	<1	**112**	**112**
	5	NA	<1	<17	ND
B18	0.5	<0.2	<1	**182**	**182**
	3	<0.2	<1	**148**	**148**
	5	NA	<1	<17	ND
B19	0.5	<0.2	**70.1**	**141**	**211.1**
	3	<0.2	**55.6**	**115**	**170.6**
	5	NA	**128**	**47.4J**	**175.4**
Soil Samples Collected by Rincon Consultants, Inc. on February 11, 2010**					
Excavation Area					
B61	0.5	NA	**89J**	**2,800**	**2,889**
	3	NA	<2.6	**7.8J**	**7.8J**
B62	0.5	NA	<2.6	**25J**	**25J**
	3	NA	**2.9J**	<6.9	**2.9J**
B63	5	NA	<2.6	<6.9	ND
B64	0.5	NA	**13J**	**530**	**543**
	3	NA	<10	<6.9	ND
B65	5	NA	<10	<50	ND
B66	0.5	NA	**17J**	**660**	**677**
	3	NA	<2.6	<6.9	ND
B67	0.5	NA	**46J**	**3,100**	**3,146**
	3	NA	**4.1J**	**81**	**85.1**
Other Areas					
B68	5	NA	<2.6	<6.9	ND
B69	3	NA	<7.8	**150**	**150**
B74	0.5	NA	<7.8	**200**	**200**
	3	NA	<2.6	<6.9	ND
B75	0.5	NA	**38**	**440**	**478**
	3	NA	<2.6	**14J**	**14J**
	5	NA	<2.6	<6.9	ND
	8	NA	<2.6	<6.9	ND
				FPD IL	100
				ESL	1,800

Concentrations detected above the laboratory method detection limit are in **bol**
Concentrations detected above the FPD IL are highlighted
FPD IL - County of Santa Barbara Fire Prevention Division Investigation Level
ESL - San Francisco Bay Regional Water Quality Control Board
Direct Exposure Soil Screening Levels, Residential Exposure Scenario
< - Not detected above the laboratory method detection limit
TPH - Total petroleum hydrocarbons
GRO - Gasoline range organics (TPHg)
DRO - Diesel range organics (TPHd)
ORO - Oil range organics (TPHo)
ND - Not detected
Soil samples analyzed by American Scientific Laboratories
* - The carbon chain for the Trak soil samples is C6 to C10 for TPHg, C8 to C24 for TPHd, and C24 to C36+ for TPHo.
** - The carbon chain for the February 2010 soil sampling is C6 to C10 for TPHg, C13 to C22 for TPHd, and C23 to C40 for TPHo

Analysis:
TPH by EPA Method 8015M

Table 3 – Soil Analytical Results - SVOCs and PNAs
125 State Street, Santa Barbara, California
results in micrograms per kilogram (µg/kg)

		PNAs														Other SVOCs	
Sample Designation	**Sample Depth (feet)**	**Acenaphthylene**	**Anthracene**	**Benz(a)anthracene**	**Benzo(a)pyrene**	**Benzo(b)flouranthene**	**Benzo(ghi)perylene**	**Benzo(k)fluoranthene**	**Chrysene**	**Dibenz(a,h)anthracene**	**Fluoranthene**	**Indeno(1,2,3-cd)pyrene**	**Naphthalene**	**Phenanthrene**	**Pyrene**	**Bis(2-ethylhexyl)phthalate**	**Di-n-octyl phthalate**
Soil Samples Collected by Rincon Consultants, Inc. between April 21 and 22, 2009																	
B10	0.5	<16.1	**21.0J**	**29.9J**	<18.9	**57.7J**	**46.9J**	**32.3J**	<14.4	**37.1J**	**50.9J**	**37.2J**	<18.9	**19.1J**	**53.1J**	<11.1	<14.7
	3	**6.42J**	**13.3J**	<1.7	<4.6	<4.62	<10.7	<4.86	**23.6J**	<9.46	**28.6J**	<8.84	<3.16	**28.9J**	**27.3J**	NA	NA
B11	0.5	**27.8J**	**29.9J**	**162J**	**144J**	**233J**	**51.2J**	**139J**	**168J**	<16.1	**257J**	<16.8	**55.9J**	**56.8J**	**222J**	<11.1	**257J**
	3	<2.76	**11.3J**	**19.1J**	**45.3J**	**37.1J**	**195**	**22.7J**	**43.2J**	**10.9J**	**67.1J**	**79.8J**	<3.16	**44.7J**	**46.7J**	NA	NA
B12	0.5	<16.1	**89.7J**	**509**	***603***	**1,090**	**572**	**1,040**	**640**	**117J**	**257J**	**464**	<18.9	**302J**	**591**	**191J**	<14.7
	3	<2.76	**4.05J**	**25.9J**	**30.9J**	**30.4J**	**120**	**19.1J**	**33.8J**	**28.3J**	**32.9J**	**79.2J**	<3.16	**17.8J**	**28J**	**97J**	<14.7
B13	0.5	<16.1	<9.9	**14.9J**	**30.5J**	**43J**	<18.4	**48.4J**	**31.2J**	<16.1	**20.8J**	<16.8	<18.9	<10.9	**25.7J**	<11.1	<14.7
	3	<2.76	<2.48	<1.7	<4.6	<4.62	<10.7	<4.86	<2.84	<9.46	<2.08	<8.84	<3.16	<2.9	<2.06	NA	NA
B14	0.5	<16.1	<9.9	**17.3J**	**22.1J**	**42.9J**	<18.4	**17.5J**	**27.5J**	<16.1	**26.7J**	<16.8	<18.9	<10.9	**23.8J**	<11.1	<14.7
	2	**2.91J**	**7.42J**	<1.7	<4.6	<4.62	<10.7	<4.86	<2.84	<9.46	**60.2J**	<8.84	**7.39J**	**37.9J**	**37.5J**	NA	NA
B15	0.5	<16.1	**29.6J**	**22.3J**	<18.9	**49.4J**	<18.4	**55.6J**	**46.2J**	<16.1	**22.7J**	<16.8	<18.9	**19.7J**	**29.1J**	**190J**	<14.7
	3	**8.31J**	**30.4J**	<1.7	<4.6	<4.62	<10.7	<4.86	**32.7J**	<9.46	**20.5J**	<8.84	**7.39J**	**37.9J**	**37.5J**	NA	NA
B16	0.5	<16.1	<9.9	**36.0J**	<18.9	**38.6J**	<18.4	**43.4J**	**34.7J**	<16.1	**30.6J**	<16.8	<18.9	**23.0J**	**25.5J**	<11.1	<14.7
B17	0.5	<16.1	**21.9J**	**37.8J**	<18.9	**118J**	<18.4	**34.4J**	**66.6J**	<16.1	**52.8J**	<16.8	<18.9	**39.2J**	**40.9J**	**176J**	<14.7
B18	0.5	<16.1	<9.9	<12.8	<18.9	<21.8	<18.4	<19	<14.4	<16.1	<8	<16.8	<18.9	<10.9	<8.2	<11.1	<14.7
B19	0.5	<16.1	<9.9	<12.8	<18.9	<21.8	<18.4	<19	<14.4	<16.1	<8	<16.8	<18.9	<10.9	<8.2	**217J**	<14.7
Soil Samples Collected by Rincon Consultants, Inc. on February 11, 2010																	
B61	0.5	<14	<17	**40**	**36**	<16	**35J**	**16J**	**51**	<20	**83**	**24**	<20	**21**	**96**	NA	NA
	3	<4.7	<4.2	**6**	<2.6	<4	<5	<3	<3	<5	<3	<3.5	<5	<4.7	<3	NA	NA
	5	<7	<8.4	**6J**	**31**	**29**	**42**	**10**	**15**	<10	**7.3J**	**31**	<10	<9.4	**21**	NA	NA
	8	<3.4	<4.1	<2.9	<2.6	<3.9	<4.9	<2.9	<2.9	<4.9	<2.9	<3.4	<4.9	<4.6	<2.9	NA	NA
B62	0.5	<3.5	<4.2	**7.3**	**13**	**17**	**14**	**16**	**17**	<5	**24**	**11**	<5	**7**	**24**	NA	NA
	3	<3.5	<4.2	<3	<2.6	<4	<5	<3	<3	<5	<3	<3.5	<5	<4.7	<3	NA	NA
	5	**4.6J**	**19**	**52**	**51**	**33**	**23**	**47**	**52**	**7J**	**11**	**27**	<5	**69**	**100**	NA	NA
	8	<3.5	<4.2	<3	<2.6	<4	<5	<3	<3	<5	<3	<3.5	<5	<4.7	<3	NA	NA
B63	5	<3.5	<4.2	<3	<2.6	<4	<5	<3	<3	<5	<3	<3.5	<5	<4.7	<3	NA	NA
B64	0.5	<24	<29	<21	<18	<28	<35	<21	**70**	<35	**30**	<24	<35	<33	**11**	NA	NA
	3	<3.4	<4.1	<3	<2.6	<3.9	<4.9	<3	<3	<4.9	<3	<3.4	<4.9	<4.6	<3	NA	NA
B65	5	<35	<35	<35	<35	<35	<70	<35	**70**	<70	<35	<35	<70	<35	**11**	NA	NA
B66	0.5	<10	<13	**23**	**21**	<12	<15	**10J**	**29**	<15	**42**	<10	<15	<14	**89**	NA	NA
	3	<3.5	<4.2	<3	**3J**	<4	<5	<3	<3	<5	<3	<3.5	<5	<5	**3.3**	NA	NA
B67	0.5	<14	**30**	**160**	***250***	**420**	**320**	**260**	**330**	**95**	**370**	**310**	<20	**110**	**420**	NA	NA
	3	<3.5	**<4.2**	**16**	**18**	**20**	**11**	**19**	**20**	<5	**35**	**11**	<5	**6.3**	**33**	NA	NA
	SL-R	3,400,000	17,000,000	150	15	150	NL	1,500	15,000	15	2,300,000	150	3,900	NL	1,700,000	35,000	NL
	SL-I	33,000,000	170,000,000	2,100	210	2,100	NL	21,000	210,000	210	22,000,000	2,100	20,000	NL	17,000,000	120,000	NL

<: Not detected above the laboratory method detection limit
J: Flag indicating the detected concentration is below the laboratory practical quantitation limit
NL: Not Listed
SVOCs: Semi Volatile Organic Compounds
PNAs: Polynuclear Aromatic Hydrocarbons

SL: United States Environmental Protection Agency Screening Levels for Chemical Contaminants at residential (R) and industrial (I) sites (July 2008)
Concentrations detected above the laboratory method detection limit are in **bold**
Concentrations detected above the SL-R are highlighted
Concentrations detected above the SL-I are in *italics*

Analysis:
SVOCs and PNAs by EPA Method 8270C

Table 4 - Confirmation Soil Sample Analytical Results - Lead
125 State Street, Santa Barbara, California

Sample Identification	Depth (feet)	Lead (mg/kg)	STLC (mg/L)	TCLP (mg/kg)
CS1	2	**65**	**6.5**	NA
CS2	2	**68**	**4**	NA
CS3	2	**38**	NA	NA
CS4	0.5	**43**	NA	NA
CS5	0.5	**180**	**17**	NA
CS6	0.5	**290**	**24**	NA
CS7	0.5	**210**	**12**	NA
CS8	0.5	**470**	**38**	NA
CS9	2	**330**	**12**	NA
CS10	0.5	**91**	**6.5**	NA
CS11	0.5	**1900**	**29**	NA
CS12	2	**80**	**4.1**	NA
CS13	2	**44**	NA	NA
CS14	2	**28**	NA	NA
CS15	2	**9.7**	NA	NA
CS16	2	**10**	NA	NA
CS17	2	**11**	NA	NA
CS18	2	**30**	NA	NA
CS19	0.5	**44**	NA	NA
CS20	0.5	**35**	NA	NA
CS21	0.5	**62**	**16**	NA
CS22	0.5	**360**	**32**	NA
CS23	2	**20**	NA	NA
CS24	0.5	**220**	**10**	NA
CS25	0.5	**250**	**40**	**2**
CS26	2	**55**	**3.8**	NA
CS27	0.5	**67**	**4.4**	NA
CS28	0.5	**240**	**13**	NA
CS29	4	**140**	**14**	**0.23**
CS30	4	**120**	**4.9**	NA
CS31	1	**1400**	**38**	NA
CS32	1	**320**	**19**	NA
CS33	4	**67**	**12**	NA
CS34	4.5	**5.8**	NA	NA
CS35	0.5	**440**	**42**	**4.9**
CS36	0.5	**240**	**12**	NA
CS37	4	**44**	NA	NA
CS38	4	**6.6**	NA	NA
CS39	4	**6.9**	NA	NA
CS40	4	**6.6**	NA	NA
CS41	0.5	**220**	**17**	NA
CS42	0.5	**180**	**8**	NA
CS43	0.5	**74**	**9.4**	NA
CS44	0.5	**110**	**9.9**	NA
CS45	0.5	**25**	NA	NA
CS46	2	**46**	NA	NA

Table 4 - Confirmation Soil Sample Analytical Results - Lead
125 State Street, Santa Barbara, California

Sample Identification	Depth (feet)	Lead (mg/kg)	STLC (mg/L)	TCLP (mg/kg)
CS47	2	**9.6**	NA	NA
CS48	2	**12**	NA	NA
CS49	2	**36**	NA	NA
CS50	0.5	**16**	NA	NA
CS51	0.5	**110**	**2.6**	NA
CS52	0.5	**270**	**61**	NA
CS53	7	**10**	NA	NA
CS54	7	**4.2**	NA	NA
CS55	7	**5.6**	NA	NA
CS56	1	**300**	**25**	NA
CS57	1.5	**13**	NA	NA
CS58	0.5	**290**	**38**	**0.74**
CS59	0.5	**370**	**49**	**1.8**
CS60	4.5	**17**	NA	NA
CS61	0.5	**380**	**16**	NA
CS62	0.5	**79**	**5.2**	NA
CS63	4	**38**	NA	NA
CS64	6	**17**	NA	NA
CS65	3	**150**	**20**	NA
CS66	6	**48**	NA	NA
CS67	1.5	**140**	**5.2**	NA
CS68	3	**100**	**2.6**	NA
CS69	6	**4.8**	NA	NA
CS70	3	**5.8**	NA	NA
CS71	6	**7.6**	NA	NA
CS72	0.5	**120**	**2.7**	NA
CS73	1	**260**	**4.4**	NA
CS74	0.5	**20**	NA	NA
CS75	1	**20**	NA	NA
CS76	4	**8.1**	NA	NA
CS77	0.5	**48**	NA	NA
CS78	0.5	**100**	**2.8**	NA
CS79	1.5	**23**	NA	NA
CS80	1	**19**	NA	NA
CS81	5	**6**	NA	NA
CS82	5	**6.6**	NA	NA
CS83	5	**46**	NA	NA
CS84	0.5	**9.1**	NA	NA
CS85	0.5	**5.8**	NA	NA
CS86	5	**7.4**	NA	NA
CS87	2.5	**9.9**	NA	NA
CS88	0.5	**40**	NA	NA
CS89	0.5	**8.1**	NA	NA
CS90	2.5	**8.5**	NA	NA
CS91	0.5	**7**	NA	NA
CS92	0.5	**14**	NA	NA

Table 4 - Confirmation Soil Sample Analytical Results - Lead
125 State Street, Santa Barbara, California

Sample Identification	Depth (feet)	Lead (mg/kg)	STLC (mg/L)	TCLP (mg/kg)
CS93	0.5	**9.5**	NA	NA
CS94	0.5	**50**	**2.3**	NA
CS95	0.5	**70**	**1.6**	NA
CS96	0.5	**28**	NA	NA
CS97	0.5	**94**	**3.9**	NA
CS98	0.5	**170**	**12**	**0.85**
CS99	0.5	**210**	**19**	**2.5**
CS100	2	**380**	**30**	**1.2**
CS101	1.5	**270**	**9.1**	**0.064**
CS102	1.5	**180**	**37**	**0.024**
CS103	4	**6.3**	NA	NA
CS104	2	**90**	**14**	**0.021**
CS105	0.5	**66**	**2.7**	NA
CS106	0.5	**67**	**0.36**	NA
	FPD IL	50	5	--
	TTLC	1,000	--	--
	STLC	--	5	--
	TCLP	--	--	5
	SL-R	400	--	--
	Background Concentration	12.4 to 97.1	--	--

Confirmation soil samples collected between May 3 and 18, 2010
-- Not Listed
NA - Not Analyzed
< - Not detected above laboratory method detection limit
mg/kg - milligrams per kilogram
mg/L - milligrams per liter
TTLC - Total Threshold Limit Concentration
STLC - Soluble Threshold Limit Concentration
TCLP - Toxicity Characteristic Leaching Procedure
SL - United States Environmental Protection Agency Screening Levels for Chemical Contaminants at residential (R) and industrial (I) sites (July 2008)
Background Concentration - Kearney, Background Concentrations of Trace and Major Elements in California Soils, University of California, 1996
FPD IL - County of Santa Barbara Fire Prevention Division Investigation Level
Concentrations detected above the laboratory method detection limit are in **bold**
Concentrations detected above the FPD IL are **highlighted**
Soil samples analyzed by Oilfield Environmental & Compliance

Analysis:

Total Lead by EPA Method 6000/7000
STLC Lead by EPA Method 6000/7000
TCLP Lead by EPA Method 6000/7000

Table 5 - Confirmation Soil Sample Analytical Results - TEPH
125 State Street, Santa Barbara, California

results in milligrams per kilogram (mg/kg)

Sample Designation	Sample Depth (feet)	TEPH		TPH C13-C40
		DRO C13-C22	ORO C23-C40	
VS1	5	<10	**7.7**	**7.7**
VS2	5	<10	**170**	**170**
VS3	5	<10	**10**	**10**
VS4	1	<10	**170**	**170**
VS5	1	<10	**120**	**120**
VS6	1	<10	**110**	**110**
VS7	1.5	<10	**39**	**39**
VS8	1.5	<10	**41**	**41**
VS9	0.5	<10	**38**	**38**
VS10	0.5	**110**	**990**	**1100**
VS11	1	<10	**99**	**99**
VS12	1	**11**	**340**	**340**
			FPD IL	100

Soil samples collected on May 17, 2010
Concentrations detected above the laboratory method detection limit are in **bold**
Concentrations detected above the FPD IL are highlighted
FPD IL - County of Santa Barbara Fire Prevention Division Investigation Level
< - Not detected above the laboratory method detection limit
TPH - Total petroleum hydrocarbons
DRO - Diesel range organics (TPHd)
ORO - Oil range organics (TPHo)
TEPH - Total Extractable Petroleum Hydrocarbons, TPHd and TPHo
C - Carbon Chain
Soil samples analyzed by Oilfield Environmental & Compliance

Analysis:
TEPH by EPA Method 8015M

Table 6 – Confirmation Soil Sample Analytical Results - PNAs
125 State Street, Santa Barbara, California

results in micrograms per kilogram (µg/kg)

		PNAs													
Sample Designation	**Sample Depth (feet)**	**Acenaphthylene**	**Anthracene**	**Benz(a)anthracene**	**Benzo(a)pyrene**	**Benzo(b)flouranthene**	**Benzo(ghi)perylene**	**Benzo(k)fluoranthene**	**Chrysene**	**Dibenz(a,h)anthracene**	**Fluoranthene**	**Indeno(1,2,3-cd)pyrene**	**Naphthalene**	**Phenanthrene**	**Pyrene**
VS2	5.5	**11**	**8.6**	**58**	**45**	**78**	**25**	**45**	**81**	<10	**94**	**25**	<10	<9.4	**86**
VS3	5.5	<3.5	<4.2	<3	<2.6	<4	<5	<3	<3	<5	<3	<3.5	<5	<4.7	<3
VS5	1	<7	<8.4	**13**	**19**	**19**	**21**	**13**	**17**	<10	**23**	**19**	<10	**13**	**23**
VS7	1.5	**5**	**4.3**	**15**	**20**	**24**	**21**	**14**	**18**	**5.3**	**24**	**18**	<5	**6.7**	**24**
VS9	0.5	<3.5	<4.2	**7.7**	**19**	**15**	**21**	**16**	**12**	<5	**16**	**15**	<5	**5**	**17**
VS12	1	<7	<8.4	**16**	**27**	**22**	**25**	**27**	**26**	<10	**35**	**19**	<10	**11**	**41**
	SL-R	3,400,000	17,000,000	150	15	150	NL	1,500	15,000	15	2,300,000	150	3,900	NL	1,700,000
	SL-I	33,000,000	170,000,000	2,100	210	2,100	NL	21,000	210,000	210	22,000,000	2,100	20,000	NL	17,000,000

Soil samples collected on May 17, 2010
<: Not detected above the laboratory method detection limit
NL: Not Listed
PNAs: Polynuclear Aromatic Hydrocarbons
SL: United States Environmental Protection Agency Screening Levels for Chemical Contaminants at residential (R) and industrial (I) sites (July 2008)
Concentrations detected above the laboratory method detection limit are in **bold**
Concentrations detected above the SL-R are highlighted
No concentrations were detected above the SL-I
Soil samples analyzed by Oilfield Environmental & Compliance, Inc.

Analysis:
PNAs by EPA Method 3550B

Table 7 - Groundwater Sample Analytical Results - Dissolved Lead
125 State Street, Santa Barbara, California

Sample Identification	Date Sampled	Dissolved Lead (mg/L)
GW1	5/18/2010	<0.0005

mg/L - Milligrams per liter
< - Not detected above the laboratory method detection limit
Groundwater sample analyzed by Oilfield Environmental & Compliance

Analysis:
Dissolved Lead by EPA Method 6000/7000

Table 8 - Backfill Analytical Results - Metals, pH, Asbestos, and Pesticides
125 State Street. Santa Barbara, California

Sample Identification	Date Sampled	Metals																	Asbestos (% type)	pH (pH Units)	Pesticides (mg/kg)
		Antimony (mg/kg)	Arsenic (mg/kg)	Barium (mg/kg)	Beryllium (mg/kg)	Cadmium (mg/kg)	Chromium (mg/kg)	Cobalt (mg/kg)	Copper (mg/kg)	Lead (mg/kg)	Mercury (mg/kg)	Molybdenum (mg/kg)	Nickel (mg/kg)	Selenium (mg/kg)	Silver (mg/kg)	Thallium (mg/kg)	Vanadium (mg/kg)	Zinc (mg/kg)			
Fill1	4/14/2010	<5	**4.9**	**8.3**	<2.5	<0.99	**7.8**	**1**	<0.99	**2**	<0.097	<0.99	**2.6**	<5	<0.99	<5	**13**	**5.5**	ND	**8.4**	ND
Fill2	5/18/2010	<2.4	**4.6**	**11**	<0.94	<0.47	**7.1**	**1.7**	**0.66J**	**1.8**	<0.01	<0.47	**4.8**	<2.4	<0.47	<2.4	**11**	**8.5**	ND	**8.24**	NA
Fill3	5/19/2010	<2.5	**6.7**	**15**	<0.99	<0.49	**9.4**	**2**	**0.8J**	**2.6**	<0.011	0.86J	**5.3**	<2.5	<0.49	<2.5	**8.9**	**13**	ND	**8.66**	NA
Fill4	5/20/2010	<2.5	**7.5**	**15**	<0.99	<5	**10**	**1.9**	**0.97J**	**3**	<0.011	<0.5	**5.1**	<2.5	<0.5	<2.5	**10**	**11**	ND	**9.25**	NA
	TTLC	500	500	10,000	75	100	2,500	8,000	2,500	1,000	20	3,500	2,000	100	500	700	2,400	5,000	NL	NL	NL
	SL-R	31	0.39	15,000	160	70	230	nl	3,100	400	6.7	390	1,600	390	390	5.2	550	23,000	NL	NL	NL
	SL-I	410	1.6	190,000	2,000	810	1,400	nl	41,000	nl	28	5,100	20,000	5,100	5,100	66	7,200	310,000	NL	NL	NL
	Background Concentration	0.15-1.95	0.6-11	133-1,400	0.25-2.70	0.05-1.70	23-1,579	2.7-46.9	9.1-96.4	12.4-97.1	0.10-0.90	NL	9-509	0.015-0.430	0.10-8.30	0.17-1.10	39-288	88-236	NL	NL	NL

Backfill soil samples collected in April and May, 2010
Concentrations detected above the laboratory method detection limit are in **bold**
Concentrations detected above the SL-R are highlighted
< - Not detected above the laboratory method detection limit
ND - Not detected above laboratory method detection limit
J - Flag indicating the detected concentration is below the laboratory practical quantitation limit
NA - Not analyzed
(mg/kg) - Milligrams per kilogram
TTLC - Total threshold limit concentration
SL - United States Environmental Protection Agency Screening Levels for Chemical Contaminants at residential (R) and industrial (I) sites (July 2008)
Background Concentration - Kearney, Background Concentrations of Trace and Major Elements in California Soils, University of California, 1996
NL - not listed
Soil samples analyzed by Oilfield Environmental & Compliance, Inc.

Analysis:

Total Metals by EPA Method 6000/7000
Asbestos by PLM via EPA Method 600/R-93/116 with CARB 435 Prep (Milling) Level A
pH by Wet Chemistry by EPA or APHA Standard Methods

Appendix 1

Boring Logs

Rincon Consultants

LOG OF BORING B61

Future Childrens Musuem
125 State Street
Santa Barbara, California

Rincon Project 08-25430

Date Completed	: February 11, 2010
Location	: North corner of subject property
Method	: Geoprobe
Drilled By	: HydroGeoSpectrum
Logged By	: Shawn Decker

Depth in Feet	Samples	USCS	GRAPHIC	DESCRIPTION	PID
0		SM		SANDY SILT with varying amounts of gravel, brown, slightly moist, non plastic, fine to medium grained, firm, no odor. Asphalty black gravel to 2 feet below grade.	0
1					
2					0
3		ML		CLAYEY SILT with sand, brown to dark brown, moist, slightly plastic, fine grained, poorly graded, firm, no odor.	
4					0
5		SM		SANDY SILT, brown, slightly moist, non-plastic, fine grained, poorly graded, firm, no odor.	
6					
7		GM		GRAVELLY SANDY SILT, brown, slightly moist, non-plastic, medium grained, poorly graded, firm, no odor.	0
8					
9					
10					

07-29-2010

Rincon Consultants

LOG OF BORING B62

Future Childrens Musuem
125 State Street
Santa Barbara, California

Rincon Project 08-25430

Date Completed	: February 11, 2010
Location	: Adjacent B20, near North Corner of Subject Property
Method	: Geoprobe
Drilled By	: HydroGeoSpectrum
Logged By	: Shawn Decker

Depth in Feet	Samples	USCS	GRAPHIC	DESCRIPTION	PID
0–2.5		SM		SANDY SILT, greater than 10 percent gravel, grey brown, slightly moist, non plastic, fine to medium grained, firm, no odor. Asphalt to 1 foot below grade.	0
2.5–3.5		SP		SAND trace silt, grey brown, slightly moist, slightly plastic, fine grained, poorly graded, hard, no odor.	0
3.5–7.5		ML		CLAYEY SILT with sand, brown, slightly moist, slightly plastic, fine grained, poorly graded, firm, no odor. Trace gravel	0
7.5–8		GM		GRAVELLY SANDY SILT, brown, slightly moist, non-plastic, medium grained, poorly graded, firm, no odor.	
8		SC		CLAYEY SAND, brown, dry, plastic, fine grained, poorly graded, very hard, no odor.	0

Depth scale: 0, 1, 2, 3, 4, 5, 6, 7, 8, 9, 10

08-09-2010

Rincon Consultants

LOG OF BORING B63

Future Childrens Musuem
125 State Street
Santa Barbara, California

Rincon Project 08-25430

Date Completed	: February 11, 2010
Location	: Adjacent B4, adjacent northwest property boundary
Method	: Geoprobe
Drilled By	: HydroGeoSpectrum
Logged By	: Shawn Decker

Depth in Feet	Samples	USCS	GRAPHIC	DESCRIPTION	PID
0		SM		SANDY SILT, greater than 10 percent gravel, orange brown to grey brown, moist, non plastic, fine to coarse grained, well graded, firm, no odor.	0
1					
2					
3					0
4		ML		CLAYEY SILT with sand, brown, slightly moist, slightly plastic, fine grained, poorly graded, firm, no odor. Trace gravel	
5					0
6					
7		GC		SANDY CLAY, greater than 10 percent gravel, grey brown, slightly moist, plastic, fine to coarse grained, well graded, soft, no odor. Trace gravel, poorly graded, hard, no odor.	
8					0
9					
10					

08-09-2010

Rincon Consultants

LOG OF BORING B64

Future Childrens Musuem
125 State Street
Santa Barbara, California

Rincon Project 08-25430

Date Completed	: February 11, 2010
Location	: Near B23, south of northern corner of subject property
Method	: Geoprobe
Drilled By	: HydroGeoSpectrum
Logged By	: Shawn Decker

Depth in Feet	Samples	USCS	GRAPHIC	DESCRIPTION	PID
0				Gravel and asphalt	
1		SM		SANDY SILT, orange brown, moist, non plastic, fine grained, poorly graded, firm, no odor.	0
2					
3					0
4					
5					0
6		ML		SANDY SILT with clay, orange brown, slightly moist, slightly plastic, fine grained, poorly graded, soft, no odor.	
7		SC		SANDY CLAY with silt, black, slightly moist, plastic, fine grained, poorly graded, hard, no odor.	
8					0
9					
10					

07-29-2010

Rincon Consultants

LOG OF BORING B65

Future Childrens Musuem
125 State Street
Santa Barbara, California

Rincon Project 08-25430

Date Completed	: February 11, 2010
Location	: Adajcent B15, adjacent northwest property boundary
Method	: Geoprobe
Drilled By	: HydroGeoSpectrum
Logged By	: Shawn Decker

Depth in Feet	Samples	USCS	GRAPHIC	DESCRIPTION	PID
0		SM		SANDY SILT, greater than 10 percent gravel, orange brown, moist, non-plastic, fine to medium grained, poorly graded, firm, no odor	0
1					
2					
					0
3					
4					
					0
5		SW		SAND and fine gravel, orange brown, wet, non plastic, fine to medium grained, well graded, soft, no odor. sand resembles beach sand	
6					
7		CL		CLAY, orange brown, wet, plastic, fine grained, poorly graded, firm, no odor. Black, no odor	0
8					
9					
10					

07-29-2010

Rincon Consultants

LOG OF BORING B66

Future Childrens Musuem
125 State Street
Santa Barbara, California

Rincon Project 08-25430

Date Completed	: February 11, 2010
Location	: Between B67 and B64
Method	: Geoprobe
Drilled By	: HydroGeoSpectrum
Logged By	: Shawn Decker

Depth in Feet	Samples	USCS	GRAPHIC	DESCRIPTION	PID
0		ML		SANDY SILT, less than 10 percent gravel, orange brown to dark brown, slightly moist, non-plastic, fine grained, well graded, firm, no odor trace clay, very slightly plastic, fine to medium grained, poorly graded	0
1					
2					
3					0
4					
5					0
6		SW		SAND trace silt, less than 10 percent gravel, orange brown, slightly moist, non plastic, fine grained, poorly graded, soft, no odor.	
7		CL		CLAY, black, slightly moist, plastic, fine grained, poorly graded, hard, no odor.	
8					0
9					
10					

07-29-2010

Rincon Consultants

LOG OF BORING B67

Future Childrens Musuem
125 State Street
Santa Barbara, California

Rincon Project 08-25430

Date Completed : February 11, 2010
Location : Between B16 and B26, south boundary of proposed excavation
Method : Geoprobe
Drilled By : HydroGeoSpectrum
Logged By : Shawn Decker

Depth in Feet	Samples	USCS	GRAPHIC	DESCRIPTION	PID
0		ML		SANDY SILT, greater than 10 percent gravel, orange brown to black, slightly moist, non-plastic, fine grained, poorly graded, firm, no odor	0
1				trace clay, moist, very slightly plastic	
2					
3					0
4					
5					0
6		SW		SAND, orange brown, slightly moist, non plastic, fine grained, poorly graded, soft, no odor.	
7		CL		SANDY CLAY, brown, slightly moist, slightly plastic, fine grained, poorly graded, firm, no odor.	
8				Black, no odor	0
9					
10					

07-29-2010

Rincon Consultants

LOG OF BORING B68

Future Childrens Musuem
125 State Street
Santa Barbara, California

Rincon Project 08-25430

Date Completed	: February 11, 2010
Location	: Adjacent B35, north of flanged fitting in center of site
Method	: Geoprobe
Drilled By	: HydroGeoSpectrum
Logged By	: Shawn Decker

Depth in Feet	Samples	USCS	GRAPHIC	DESCRIPTION	PID
0				SANDY SILT, orange brown, slightly moist, non-plastic, fine grained, poorly graded, firm, no odor	
1					
2					
		ML			0
3				Trace clay, very slightly plastic	
					0
4					
					0
5					
6					

07-29-2010

Rincon Consultants

LOG OF BORING B69

Future Childrens Musuem
125 State Street
Santa Barbara, California

Rincon Project 08-25430

Date Completed	: February 11, 2010
Location	: Adjacent B52, east side of concrete pad
Method	: Geoprobe
Drilled By	: HydroGeoSpectrum
Logged By	: Shawn Decker

Depth in Feet	Samples	USCS	GRAPHIC	DESCRIPTION	PID
0				SANDY SILT, less than 10 percent gravel, orange brown, moist, non-plastic, fine to medium grained, poorly graded, firm, no odor	
1					
2					
		ML			0
3				Trace clay, black, very slightly plastic, no odor	
					0
4				Non-plastic	
					0
5					
6					

07-29-2010

Rincon Consultants

LOG OF BORING B70

Future Childrens Musuem
125 State Street
Santa Barbara, California

Rincon Project 08-25430

Date Completed	: February 11, 2010
Location	: Southern corner of subject property
Method	: Geoprobe
Drilled By	: HydroGeoSpectrum
Logged By	: Shawn Decker

Depth in Feet	Samples	USCS	GRAPHIC	DESCRIPTION	PID
0				SANDY SILT, orange brown, slightly moist, non-plastic, fine grained, poorly graded, firm, no odor	
1					
2					
		ML			0
3				Less than 10 percent gravel, black and brown	
					0
4				Trace clay, brown, moist, very slightly plastic	
					0
5					
6					

07-29-2010

Rincon Consultants

LOG OF BORING B71

Future Childrens Musuem
125 State Street
Santa Barbara, California

Rincon Project 08-25430

Date Completed : February 11, 2010
Location : Adjacent B54, southeast boundary of subject property
Method : Geoprobe
Drilled By : HydroGeoSpectrum
Logged By : Shawn Decker

Depth in Feet	Samples	USCS	GRAPHIC	DESCRIPTION	PID
0				SANDY SILT, orange brown, slightly moist, non-plastic, fine grained, poorly graded, firm, no odor	
1					
2					
		ML			0
3				dark brown to yellow brown, well graded	
					0
4					
				Trace clay, brown and black	0
5					
6					

07-29-2010

Rincon Consultants

LOG OF BORING B72

Future Childrens Musuem
125 State Street
Santa Barbara, California

Rincon Project 08-25430

Date Completed	: February 11, 2010
Location	: Adjacent B48, southeast boundary of subject property
Method	: Geoprobe
Drilled By	: HydroGeoSpectrum
Logged By	: Shawn Decker

Depth in Feet	Samples	USCS	GRAPHIC	DESCRIPTION	PID
0				SANDY SILT, orange brown, slightly moist, non-plastic, fine grained, poorly graded, firm, no odor	
1					
2					
		ML			0
3				Trace clay, moist, very slightly plastic	
					0
4					
				wet, soft	0
5					
6					

07-29-2010

Rincon Consultants

LOG OF BORING B73

Future Childrens Musuem
125 State Street
Santa Barbara, California

Rincon Project 08-25430

Date Completed	: February 11, 2010
Location	: Adjacent B42, southeast boundary of subject property
Method	: Geoprobe
Drilled By	: HydroGeoSpectrum
Logged By	: Shawn Decker

Depth in Feet	Samples	USCS	GRAPHIC	DESCRIPTION	PID
0				SANDY SILT, orange brown, slightly moist, non-plastic, fine grained, poorly graded, firm, no odor	
1					
2					
	■	ML			0
3				Greater than 10 percent coarse gravel, orange brown to black	
	■				0
4				Trace clay, brown, very slightly plastic	
	■				0
5					
6					

07-29-2010

Rincon Consultants

LOG OF BORING B74

Future Childrens Musuem
125 State Street
Santa Barbara, California

Rincon Project 08-25430

Date Completed	: February 11, 2010
Location	: Near trees adajcent south of Signalman's Building
Method	: Geoprobe
Drilled By	: HydroGeoSpectrum
Logged By	: Shawn Decker

Depth in Feet	Samples	USCS	GRAPHIC	DESCRIPTION	PID
0		ML		SANDY SILT, greater than 10 percent gravel, brown and black, slightly moist, non-plastic, fine grained, well graded, soft, no odor	0
1					
2				Trace clay, very slightly plastic, firm	
3					0
4					
5					0
6		SW		SAND, orange brown, moist, non-plastic, fine grained, poorly graded, soft. resembles beach sand	
7		ML		SANDY SILT, slightly moist, non-plastic, very fine grained, poorly graded, firm, no odor.	
8					0
9					
10					

07-29-2010

Rincon Consultants

LOG OF BORING B75

Future Childrens Musuem
125 State Street
Santa Barbara, California

Rincon Project 08-25430

Date Completed	: February 11, 2010
Location	: Western corner of subject property
Method	: Geoprobe
Drilled By	: HydroGeoSpectrum
Logged By	: Shawn Decker

Depth in Feet	Samples	USCS	GRAPHIC	DESCRIPTION	PID
0		ML		SANDY SILT, greater than 10 percent gravel, dark brown to orange brown, slightly moist, non-plastic, fine to medium grained, well graded, firm, no odor	0
1					
2					
				Trace clay, brown, wet, very slightly plastic, soft	0
3					
4					
					0
5		SW		SAND, orange brown, moist, non-plastic, fine to medium grained, poorly graded, soft. resembles beach sand	
6					
7		CL		SANDY CLAY trace silt, slightly moist, plastic, fine grained, poorly graded, hard, no odor.	
					0
8					
9					
10					

07-29-2010

Appendix 2

Phase II ESA Analytical Reports

Oilfield Environmental and Compliance, INC.

Shawn Decker
Rincón Consultants
790 East Santa Clara
Ventura, CA 93455

17 March 2010

RE: 125 State Street - Santa Barbara

Work Order: 1000511

Dear Client:

Enclosed is an analytical report for the above referenced project. The samples included in this report were received on 12-Feb-10 11:45 and analyzed in accordance with the attached chain-of-custody.

Unless otherwise noted, all analytical testing was accomplished in accordance with the guidelines established in our Quality Assurance Manual, applicable standard operating procedures, and other related documentation. The results in this analytical report are limited to the samples tested and any reproduction thereof must be made in its entirety.

If you have any questions regarding this report, please do not hesitate to contact the undersigned.

Sincerely,

Vanessa Miller

Project Manager Assistant

TEL: (805) 922-4772
307 Roemer Way, Suite 300, Santa Maria, CA 93454 www.oecusa.com FAX: (805) 925-3376

B61-0.5	1000511-01	Solid	11-Feb-10 09:00	12-Feb-10 11:45
B61-3	1000511-02	Solid	11-Feb-10 09:10	12-Feb-10 11:45
B61-5	1000511-03	Solid	11-Feb-10 09:20	12-Feb-10 11:45
B61-8	1000511-04	Solid	11-Feb-10 09:30	12-Feb-10 11:45
B62-0.5	1000511-05	Solid	11-Feb-10 09:40	12-Feb-10 11:45
B62-3	1000511-06	Solid	11-Feb-10 09:50	12-Feb-10 11:45
B62-5	1000511-07	Solid	11-Feb-10 10:00	12-Feb-10 11:45
B62-8	1000511-08	Solid	11-Feb-10 10:05	12-Feb-10 11:45
B63-5	1000511-11	Solid	11-Feb-10 10:20	12-Feb-10 11:45
B64-0.5	1000511-13	Solid	11-Feb-10 10:35	12-Feb-10 11:45
B64-3	1000511-14	Solid	11-Feb-10 10:40	12-Feb-10 11:45
B65-5	1000511-19	Solid	11-Feb-10 11:05	12-Feb-10 11:45
B66-0.5	1000511-21	Solid	11-Feb-10 11:20	12-Feb-10 11:45
B66-3	1000511-22	Solid	11-Feb-10 11:25	12-Feb-10 11:45
B67-0.5	1000511-25	Solid	11-Feb-10 11:45	12-Feb-10 11:45
B67-3	1000511-26	Solid	11-Feb-10 11:50	12-Feb-10 11:45
B68-3	1000511-29	Solid	11-Feb-10 12:10	12-Feb-10 11:45
B68-5	1000511-31	Solid	11-Feb-10 12:20	12-Feb-10 11:45
B69-3	1000511-32	Solid	11-Feb-10 12:25	12-Feb-10 11:45
B69-4	1000511-33	Solid	11-Feb-10 12:35	12-Feb-10 11:45
B69-5	1000511-34	Solid	11-Feb-10 12:40	12-Feb-10 11:45
B70-3	1000511-35	Solid	11-Feb-10 12:45	12-Feb-10 11:45
B70-4	1000511-36	Solid	11-Feb-10 12:55	12-Feb-10 11:45
B71-3	1000511-38	Solid	11-Feb-10 13:15	12-Feb-10 11:45
B71-4	1000511-39	Solid	11-Feb-10 13:20	12-Feb-10 11:45
B71-5	1000511-40	Solid	11-Feb-10 13:25	12-Feb-10 11:45
B72-3	1000511-41	Solid	11-Feb-10 13:35	12-Feb-10 11:45
B72-4	1000511-42	Solid	11-Feb-10 13:40	12-Feb-10 11:45

B73-3	1000511-44	Solid	11-Feb-10 13:55	12-Feb-10 11:45
B73-4	1000511-45	Solid	11-Feb-10 14:00	12-Feb-10 11:45
B73-5	1000511-46	Solid	11-Feb-10 14:05	12-Feb-10 11:45
B74-0.5	1000511-47	Solid	11-Feb-10 14:15	12-Feb-10 11:45
B74-3	1000511-48	Solid	11-Feb-10 14:20	12-Feb-10 11:45
B75-0.5	1000511-51	Solid	11-Feb-10 14:40	12-Feb-10 11:45
B75-3	1000511-52	Solid	11-Feb-10 14:45	12-Feb-10 11:45
B75-5	1000511-53	Solid	11-Feb-10 14:50	12-Feb-10 11:45
B75-8	1000511-54	Solid	11-Feb-10 14:55	12-Feb-10 11:45

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street - Santa Barbara	
790 East Santa Clara	Project Number: 08-25430	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	17-Mar-10 17:35

B61-0.5

1000511-01 (Solid)

Analyte	Result	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
TEPH by GC FID									
TPH Diesel (C13-C22)	ND	100	mg/kg	10	A002297	18-Feb-10	18-Feb-10	EPA 8015	
TPH Motor Oil (C23-C40)	**2800**	500	"	"	"	"	"	"	
Surrogate: o-Terphenyl		*77.3 %*	*50-150*		"	"	"	"	
Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring									**C-03, R-01**
Acenaphthene	ND	0.020	mg/kg	1	A002295	18-Feb-10	21-Feb-10	EPA 8270M	
Acenaphthylene	ND	0.020	"	"	"	"	"	"	
Anthracene	ND	0.020	"	"	"	"	"	"	
Benz(a)anthracene	**0.040**	0.020	"	"	"	"	"	"	
Benzo (b) fluoranthene	ND	0.020	"	"	"	"	"	"	
Benzo (k) fluoranthene	ND	0.020	"	"	"	"	"	"	
Benzo (a) pyrene	**0.036**	0.020	"	"	"	"	"	"	
Benzo (g,h,i) perylene	ND	0.040	"	"	"	"	"	"	
Chrysene	**0.051**	0.020	"	"	"	"	"	"	
Dibenz (a,h) anthracene	ND	0.040	"	"	"	"	"	"	
Fluoranthene	**0.083**	0.020	"	"	"	"	"	"	
Fluorene	ND	0.020	"	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	**0.024**	0.020	"	"	"	"	"	"	
Naphthalene	ND	0.040	"	"	"	"	"	"	
Phenanthrene	**0.021**	0.020	"	"	"	"	"	"	
Pyrene	**0.096**	0.020	"	"	"	"	"	"	
Surrogate: p-Terphenyl-d14		*120 %*	*50-120*		"	"	"	"	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street - Santa Barbara	
790 East Santa Clara	Project Number: 08-25430	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	17-Mar-10 17:35

B61-3
1000511-02 (Solid)

Analyte	Result	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
TEPH by GC FID									
TPH Diesel (C13-C22)	ND	10	mg/kg	1	A002297	18-Feb-10	18-Feb-10	EPA 8015	
TPH Motor Oil (C23-C40)	ND	50	"	"	"	"	"	"	
Surrogate: o-Terphenyl		*74.7 %*	*50-150*		"	"	"	"	
Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring									
Acenaphthene	ND	0.0050	mg/kg	1	A002295	18-Feb-10	18-Feb-10	EPA 8270M	
Acenaphthylene	ND	0.0050	"	"	"	"	"	"	
Anthracene	ND	0.0050	"	"	"	"	"	"	
Benz(a)anthracene	**0.0060**	0.0050	"	"	"	"	"	"	
Benzo (b) fluoranthene	ND	0.0050	"	"	"	"	"	"	
Benzo (k) fluoranthene	ND	0.0050	"	"	"	"	"	"	
Benzo (a) pyrene	ND	0.0050	"	"	"	"	"	"	
Benzo (g,h,i) perylene	ND	0.010	"	"	"	"	"	"	
Chrysene	ND	0.0050	"	"	"	"	"	"	
Dibenz (a,h) anthracene	ND	0.010	"	"	"	"	"	"	
Fluoranthene	ND	0.0050	"	"	"	"	"	"	
Fluorene	ND	0.0050	"	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	ND	0.0050	"	"	"	"	"	"	
Naphthalene	ND	0.010	"	"	"	"	"	"	
Phenanthrene	ND	0.0050	"	"	"	"	"	"	
Pyrene	ND	0.0050	"	"	"	"	"	"	
Surrogate: p-Terphenyl-d14		*97.5 %*	*50-120*		"	"	"	"	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street - Santa Barbara	
790 East Santa Clara	Project Number: 08-25430	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	17-Mar-10 17:35

B61-5
1000511-03 (Solid)

Analyte	Result	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring									**C-03, R-01**
Acenaphthene	ND	0.010	mg/kg	1	A002295	18-Feb-10	21-Feb-10	EPA 8270M	
Acenaphthylene	ND	0.010	"	"	"	"	"	"	
Anthracene	ND	0.010	"	"	"	"	"	"	
Benz(a)anthracene	ND	0.010	"	"	"	"	"	"	
Benzo (b) fluoranthene	**0.029**	0.010	"	"	"	"	"	"	
Benzo (k) fluoranthene	**0.010**	0.010	"	"	"	"	"	"	
Benzo (a) pyrene	**0.031**	0.010	"	"	"	"	"	"	
Benzo (g,h,i) perylene	**0.042**	0.020	"	"	"	"	"	"	
Chrysene	**0.015**	0.010	"	"	"	"	"	"	
Dibenz (a,h) anthracene	ND	0.020	"	"	"	"	"	"	
Fluoranthene	ND	0.010	"	"	"	"	"	"	
Fluorene	ND	0.010	"	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	**0.031**	0.010	"	"	"	"	"	"	
Naphthalene	ND	0.020	"	"	"	"	"	"	
Phenanthrene	ND	0.010	"	"	"	"	"	"	
Pyrene	**0.021**	0.010	"	"	"	"	"	"	
Surrogate: p-Terphenyl-d14		*101 %*	*50-120*		"	"	"	"	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street - Santa Barbara	
790 East Santa Clara	Project Number: 08-25430	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	17-Mar-10 17:35

B61-8
1000511-04 (Solid)

Analyte	Result	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring									
Acenaphthene	ND	0.0049	mg/kg	1	A002388	24-Feb-10	27-Feb-10	EPA 8270M	
Acenaphthylene	ND	0.0049	"	"	"	"	"	"	
Anthracene	ND	0.0049	"	"	"	"	"	"	
Benz(a)anthracene	ND	0.0049	"	"	"	"	"	"	
Benzo (b) fluoranthene	ND	0.0049	"	"	"	"	"	"	
Benzo (k) fluoranthene	ND	0.0049	"	"	"	"	"	"	
Benzo (a) pyrene	ND	0.0049	"	"	"	"	"	"	
Benzo (g,h,i) perylene	ND	0.0098	"	"	"	"	"	"	
Chrysene	ND	0.0049	"	"	"	"	"	"	
Dibenz (a,h) anthracene	ND	0.0098	"	"	"	"	"	"	
Fluoranthene	ND	0.0049	"	"	"	"	"	"	
Fluorene	ND	0.0049	"	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	ND	0.0049	"	"	"	"	"	"	
Naphthalene	ND	0.0098	"	"	"	"	"	"	
Phenanthrene	ND	0.0049	"	"	"	"	"	"	
Pyrene	ND	0.0049	"	"	"	"	"	"	
Surrogate: p-Terphenyl-d14		*120 %*	*50-120*		"	"	"	"	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street - Santa Barbara	
790 East Santa Clara	Project Number: 08-25430	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	17-Mar-10 17:35

B62-0.5
1000511-05 (Solid)

Analyte	Result	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
TEPH by GC FID									
TPH Diesel (C13-C22)	ND	10	mg/kg	1	A002297	18-Feb-10	19-Feb-10	EPA 8015	
TPH Motor Oil (C23-C40)	ND	50	"	"	"	"	"	"	
Surrogate: o-Terphenyl		*80.2 %*	*50-150*		"	"	"	"	
Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring									
Acenaphthene	ND	0.0050	mg/kg	1	A002388	24-Feb-10	27-Feb-10	EPA 8270M	
Acenaphthylene	ND	0.0050	"	"	"	"	"	"	
Anthracene	ND	0.0050	"	"	"	"	"	"	
Benz(a)anthracene	**0.0073**	0.0050	"	"	"	"	"	"	
Benzo (b) fluoranthene	**0.017**	0.0050	"	"	"	"	"	"	
Benzo (k) fluoranthene	**0.016**	0.0050	"	"	"	"	"	"	
Benzo (a) pyrene	**0.013**	0.0050	"	"	"	"	"	"	
Benzo (g,h,i) perylene	**0.014**	0.010	"	"	"	"	"	"	
Chrysene	**0.017**	0.0050	"	"	"	"	"	"	
Dibenz (a,h) anthracene	ND	0.010	"	"	"	"	"	"	
Fluoranthene	**0.024**	0.0050	"	"	"	"	"	"	
Fluorene	ND	0.0050	"	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	**0.011**	0.0050	"	"	"	"	"	"	
Naphthalene	ND	0.010	"	"	"	"	"	"	
Phenanthrene	**0.0070**	0.0050	"	"	"	"	"	"	
Pyrene	**0.024**	0.0050	"	"	"	"	"	"	
Surrogate: p-Terphenyl-d14		*115 %*	*50-120*		"	"	"	"	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street - Santa Barbara	
790 East Santa Clara	Project Number: 08-25430	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	17-Mar-10 17:35

B62-3
1000511-06 (Solid)

Analyte	Result	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
TEPH by GC FID									
TPH Diesel (C13-C22)	ND	10	mg/kg	1	A002297	18-Feb-10	19-Feb-10	EPA 8015	
TPH Motor Oil (C23-C40)	ND	50	"	"	"	"	"	"	
Surrogate: o-Terphenyl		*71.3 %*	*50-150*		"	"	"	"	
Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring									
Acenaphthene	ND	0.0050	mg/kg	1	A002388	24-Feb-10	27-Feb-10	EPA 8270M	
Acenaphthylene	ND	0.0050	"	"	"	"	"	"	
Anthracene	ND	0.0050	"	"	"	"	"	"	
Benz(a)anthracene	ND	0.0050	"	"	"	"	"	"	
Benzo (b) fluoranthene	ND	0.0050	"	"	"	"	"	"	
Benzo (k) fluoranthene	ND	0.0050	"	"	"	"	"	"	
Benzo (a) pyrene	ND	0.0050	"	"	"	"	"	"	
Benzo (g,h,i) perylene	ND	0.010	"	"	"	"	"	"	
Chrysene	ND	0.0050	"	"	"	"	"	"	
Dibenz (a,h) anthracene	ND	0.010	"	"	"	"	"	"	
Fluoranthene	ND	0.0050	"	"	"	"	"	"	
Fluorene	ND	0.0050	"	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	ND	0.0050	"	"	"	"	"	"	
Naphthalene	ND	0.010	"	"	"	"	"	"	
Phenanthrene	ND	0.0050	"	"	"	"	"	"	
Pyrene	ND	0.0050	"	"	"	"	"	"	
Surrogate: p-Terphenyl-d14		*115 %*	*50-120*		"	"	"	"	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street - Santa Barbara	
790 East Santa Clara	Project Number: 08-25430	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	17-Mar-10 17:35

B62-5
1000511-07 (Solid)

Analyte	Result	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring									
Acenaphthene	ND	0.0050	mg/kg	1	A002388	24-Feb-10	27-Feb-10	EPA 8270M	
Acenaphthylene	ND	0.0050	"	"	"	"	"	"	
Anthracene	**0.019**	0.0050	"	"	"	"	"	"	
Benz(a)anthracene	**0.052**	0.0050	"	"	"	"	"	"	
Benzo (b) fluoranthene	**0.033**	0.0050	"	"	"	"	"	"	
Benzo (k) fluoranthene	**0.047**	0.0050	"	"	"	"	"	"	
Benzo (a) pyrene	**0.051**	0.0050	"	"	"	"	"	"	
Benzo (g,h,i) perylene	**0.023**	0.0099	"	"	"	"	"	"	
Chrysene	**0.052**	0.0050	"	"	"	"	"	"	
Dibenz (a,h) anthracene	ND	0.0099	"	"	"	"	"	"	
Fluoranthene	**0.11**	0.0050	"	"	"	"	"	"	
Fluorene	ND	0.0050	"	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	**0.027**	0.0050	"	"	"	"	"	"	
Naphthalene	ND	0.0099	"	"	"	"	"	"	
Phenanthrene	**0.069**	0.0050	"	"	"	"	"	"	
Pyrene	**0.10**	0.0050	"	"	"	"	"	"	
Surrogate: p-Terphenyl-d14		*120 %*	*50-120*		"	"	"	"	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street - Santa Barbara	
790 East Santa Clara	Project Number: 08-25430	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	17-Mar-10 17:35

B62-8
1000511-08 (Solid)

Analyte	Result	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring									
Acenaphthene	ND	0.0050	mg/kg	1	A002388	24-Feb-10	27-Feb-10	EPA 8270M	
Acenaphthylene	ND	0.0050	"	"	"	"	"	"	
Anthracene	ND	0.0050	"	"	"	"	"	"	
Benz(a)anthracene	ND	0.0050	"	"	"	"	"	"	
Benzo (b) fluoranthene	ND	0.0050	"	"	"	"	"	"	
Benzo (k) fluoranthene	ND	0.0050	"	"	"	"	"	"	
Benzo (a) pyrene	ND	0.0050	"	"	"	"	"	"	
Benzo (g,h,i) perylene	ND	0.010	"	"	"	"	"	"	
Chrysene	ND	0.0050	"	"	"	"	"	"	
Dibenz (a,h) anthracene	ND	0.010	"	"	"	"	"	"	
Fluoranthene	ND	0.0050	"	"	"	"	"	"	
Fluorene	ND	0.0050	"	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	ND	0.0050	"	"	"	"	"	"	
Naphthalene	ND	0.010	"	"	"	"	"	"	
Phenanthrene	ND	0.0050	"	"	"	"	"	"	
Pyrene	ND	0.0050	"	"	"	"	"	"	
Surrogate: p-Terphenyl-d14		*119 %*	*50-120*		"	"	"	"	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street - Santa Barbara	
790 East Santa Clara	Project Number: 08-25430	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	17-Mar-10 17:35

B63-5
1000511-11 (Solid)

Analyte	Result	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
TEPH by GC FID									
TPH Diesel (C13-C22)	ND	10	mg/kg	1	A002297	18-Feb-10	19-Feb-10	EPA 8015	
TPH Motor Oil (C23-C40)	ND	50	"	"	"	"	"	"	
Surrogate: o-Terphenyl		*69.3 %*	*50-150*		"	"	"	"	
Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring									
Acenaphthene	ND	0.0050	mg/kg	1	A002295	18-Feb-10	18-Feb-10	EPA 8270M	
Acenaphthylene	ND	0.0050	"	"	"	"	"	"	
Anthracene	ND	0.0050	"	"	"	"	"	"	
Benz(a)anthracene	ND	0.0050	"	"	"	"	"	"	
Benzo (b) fluoranthene	ND	0.0050	"	"	"	"	"	"	
Benzo (k) fluoranthene	ND	0.0050	"	"	"	"	"	"	
Benzo (a) pyrene	ND	0.0050	"	"	"	"	"	"	
Benzo (g,h,i) perylene	ND	0.010	"	"	"	"	"	"	
Chrysene	ND	0.0050	"	"	"	"	"	"	
Dibenz (a,h) anthracene	ND	0.010	"	"	"	"	"	"	
Fluoranthene	ND	0.0050	"	"	"	"	"	"	
Fluorene	ND	0.0050	"	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	ND	0.0050	"	"	"	"	"	"	
Naphthalene	ND	0.010	"	"	"	"	"	"	
Phenanthrene	ND	0.0050	"	"	"	"	"	"	
Pyrene	ND	0.0050	"	"	"	"	"	"	
Surrogate: p-Terphenyl-d14		*96.9 %*	*50-120*		"	"	"	"	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street - Santa Barbara	
790 East Santa Clara	Project Number: 08-25430	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	17-Mar-10 17:35

B64-0.5
1000511-13 (Solid)

Analyte	Result	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
TEPH by GC FID									
TPH Diesel (C13-C22)	ND	30	mg/kg	3	A002297	18-Feb-10	19-Feb-10	EPA 8015	
TPH Motor Oil (C23-C40)	**530**	150	"	"	"	"	"	"	
Surrogate: o-Terphenyl		*61.0 %*	*50-150*		"	"	"	"	
Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring									**C-03, R-01**
Acenaphthene	ND	0.035	mg/kg	1	A002295	18-Feb-10	21-Feb-10	EPA 8270M	
Acenaphthylene	ND	0.035	"	"	"	"	"	"	
Anthracene	ND	0.035	"	"	"	"	"	"	
Benz(a)anthracene	ND	0.035	"	"	"	"	"	"	
Benzo (b) fluoranthene	ND	0.035	"	"	"	"	"	"	
Benzo (k) fluoranthene	ND	0.035	"	"	"	"	"	"	
Benzo (a) pyrene	ND	0.035	"	"	"	"	"	"	
Benzo (g,h,i) perylene	ND	0.070	"	"	"	"	"	"	
Chrysene	**0.070**	0.035	"	"	"	"	"	"	
Dibenz (a,h) anthracene	ND	0.070	"	"	"	"	"	"	
Fluoranthene	ND	0.035	"	"	"	"	"	"	
Fluorene	ND	0.035	"	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	ND	0.035	"	"	"	"	"	"	
Naphthalene	ND	0.070	"	"	"	"	"	"	
Phenanthrene	ND	0.035	"	"	"	"	"	"	
Pyrene	**0.11**	0.035	"	"	"	"	"	"	
Surrogate: p-Terphenyl-d14		*158 %*	*50-120*		"	"	"	"	*S-04*

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street - Santa Barbara	
790 East Santa Clara	Project Number: 08-25430	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	17-Mar-10 17:35

B64-3
1000511-14 (Solid)

Analyte	Result	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
TEPH by GC FID									
TPH Diesel (C13-C22)	ND	10	mg/kg	1	A002412	24-Feb-10	03-Mar-10	EPA 8015	
TPH Motor Oil (C23-C40)	ND	50	"	"	"	"	"	"	
Surrogate: o-Terphenyl		*78.8 %*	*50-150*		"	"	"	"	
Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring									
Acenaphthene	ND	0.0049	mg/kg	1	A002388	24-Feb-10	27-Feb-10	EPA 8270M	
Acenaphthylene	ND	0.0049	"	"	"	"	"	"	
Anthracene	ND	0.0049	"	"	"	"	"	"	
Benz(a)anthracene	ND	0.0049	"	"	"	"	"	"	
Benzo (b) fluoranthene	ND	0.0049	"	"	"	"	"	"	
Benzo (k) fluoranthene	ND	0.0049	"	"	"	"	"	"	
Benzo (a) pyrene	ND	0.0049	"	"	"	"	"	"	
Benzo (g,h,i) perylene	ND	0.0098	"	"	"	"	"	"	
Chrysene	ND	0.0049	"	"	"	"	"	"	
Dibenz (a,h) anthracene	ND	0.0098	"	"	"	"	"	"	
Fluoranthene	ND	0.0049	"	"	"	"	"	"	
Fluorene	ND	0.0049	"	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	ND	0.0049	"	"	"	"	"	"	
Naphthalene	ND	0.0098	"	"	"	"	"	"	
Phenanthrene	ND	0.0049	"	"	"	"	"	"	
Pyrene	ND	0.0049	"	"	"	"	"	"	
Surrogate: p-Terphenyl-d14		*116 %*	*50-120*		"	"	"	"	

B65-5
1000511-19 (Solid)

Analyte	Result	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
TEPH by GC FID									
TPH Diesel (C13-C22)	ND	10	mg/kg	1	A002297	18-Feb-10	19-Feb-10	EPA 8015	
TPH Motor Oil (C23-C40)	ND	50	"	"	"	"	"	"	
Surrogate: o-Terphenyl		*91.4 %*	*50-150*		"	"	"	"	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street - Santa Barbara	
790 East Santa Clara	Project Number: 08-25430	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	17-Mar-10 17:35

B66-0.5
1000511-21 (Solid)

Analyte	Result	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
TEPH by GC FID									
TPH Diesel (C13-C22)	ND	30	mg/kg	3	A002297	18-Feb-10	19-Feb-10	EPA 8015	
TPH Motor Oil (C23-C40)	**660**	150	"	"	"	"	"	"	
Surrogate: o-Terphenyl		*58.6 %*	*50-150*		"	"	"	"	
Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring									**C-03, R-01**
Acenaphthene	ND	0.015	mg/kg	1	A002295	18-Feb-10	21-Feb-10	EPA 8270M	
Acenaphthylene	ND	0.015	"	"	"	"	"	"	
Anthracene	ND	0.015	"	"	"	"	"	"	
Benz(a)anthracene	**0.023**	0.015	"	"	"	"	"	"	
Benzo (b) fluoranthene	ND	0.015	"	"	"	"	"	"	
Benzo (k) fluoranthene	ND	0.015	"	"	"	"	"	"	
Benzo (a) pyrene	**0.021**	0.015	"	"	"	"	"	"	
Benzo (g,h,i) perylene	ND	0.030	"	"	"	"	"	"	
Chrysene	**0.029**	0.015	"	"	"	"	"	"	
Dibenz (a,h) anthracene	ND	0.030	"	"	"	"	"	"	
Fluoranthene	**0.042**	0.015	"	"	"	"	"	"	
Fluorene	ND	0.015	"	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	ND	0.015	"	"	"	"	"	"	
Naphthalene	ND	0.030	"	"	"	"	"	"	
Phenanthrene	ND	0.015	"	"	"	"	"	"	
Pyrene	**0.089**	0.015	"	"	"	"	"	"	
Surrogate: p-Terphenyl-d14		*142 %*	*50-120*		"	"	"	"	*S-04*

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street - Santa Barbara	
790 East Santa Clara	Project Number: 08-25430	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	17-Mar-10 17:35

B66-3
1000511-22 (Solid)

Analyte	Result	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
TEPH by GC FID									
TPH Diesel (C13-C22)	ND	10	mg/kg	1	A002297	18-Feb-10	19-Feb-10	EPA 8015	
TPH Motor Oil (C23-C40)	ND	50	"	"	"	"	"	"	
Surrogate: o-Terphenyl		*70.6 %*	*50-150*		"	"	"	"	
Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring									
Acenaphthene	ND	0.0050	mg/kg	1	A002388	24-Feb-10	27-Feb-10	EPA 8270M	
Acenaphthylene	ND	0.0050	"	"	"	"	"	"	
Anthracene	ND	0.0050	"	"	"	"	"	"	
Benz(a)anthracene	ND	0.0050	"	"	"	"	"	"	
Benzo (b) fluoranthene	ND	0.0050	"	"	"	"	"	"	
Benzo (k) fluoranthene	ND	0.0050	"	"	"	"	"	"	
Benzo (a) pyrene	ND	0.0050	"	"	"	"	"	"	
Benzo (g,h,i) perylene	ND	0.010	"	"	"	"	"	"	
Chrysene	ND	0.0050	"	"	"	"	"	"	
Dibenz (a,h) anthracene	ND	0.010	"	"	"	"	"	"	
Fluoranthene	ND	0.0050	"	"	"	"	"	"	
Fluorene	ND	0.0050	"	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	ND	0.0050	"	"	"	"	"	"	
Naphthalene	ND	0.010	"	"	"	"	"	"	
Phenanthrene	ND	0.0050	"	"	"	"	"	"	
Pyrene	ND	0.0050	"	"	"	"	"	"	
Surrogate: p-Terphenyl-d14		*116 %*	*50-120*		"	"	"	"	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street - Santa Barbara	
790 East Santa Clara	Project Number: 08-25430	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	17-Mar-10 17:35

B67-0.5
1000511-25 (Solid)

Analyte	Result	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
TEPH by GC FID									
TPH Diesel (C13-C22)	ND	100	mg/kg	10	A002297	18-Feb-10	19-Feb-10	EPA 8015	
TPH Motor Oil (C23-C40)	**3100**	500	"	"	"	"	"	"	
Surrogate: o-Terphenyl		*68.1 %*	*50-150*		"	"	"	"	
Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring									**C-03, R-01**
Acenaphthene	ND	0.020	mg/kg	1	A002388	24-Feb-10	27-Feb-10	EPA 8270M	
Acenaphthylene	ND	0.020	"	"	"	"	"	"	
Anthracene	**0.030**	0.020	"	"	"	"	"	"	
Benz(a)anthracene	**0.16**	0.020	"	"	"	"	"	"	
Benzo (b) fluoranthene	**0.42**	0.020	"	"	"	"	"	"	
Benzo (k) fluoranthene	**0.26**	0.020	"	"	"	"	"	"	
Benzo (a) pyrene	**0.25**	0.020	"	"	"	"	"	"	
Benzo (g,h,i) perylene	**0.32**	0.039	"	"	"	"	"	"	
Chrysene	**0.33**	0.020	"	"	"	"	"	"	
Dibenz (a,h) anthracene	**0.095**	0.039	"	"	"	"	"	"	
Fluoranthene	**0.37**	0.20	"	10	"	"	27-Feb-10	"	
Fluorene	ND	0.020	"	1	"	"	27-Feb-10	"	
Indeno (1,2,3-cd) pyrene	**0.31**	0.020	"	"	"	"	"	"	
Naphthalene	ND	0.039	"	"	"	"	"	"	
Phenanthrene	**0.11**	0.020	"	"	"	"	"	"	
Pyrene	**0.42**	0.20	"	10	"	"	27-Feb-10	"	
Surrogate: p-Terphenyl-d14		*150 %*	*50-120*		"	"	*27-Feb-10*	"	*S-04*

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street - Santa Barbara	
790 East Santa Clara	Project Number: 08-25430	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	17-Mar-10 17:35

B67-3
1000511-26 (Solid)

Analyte	Result	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
TEPH by GC FID									
TPH Diesel (C13-C22)	ND	10	mg/kg	1	A002297	18-Feb-10	19-Feb-10	EPA 8015	
TPH Motor Oil (C23-C40)	**81**	50	"	"	"	"	"	"	
Surrogate: o-Terphenyl		*67.4 %*	*50-150*		"	"	"	"	
Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring									
Acenaphthene	ND	0.0050	mg/kg	1	A002388	24-Feb-10	27-Feb-10	EPA 8270M	
Acenaphthylene	ND	0.0050	"	"	"	"	"	"	
Anthracene	ND	0.0050	"	"	"	"	"	"	
Benz(a)anthracene	**0.016**	0.0050	"	"	"	"	"	"	
Benzo (b) fluoranthene	**0.020**	0.0050	"	"	"	"	"	"	
Benzo (k) fluoranthene	**0.019**	0.0050	"	"	"	"	"	"	
Benzo (a) pyrene	**0.018**	0.0050	"	"	"	"	"	"	
Benzo (g,h,i) perylene	**0.011**	0.010	"	"	"	"	"	"	
Chrysene	**0.020**	0.0050	"	"	"	"	"	"	
Dibenz (a,h) anthracene	ND	0.010	"	"	"	"	"	"	
Fluoranthene	**0.035**	0.0050	"	"	"	"	"	"	
Fluorene	ND	0.0050	"	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	**0.011**	0.0050	"	"	"	"	"	"	
Naphthalene	ND	0.010	"	"	"	"	"	"	
Phenanthrene	**0.0063**	0.0050	"	"	"	"	"	"	
Pyrene	**0.033**	0.0050	"	"	"	"	"	"	
Surrogate: p-Terphenyl-d14		*146 %*	*50-120*		"	"	"	"	*S-04*

B68-3
1000511-29 (Solid)

Analyte	Result	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods									
Lead	**14**	0.99	mg/kg	5	A002251	16-Feb-10	16-Feb-10	EPA 6020	
STLC Metals by 6000/7000 Series Methods									
Lead	**0.87**	0.020	mg/L	10	A002303	18-Feb-10	18-Feb-10	STLC/EPA 6020	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street - Santa Barbara	
790 East Santa Clara	Project Number: 08-25430	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	17-Mar-10 17:35

B68-5
1000511-31 (Solid)

Analyte	Result	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
TEPH by GC FID									
TPH Diesel (C13-C22)	ND	10	mg/kg	1	A002297	18-Feb-10	19-Feb-10	EPA 8015	
TPH Motor Oil (C23-C40)	ND	50	"	"	"	"	"	"	
Surrogate: o-Terphenyl		*71.8 %*	*50-150*		"	"	"	"	

B69-3
1000511-32 (Solid)

Analyte	Result	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods									
Lead	**1200**	20	mg/kg	100	A002251	16-Feb-10	16-Feb-10	EPA 6020	N-01, N-03
STLC Metals by 6000/7000 Series Methods									
Lead	**60**	0.40	mg/L	200	A002303	18-Feb-10	19-Feb-10	STLC/EPA 6020	N-06
TCLP Metals by 6000/7000 Series Methods									
Lead	**1.4**	0.010	mg/L	10	A003016	01-Mar-10	02-Mar-10	EPA 1311/EPA 6020	
TEPH by GC FID									
TPH Diesel (C13-C22)	ND	30	mg/kg	3	A002297	18-Feb-10	19-Feb-10	EPA 8015	
TPH Motor Oil (C23-C40)	**150**	150	"	"	"	"	"	"	
Surrogate: o-Terphenyl		*59.6 %*	*50-150*		"	"	"	"	

Oilfield Environmental and Compliance, INC.

Rincon Consultants 790 East Santa Clara Ventura CA, 93455	Project: 125 State Street - Santa Barbara Project Number: 08-25430 Project Manager: Shawn Decker	**Reported:** 17-Mar-10 17:35

B69-4
1000511-33 (Solid)

Analyte	Result	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods									
Lead	**160**	2.0	mg/kg	10	A003053	03-Mar-10	04-Mar-10	EPA 6020	N-02, N-03
STLC Metals by 6000/7000 Series Methods									
Lead	**7.1**	0.050	mg/L	50	A003017	01-Mar-10	03-Mar-10	STLC/EPA 6020	
TCLP Metals by 6000/7000 Series Methods									
Lead	**0.035**	0.010	mg/L	10	A003223	15-Mar-10	16-Mar-10	EPA 1311/EPA 6020	

B69-5
1000511-34 (Solid)

Analyte	Result	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods									
Lead	**5.3**	1.0	mg/kg	5	A003230	15-Mar-10	17-Mar-10	EPA 6020	
STLC Metals by 6000/7000 Series Methods									
Lead	**0.12**	0.010	mg/L	10	A003222	15-Mar-10	17-Mar-10	STLC/EPA 6020	

B70-3
1000511-35 (Solid)

Analyte	Result	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods									
Lead	**960**	9.9	mg/kg	50	A002251	16-Feb-10	16-Feb-10	EPA 6020	N-02, N-03
STLC Metals by 6000/7000 Series Methods									
Lead	**64**	0.40	mg/L	200	A002303	18-Feb-10	19-Feb-10	STLC/EPA 6020	N-06
TCLP Metals by 6000/7000 Series Methods									
Lead	**2.9**	0.020	mg/L	20	A003016	01-Mar-10	02-Mar-10	EPA 1311/EPA 6020	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street - Santa Barbara	
790 East Santa Clara	Project Number: 08-25430	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	17-Mar-10 17:35

B70-4
1000511-36 (Solid)

Analyte	Result	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods									
Lead	**32**	0.98	mg/kg	5	A003053	03-Mar-10	04-Mar-10	EPA 6020	
STLC Metals by 6000/7000 Series Methods									
Lead	**0.61**	0.010	mg/L	10	A003017	01-Mar-10	03-Mar-10	STLC/EPA 6020	

B71-3
1000511-38 (Solid)

Analyte	Result	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods									
Lead	**270**	2.0	mg/kg	10	A002251	16-Feb-10	16-Feb-10	EPA 6020	N-02, N-03
STLC Metals by 6000/7000 Series Methods									
Lead	**42**	0.40	mg/L	200	A002303	18-Feb-10	19-Feb-10	STLC/EPA 6020	N-06
TCLP Metals by 6000/7000 Series Methods									
Lead	**0.86**	0.010	mg/L	10	A003016	01-Mar-10	02-Mar-10	EPA 1311/EPA 6020	

B71-4
1000511-39 (Solid)

Analyte	Result	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods									
Lead	**280**	4.0	mg/kg	20	A003053	03-Mar-10	04-Mar-10	EPA 6020	N-02, N-03
STLC Metals by 6000/7000 Series Methods									
Lead	**21**	0.10	mg/L	100	A003017	01-Mar-10	03-Mar-10	STLC/EPA 6020	
TCLP Metals by 6000/7000 Series Methods									
Lead	**0.51**	0.010	mg/L	10	A003223	15-Mar-10	16-Mar-10	EPA 1311/EPA 6020	

B71-5
1000511-40 (Solid)

Analyte	Result	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods									
Lead	**400**	4.0	mg/kg	20	A003230	15-Mar-10	17-Mar-10	EPA 6020	N-02, N-03
STLC Metals by 6000/7000 Series Methods									
Lead	**21**	0.10	mg/L	100	A003222	15-Mar-10	17-Mar-10	STLC/EPA 6020	N-04

B72-3
1000511-41 (Solid)

Analyte	Result	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods									
Lead	**20**	0.99	mg/kg	5	A002251	16-Feb-10	16-Feb-10	EPA 6020	
STLC Metals by 6000/7000 Series Methods									
Lead	**0.59**	0.020	mg/L	10	A002303	18-Feb-10	18-Feb-10	STLC/EPA 6020	

B72-4
1000511-42 (Solid)

Analyte	Result	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods									
Lead	**6.7**	1.0	mg/kg	5	A003230	15-Mar-10	17-Mar-10	EPA 6020	
STLC Metals by 6000/7000 Series Methods									
Lead	**0.13**	0.010	mg/L	10	A003222	15-Mar-10	17-Mar-10	STLC/EPA 6020	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street - Santa Barbara	
790 East Santa Clara	Project Number: 08-25430	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	17-Mar-10 17:35

B73-3
1000511-44 (Solid)

Analyte	Result	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods									
Lead	**35**	1.0	mg/kg	5	A002251	16-Feb-10	16-Feb-10	EPA 6020	

B73-4
1000511-45 (Solid)

Analyte	Result	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods									
Lead	**6.1**	0.99	mg/kg	5	A002251	16-Feb-10	16-Feb-10	EPA 6020	

B73-5
1000511-46 (Solid)

Analyte	Result	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods									
Lead	**6.9**	0.99	mg/kg	5	A002251	16-Feb-10	16-Feb-10	EPA 6020	

B74-0.5
1000511-47 (Solid)

Analyte	Result	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
TEPH by GC FID									
TPH Diesel (C13-C22)	ND	30	mg/kg	3	A002297	18-Feb-10	19-Feb-10	EPA 8015	
TPH Motor Oil (C23-C40)	**200**	150	"	"	"	"	"	"	
Surrogate: o-Terphenyl		*54.6 %*	*50-150*		"	"	"	"	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street - Santa Barbara	
790 East Santa Clara	Project Number: 08-25430	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	17-Mar-10 17:35

B74-3
1000511-48 (Solid)

Analyte	Result	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
TEPH by GC FID									
TPH Diesel (C13-C22)	ND	10	mg/kg	1	A002297	18-Feb-10	19-Feb-10	EPA 8015	
TPH Motor Oil (C23-C40)	ND	50	"	"	"	"	"	"	
Surrogate: o-Terphenyl		*70.4 %*	*50-150*		"	"	"	"	

B75-0.5
1000511-51 (Solid)

Analyte	Result	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
TEPH by GC FID									
TPH Diesel (C13-C22)	**38**	10	mg/kg	1	A002307	18-Feb-10	19-Feb-10	EPA 8015	
TPH Motor Oil (C23-C40)	**440**	50	"	"	"	"	"	"	
Surrogate: o-Terphenyl		*71.7 %*	*50-150*		"	"	"	"	

B75-3
1000511-52 (Solid)

Analyte	Result	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
TEPH by GC FID									
TPH Diesel (C13-C22)	ND	10	mg/kg	1	A002307	18-Feb-10	19-Feb-10	EPA 8015	
TPH Motor Oil (C23-C40)	ND	50	"	"	"	"	"	"	
Surrogate: o-Terphenyl		*66.5 %*	*50-150*		"	"	"	"	

B75-5
1000511-53 (Solid)

Analyte	Result	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
TEPH by GC FID									
TPH Diesel (C13-C22)	ND	10	mg/kg	1	A002307	18-Feb-10	19-Feb-10	EPA 8015	
TPH Motor Oil (C23-C40)	ND	50	"	"	"	"	"	"	
Surrogate: o-Terphenyl		*66.6 %*	*50-150*		"	"	"	"	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street - Santa Barbara	
790 East Santa Clara	Project Number: 08-25430	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	17-Mar-10 17:35

B75-8

1000511-54 (Solid)

Analyte	Result	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
TEPH by GC FID									
TPH Diesel (C13-C22)	ND	10	mg/kg	1	A002307	18-Feb-10	19-Feb-10	EPA 8015	
TPH Motor Oil (C23-C40)	ND	50	"	"	"	"	"	"	
Surrogate: o-Terphenyl		*69.8 %*	*50-150*		"	"	"	"	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street - Santa Barbara	
790 East Santa Clara	Project Number: 08-25430	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	17-Mar-10 17:35

Total Metals by EPA 6000/7000 Series Methods - Quality Control

Analyte	Result	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
Batch A002251 - EPA 3050B										
Blank (A002251-BLK1)				Prepared & Analyzed: 16-Feb-10						
Lead	ND	0.20	mg/kg							
LCS (A002251-BS1)				Prepared & Analyzed: 16-Feb-10						
Lead	15.4	0.20	mg/kg	15.0		103	85-115		20	
LCS Dup (A002251-BSD1)				Prepared & Analyzed: 16-Feb-10						
Lead	15.5	0.20	mg/kg	15.0		103	85-115	0.419	20	
Duplicate (A002251-DUP1)		**Source: 1000511-29**		Prepared & Analyzed: 16-Feb-10						
Lead	37.0	0.98	mg/kg		13.5			93.0	20	QM-04
Matrix Spike (A002251-MS1)		**Source: 1000511-29**		Prepared & Analyzed: 16-Feb-10						
Lead	336	4.0	mg/kg	296	13.5	109	63-136		20	
Matrix Spike Dup (A002251-MSD1)		**Source: 1000511-29**		Prepared & Analyzed: 16-Feb-10						
Lead	324	4.0	mg/kg	298	13.5	104	63-136	4.52	20	
Batch A003053 - EPA 3050B										
Blank (A003053-BLK1)				Prepared: 03-Mar-10 Analyzed: 04-Mar-10						
Lead	ND	0.20	mg/kg							
LCS (A003053-BS1)				Prepared: 03-Mar-10 Analyzed: 04-Mar-10						
Lead	15.7	0.20	mg/kg	15.0		105	85-115		20	
LCS Dup (A003053-BSD1)				Prepared: 03-Mar-10 Analyzed: 04-Mar-10						
Lead	15.6	0.20	mg/kg	15.0		104	85-115	1.05	20	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street - Santa Barbara	
790 East Santa Clara	Project Number: 08-25430	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	17-Mar-10 17:35

Total Metals by EPA 6000/7000 Series Methods - Quality Control

Analyte	Result	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
Batch A003053 - EPA 3050B										
Duplicate (A003053-DUP1)		**Source: 1000654-01**		Prepared: 03-Mar-10 Analyzed: 04-Mar-10						
Lead	10.2	0.99	mg/kg		15.5			41.8	20	QR-03
Matrix Spike (A003053-MS1)		**Source: 1000654-01**		Prepared: 03-Mar-10 Analyzed: 04-Mar-10						
Lead	319	3.9	mg/kg	295	15.5	103	63-136		20	
Matrix Spike Dup (A003053-MSD1)		**Source: 1000654-01**		Prepared: 03-Mar-10 Analyzed: 04-Mar-10						
Lead	310	4.0	mg/kg	299	15.5	98.3	63-136	4.41	20	
Batch A003230 - EPA 3050B										
Blank (A003230-BLK1)				Prepared: 15-Mar-10 Analyzed: 17-Mar-10						
Lead	ND	0.20	mg/kg							
LCS (A003230-BS1)				Prepared: 15-Mar-10 Analyzed: 17-Mar-10						
Lead	14.6	0.20	mg/kg	15.0		97.1	85-115		20	
LCS Dup (A003230-BSD1)				Prepared: 15-Mar-10 Analyzed: 17-Mar-10						
Lead	14.3	0.20	mg/kg	15.0		95.1	85-115	2.15	20	
Duplicate (A003230-DUP1)		**Source: 1000877-13**		Prepared: 15-Mar-10 Analyzed: 17-Mar-10						
Lead	7.57	0.98	mg/kg		7.65			1.08	20	
Matrix Spike (A003230-MS1)		**Source: 1000877-13**		Prepared: 15-Mar-10 Analyzed: 17-Mar-10						
Lead	303	3.9	mg/kg	295	7.65	100	63-136		20	
Matrix Spike Dup (A003230-MSD1)		**Source: 1000877-13**		Prepared: 15-Mar-10 Analyzed: 17-Mar-10						
Lead	304	4.0	mg/kg	299	7.65	99.0	63-136	1.23	20	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street - Santa Barbara	
790 East Santa Clara	Project Number: 08-25430	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	17-Mar-10 17:35

STLC Metals by 6000/7000 Series Methods - Quality Control

Analyte	Result	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
Batch A002303 - EPA 3005A Leachate										
Blank (A002303-BLK1)				Prepared & Analyzed: 18-Feb-10						
Lead	ND	0.0010	mg/L							
LCS (A002303-BS1)				Prepared & Analyzed: 18-Feb-10						
Lead	0.157	0.0010	mg/L	0.150		105	85-115		20	
LCS Dup (A002303-BSD1)				Prepared & Analyzed: 18-Feb-10						
Lead	0.158	0.0010	mg/L	0.150		105	85-115	0.448	20	
Duplicate (A002303-DUP1)		**Source: 1000511-29**		Prepared & Analyzed: 18-Feb-10						
Lead	0.642	0.010	mg/L		0.871			30.2	20	QR-04
Matrix Spike (A002303-MS1)		**Source: 1000511-29**		Prepared & Analyzed: 18-Feb-10						
Lead	7.48	0.040	mg/L	6.00	0.871	110	66.7-136		20	
Matrix Spike Dup (A002303-MSD1)		**Source: 1000511-29**		Prepared & Analyzed: 18-Feb-10						
Lead	7.46	0.040	mg/L	6.00	0.871	110	66.7-136	0.353	20	
Batch A003017 - EPA 3005A Leachate										
Blank (A003017-BLK1)				Prepared: 01-Mar-10 Analyzed: 03-Mar-10						
Lead	ND	0.0010	mg/L							
LCS (A003017-BS1)				Prepared: 01-Mar-10 Analyzed: 03-Mar-10						
Lead	0.148	0.0010	mg/L	0.150		98.8	85-115		20	
LCS Dup (A003017-BSD1)				Prepared: 01-Mar-10 Analyzed: 03-Mar-10						
Lead	0.150	0.0010	mg/L	0.150		100	85-115	1.34	20	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street - Santa Barbara	
790 East Santa Clara	Project Number: 08-25430	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	17-Mar-10 17:35

STLC Metals by 6000/7000 Series Methods - Quality Control

Analyte	Result	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
Batch A003017 - EPA 3005A Leachate										
Duplicate (A003017-DUP1)		**Source: 1000511-33**		Prepared: 01-Mar-10 Analyzed: 03-Mar-10						
Lead	7.16	0.050	mg/L		7.08			1.13	20	
Matrix Spike (A003017-MS1)		**Source: 1000511-33**		Prepared: 01-Mar-10 Analyzed: 03-Mar-10						
Lead	13.7	0.10	mg/L	6.00	7.08	111	66.7-136		20	
Matrix Spike Dup (A003017-MSD1)		**Source: 1000511-33**		Prepared: 01-Mar-10 Analyzed: 03-Mar-10						
Lead	13.9	0.10	mg/L	6.00	7.08	114	66.7-136	2.90	20	
Batch A003222 - EPA 3005A Leachate										
Blank (A003222-BLK1)				Prepared: 15-Mar-10 Analyzed: 17-Mar-10						
Lead	ND	0.0010	mg/L							
LCS (A003222-BS1)				Prepared: 15-Mar-10 Analyzed: 17-Mar-10						
Lead	0.149	0.0010	mg/L	0.150		99.5	85-115		20	
LCS Dup (A003222-BSD1)				Prepared: 15-Mar-10 Analyzed: 17-Mar-10						
Lead	0.151	0.0010	mg/L	0.150		101	85-115	0.998	20	
Duplicate (A003222-DUP1)		**Source: 1000511-34**		Prepared: 15-Mar-10 Analyzed: 17-Mar-10						
Lead	0.126	0.010	mg/L		0.119			5.77	20	
Matrix Spike (A003222-MS1)		**Source: 1000511-34**		Prepared: 15-Mar-10 Analyzed: 17-Mar-10						
Lead	7.13	0.040	mg/L	6.00	0.119	117	66.7-136		20	
Matrix Spike Dup (A003222-MSD1)		**Source: 1000511-34**		Prepared: 15-Mar-10 Analyzed: 17-Mar-10						
Lead	6.67	0.040	mg/L	6.00	0.119	109	66.7-136	6.80	20	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street - Santa Barbara	
790 East Santa Clara	Project Number: 08-25430	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	17-Mar-10 17:35

TCLP Metals by 6000/7000 Series Methods - Quality Control

Analyte	Result	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
Batch A003016 - EPA 3005A Leachate										
Blank (A003016-BLK1)				Prepared: 01-Mar-10 Analyzed: 02-Mar-10						
Lead	ND	0.0010	mg/L							
LCS (A003016-BS1)				Prepared: 01-Mar-10 Analyzed: 02-Mar-10						
Lead	0.150	0.0010	mg/L	0.150		99.7	85-115		20	
LCS Dup (A003016-BSD1)				Prepared: 01-Mar-10 Analyzed: 02-Mar-10						
Lead	0.154	0.0010	mg/L	0.150		103	85-115	3.05	20	
Duplicate (A003016-DUP1)		**Source: 1000511-32**		Prepared: 01-Mar-10 Analyzed: 02-Mar-10						
Lead	1.44	0.010	mg/L		1.43			0.777	20	
Matrix Spike (A003016-MS1)		**Source: 1000511-32**		Prepared: 01-Mar-10 Analyzed: 02-Mar-10						
Lead	7.59	0.040	mg/L	6.00	1.43	103	66.7-136		20	
Matrix Spike Dup (A003016-MSD1)		**Source: 1000511-32**		Prepared: 01-Mar-10 Analyzed: 02-Mar-10						
Lead	7.18	0.040	mg/L	6.00	1.43	95.8	66.7-136	7.00	20	
Batch A003223 - EPA 3005A Leachate										
Blank (A003223-BLK1)				Prepared: 15-Mar-10 Analyzed: 16-Mar-10						
Lead	ND	0.0010	mg/L							
LCS (A003223-BS1)				Prepared: 15-Mar-10 Analyzed: 16-Mar-10						
Lead	0.149	0.0010	mg/L	0.150		99.6	85-115		20	
LCS Dup (A003223-BSD1)				Prepared: 15-Mar-10 Analyzed: 16-Mar-10						
Lead	0.145	0.0010	mg/L	0.150		96.6	85-115	3.01	20	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street - Santa Barbara	
790 East Santa Clara	Project Number: 08-25430	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	17-Mar-10 17:35

TCLP Metals by 6000/7000 Series Methods - Quality Control

Analyte	Result	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
Batch A003223 - EPA 3005A Leachate										
Duplicate (A003223-DUP1)		**Source: 1000475-01**		Prepared: 15-Mar-10 Analyzed: 16-Mar-10						
Lead	0.107	0.010	mg/L		0.111			4.14	20	
Matrix Spike (A003223-MS1)		**Source: 1000475-01**		Prepared: 15-Mar-10 Analyzed: 16-Mar-10						
Lead	6.80	0.040	mg/L	6.00	0.111	112	66.7-136		20	
Matrix Spike Dup (A003223-MSD1)		**Source: 1000475-01**		Prepared: 15-Mar-10 Analyzed: 16-Mar-10						
Lead	6.43	0.040	mg/L	6.00	0.111	105	66.7-136	5.69	20	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street - Santa Barbara	
790 East Santa Clara	Project Number: 08-25430	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	17-Mar-10 17:35

TEPH by GC FID - Quality Control

Analyte	Result	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
Batch A002297 - EPA 3550B										
Blank (A002297-BLK1)				Prepared & Analyzed: 18-Feb-10						
TPH Diesel (C13-C22)	ND	10	mg/kg							
TPH Motor Oil (C23-C40)	ND	50	"							
Surrogate: o-Terphenyl	*36.0*		"	*50.0*		*72.1*	*50-150*			
LCS (A002297-BS1)				Prepared & Analyzed: 18-Feb-10						
TPH Diesel (C13-C22)	412	10	mg/kg	500		82.3	70-130		20	
Surrogate: o-Terphenyl	*35.0*		"	*50.0*		*69.9*	*50-150*			
LCS Dup (A002297-BSD1)				Prepared & Analyzed: 18-Feb-10						
TPH Diesel (C13-C22)	390	10	mg/kg	500		78.0	70-130	5.34	20	
Surrogate: o-Terphenyl	*35.4*		"	*50.0*		*70.8*	*50-150*			
Duplicate (A002297-DUP1)		**Source: 1000511-01**		Prepared: 18-Feb-10 Analyzed: 19-Feb-10						
TPH Diesel (C13-C22)	ND	10	mg/kg		89.2				20	
TPH Motor Oil (C23-C40)	ND	50	"		2830				20	
Surrogate: o-Terphenyl	*34.1*		"	*50.0*		*68.1*	*50-150*			
Matrix Spike (A002297-MS1)		**Source: 1000511-01**		Prepared: 18-Feb-10 Analyzed: 19-Feb-10						
TPH Diesel (C13-C22)	438	10	mg/kg	500	89.2	69.9	70-130		20	QM-08
Surrogate: o-Terphenyl	*35.9*		"	*50.0*		*71.9*	*50-150*			
Matrix Spike Dup (A002297-MSD1)		**Source: 1000511-01**		Prepared: 18-Feb-10 Analyzed: 19-Feb-10						
TPH Diesel (C13-C22)	415	10	mg/kg	500	89.2	65.1	70-130	5.54	20	QM-08
Surrogate: o-Terphenyl	*36.8*		"	*50.0*		*73.6*	*50-150*			
Batch A002307 - EPA 3550B										
Blank (A002307-BLK1)				Prepared: 18-Feb-10 Analyzed: 19-Feb-10						
TPH Diesel (C13-C22)	ND	10	mg/kg							
TPH Motor Oil (C23-C40)	ND	50	"							
Surrogate: o-Terphenyl	*46.7*		"	*50.0*		*93.5*	*50-150*			

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street - Santa Barbara	
790 East Santa Clara	Project Number: 08-25430	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	17-Mar-10 17:35

TEPH by GC FID - Quality Control

Analyte	Result	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
Batch A002307 - EPA 3550B										
LCS (A002307-BS1)				Prepared: 18-Feb-10 Analyzed: 19-Feb-10						
TPH Diesel (C13-C22)	433	10	mg/kg	500		86.7	70-130		20	
Surrogate: o-Terphenyl	*36.7*		"	*50.0*		*73.4*	*50-150*			
LCS Dup (A002307-BSD1)				Prepared: 18-Feb-10 Analyzed: 19-Feb-10						
TPH Diesel (C13-C22)	426	10	mg/kg	500		85.3	70-130	1.62	20	
Surrogate: o-Terphenyl	*34.9*		"	*50.0*		*69.8*	*50-150*			
Batch A002412 - EPA 3550B										
Blank (A002412-BLK1)				Prepared: 24-Feb-10 Analyzed: 03-Mar-10						
TPH Diesel (C13-C22)	ND	10	mg/kg							
TPH Motor Oil (C23-C40)	ND	50	"							
Surrogate: o-Terphenyl	*35.6*		"	*50.0*		*71.1*	*50-150*			
LCS (A002412-BS1)				Prepared: 24-Feb-10 Analyzed: 03-Mar-10						
TPH Diesel (C13-C22)	413	10	mg/kg	500		82.6	70-130		20	
Surrogate: o-Terphenyl	*36.9*		"	*50.0*		*73.7*	*50-150*			
LCS Dup (A002412-BSD1)				Prepared: 24-Feb-10 Analyzed: 03-Mar-10						
TPH Diesel (C13-C22)	417	10	mg/kg	500		83.4	70-130	0.884	20	
Surrogate: o-Terphenyl	*35.3*		"	*50.0*		*70.6*	*50-150*			

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street - Santa Barbara	
790 East Santa Clara	Project Number: 08-25430	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	17-Mar-10 17:35

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring - Quality Control

Analyte	Result	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
Batch A002295 - EPA 3550B MS										
Blank (A002295-BLK1)				Prepared & Analyzed: 18-Feb-10						
Acenaphthene	ND	0.0050	mg/kg							
Acenaphthylene	ND	0.0050	"							
Anthracene	ND	0.0050	"							
Benz(a)anthracene	ND	0.0050	"							
Benzo (b) fluoranthene	ND	0.0050	"							
Benzo (k) fluoranthene	ND	0.0050	"							
Benzo (a) pyrene	ND	0.0050	"							
Benzo (g,h,i) perylene	ND	0.010	"							
Chrysene	ND	0.0050	"							
Dibenz (a,h) anthracene	ND	0.010	"							
Fluoranthene	ND	0.0050	"							
Fluorene	ND	0.0050	"							
Indeno (1,2,3-cd) pyrene	ND	0.0050	"							
Naphthalene	ND	0.010	"							
Phenanthrene	ND	0.0050	"							
Pyrene	ND	0.0050	"							
Surrogate: p-Terphenyl-d14	*0.0253*		"	*0.0267*		*95.0*	*29-165*			
LCS (A002295-BS1)				Prepared & Analyzed: 18-Feb-10						
Acenaphthene	0.0213	0.0050	mg/kg	0.0267		80.0	40-120		30	
Acenaphthylene	0.0210	0.0050	"	0.0267		78.7	40-120		30	
Anthracene	0.0240	0.0050	"	0.0267		90.0	40-120		30	
Benz(a)anthracene	0.0237	0.0050	"	0.0267		88.8	40-120		30	
Benzo (b) fluoranthene	0.0187	0.0050	"	0.0267		70.0	40-120		30	
Benzo (k) fluoranthene	0.0277	0.0050	"	0.0267		104	40-120		30	
Benzo (a) pyrene	0.0197	0.0050	"	0.0267		73.8	40-120		30	
Benzo (g,h,i) perylene	0.0213	0.010	"	0.0267		80.0	40-120		30	
Chrysene	0.0240	0.0050	"	0.0267		90.0	40-120		30	
Dibenz (a,h) anthracene	0.0197	0.010	"	0.0267		73.8	40-120		30	
Fluoranthene	0.0247	0.0050	"	0.0267		92.5	40-120		30	
Fluorene	0.0240	0.0050	"	0.0267		90.0	40-120		30	
Indeno (1,2,3-cd) pyrene	0.0207	0.0050	"	0.0267		77.5	40-120		30	
Naphthalene	0.0197	0.010	"	0.0267		73.8	40-120		30	
Phenanthrene	0.0243	0.0050	"	0.0267		91.2	40-120		30	
Pyrene	0.0257	0.0050	"	0.0267		96.3	40-120		30	
Surrogate: p-Terphenyl-d14	*0.0267*		"	*0.0267*		*100*	*29-165*			

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street - Santa Barbara	
790 East Santa Clara	Project Number: 08-25430	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	17-Mar-10 17:35

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring - Quality Control

Analyte	Result	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
Batch A002295 - EPA 3550B MS										
LCS Dup (A002295-BSD1)				Prepared & Analyzed: 18-Feb-10						
Acenaphthene	0.0200	0.0050	mg/kg	0.0267		75.0	40-120	6.45	30	
Acenaphthylene	0.0193	0.0050	"	0.0267		72.5	40-120	8.26	30	
Anthracene	0.0190	0.0050	"	0.0267		71.2	40-120	23.3	30	
Benz(a)anthracene	0.0250	0.0050	"	0.0267		93.7	40-120	5.48	30	
Benzo (b) fluoranthene	0.0203	0.0050	"	0.0267		76.2	40-120	8.55	30	
Benzo (k) fluoranthene	0.0270	0.0050	"	0.0267		101	40-120	2.44	30	
Benzo (a) pyrene	0.0213	0.0050	"	0.0267		80.0	40-120	8.13	30	
Benzo (g,h,i) perylene	0.0230	0.010	"	0.0267		86.2	40-120	7.52	30	
Chrysene	0.0227	0.0050	"	0.0267		85.0	40-120	5.71	30	
Dibenz (a,h) anthracene	0.0240	0.010	"	0.0267		90.0	40-120	19.8	30	
Fluoranthene	0.0237	0.0050	"	0.0267		88.8	40-120	4.14	30	
Fluorene	0.0227	0.0050	"	0.0267		85.0	40-120	5.71	30	
Indeno (1,2,3-cd) pyrene	0.0270	0.0050	"	0.0267		101	40-120	26.6	30	
Naphthalene	0.0177	0.010	"	0.0267		66.2	40-120	10.7	30	
Phenanthrene	0.0257	0.0050	"	0.0267		96.3	40-120	5.33	30	
Pyrene	0.0243	0.0050	"	0.0267		91.2	40-120	5.33	30	
Surrogate: p-Terphenyl-d14	*0.0273*		"	*0.0267*		*102*	*29-165*			
Batch A002388 - EPA 3550B MS										
Blank (A002388-BLK1)				Prepared: 24-Feb-10 Analyzed: 25-Feb-10						
Acenaphthene	ND	0.0050	mg/kg							
Acenaphthylene	ND	0.0050	"							
Anthracene	ND	0.0050	"							
Benz(a)anthracene	ND	0.0050	"							
Benzo (b) fluoranthene	ND	0.0050	"							
Benzo (k) fluoranthene	ND	0.0050	"							
Benzo (a) pyrene	ND	0.0050	"							
Benzo (g,h,i) perylene	ND	0.010	"							
Chrysene	ND	0.0050	"							
Dibenz (a,h) anthracene	ND	0.010	"							
Fluoranthene	ND	0.0050	"							
Fluorene	ND	0.0050	"							
Indeno (1,2,3-cd) pyrene	ND	0.0050	"							
Naphthalene	ND	0.010	"							
Phenanthrene	ND	0.0050	"							
Pyrene	ND	0.0050	"							
Surrogate: p-Terphenyl-d14	*0.0237*		"	*0.0267*		*88.8*	*29-165*			

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street - Santa Barbara	
790 East Santa Clara	Project Number: 08-25430	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	17-Mar-10 17:35

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring - Quality Control

Analyte	Result	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
Batch A002388 - EPA 3550B MS										
Blank (A002388-BLK2)				Prepared: 24-Feb-10 Analyzed: 26-Feb-10						**C-03**
Acenaphthene	ND	0.0050	mg/kg							
Acenaphthylene	ND	0.0050	"							
Anthracene	ND	0.0050	"							
Benz(a)anthracene	ND	0.0050	"							
Benzo (b) fluoranthene	ND	0.0050	"							
Benzo (k) fluoranthene	ND	0.0050	"							
Benzo (a) pyrene	ND	0.0050	"							
Benzo (g,h,i) perylene	ND	0.010	"							
Chrysene	ND	0.0050	"							
Dibenz (a,h) anthracene	ND	0.010	"							
Fluoranthene	ND	0.0050	"							
Fluorene	ND	0.0050	"							
Indeno (1,2,3-cd) pyrene	ND	0.0050	"							
Naphthalene	ND	0.010	"							
Phenanthrene	ND	0.0050	"							
Pyrene	ND	0.0050	"							
Surrogate: p-Terphenyl-d14	*0.0297*		"	*0.0267*		*111*	*29-165*			
LCS (A002388-BS1)				Prepared: 24-Feb-10 Analyzed: 25-Feb-10						
Acenaphthene	0.0147	0.0050	mg/kg	0.0267		55.0	40-120		30	
Acenaphthylene	0.0157	0.0050	"	0.0267		58.8	40-120		30	
Anthracene	0.0150	0.0050	"	0.0267		56.2	40-120		30	
Benz(a)anthracene	0.0220	0.0050	"	0.0267		82.5	40-120		30	
Benzo (b) fluoranthene	0.0257	0.0050	"	0.0267		96.3	40-120		30	
Benzo (k) fluoranthene	0.0230	0.0050	"	0.0267		86.2	40-120		30	
Benzo (a) pyrene	0.0183	0.0050	"	0.0267		68.7	40-120		30	
Benzo (g,h,i) perylene	0.0257	0.010	"	0.0267		96.3	40-120		30	
Chrysene	0.0230	0.0050	"	0.0267		86.2	40-120		30	
Dibenz (a,h) anthracene	0.0200	0.010	"	0.0267		75.0	40-120		30	
Fluoranthene	0.0200	0.0050	"	0.0267		75.0	40-120		30	
Fluorene	0.0167	0.0050	"	0.0267		62.5	40-120		30	
Indeno (1,2,3-cd) pyrene	0.0220	0.0050	"	0.0267		82.5	40-120		30	
Naphthalene	0.0140	0.010	"	0.0267		52.5	40-120		30	
Phenanthrene	0.0180	0.0050	"	0.0267		67.5	40-120		30	
Pyrene	0.0217	0.0050	"	0.0267		81.3	40-120		30	
Surrogate: p-Terphenyl-d14	*0.0243*		"	*0.0267*		*91.2*	*29-165*			

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street - Santa Barbara	
790 East Santa Clara	Project Number: 08-25430	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	17-Mar-10 17:35

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring - Quality Control

Analyte	Result	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
Batch A002388 - EPA 3550B MS										
LCS Dup (A002388-BSD1)				Prepared: 24-Feb-10 Analyzed: 25-Feb-10						
Acenaphthene	0.0130	0.0050	mg/kg	0.0267		48.8	40-120	12.0	30	
Acenaphthylene	0.0140	0.0050	"	0.0267		52.5	40-120	11.2	30	
Anthracene	0.0157	0.0050	"	0.0267		58.8	40-120	4.35	30	
Benz(a)anthracene	0.0233	0.0050	"	0.0267		87.5	40-120	5.88	30	
Benzo (b) fluoranthene	0.0253	0.0050	"	0.0267		95.0	40-120	1.31	30	
Benzo (k) fluoranthene	0.0250	0.0050	"	0.0267		93.7	40-120	8.33	30	
Benzo (a) pyrene	0.0207	0.0050	"	0.0267		77.5	40-120	12.0	30	
Benzo (g,h,i) perylene	0.0273	0.010	"	0.0267		102	40-120	6.29	30	
Chrysene	0.0237	0.0050	"	0.0267		88.8	40-120	2.86	30	
Dibenz (a,h) anthracene	0.0223	0.010	"	0.0267		83.7	40-120	11.0	30	
Fluoranthene	0.0203	0.0050	"	0.0267		76.2	40-120	1.65	30	
Fluorene	0.0163	0.0050	"	0.0267		61.2	40-120	2.02	30	
Indeno (1,2,3-cd) pyrene	0.0230	0.0050	"	0.0267		86.2	40-120	4.44	30	
Naphthalene	0.0110	0.010	"	0.0267		41.2	40-120	24.0	30	
Phenanthrene	0.0187	0.0050	"	0.0267		70.0	40-120	3.64	30	
Pyrene	0.0217	0.0050	"	0.0267		81.3	40-120	0.00	30	
Surrogate: p-Terphenyl-d14	*0.0247*		"	*0.0267*		*92.5*	*29-165*			
Duplicate (A002388-DUP1)		**Source: 1000639-01**		Prepared: 24-Feb-10 Analyzed: 27-Feb-10						
Acenaphthene	ND	0.0050	mg/kg		ND				30	
Acenaphthylene	ND	0.0050	"		ND				30	
Anthracene	ND	0.0050	"		ND				30	
Benz(a)anthracene	ND	0.0050	"		ND				30	
Benzo (b) fluoranthene	ND	0.0050	"		ND				30	
Benzo (k) fluoranthene	ND	0.0050	"		ND				30	
Benzo (a) pyrene	ND	0.0050	"		ND				30	
Benzo (g,h,i) perylene	ND	0.010	"		ND				30	
Chrysene	ND	0.0050	"		ND				30	
Dibenz (a,h) anthracene	ND	0.010	"		ND				30	
Fluoranthene	ND	0.0050	"		ND				30	
Fluorene	ND	0.0050	"		ND				30	
Indeno (1,2,3-cd) pyrene	ND	0.0050	"		ND				30	
Naphthalene	ND	0.010	"		ND				30	
Phenanthrene	ND	0.0050	"		ND				30	
Pyrene	ND	0.0050	"		ND				30	
Surrogate: p-Terphenyl-d14	*0.0263*		"	*0.0266*		*98.8*	*29-165*			

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street - Santa Barbara	
790 East Santa Clara	Project Number: 08-25430	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	17-Mar-10 17:35

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring - Quality Control

Analyte	Result	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
Batch A002388 - EPA 3550B MS										
Matrix Spike (A002388-MS1)		**Source: 1000639-01**		Prepared: 24-Feb-10 Analyzed: 26-Feb-10						**C-03**
Acenaphthene	0.00963	0.0050	mg/kg	0.0266	ND	36.2	0-131		30	QM-12
Acenaphthylene	0.00930	0.0050	"	0.0266	ND	35.0	0-125		30	QM-12
Anthracene	0.0120	0.0050	"	0.0266	ND	45.0	0-144		30	
Benz(a)anthracene	0.0236	0.0050	"	0.0266	ND	88.7	27-161		30	
Benzo (b) fluoranthene	0.0266	0.0050	"	0.0266	ND	100	36-147		30	
Benzo (k) fluoranthene	0.0282	0.0050	"	0.0266	ND	106	47-137		30	
Benzo (a) pyrene	0.0232	0.0050	"	0.0266	ND	87.5	21-152		30	
Benzo (g,h,i) perylene	0.0276	0.010	"	0.0266	ND	104	37-145		30	
Chrysene	0.0246	0.0050	"	0.0266	ND	92.5	45-134		30	
Dibenz (a,h) anthracene	0.0209	0.010	"	0.0266	ND	78.7	36-159		30	
Fluoranthene	0.0282	0.0050	"	0.0266	ND	106	36-137		30	
Fluorene	0.0110	0.0050	"	0.0266	ND	41.2	0-135		30	
Indeno (1,2,3-cd) pyrene	0.0249	0.0050	"	0.0266	ND	93.7	32-163		30	
Naphthalene	0.00930	0.010	"	0.0266	ND	35.0	0-111		30	QM-12
Phenanthrene	0.0133	0.0050	"	0.0266	ND	50.0	4-141		30	
Pyrene	0.0312	0.0050	"	0.0266	ND	118	32-143		30	
Surrogate: p-Terphenyl-d14	*0.0319*		"	*0.0266*		*120*	*29-165*			
Matrix Spike Dup (A002388-MSD1)		**Source: 1000639-01**		Prepared: 24-Feb-10 Analyzed: 26-Feb-10						**C-03**
Acenaphthene	0.0113	0.0050	mg/kg	0.0266	ND	42.5	0-131	15.9	30	
Acenaphthylene	0.0110	0.0050	"	0.0266	ND	41.2	0-125	16.5	30	
Anthracene	0.0136	0.0050	"	0.0266	ND	51.2	0-144	13.1	30	
Benz(a)anthracene	0.0213	0.0050	"	0.0266	ND	80.0	27-161	10.3	30	
Benzo (b) fluoranthene	0.0306	0.0050	"	0.0266	ND	115	36-147	14.0	30	
Benzo (k) fluoranthene	0.0276	0.0050	"	0.0266	ND	104	47-137	2.31	30	
Benzo (a) pyrene	0.0229	0.0050	"	0.0266	ND	86.2	21-152	1.37	30	
Benzo (g,h,i) perylene	0.0263	0.010	"	0.0266	ND	98.7	37-145	4.87	30	
Chrysene	0.0223	0.0050	"	0.0266	ND	83.7	45-134	9.86	30	
Dibenz (a,h) anthracene	0.0239	0.010	"	0.0266	ND	90.0	36-159	13.4	30	
Fluoranthene	0.0296	0.0050	"	0.0266	ND	111	36-137	4.66	30	
Fluorene	0.0136	0.0050	"	0.0266	ND	51.2	0-135	21.7	30	
Indeno (1,2,3-cd) pyrene	0.0256	0.0050	"	0.0266	ND	96.2	32-163	2.70	30	
Naphthalene	0.0106	0.010	"	0.0266	ND	40.0	0-111	13.4	30	
Phenanthrene	0.0153	0.0050	"	0.0266	ND	57.5	4-141	14.0	30	
Pyrene	0.0322	0.0050	"	0.0266	ND	121	32-143	3.21	30	QM-12
Surrogate: p-Terphenyl-d14	*0.0356*		"	*0.0266*		*134*	*29-165*			

Notes and Definitions

S-04	The surrogate recovery for this sample is outside of established control limits due to a sample matrix effect.
R-01	The Reporting Limit has been raised to account for matrix interference.
QR-04	The RPD exceeded the QC control limits.
QR-03	The RPD value for the sample duplicate or MS/MSD was outside of QC acceptance limits due to matrix interference. QC batch accepted based on LCS and/or LCSD recovery and/or RPD values.
QM-12	The spike level was outside acceptance limits. The batch was accepted based on acceptable recovery of the remaining spikes.
QM-08	The spike recovery was outside acceptance limits for the MS and/or MSD. The QC Batch was accepted based on LCS/LCSD percent recoveries and RPD values.
QM-04	Visual evaluation of the sample indicates the RPD is above the control limit due to a non-homogeneous sample matrix.
N-06	STLC analyte concentration exceeds STLC limit.
N-04	Total analyte concentration exceeds STLC limit.
N-03	Analyte concentration above 20 X TCLP.
N-02	Analyte concentration below TTLC but above 10 X STLC.
N-01	Analyte concentration exceeds TTLC.
C-03	To reduce matrix interference, the sample extract has undergone silica-gel clean-up, method 3630, which is specific to polar compound contamination.
DET	Analyte DETECTED
ND	Analyte NOT DETECTED at or above the reporting limit
NR	Not Reported
dry	Sample results reported on a dry weight basis
RPD	Relative Percent Difference

Oilfield Environmental and Compliance
307 Roemer Way Suite 300, Santa Maria CA 93454
phone: (805) 922-4772 fax: (805) 925-3376 www.oecusa.com

Highway 33, McKittrick CA
phone: (661) 762-9143

CHAIN OF CUSTODY

Company: Rincon Consultants, Inc.
Address: 790 East Santa Clara Street
City/State/ZIP: ~~Santa Barbara~~ Ventura, CA 93001
Phone: 805 641 1000 Fax: 805 641 1072 E-mail: sdeckler@rinconconsult
Report To: Rincon Sampler: SD
Send report via- FAX- ☐ PDF- ☑ Coll/LUFT EDF- ☐ EDD- ☐
Turnaround Time: 10 Days- ☐ 5 Days- ☑ 72 hr- ☐ 48 hr- ☐ 24 hr- ☐ ASAP- ☐

Project Name/#: 08-25430
Site: 125 State St., Santa Barbara, CA

OEC Sample ID	Date/Time Sampled	Matrix	# of Cont.	Client Sample ID	TEPH 8015M	PNA 8270C	Special Instructions:
1000511-1A	2-11-10 / 9:00	Soil	1	B61-0.5	X	X	MDL
2A	/ 9:10			B61-3	X	X	
3A	/ 9:20			B61-5		X	
4A	/ 9:30			B61-8			HOLD
5A	/ 9:40			B62-0.5	X		
6A	/ 9:50			B62-3	X		
7A	10:00			B62-5			HOLD
8A	10:05			B62-8			
9A	10:10			B63-0.5			
10A	10:15			B63-3			
11A	10:20			B63-5	X	X	
12A	10:30			B63-8			HOLD

Relinquished By:	Date: 2-12-10	Time:
Received By:	Date: 2-12-10	Time: 0945
Relinquished By:	Date: 2-12-10	Time: 1145
Received By:	Date: 2-12-10	Time: 1145
Relinquished By:	Date:	Time:
Received By:	Date:	Time:

Comments/PO#: 1. Asphalt may be present in 0.5' samples
2. Hold samples for possible additional analyses

Oilfield Environmental and Compliance

307 Roemer Way Suite 300, Santa Maria CA 93454
phone: (805) 922-4772 fax: (805) 925-3376 www.oecusa.com

Highway 33, McKittrick CA
phone: (661) 762-9143

CHAIN OF CUSTODY

Company: Rincon Consultants, Inc.
Address: 790 East Santa Clara Street
City/State/ZIP: Ventura, CA 93001
Phone: 805641 1000 Fax: 805641 1072 E-mail: [illegible]
Report To: Rincon Sampler: SD
Send report via- FAX- ☐ PDF- ☑ Colt/LUFT EDF- ☐ EDD- ☐
Turnaround Time: 10 Days- ☐ 5 Days- ☑ 72 hr- ☐ 48 hr- ☐ 24 hr- ☐ ASAP- ☐

Project Name/#: 08-25430
Site: 125 State St., Santa Barbara, CA

OEC Sample ID	Date/Time Sampled	Matrix	# of Cont.	Client Sample ID	TEPH 8015M	PNA 8270C									Special Instructions:
1000511-13A	2-11-10/10:35	Soil	1	B64-0.5	X	X									MDL
14A	10:40			B64-3											HOLD
15A	10:45			B64-5											
16A	10:50			B64-8											
17A	10:55			B65-0.5											
18A	11:00			B65-3											
19A	11:05			B65-5	X										
20A	11:10			B65-8											HOLD
21A	11:20			B66-0.5	X	X									
22A	11:25			B66-3	X										
23A	11:30			B66-5											HOLD
24A	11:35			B66-8											HOLD

Relinquished By: [signature]	Date: 2-12-10	Time:
Received By: [signature]	Date: 2-12-10	Time: 0945
Relinquished By: [signature]	Date: 2-12-10	Time: 1145
Received By: [signature]	Date: 2-12-10	Time: 1145
Relinquished By:	Date:	Time:
Received By:	Date:	Time:

Comments/PO#:

Oilfield Environmental and Compliance

307 Roemer Way Suite 300, Santa Maria CA 93454
phone: (805) 922-4772 fax: (805) 925-3376 www.oecusa.com

Highway 33, McKittrick CA
phone: (661) 762-9143

CHAIN OF CUSTODY

Company: Rincon Consultants, Inc.
Address: 790 East Santa Clara Street
City/State/ZIP: ~~Santa Barbara~~ Ventura, CA 93001
Phone: 805 641 1000 Fax: 805 641 1072 E-mail: [illegible]
Report To: Rincon Sampler: SD
Send report via- FAX- ☐ PDF- ☑ Colt/LUFT EDF- ☐ EDD- ☐
Turnaround Time: 10 Days- ☐ 5 Days- ☑ 72 hr- ☐ 48 hr- ☐ 24 hr- ☐ ASAP- ☐

Project Name/#: 08-25430
Site: 125 State St., Santa Barbara, CA

OEC Sample ID	Date/Time Sampled	Matrix	# of Cont.	Client Sample ID	TEPH 8015M	PNA 8270C	Total Lead 6010B	STLC Lead	Special Instructions:
100054-25A	2-11-10/11:45	Soil	1	B67-0.5	X				MDL
26A	11:50			B67-3	X				
27A	11:55			B67-5					Hold
28A	12:00			B67-8					
29A	12:10			B68-3			X	X	
30A	12:15			B68-4					Hold
31A	12:20			B68-5	X				
32A	12:25			B69-3	X		X	X	
33A	12:35			B69-4					Hold
34A	12:40			B69-5					
35A	12:45			B70-3			X	X	
36A	12:55			B70-4					Hold

Relinquished By: [signature]	Date: 2-12-10	Time:
Received By: [signature]	Date: 2-12-10	Time: 0945
Relinquished By: [signature]	Date: 2-12-10	Time: 1145
Received By: [signature]	Date: 2-12-10	Time: 1145
Relinquished By:	Date:	Time:
Received By:	Date:	Time:

Comments/PO#:

Oilfield Environmental and Compliance
307 Roemer Way Suite 300, Santa Maria CA 93454
phone: (805) 922-4772 fax: (805) 925-3376 www.oecusa.com

Highway 33, McKittrick CA
phone: (661) 762-9143

CHAIN OF CUSTODY

Company: Rincon Consultants, Inc.
Address: 790 East Santa Clara Street
City/State/ZIP: Ventura, CA 93001
Phone: 805 641 1000 Fax: 805 641 1072 E-mail: [illegible]
Report To: Rincon Sampler: SD
Send report via- FAX- ☐ PDF- ☑ Colt/LUFT EDF- ☐ EDD- ☐
Turnaround Time: 10 Days- ☐ 5 Days- ☑ 72 hr- ☐ 48 hr- ☐ 24 hr- ☐ ASAP- ☐

Project Name/#: 08-25430
Site: 125 State St., Santa Barbara, CA

OEC Sample ID	Date/Time Sampled	Matrix	# of Cont.	Client Sample ID	TEPH8015M	PNA8270C	Lead 6010B	STLC Lead							Special Instructions:
1000511-37A	2-11-10/13:05	Soil	1	B70-5											MDL HOLD
38A	13:15			B71-3			X	X							
39A	13:20			B71-4											HOLD
40A	13:25			B71-5											
41A	13:35			B72-3			X	X							
42A	13:40			B72-4											HOLD
43A	13:45			B72-5											
44A	13:55			B73-3			X								
45A	14:00			B73-4			X								
46A	14:05			B73-5			X								
47A	14:15			B74-0.5	X										
48A	14:20			B74-3	X										

Relinquished By: [signature]	Date: 2-12-10	Time:
Received By: [signature]	Date: 2-12-10	Time: 0045
Relinquished By: [signature]	Date: 2-12-10	Time: 1145
Received By: [signature]	Date: 2-12-10	Time: 1145
Relinquished By:	Date:	Time:
Received By:	Date:	Time:

Comments/PO#:

Oilfield Environmental and Compliance
307 Roemer Way Suite 300, Santa Maria CA 93454
phone: (805) 922-4772 fax: (805) 925-3376 www.oecusa.com

Highway 33, McKittrick CA
phone: (661) 762-9143

CHAIN OF CUSTODY

Company: Rincon Consultants, Inc.
Address: 790 East Santa Clara Street
City/State/ZIP: Ventura, CA 93001
Phone: 805 641 1000 Fax: 805 641 1072 E-mail: [illegible]
Report To: Rincon Sampler: SD
Send report via- FAX- ☐ PDF- ☑ Colt/LUFT EDF- ☐ EDD- ☐
Turnaround Time: 10 Days- ☐ 5 Days- ☑ 72 hr- ☐ 48 hr- ☐ 24 hr- ☐ ASAP- ☐

Project Name/#: 08-25430
Site: 125 State St., Santa Barbara, CA

OEC Sample ID	Date/Time Sampled	Matrix	# of Cont.	Client Sample ID	Analysis Requested: TEPH 8015M										Special Instructions:
1000511-49A	2-12-10/ 14:25	Soil	1	B74-5											MDL HOLD
50A	14:30			B74-8											
51A	14:40			B75-0.5	X										
52A	14:45			B75-3	X										
53A	14:50			B75-5	X										
54A	14:55			B75-8	X										

Relinquished By: [signature]	Date: 2-12-10	Time:
Received By: [signature]	Date: 2-12-10	Time: 0945
Relinquished By: [signature]	Date: 2-12-10	Time: 1145
Received By: [signature]	Date: 2-12-10	Time: 1145
Relinquished By:	Date:	Time:
Received By:	Date:	Time:

Comments/PO#:

SAMPLE RECEIPT

Rev. 01/15/10

CLIENT: Rincon OEC ID #: 100054 Temp: 3 °C
Acceptable Range: 0°C to 6°C

COC RECEIVED DATE/TIME: 2-12-10 1145 RECEIPT LOGIN DATE/TIME: 2-12-10 1225 REFRIGERATOR(s): 1

SAMPLE TRANSPORT, RECEIPT, CONDITION & PRESERVATION:		Yes	No	N/A	(*) PROBLEM CHAIN FORM NEEDED
☒ OEC Courier/Sampler	COC document(s) received with samples	☒	☐*	☐	Custody Seals (circle): Present / Absent
☐ Delivery(Other than OEC Courier)	Correct containers for analysis requested	☒	☐*	☐	Samples / Coolers
☒ Samples Received on Ice	Container(s) intact and in good condition	☒	☐*	☐	Intact / Broken*
☐ Samples Received Outside Temp. Range*	Container label(s) consistent with COC	☐	☒*	☐	Method of Shipment & Tracking #(if applicable):
☐ Samples Direct from field (Outside Temp)	OEC preservative added (**note std ID)	☐**	☐	☒	
☐ After-Hours Outside Drop-off [Brought Inside]	Proper preservation on sample label(s)	☐	☐	☒	(**) OEC Preservative ID:
(Initials/Date/Time):	VOA containers free of headspace	☐	☐*	☒	Dissolved Metals Filtration: (Date/Init/Preserve ID)
	Tedlar Bags free of condensation	☐	☐*	☒	

CONTAINERS, COC CHANGES AND/OR CORRECTIONS CHANGES AUTHORIZED BY:

OEC ID	Client ID ***If blank, refer to CoC	Container Description	Preservative	ResCl /pH	Matrix	Date/Time Sampled ***	Comments / Remarks / Condition Notes, Etc.
1-54A		1 tube each	—	—	solid		

RECEIPT LOGIN BY: LY RECEIPT REVIEWED BY: [signature]

OEC PROBLEM CHAIN

CLIENT: Rincon **OEC ID #:** 1000511

ISSUES RECORDED BY (DATE/TIME/INITIALS): 2-12-10 1225 ky

ISSUE(S): PLEASE PROVIDE DETAILS OF ISSUE(S) BELOW – Samples/Containers Affected, as necessary.

- ☐ Samples Received Outside Temp. Range (see below)
- ☐ **NO** COC document(s) received with samples
- ☐ Container(s) **NOT** intact or in good condition
- ☐ Incorrect containers for analysis requested
- ☒ Container label(s) **NOT** consistent with COC
- ☐ Custody Seals Broken
- ☒ OTHER: (if multiple, identify with numbers)

① Some samples with no analyses requested
② There are 2 samples labeled B65-3
and no sample to match
COC B66-3
(ky)

RESOLUTIONS: MINIMUM INFO: Issue#[if necessary] – Description – Contact Type (Verbal, email, etc.) – Client Authorization Contact – Date/Time/Initials

called client and left message

B5-3 has gravel (a little)
B6-3 has no gravel, samples labeled accordingly

~~Ava~~ Samples w/ Blank analyses are on HOLD

FINAL RESOLUTION OF ISSUES BY (DATE/TIME/INITIALS): BDO 1315 2/12/10

09/09/08

Oilfield Environmental and Compliance
307 Roemer Way Suite 300, Santa Maria CA 93454
phone: (805) 922-4772 fax: (805) 925-3376 www.oecusa.com

Highway 33, McKittrick CA
phone: (661) 762-9143

CHAIN OF CUSTODY

Company: Rincon Consultants, Inc.
Address: 790 East Santa Clara Street
City/State/ZIP: ~~Santa Barbara~~ Ventura, CA 93001
Phone: 805 641 1000 Fax: 805 641 1072 E-mail: sdeller@rinconconsult
Report To: Rincon Sampler: SD
Send report via- FAX- ☐ PDF- ☑ Colt/LUFT EDF- ☐ EDD- ☐
Turnaround Time: 10 Days- ☐ 5 Days- ☑ 72 hr- ☐ 48 hr- ☐ 24 hr- ☐ ASAP- ☐

Project Name/#: 08-25430
Site: 125 State St., Santa Barbara, CA

OEC Sample ID	Date/Time Sampled	Matrix	# of Cont.	Client Sample ID	TEPH 8015M	PNA 8270C									Special Instructions:
1000511-1A	2-11-10 / 9:00	Soil	1	B61-0.5	X	X									MDL
2A	/ 9:10			B61-3	X	X									
3A	/ 9:20			B61-5		X									
4A	/ 9:30			B61-8		△									HOLD
5A	/ 9:40			B62-0.5	X	△									
6A	/ 9:50			B62-3	X	△									
7A	10:00			B62-5		△									HOLD
8A	10:05			B62-8		△									
9A	10:10			B63-0.5											
10A	10:15			B63-3											
11A	10:20			B63-5	X	X									
12A	10:30			B63-8											HOLD

Relinquished By: [signature] Date: 2-12-10 Time:
Received By: [signature] Date: 2-12-10 Time: 0945
Relinquished By: [signature] Date: 2-12-10 Time: 1145
Received By: [signature] Date: 2-12-10 Time: 1145
Relinquished By: Date: Time:
Received By: Date: Time:

Comments/PO#: 1. Asphalt may be present in 0.5' samples
2. Hold samples for possible additional analyses

Oilfield Environmental and Compliance
307 Roemer Way Suite 300, Santa Maria CA 93454
phone: (805) 922-4772 fax: (805) 925-3376 www.oecusa.com

Highway 33, McKittrick CA
phone: (661) 762-9143

CHAIN OF CUSTODY

Company: Rincon Consultants, Inc.
Address: 790 East Santa Clara Street
City/State/ZIP: Ventura, CA 93001
Phone: 805641 1000 Fax: 805641 1072 E-mail: [illegible]
Report To: Rincon Sampler: SD
Send report via- FAX- ☐ PDF- ☑ Colt/LUFT EDF- ☐ EDD- ☐
Turnaround Time: 10 Days- ☐ 5 Days- ☑ 72 hr- ☐ 48 hr- ☐ 24 hr- ☐ ASAP- ☐

Project Name/#: 08-25430
Site: 125 State St., Santa Barbara, CA

OEC Sample ID	Date/Time Sampled	Matrix	# of Cont.	Client Sample ID	TEPH 8015M	PNA 8270C									Special Instructions:
1000511-12A	2-11-10/10:35	Soil	1	B64-0.5	X	X									MDL
14A	10:40			B64-3	Δ	Δ									HOLD
15A	10:45			B64-5											
16A	10:50			B64-8											
17A	10:55			B65-0.5											
18A	11:00			B65-3											
19A	11:05			B65-5	X										
20A	11:10			B65-8											HOLD
21A	11:20			B66-0.5	X	X									
22A	11:25			B66-3	X	Δ									
23A	11:30			B66-5											HOLD
24A	11:35			B66-8											HOLD

Relinquished By: [signature]	Date: 2-12-10	Time:
Received By: [signature]	Date: 2-12-10	Time: 0945
Relinquished By: [signature]	Date: 2-12-10	Time: 1145
Received By: [signature]	Date: 2-12-10	Time: 1145
Relinquished By:	Date:	Time:
Received By:	Date:	Time:

Comments/PO#:

Oilfield Environmental and Compliance
307 Roemer Way Suite 300, Santa Maria CA 93454
phone: (805) 922-4772 fax: (805) 925-3376 www.oecusa.com

Highway 33, McKittrick CA
phone: (661) 762-9143

CHAIN OF CUSTODY

Company: Rincon Consultants, Inc.
Address: 790 East Santa Clara Street
City/State/ZIP: ~~Santa Barbara~~ Ventura, CA 93001
Phone: 805 641 1000 Fax: 805 641 1072 E-mail: [illegible]
Report To: Rincon Sampler: SD
Send report via- FAX- ☐ PDF- ☑ Colt/LUFT EDF- ☐ EDD- ☐
Turnaround Time: 10 Days- ☐ 5 Days- ☑ 72 hr- ☐ 48 hr- ☐ 24 hr- ☐ ASAP- ☐

Project Name/#: 08-25430
Site: 125 State St., Santa Barbara, CA

OEC Sample ID	Date/Time Sampled	Matrix	# of Cont.	Client Sample ID	TEPH 8015M	PNA 8270C	Total Cd 6010B	STLC Lead	TCLP Lead						Special Instructions:
100051-25A	2-11-10/11:45	Soil	1	B67-0.5	X	△									MDL
26A	11:50			B67-3	X	△									
27A	11:55			B67-5											HOLD
28A	12:00			B67-8											
29A	12:10			B68-3			X	X							
30A	12:15			B68-4											HOLD
31A	12:20			B68-5	X										
32A	12:25			B69-3	X		X	X	△						
33A	12:35			B69-4			△	△							HOLD
34A	12:40			B69-5											
35A	12:45			B70-3			X	X	△						
36A	12:55			B70-4			△	△							HOLD

Relinquished By: [signature]	Date: 2-12-10	Time:
Received By: [signature]	Date: 2-12-10	Time: 0945
Relinquished By: [signature]	Date: 2-12-10	Time: 1145
Received By: [signature]	Date: 2-12-10	Time: 1145
Relinquished By:	Date:	Time:
Received By:	Date:	Time:

Comments/PO#:

Oilfield Environmental and Compliance
307 Roemer Way Suite 300, Santa Maria CA 93454
phone: (805) 922-4772 fax: (805) 925-3376 www.oecusa.com

Highway 33, McKittrick CA
phone: (661) 762-9143

CHAIN OF CUSTODY

Company: Rincon Consultants, Inc.
Address: 790 East Santa Clara Street
City/State/ZIP: Ventura, CA 93001
Phone: 805 641 1000 Fax: 805 641 1072 E-mail: [illegible]
Report To: Rincon Sampler: SD
Send report via- FAX- ☐ PDF- ☑ Coll/LUFT EDF- ☐ EDD- ☐
Turnaround Time: 10 Days- ☐ 5 Days- ☑ 72 hr- ☐ 48 hr- ☐ 24 hr- ☐ ASAP- ☐

Project Name/#: 08-25430
Site: 125 State St., Santa Barbara, CA

OEC Sample ID	Date/Time Sampled	Matrix	# of Cont.	Client Sample ID	TEPH8015M	PNA8270C	Lead 6010B	STLC Lead	TCLP Lead						Special Instructions:
1006541-37A	2-11-10/13:05	Soil	1	B70-5											MDL HOLD
38A	13:15			B71-3			X	X	△						
39A	13:20			B71-4			△	▲							HOLD ↓
40A	13:25			B71-5											
41A	13:35			B72-3			X	X							
42A	13:40			B72-4											HOLD ↓
43A	13:45			B72-5											
44A	13:55			B73-3			X								
45A	14:00			B73-4			X								
46A	14:05			B73-5			X								
47A	14:15			B74-0.5	X										
48A	14:20			B74-3	X										

Relinquished By: [signature]	Date: 2-12-10	Time:
Received By: [signature]	Date: 2-12-10	Time: 0945
Relinquished By: [signature]	Date: 2-12-10	Time: 1145
Received By: [signature]	Date: 2-12-10	Time: 1145
Relinquished By:	Date:	Time:
Received By:	Date:	Time:

Comments/PO#:

Oilfield Environmental and Compliance
307 Roemer Way Suite 300, Santa Maria CA 93454
phone: (805) 922-4772 fax: (805) 925-3376 www.oecusa.com

Highway 33, McKittrick CA
phone: (661) 762-9143

CHAIN OF CUSTODY

Company: Rincon Consultants, Inc.
Address: 790 East Santa Clara Street
City/State/ZIP: Ventura, CA 93001
Phone: 805 641 1000 Fax: 805 641 1072 E-mail: sdeeds@rincon...
Report To: Rincon Sampler: SD
Send report via- FAX- ☐ PDF- ☑ Colt/LUFT EDF- ☐ EDD- ☐
Turnaround Time: 10 Days- ☐ 5 Days- ☑ 72 hr- ☐ 48 hr- ☐ 24 hr- ☐ ASAP- ☐

Project Name/#: 08-25450
Site: 125 State St., Santa Barbara, CA

OEC Sample ID	Date/Time Sampled	Matrix	# of Cont.	Client Sample ID	Analysis Requested: TEPH 8015M	Special Instructions:
1000511-49A	2-11-10/ 14:25	Soil	1	B74-5		MDL 4mg/kg
50A	14:30			B74-8		
51A	14:40			B75-0.5	X	
52A	14:45			B75-3	X	
53A	14:50			B75-5	X	
54A	14:55			B75-8	X	

Relinquished By:	Date: 2-12-10	Time:
Received By:	Date: 2-12-10	Time: 0945
Relinquished By:	Date: 2-12-10	Time: 1145
Received By:	Date: 2-12-10	Time: 1145
Relinquished By:	Date:	Time:
Received By:	Date:	Time:

Comments/PO#:

Oilfield Environmental and Compliance
307 Roemer Way Suite 300, Santa Maria CA 93454
phone: (805) 922-4772 fax: (805) 925-3376 www.oecusa.com

Highway 33, McKittrick CA
phone: (661) 762-9143

CHAIN OF CUSTODY

Company: Rincon Consultants, Inc.
Address: 790 East Santa Clara Street
City/State/ZIP: ~~Santa Barbara~~ Ventura, CA 93001
Phone: 805 641 1000 Fax: 805 641 1072 E-mail: sdeckler@rinconconsult
Report To: Rincon Sampler: SD
Send report via- FAX- ☐ PDF- ☑ Colt/LUFT EDF- ☐ EDD- ☐
Turnaround Time: 10 Days- ☐ 5 Days- ☑ 72 hr- ☐ 48 hr- ☐ 24 hr- ☐ ASAP- ☐

Project Name/#: 08-25430
Site: 125 State St., Santa Barbara, CA

OEC Sample ID	Date/Time Sampled	Matrix	# of Cont.	Client Sample ID	TEPH 8015M	PNA 8270C									Special Instructions:
1000511-1A	2-11-10 / 9:00	Soil	1	B61-0.5	X	X									MDL
2A	/ 9:10			B61-3	X	X									
3A	/ 9:20			B61-5		X									
4A	/ 9:30			B61-8		△									HOLD
5A	/ 9:40			B62-0.5	X	△									
6A	/ 9:50			B62-3	X	△									
7A	10:00			B62-5		△									HOLD
8A	10:05			B62-8		△									
9A	10:10			B63-0.5											
10A	10:15			B63-3											
11A	10:20			B63-5	X	X									
12A	10:30			B63-8											HOLD

Analysis Requested

Special Instructions: ⊙ A00-00 3/9/10 ok; Δ A00-00 2/24/10

Relinquished By:	Date: 2-12-10	Time:
Received By:	Date: 2-12-10	Time: 0945
Relinquished By:	Date: 2-12-10	Time: 1145
Received By:	Date: 2-12-10	Time: 1145
Relinquished By:	Date:	Time:
Received By:	Date:	Time:

Comments/PO#: 1. Asphalt may be present in 0.5' samples
2. Hold samples for possible additional analyses

Oilfield Environmental and Compliance

307 Roemer Way Suite 300, Santa Maria CA 93454
phone: (805) 922-4772 fax: (805) 925-3376 www.oecusa.com

Highway 33, McKittrick CA
phone: (661) 762-9143

CHAIN OF CUSTODY

Company: Rincon Consultants, Inc.
Address: 790 East Santa Clara Street
City/State/ZIP: Ventura, CA 93001
Phone: 805641 1000 Fax: 805641 1072 E-mail: [illegible]
Report To: Rincon Sampler: SD
Send report via- FAX- ☐ PDF- ☑ Colt/LUFT EDF- ☐ EDD- ☐
Turnaround Time: 10 Days- ☐ 5 Days- ☑ 72 hr- ☐ 48 hr- ☐ 24 hr- ☐ ASAP- ☐

Project Name/#: 08-25430
Site: 125 State St., Santa Barbara, CA

OEC Sample ID	Date/Time Sampled	Matrix	# of Cont.	Client Sample ID	TEPH 8015M	PNA 8270C									Special Instructions:
1000511-12A	2-11-10/10:35	Soil	1	B64-0.5	X	X									MDL
14A	10:40			B64-3	Δ	Δ									HOLD
15A	10:45			B64-5											
16A	10:50			B64-8											
17A	10:55			B65-0.5											
18A	11:00			B65-3											
19A	11:05			B65-5	X										
20A	11:10			B65-8											HOLD
21A	11:20			B66-0.5	X	X									
22A	11:25			B66-3	X	Δ									
23A	11:30			B66-5											HOLD
24A	11:35			B66-8											HOLD

Analysis Requested

Relinquished By: [signature]	Date: 2-12-10	Time:	
Received By: [signature]	Date: 2-12-10	Time: 0945	
Relinquished By: [signature]	Date: 2-12-10	Time: 1145	
Received By: [signature]	Date: 2-12-10	Time: 1145	
Relinquished By:	Date:	Time:	
Received By:	Date:	Time:	

Comments/PO#:

Oilfield Environmental and Compliance
307 Roemer Way Suite 300, Santa Maria CA 93454
phone: (805) 922-4772 fax: (805) 925-3376 www.oecusa.com

Highway 33, McKittrick CA
phone: (661) 762-9143

CHAIN OF CUSTODY

Company: Rincon Consultants, Inc.
Address: 790 East Santa Clara Street
City/State/ZIP: ~~Santa Barbara~~ Ventura, CA 93001
Phone: 805 641 1000 Fax: 805 641 1072 E-mail: [illegible]
Report To: Rincon Sampler: SD
Send report via- FAX- ☐ PDF- ☑ Coll/LUFT EDF- ☐ EDD- ☐
Turnaround Time: 10 Days- ☐ 5 Days- ☑ 72 hr- ☐ 48 hr- ☐ 24 hr- ☐ ASAP- ☐

Project Name/#: 08-25430
Site: 125 State St., Santa Barbara, CA

OEC Sample ID	Date/Time Sampled	Matrix	# of Cont.	Client Sample ID	TEPH 8015M	PNA 8270C	Total Lead 6010B	STLC Lead	TCLP 1000						Special Instructions:
1000511-25A	2-11-10/11:45	Soil	1	B67-0.5	X	△									⊙ ADD-ON 3/9/10
26A	11:50			B67-3	X	△									△ ADD-ON 3/24/10
27A	11:55			B67-5											MDL
28A	12:00			B67-8											HOLD
29A	12:10			B68-3			X	X							
30A	12:15			B68-4											HOLD
31A	12:20			B68-5	X										
32A	12:25			B69-3	X		X	X	△						
33A	12:35			B69-4			△	△	⊙						HOLD
34A	12:40			B69-5			⊙	⊙							
35A	12:45			B70-3			X	X	△						
36A	12:55			B70-4			△	△							HOLD

Relinquished By: [signature]	Date: 2-12-10	Time:
Received By: [signature]	Date: 2-12-10	Time: 0945
Relinquished By: [signature]	Date: 2-12-10	Time: 1145
Received By: [signature]	Date: 2-12-10	Time: 1145
Relinquished By:	Date:	Time:
Received By:	Date:	Time:

Comments/PO#:

Oilfield Environmental and Compliance
307 Roemer Way Suite 300, Santa Maria CA 93454
phone: (805) 922-4772 fax: (805) 925-3376 www.oecusa.com

Highway 33, McKittrick CA
phone: (661) 762-9143

CHAIN OF CUSTODY

Company: Rincon Consultants, Inc.
Address: 790 East Santa Clara Street
City/State/ZIP: Ventura, CA 93001
Phone: 805 641 1000 Fax: 805 641 1072 E-mail: [illegible]
Report To: Rincon Sampler: SD
Send report via- FAX- ☐ PDF- ☑ Coit/LUFT EDF- ☐ EDD- ☐
Turnaround Time: 10 Days- ☐ 5 Days- ☑ 72 hr- ☐ 48 hr- ☐ 24 hr- ☐ ASAP- ☐

Project Name/#: 08-25430
Site: 125 State St., Santa Barbara, CA

Analysis Requested

OEC Sample ID	Date/Time Sampled	Matrix	# of Cont.	Client Sample ID	TEPH 8015M	PNA 8270C	Lead 6010B	STLC Lead	TCLP Lead						Special Instructions:
1000511-37A	2-11-10/13:05	Soil	1	B70-5											MDL HOLD
38A	13:15			B71-3			X	X	△						
39A	13:20			B71-4			△	△	⊙						HOLD
40A	13:25			B71-5			⊙	⊙							
41A	13:35			B72-3			X	X							
42A	13:40			B72-4			⊙	⊙							HOLD
43A	13:45			B72-5											
44A	13:55			B73-3			X								
45A	14:00			B73-4			X								
46A	14:05			B73-5			X								
47A	14:15			B74-0.5	X										
48A	14:20			B74-3	X										

Special Instructions: ⊙ 400-00 3/9/10 [illegible]
△ 400-00 3/24/10 [illegible]

Relinquished By: [signature]	Date: 2-12-10	Time:	
Received By: [signature]	Date: 2-12-10	Time: 0045	
Relinquished By: [signature]	Date: 2-12-10	Time: 1145	
Received By: [signature]	Date: 2-12-10	Time: 1145	
Relinquished By:	Date:	Time:	
Received By:	Date:	Time:	

Comments/PO#:

Oilfield Environmental and Compliance
307 Roemer Way Suite 300, Santa Maria CA 93454
phone: (805) 922-4772 fax: (805) 925-3376 www.oecusa.com

Highway 33, McKittrick CA
phone: (661) 762-9143

CHAIN OF CUSTODY

Company: Rincon Consultants, Inc.
Address: 790 East Santa Clara Street
City/State/ZIP: Ventura, CA 93001
Phone: 805 641 1000 Fax: 805 641 1072 E-mail: sdeeds@rinconconsultants
Report To: Rincon Sampler: SD
Send report via- FAX- ☐ PDF- ☑ Colt/LUFT EDF- ☐ EDD- ☐
Turnaround Time: 10 Days- ☐ 5 Days- ☑ 72 hr- ☐ 48 hr- ☐ 24 hr- ☐ ASAP- ☐

Project Name/#: 08-25430
Site: 125 State St., Santa Barbara, CA

OEC Sample ID	Date/Time Sampled	Matrix	# of Cont.	Client Sample ID	Analysis Requested: TEPH 8015M	Special Instructions:
1000511-49A	2-11-10/14:25	Soil	1	B74-5		MDL 40
50A	14:30			B74-8		
51A	14:40			B75-0.5	X	
52A	14:45			B75-3	X	
53A	14:50			B75-5	X	
54A	14:55			B75-8	X	

Relinquished By:	Date: 2-12-10	Time:
Received By:	Date: 2-12-10	Time: 0945
Relinquished By:	Date: 2-12-10	Time: 1145
Received By:	Date: 2-12-10	Time: 1145
Relinquished By:	Date:	Time:
Received By:	Date:	Time:

Comments/PO#:

Appendix 3

Permits

City of Santa Barbara
Building & Safety Division
Job Card

FLOOD ZONE

Permit Application # **BLD2010-00759**
Project Address___: **125 STATE ST**
Project Type_____: **C/A-SITE WORK**

Issued: 04/29/2010
Initial Expiration: 10/26/2010
APN # 033-075-012

Description of Work:
Excavate 800 cubic yards of contaminated soil; backfill with 960 cubic yards fill material.

People Associated with this Permit:

CON	RINCON CONSULTANTS	VENTURA	CA
OWN	REDEVELOPMENT AGENCY/SANTA BARBAR	SANTA BARBARA	CA

Code Summary Information:

P.C. Conditions:	N	Occupancy:		**Building Areas:** New Floor:		Deck:	
Soils Report:	N	Use:	COM	Alteration:		Paving:	
Notice & Order:	N	Occupant Load:		Demo:			
Geo. Report:	N	FEMA Flood Zone:	Y	Garage/Carp		School Fee:	
Type of Work:	OTH	Plan Sheets:	3	Accessory:		Valuation:	$150,000

CITY OF SANTA BARBARA BUILDING INSPECTION RECORD

FOR BUILDING INSPECTION REQUESTS CALL **(805) 564-5492** ONE DAY IN ADVANCE

Fire Department Inspections: 564-5702 Public Works/Transportation Inspections: 564-5388

Reinspection fees may be assessed if the plans or inspection records are not available

On the job site or if the work for which the inspection has been called is not completed.

THIS PERMIT IS VALID FOR 180 DAYS FROM THE DATE OF THE LAST INSPECTION

INSPECTION TYPE	Date	Inspector Approval
Pre-Demolition		
Erosion Control		
Pre-Seismic - RSVP		
Setbacks, Bld. Location, Floor Survey		
Elevation FEMA Certificate - Foundation		
Reinforcing Steel, Forms, Embedments		
Grounding Electrode (UFER)		
Temporary Power - OK to Release		
Special Inspection (Deputy) Interim Report		
OK to Pour Concrete		
DO NOT POUR CONCRETE UNTIL ALL REQUIRED INSPECTIONS ABOVE ARE SIGNED		
Water Piping Groundwork, TEST		
Gas Piping Groundwork, TEST		
Sewer Lateral, TEST		
Sewer Backwater Device		
Electrical Groundwork		
Floor Framing, Hold Downs		
Underground / Underfloor Plumbing		
OK to Pour Concrete Slab		
ROUGH INSPECTIONS		
Pre-Roof Sheathing		
Roof Nailing		
Roof Insulation		
Floor Nailing		
Shear Panel Nailing / Load Path		
Rough Fire Alarm Wiring / Devices Locations		
Rough Drain-Waste-Vent, TEST		
Special Inspection / Structural Observation		
Rough Water / Gas Piping		
Rough Mechanical		
Rough Electrical		
Rough Framing / Windows / Egress		
DO NOT INSULATE OR COVER FRAMING UNTIL ALL REQUIRED INSPECTIONS ABOVE ARE SIGNED		

INSPECTION TYPE	Date	Inspector Approval
Exterior Lathing / Underlayment		
Insulation - Floors / Walls / Ceilings		
Exterior Design Review Requirements		
Drywall Nailing		
T-Bar Ceiling Framing - OK to Place Tile		
DO NOT TAPE OR PLASTER UNTIL ALL REQUIRED INSPECTIONS ABOVE ARE SIGNED		
POOLS AND SPAS, FENCES		
Pool Reinforcing Steel / Location		
Pool Bonding - Grid, Equipment, Fixture, Deck		
Pool Plumbing Lines / Gas, TEST		
OK to Shotcrete		
Special Inspection - Shotcrete, TEST, Report		
Pool Fencing / Gates / Door Alarms / Cover		
OK to Plaster		
BLOCKWALLS, FENCES, RETAINING WALLS		
Block Wall Foundation - OK to Pour Concrete		
Block Wall Reinforcing - OK to Grout 1 2 3 4		
FINAL Block Wall / Fence		
FINAL INSPECTIONS		
FINAL Demolition		
FINAL Erosion Control		
FEMA Elevation / Floodproof Certificate		
FINAL Mechanical / Plumbing		
FINAL Gas, TEST - OK to Set Meter		
FINAL Electrical - OK to Set Meter		
FINAL County Health Department		
FINAL Fire Alarm / Sprinkler System		
FINAL Fire Department		
FINAL Landscaping - Certificate		
FINAL Design Review Requirements		
FINAL Public Works Department		
FINAL Disabled Access		
FINAL Special Inspection Reports		
Temporary Occupancy Allowed - Conditions		
FINAL Building		
DO NOT OCCUPY OR USE THE AREA UNTIL ALL REQUIRED INSPECTIONS ABOVE ARE SIGNED		

Notes:

City of Santa Barbara
Public Works Department
Construction Permit

City of Santa Barbara Public Works
ENGINEERING APPROVAL
Date 5-18-10 Initials CC
The stamping of this set of plans and specifications shall not be held to permit or to be an approval of the violation of any provisions of any City Ordinance or State Law.
Call 24 hrs. in advance for inspection. (805) 564-5388

Issued by: MC

PERMIT # PBW2010-00694
SITE ADDRESS: 125 STATE ST

Issued: 5/18/2010

PEOPLE ASSOCIATED WITH THIS PERMIT:
OWN REDEVELOPMENT AGENCY/SANTA BARBARA PO BOX 1990 SANTA BARBARA CA 93012
CON RINCON CONSULTANTS 790 E. SANTA CLARA VENTURA CA 93003

PROJECT NAME: HYDRANT METER **PARCEL:** 033-075-012 **ZONE:** HRC-2/SD-3
PROJECT DESCRIPTION:
Hydrant meter on FH-H10-015 on 100 Blk Kimberly Ave.

Street Improvements	Water	Sewer
Driveways (ea.):	Buy-ins:	Buy-ins:
Sidewalk (l.f):	Tap/svc/meters:	Taps:
Curb/Gutter (l.f.):	Meter Sets:	Laterals:
Minor Work (ea.):	Meter Increases:	Drainage
Trench/Bore (s.f.):	Meter Reductions:	Curb Drains:
Ramps (ea.):	Hydrant Meters:	Storm Drains:
Streetlights (ea.):	Fireline Taps:	Other
Wells (ea.):	Priv. Main Taps:	Utility Co. (s.f.):

ALL WORK SHALL CONFORM TO THE 2006 STANDARD SPECIFICATIONS OF PUBLIC WORKS CONSTRUCTION - "GREENBOOK" - SBMC 22.60.90

PRIOR TO BEGINNING ANY WORK, THE CONTRACTOR SHALL MEET WITH THE PUBLIC WORKS INSPECTOR TO DISCUSS INSPECTION REQUIREMENTS. THIS MEETING SHALL BE ARRANGED AT LEAST TWENTY-FOUR (24) HOURS IN ADVANCE BY CALLING 564-5396.

It is understood and agreed that the Owner and Contractor are wholly responsible, jointly and severally, for any damage or liability occurring by reason of anything done or omitted to be done by the Owner or Contractor under, or in connection with, any work, authority or jurisdiction delegated under this permit. It is further agreed that the Owner and Contractor will defend, indemnify, and save harmless the City of Santa Barbara and its officers and employees from any and all loss, liability, damages, or judgments resulting from any claims made against any of them by reason of, or in conjunction with, any work actually done under authority of this permit.

Except for the above hold harmless and indemnification provisions (which shall remain in effect), this permit shall be void if work is not commenced within thirty (30) days after permit issuance date and completed within ninety (90) days after the start of such work unless a written extension is given by the Public Works Department.

I certify that I have read this application and declare under penalty of perjury that the information contained herein is true, correct and complete. I agree to comply with all city and county ordinances and state laws relating to construction within the public right-of-way. I am the owner of the property listed on this permit or I, as the contractor, am acting with the owner's full knowledge and consent.

Executed at City of Santa Barbara on 5-18-10 Owner or Contractor

THIS PERMIT MUST BE AVAILABLE ON THE SITE AT ALL TIMES

City of Santa Barbara
Public Works Department
Parking Restriction Waiver Permit

Issued by: DS

City of Santa Barbara Public Works
ENGINEERING APPROVAL
Date 5-5-10 Initials
The stamping of this set of plans and specifications shall not be held to permit or to be an approval of the violation of any provisions of any City Ordinance or State Law.
Call 24 hrs. in advance for inspection. (805) 564-5388

PERMIT # PBW2010-00604 **Issued:** 5/5/2010
LOCATION PARKED: 125 STATE ST

PEOPLE ASSOCIATED WITH THIS PERMIT:
OWN REDEVELOPMENT AGENCY/SANTA BARBARA PO BOX 1990 SANTA BARBARA CA 93012
CON RINCON CONSULTANTS 790 E. SANTA CLARA VENTURA CA 93003

AUTHORIZED:
Haul route Permit. Trucks will enter property from Yanonali side, ONLY FOUR TRUCKS SHALL BE STAGED AT ONE TIME ON WEST YANONALI STREET, No Parking shall be posted by contractor and PEO J.Smith at 897-3726 shall be contacted after posting.

Dates & Times	**Start:**	Mon 5/3/10	**End:**	Mon 5/17/1(

Vehicle	**Make:**	**Model:**
	Color:	**License #:**

Permits are not valid for parking in the following zones, unless otherwise specified: no parking zones/red curb areas, handicapped zones, or passenger loading zones. Non-compliance to permit conditions may result in immediate revocation of permit, the loss of fees paid, and possible citation. The Public Works Department and Police Department are authorized to revoke a permit for non-compliance. All permit fees are non-refundable. This permit is non-transferable and photocopies will not be accepted. Permit issuance is subject to City Transportation Engineer approval.

I certify that I have read the permit conditions above and declare that the information contained herein is true, correct and complete. I understand the authorized exemption or waiver and agree to comply with all city and county ordinances and state laws relating to the operation and parking of the subject motor vehicle. I am the owner of the vehicle listed on this permit or I, as the agent or contractor, am acting with the owner's full knowledge and consent.

Date 5-5-10 Owner, Agent, or Contractor Signature

805-570-3680

THIS PERMIT MUST BE PLACED ON THE PERMIT VEHICLE DASHBOARD, IN VIEW, AT ALL TIMES, OR AVAILABLE ON THE SITE, AT ALL TIMES (FOR NON-VEHICLE PERMITS).

Our Vision Clean Air

Santa Barbara County
Air Pollution Control District

MAR 23 2010

Certified Mail 7009 2250 0004 4643 5876
Return Receipt Requested

Mr. Richard Aparicio
City of Santa Barbara Redevelopment Company
PO Box 1990
Santa Barbara, CA 93102

FID: 11292
Permit: E 13404
SSID: 11049

Re: Permit Exemption Request Approval Exempt 13404

Dear Mr. Aparicio:

On March 4, 2010, the Santa Barbara County Air Pollution Control District (APCD) received a work-plan proposal for the excavation of less than 1,000 cubic yards of soil contaminated by lead, total petroleum hydrocarbons, and polynuclear aromatic hydrocarbons at 125 State Street in Santa Barbara. Restoration activities will consist of excavation, sampling, and transportation offsite for the disposal of contaminated soil. Upon completion, the excavation will be backfilled with clean, imported-fill soil.

After a thorough review of your exemption application and work plan, we have determined that the excavation project will be done consistent with the APCD's soil excavation policy and should not pose a health risk to the public. As such, the proposed contaminated soil excavation project is exempt from the requirements to obtain a permit. Please note, however, that the following conditions shall apply to this excavation project:

Property Owner: City of Santa Barbara Redevelopment Agency
PO Box 1990
Santa Barbara, CA 93102

Operator: Rincon Consultants
790 E. Santa Clara Street
Ventura, CA 93001

Equipment/Process Exempted: Contaminated Soil Excavation and Disposal Project located at 125 State Street in Santa Barbara, California.

Basis for Exemption: APCD Policy 7-A "*Request for Exemption from Permit for Excavation of Contaminated Soils*".

Conditions:

1. Odors shall not be detectable beyond the property boundary. If odors are detected outside of the property boundary, the project shall cease immediately and mitigation measures shall be taken to eliminate the nuisance potential. These measures shall include applying heavy-duty plastic

Terence E. Dressler • Air Pollution Control Officer
260 North San Antonio Road, Suite A • Santa Barbara, CA • 93110 • www.sbcapcd.org • 805.961.8800 • 805.961.8801 (fax)

sheeting that is held securely to the ground over excavated areas. This sheeting shall be kept readily available onsite during the project.

2. Dust shall be controlled by use of water spray trucks to prevent any nuisances.

3. No chemicals defined by APCD Rule 102 as a Reactive Organic Compound shall be used during the excavation.

4. No chemicals designated as a Toxic Air Contaminant or Candidate Toxic Air Contaminant shall be used during the excavation.

5. All particulate emissions from load-out and transit of excavated materials shall be controlled by applying water, and covering the loads with continuous heavy-duty plastic sheeting prior to exiting load-out area and during transit. No openings or holes in the covers shall be permitted.

6. All temporary soil stockpiles shall be covered with continuous heavy-duty plastic sheeting and kept moist in order to control dust generation. At the end of each work day, temporary soil stockpiles, open pits and exposed sidewalls shall be covered with continuous heavy-duty plastic sheeting held securely to the ground.

7. All contaminated soil removed from the site shall be transported to a State-approved treatment/disposal facility.

8. Areas of vehicle movement shall be kept damp enough to prevent dust from leaving the site.

9. In the event the project produces nuisance complaints from the general public or visible dust emissions are evident offsite, the project shall cease immediately and mitigation measures shall be taken to eliminate the nuisance potential. These measures shall include applying heavy-duty plastic sheeting that is held securely to the ground over excavated areas. This sheeting shall be kept readily available onsite during the project.

10. The applicant shall record and maintain the following information. This data shall be maintained for a minimum of three (3) years from the date of each entry and made available to the APCD upon request:

    a. Dates and number of hours per day of excavation activities.

    b. Start and end times each day excavation activities occur.

    c. Amount of soil excavated per day.

    d Description of type and engine size of onsite mobile excavation equipment used.

    e. Records of treatment/disposal shall be maintained for all contaminated soil removed from this site. Such records shall include identification and location of the generator, the transporter and the receiving facility. In addition, such records shall be signed and dated by each of the above parties indicating the receipt or relinquishment of the contaminated soil at the time custody is transferred.

11. Within 60 days of the completion of the project, a written report documenting compliance with the terms and conditions of this exemption shall be provided by the applicant to the APCD (Attn: *CSC Project Manager*). The report shall contain information necessary to verify compliance with the emission limits and other requirements of this exemption. The report shall be in a format approved by the APCD. Compliance with all limitations and restrictions shall be documented in the submittals. All logs and other basic source data not included in the report shall be made available to the APCD upon request. The report shall include all records required by condition 10.a. – e. above.

12. Rincon Consultants will notify the APCD (in writing, Attn: *CSC Project Manager*) upon completion of the project.

13. This exemption approval letter or a facsimile shall be on site during the project or available upon request by the APCD.

14. This exemption is valid for one year from the date of issuance.

15. The amount of contaminated soil excavated under this exemption shall not exceed 1,000 cubic yards. If additional work is required beyond this, the applicant shall immediately cease work and submit an exemption or permit application. No additional work may be completed until a new exemption or permit is issued.

16. The conditions of this exemption are valid for the entire length of the project, including excavation, sampling, stockpiling and transportation offsite and backfilling with clean, imported-fill soil. This condition shall not be construed as allowing work beyond one year from issuance or allowing excavation beyond the 1,000 cubic yards of contaminated soil.

17. Heavy duty plastic sheeting required by this permit shall be at least 20 mil thick. DURA SKRIM 10HUV, a 10 mil, polyester-reinforced polyethylene sheeting may be used in place of 20 mil plastic sheeting. If the APCD determines at any time that DURA SKRIM 10HUV sheeting is not effective at controlling dust or ROC emissions, the permittee shall apply 20 mil plastic sheeting.

Performing activities at this site that were not outlined in the work plan received by the APCD, which fall outside of the parameters specified in your plan, or that have the potential to cause an adverse impact on the air quality or on public health, may be grounds to revoke this exemption. Any changes to the work plan must be submitted to and approved by the APCD in writing prior to conducting any work at the site, and may be subject to an APCD permit. Although you are not currently required to obtain permits for this activity, the APCD's prohibitory rules (Regulation III) may still require you to operate within specified limitations. Be sure to familiarize yourself with the applicable rules to ensure continued compliance of your equipment. Additionally, please be aware that this exemption does not relieve you of the responsibility for obtaining permit approvals from other agencies for this activity.

If you have any questions, please call Paula Iorio at 961-8867. Thank you for your cooperation.

Sincerely,

Michael Goldman, Manager
Engineering & Compliance Division

cc: State St, 125 (CSC) 11292 Project File SC
Mr. Walt Hamann, Rincon Consultants
ECD Chron File
Paula Iorio

\\sbcapcd.org\shares\Groups\ENGR\WP\CSC\Exempt\E-13404\Exempt 13404 - Exemption Request Approval - 3-22-2010.doc

Appendix 4

Tree Inventory and Tree Protection Plan

Appendix 4

Tree Inventory and Tree Protection Plan

Rincon Consultants, Inc.
790 East Santa Clara Street
Ventura, California 93001

805 641 1000
FAX 641 1072

info@rinconconsultants.com
www.rinconconsultants.com

March 17, 2010
Job No. 08-25430

Cenen Aparicio
City of Santa Barbara
Public Works Department
1221 Anacapa Street
Santa Barbara, California 93101

Subject: Tree Inventory and Protection Plan for 125 State Street, City of Santa Barbara, California

Dear Mr. Aparicio:

Rincon Consultants was requested by the City of Santa Barbara to assess the trees located at 125 State Street and provide feedback regarding the trees' conditions and to recommend protection measures to be used during grading and removal of contaminated soils. This report presents the findings and recommendations of the Tree Inventory and Protection Plan for the above referenced property as determined by the field assessment on March 17, 2010. The subject property includes a 21,967 square foot (0.5 acre) lot and a 403 square foot lot (Figure 1, Site Map). The subject property is bound by Kimberly Avenue to the west, the railroad right of way/easement to the north (including the signalman's building), State Street to the east, and commercial buildings to the south. The grading plan includes removal of contaminated soil at two to four feet below present grade.

Seven (7) trees are on the site within the fence line and five (5) trees are outside the fence line associated with the city's sidewalks, all of which are non-native landscaping trees (Figure 2). Of these trees, nine (9) are expected to be subject to encroachment and possible long-term damage from grading unless tree protection measures are implemented.

ASSIGNMENT

Rincon Consultants Certified Arborist, Julie Broughton, was assigned to assess trees on and adjacent to the project site property that may be impacted by the proposed grading, prepare an inventory with an assessment of their conditions and make recommendations for protection during grading.

Limits of the Assignment

- This report is based on a VTA (visual tree assessment) and does not include any above (aerial) or below ground inspections.

- The inventory of trees is based on lot lines outlined in the Phase II Environmental Site Assessment Work Plan and Remedial Action Plan prepared by Rincon Consultants, Inc., September 25, 2009.
- This inventory is limited to trees that have significant trunks and stand alone qualities at least 4 inches in diameter and greater.

Use and Purpose of this Report

- To fulfill a requirement of the City of Santa Barbara as part of the application process needed prior to issuance of a grading permit.
- To assist in protecting trees, enhancing the health and structure of trees and minimizing damage to trees within the parameters of the project.
- To maintain the current health and structure of the existing trees as a viable resource in the community through protection and management during grading and construction activities.

Scope of the Project

This project incorporates the following elements:

- A preliminary assessment of the project site.
- Compilation of a tree inventory from the site plan in conjunction with a field inspection. This inventory includes verification and identification of trees on the site, the condition of the trees and potential impacts from the proposed project.
- Final report with fencing plan, tree protection measures to be implemented during construction grading and soil removal.

OBSERVATIONS

The project site located at 123 State Street contains vegetation dominated by ruderal, non-native annual forbs and grasses over the majority of the property, with non-native ornamental landscape trees and shrubs at the perimeter both within the property fence line and associated with the City's sidewalks. Twelve (12) mature trees are present whose canopies are located within the project boundary with trunk DBH (diameter at breast height measured at 54" above ground) of at least 4 inches in diameter or greater. Two distinct areas of the perimeter (northeast and southwest) are landscaped with non-native ornamental shrubs. The remainder of the project site contained recently mowed ruderal, non-native weedy forbs and grasses, concrete pads, utility poles and a vacant building.

Six species of tree are within and adjacent to the project property including European fan palm (*Chamaerops humilis*), jacaranda (*Jacaranda mimosifolia*), bougainvillea goldenrain tree (*Koelreuteria bipinnata*), New Zealand Christmas tree (*Metrosideros excelsa*), pittosporum (*Pittosporum undulatum*), and California fan palm (*Washingtonia filifera*). The majority of the trees are in fair to good health with only one of the jacarandas (Tree #3, Photo 3 and 7) showing structural defects and damage. All trees showed evidence of previous maintenance including topping and lateral branch pruning. Biologically, the trees are healthy with minimal structural defects including root crowding by the sidewalk and roadway, and mechanical injury to the trunks.

TREE INVENTORY

The following table compiled by the Certified Arborist includes:

- Each tree found on the site map and a corresponding identification number.
- DBH or diameter at breast height measured at 54 inches above ground (two numbers indicates multiple trunks).
- A scaled condition rating from one to five, with five (5) being the ideal specimen and one (1) a very poor or dead tree. An average condition rating of three (3) indicates a viable tree that is biologically healthy whose structure is generally fair.
- Potential project impacts from grading are based on the site plans.
- Tree Protection Measures outlining recommendations to reduce potential project impacts to less than significant. Protection measures will include Tree Protection Zone perimeter recommendations to insure tree health and allow for retention of trees during construction activities, particularly during and after grading/excavation activities.

ID #	Species	Common Name	DBH in inches	Condition Rating	Comments	Project Notes/Recommendations
1	*Jacaranda mimosifolia*	Jacaranda	24	3	Canopy only located within the western fenceline.	This tree has a high likelihood of sustaining damage from the currently proposed construction.
2	*Koelreuteria bipinnata*	Bougainvillea goldenrain tree	22	3	Trunk and canopy located within the western fenceline.	This tree has a high likelihood of sustaining damage from the currently proposed construction.
3	*Jacaranda mimosifolia*	Jacaranda	35	3	Canopy only located within the western fenceline.	This tree has a high likelihood of sustaining damage from the currently proposed construction. A protection zone established at the dripline should be adequate protection for this tree. Any work occurring within this protection zone shall be done by hand and all roots 0.5 inches in diameter or greater will be cut cleanly if encountered or damaged.
4	*Jacaranda mimosifolia*	Jacaranda	18	3	Located at the northeast corner	This tree has a high likelihood of sustaining damage from the currently proposed construction. A protection zone established at the dripline should be adequate protection for this tree. Any work occurring within this protection zone shall be done by hand and all roots will be cut cleanly if encountered or damaged.
5	*Jacaranda mimosifolia*	Jacaranda	12	3	Located at the northeast corner	This tree is located within the project boundary but not currently within the proposed construction zone. A protection zone established at the dripline should be identified prior to any work done within 5 feet of the dripline of this tree.

ID #	Species	Common Name	DBH in inches	Condition Rating	Comments	Project Notes/Recommendations
6	*Pittosporum undulatum*	pittosporum, Victorian box	14	3	Located along the fence line to the north adjacent to the train tracks.	This tree is located within the project boundary but not currently within the proposed construction zone. A protection zone established at the dripline should be identified prior to any work done within 5 feet of the dripline of this tree.
7	*Pittosporum undulatum*	pittosporum, Victorian box	Two trunks; 15, 14	4	Located along the fence line to the north adjacent to the train tracks	This tree is located within the project boundary but not currently within the proposed construction zone. A protection zone established at the dripline should be identified prior to any work done within 5 feet of the dripline of this tree.
8	*Pittosporum undulatum*	pittosporum, Victorian box	Two trunks; 13, 13	4	Located along the fence line to the north adjacent to the train tracks	This tree is located within the project boundary but not currently within the proposed construction zone. A protection zone established at the dripline should be identified prior to any work done within 5 feet of the dripline of this tree.
9	Chamaerops humilis	European fan palm	Multi-trunked; 12, 12 , 12, and 8	4	Present on the southeast corner of the project site. .	The proposed construction plan indicates that excavation and grading will occur adjacent to this palm. Palm roots are concentrated in root balls instead of a spreading fibrous root system. Palms are not typically measured using the dripline formula. For this palm, using 1 foot diameter protection zone per 1 inch diameter of a single trunk (12 inch DBH = 12 foot diameter root/protection zone) will be adequate. Any work occurring within this protection zone shall be done by hand and all roots will be cut cleanly if encountered or damaged.
10	*Washingtonia filifera*	California fan palm	n/a	3	Not within the project boundaries, planted adjacent to or associated with paved sidewalks. Tree protection zone may fall within the construction boundary.	Although the canopy does not enter the project boundary the protection root zone overlaps with the protection root zone of Tree #9. If the protection zone of Tree #9 is adhered to, no construction damage is expected to be incurred for this tree.
11	*Metrosideros excelsa*	New Zealand Christmas tree	n/a	3	Not within the project boundaries, planted adjacent to or associated with paved sidewalks. Tree protection zone may fall within the construction boundary.	The western edge of the dripline of the canopy extends slightly beyond the eastern stone fence of the project boundary. The current excavation and grading plans occur outside the tree protection zone of this tree, thus no impact to this tree is expected.

ID #	Species	Common Name	DBH in inches	Condition Rating	Comments	Project Notes/Recommendations
12	*Metrosideros excelsa*	New Zealand Christmas tree	n/a	3	Not within the project boundaries, planted adjacent to or associated with paved sidewalks. Tree protection zone may fall within the construction boundary.	The western edge of the dripline of the canopy extends slightly beyond the eastern stone fence of the project boundary. The current excavation and grading plans occur outside the tree protection zone of this tree, thus no impact to this tree is expected.

DISCUSSION

All of the trees found within and adjacent to the project site are biologically healthy with only minor structural damage. The majority of the damage is due to root crowding (Photo 8), expected reduced root support system caused by existing asphalted streets and minor mechanical damage to the trunks (Photo 7).

PROJECT IMPACTS

The project is would remove approximately 2 to 4 feet of soil below current grade within the proposed grading area, and consequentially remove any tree roots that may be present within that zone. In addition, equipment may accidentally injure a tree if the equipment operator is not alert to its presence. If appropriate protection measures are implemented, it is not expected that grading will significantly impact any of the existing trees identified within this report.

RECOMMENDATIONS

Tree Protection Measures

1. A pre-construction meeting should be held with contractors prior to commencement of work to discuss tree protection measures.
2. Construction fencing will be installed to establish tree protection zones (TPZ) under the direction of a certified arborist.
3. Construction fencing should be maintained for the duration of the project.
4. The TPZ should be void of all activities, including parking of vehicles, operation of equipment, storage of materials and dumping of temporary spoils from excavation or grading.
5. Any excavation or grading occurring within the TPZ should be done by hand when feasible to reduce impact to roots caused by increased compaction of soil or damage to the root structures.
6. Any roots accidentally damaged or encountered during grading that are ½ inch or greater should be cut cleanly. Roots that are less than 2 inches in diameter will be cut cleanly with an axe or hatchet. Roots that are greater than 2 inches in diameter will be cut cleanly with a hand saw or Sawzall. If roots are encountered that are

greater than 2 inches in diameter an arborist will be onsite to supervise the root pruning.

7. Open trenches should be refilled at the end of each day to reduce tree root desiccation. Following grading within the critical root zone the soils should be returned to the original grade and lightly compacted. If grading occurs within the dry season, impacted critical root zones should be irrigated monthly to moisten soil 6 – 12 inches below the ground. Irrigation may not be necessary from November through May provided rainfall levels are normal.

If all of the above measures are implemented during the entire phase of grading, the current health and structural stability of the trees identified within this report should not be affected by constructions activities.

ARBORISTS DISCLOSURE STATEMENT AND CERTIFICATION OF PERFORMANCE

Information contained in this report covers only those trees examined and listed within this report as examined. This report reflects the condition of the trees at the time of inspection which was limited to visual examination of accessible items without dissections, excavation, probing, coring, or electronic resonance. No warranty or guarantee, is expressed or implied that problems or deficiencies of the trees may not arise in the future. Visual inspections cannot detect every condition that could possibly lead to structural failure or a decline in the health of a tree. Trees are living organisms that fail in ways that cannot be explained nor fully understood. Conditions are often hidden within trees and below ground. A tree cannot be guaranteed healthy or safe under all circumstances, or for a specified period of time. Remedial treatments cannot be guaranteed.

I, Julie Broughton, certify that I have personally inspected the trees on the property referred to in this report and have stated my findings accurately.

The analysis, opinions and conclusions stated herein are my own and are based on current scientific procedures and commonly accepted arboricultural practices.

Prepared by: _____
Julie D. Broughton, PhD (c)
Certified Arborist #WE-8726A
International Society of Arboriculture

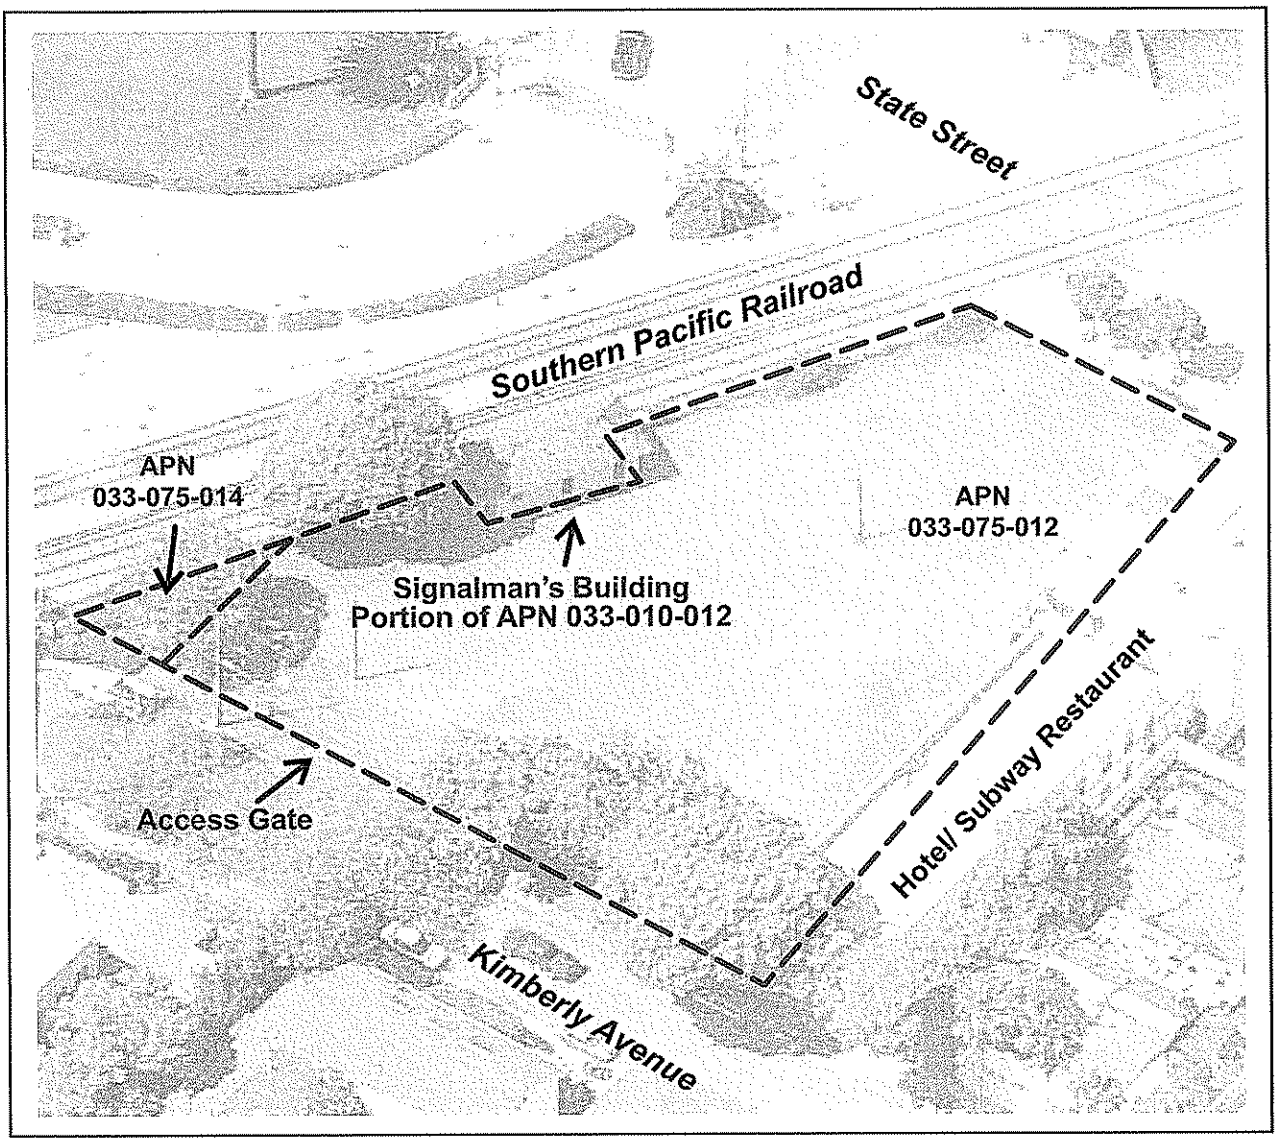

Subject Property Boundary

0 50 100

approximate scale in feet

North

Site Map

Figure 1

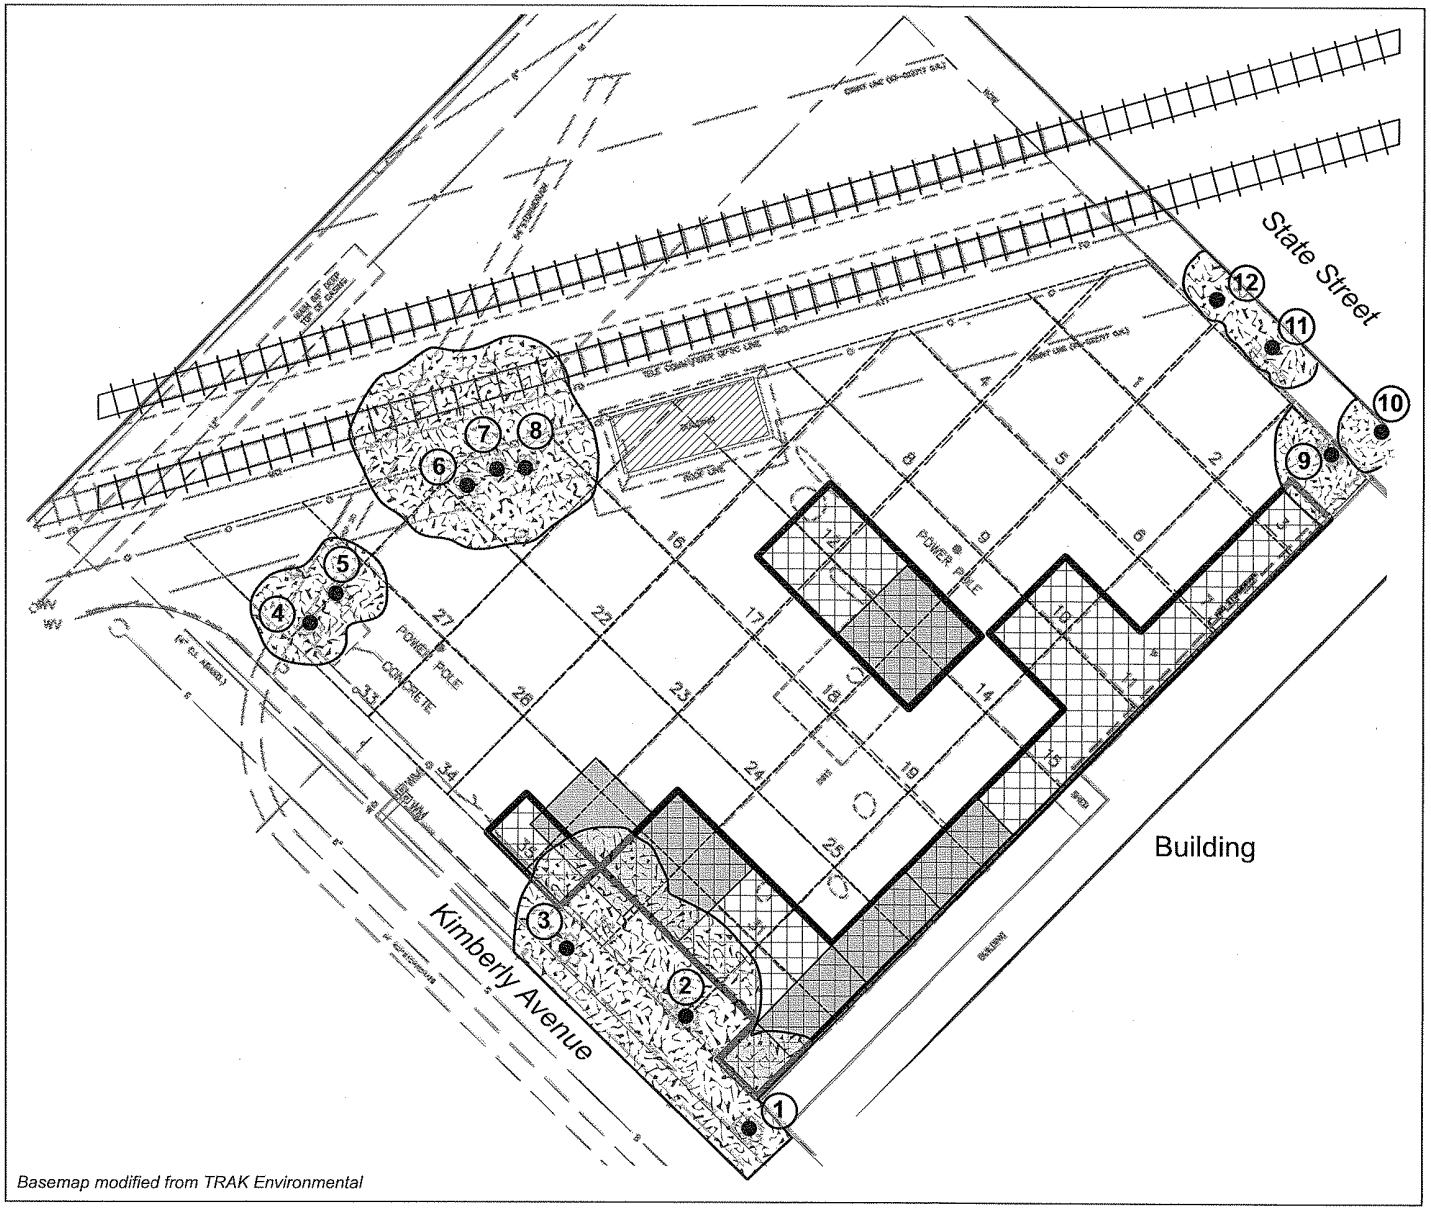

Basemap modified from TRAK Environmental

LEGEND

- Trees
- Tree Protection Zone

N

0 15 30 60
Scale in Feet

Tree Protection Map

125 State Street
Santa Barbara, California

Figure 2

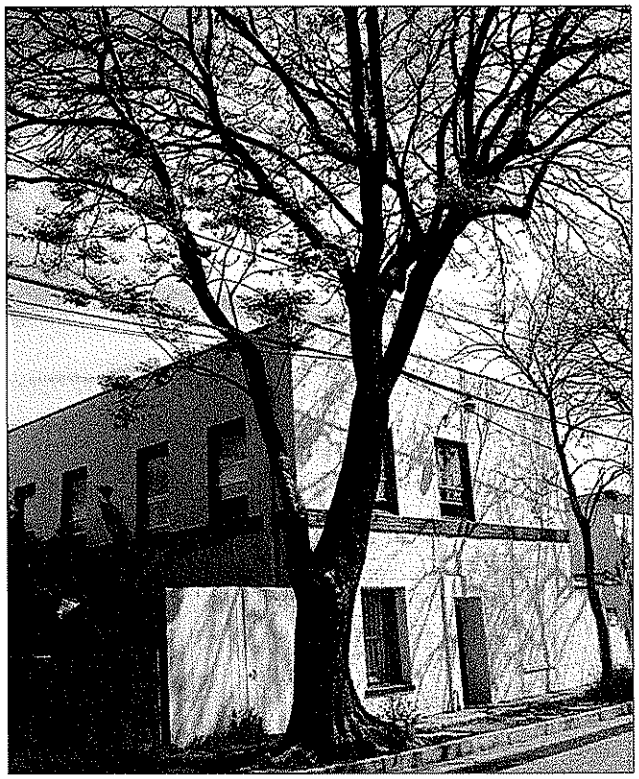

Photo 1. Tree #1, Jacaranda located on west end of project site.

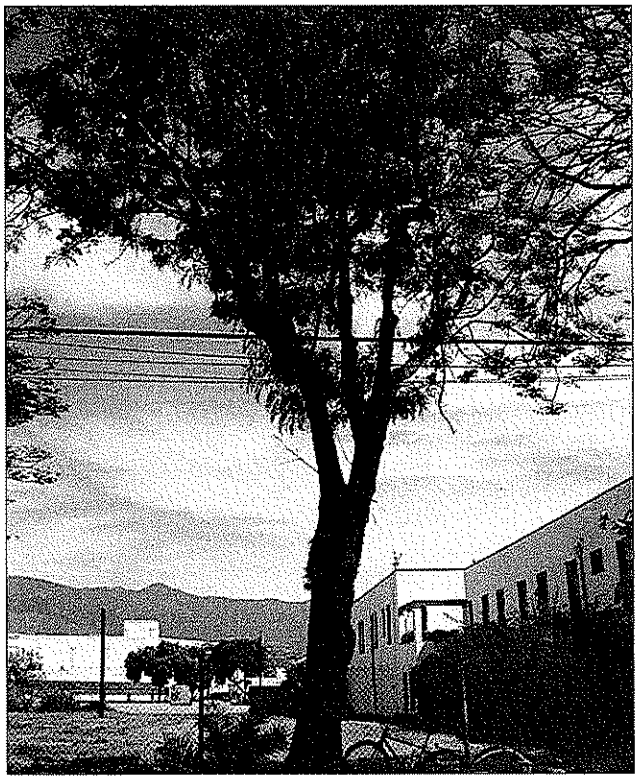

Photo 2. Tree #2 , bougainvillea goldenrain tree, located outside the western fenceline.

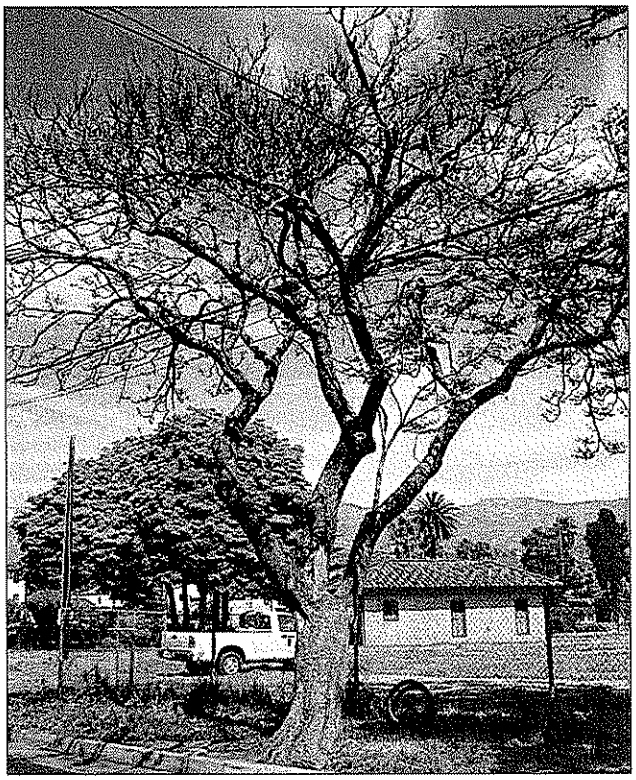

Photo 3. Tree #3, Jacaranda located on southwest corner of project site.

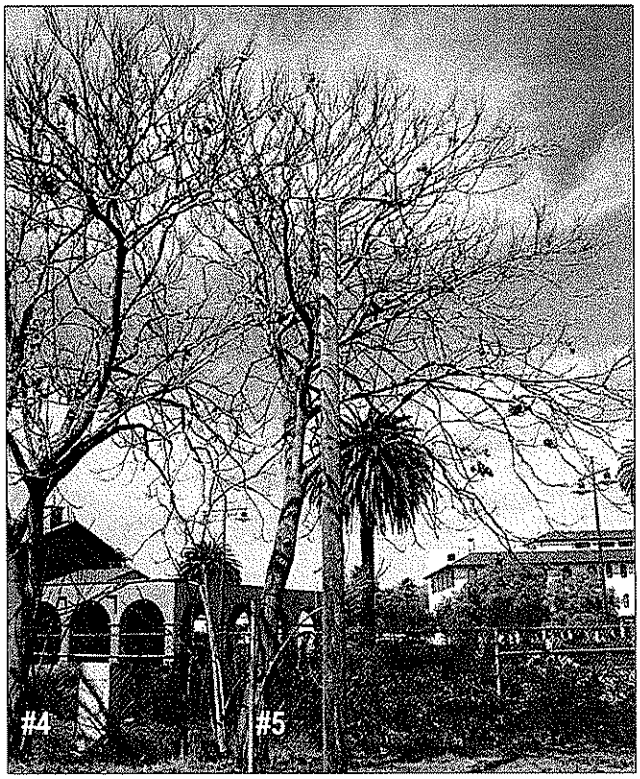

Photo 4. Trees #4 and #5, Jacaranda located on the west end of the project site, within the fencing.

Site Photos (Sheet 1 of 2)

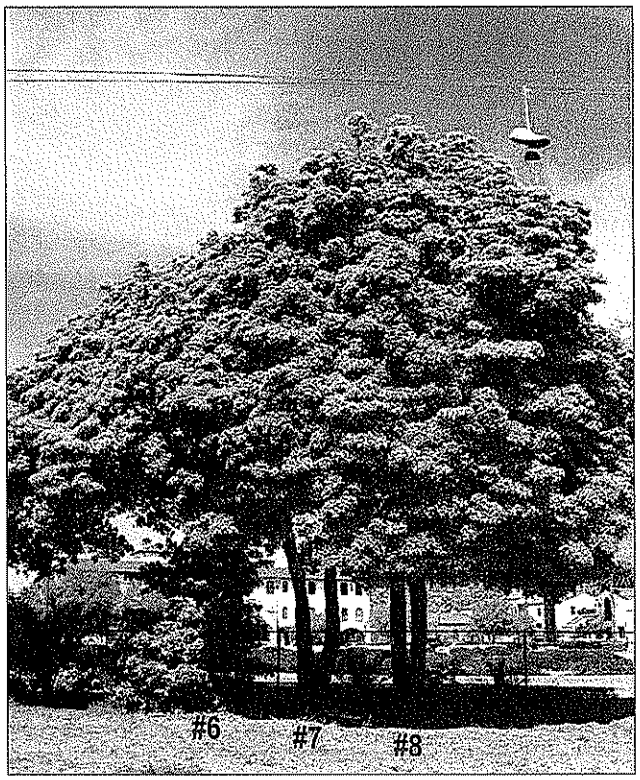

Photo 5. Pittosporum trees #6-8 located inside the northwest fenceline.

Photo 6. Tree #9 European fan palm located at southeast cover of project.

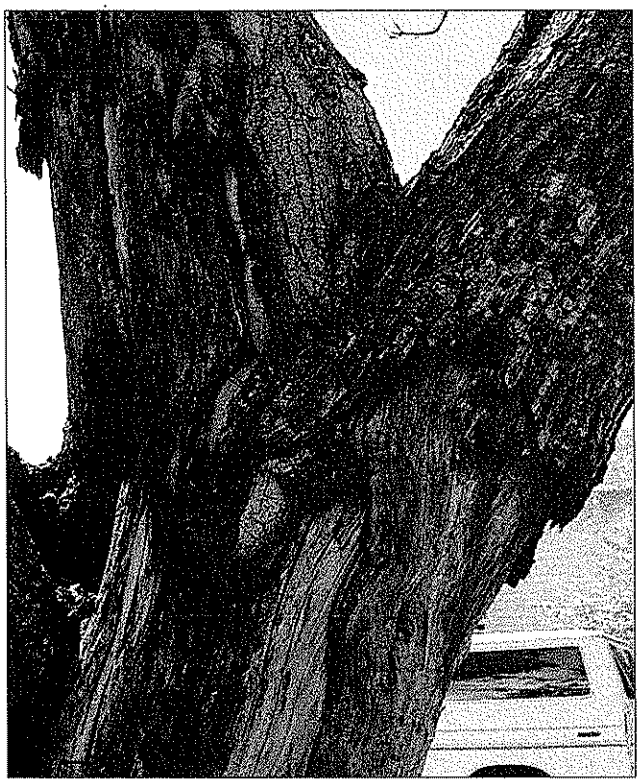

Photo 7. Tree #3, jacaranda, with minor mechanical trunk damage.

Photo 8. Tree #1, jacaranda, with evidence of root crowding by curb and street gutter.

Site Photos (Sheet 2 of 2)

Appendix 5

Confirmation Soil Sampling Plan

Rincon Consultants, Inc.
790 East Santa Clara Street
Ventura, California 93001

805 641 1000
FAX 641 1072

info@rinconconsultants.com
www.rinconconsultants.com

April 29, 2010
Project 08-25430

Cenen Aparicio
City of Santa Barbara
Public Works Department
1221 Anacapa Street
Santa Barbara, California 93101

Confirmation Soil Sampling Plan
125 State Street
Santa Barbara, California

Dear Mr. Aparicio:

Rincon Consultants, Inc. has been contracted by the City of Santa Barbara Redevelopment Agency (RDA) to conduct a remedial excavation at the property located at 125 State Street, Santa Barbara, California. Total lead, soluble lead, total petroleum hydrocarbons (TPH) in the oil range (TPHo), and polynuclear aromatics (PNAs) have been detected at concentrations exceeding both the County of Santa Barbara Fire Prevention Division (FPD) Investigation Levels and exceeding cleanup goals proposed in the September 25, 2009, Remedial Action Plan (RAP) prepared by Rincon for the subject property. This Confirmation Soil Sampling Plan outlines the methodogy that will be used to collect soil samples to demonstrate the effectiveness of the remdial excavation.

If you have any questions, or if we can be of any future assistance, please do not hesitate to contact us.

Sincerely,
RINCON CONSULTANTS, INC.

Shawn Decker, MESM, LEED AP
Project Manager, Environmental Services

Walter Hamann, PG, CEG, REA II
Vice President, Environmental Services

REGISTERED GEOLOGIST
WALTER L. HAMANN
No. EG 1635
CERTIFIED ENGINEERING GEOLOGIST
STATE OF CALIFORNIA

Introduction

Rincon Consultants, Inc. has been contracted by the City of Santa Barbara Redevelopment Agency (RDA) to conduct a remedial excavation at the property located at 125 State Street, Santa Barbara, California (Figure 1). The subject property consists of a 21,967 square foot (0.5 acre) parcel and a 403 square foot parcel (Figure 2). The subject property is identified as APNs 033-075-012 and -014 and a portion of APN 033-010-012. The subject property is currently developed with a small structure known as the Signalman's Building which was used by the railroad company as part of its railroad operations, a concrete pad, and the base of a small structure constructed of brick and cement. The majority of the subject property is vacant land covered by discontinuous areas of asphalt that may be buried by up to 6 inches of soil. Access to the subject property is available from a walkway on State Street and a gate on Kimberly Avenue. The subject property is bound by Kimberly Avenue to the west, the railroad right of way/easement to the north, State Street to the east, and a hotel and restaurant to the south.

Total lead, soluble lead, total petroleum hydrocarbons (TPH) in the diesel range (TPHd) and in the oil range (TPHo), and polynuclear aromatics (PNAs) have been detected at concentrations exceeding the County of Santa Barbara Fire Prevention Division (FPD) Investigation Levels in the shallow soil at the subject property. There are tentative plans to redevelop the subject property with a children's museum pending environmental review.

This Confirmation Soil Sampling Plan describes the methodology that will be used to collect confirmation soil samples from the remedial excavation.

Confirmation Soil Sampling Plan

Confirmation soil samples will be collected to demonstrate the effectiveness of the remedial excavation in removing contaminants existing in the soil at concentrations exceeding FPD Investigation Levels. Confirmation soil samples will be collected from the excavation sidewall and bottom at a rate of one sample per every 100 square feet of excavation sidewall and bottom (Figure 2).

Confirmation soil samples will be collected directly from the excavation sidewall or bottom. If it is determined to not be safe to enter the excavation then confirmation soil samples will be collected from the backhoe bucket. If there is field evidence of contamination in the confirmation sample this information will be provided to the City of Santa Barbara. If directed by the City of Santa Barbara, the excavation will be extended until there is not field evidence of contamination. Field evidence of contamination includes discoloration, odors, and elevated photoionization detector (PID) readings.

Soil will be stockpiled on Visqueen prior to loading for removal and disposal. Upon completion of excavation activities, the area beneath the stockpiled soil will be overexcavated by 1 to 2 inches and confirmation soil samples will be collected. The confirmation soil samples will be collected to confirm that contaminated soil placed on the Visqueen did not contaminate the soil beneath the Visqueen.

Soil samples will be collected in either glass jars or brass rings. The glass jar or brass ring will be sealed with Teflon, capped, labeled, placed in a sealable plastic bag, and stored in a cooler with blue ice pending delivery to the analytical laboratory.

Soil from the area of soil sample collection will be placed in a plastic bag and used for soil classification using the Unified Soil Classification System and to screen for VOCs using a PID. The plastic bag containing the soil is opened after allowing time for VOCs to volatilize. The PID probe tip is then placed within one-eighth inch of the soil. Prior to testing, the PID is calibrated to an isobutylene standard. The PID data will be recorded in the field notes.

Confirmation Soil Sample Analysis

TPH and PNA Impacted Soil

Confirmation soil samples collected from the area of TPH and PNA impacted soil will be analyzed for TPH diesel and motor oil range by EPA Method 8015M and PNAs by EPA Method 3550B.

Lead Impacted Soil

Confirmation soil samples collected from the area of lead impacted soil will be analyzed for total lead. If the lead concentrations are or exceed 50 milligrams per kilogram (mg/kg), the sample will be analyzed for Soluble Threshold Limit Concentration (STLC) lead by EPA Method 6000/7000. If soluble lead is detected at a concentration exceeding 5 milligrams per liter (mg/L) then the sample will be analyzed for Toxicity Leaching Procedure Limit (TCLP).

Additional Confirmation Soil Sampling

If contaminants are detected in confirmation soil samples at concentrations exceeding FPD Investigation Levels the City of Santa Barbara will be consulted with to determine if additional excavation and sampling should be conducted. If additional excavation is conducted confirmation sampling will be completed at a rate of one sample per every 100 square feet of additional excavation bottom or sidewall.

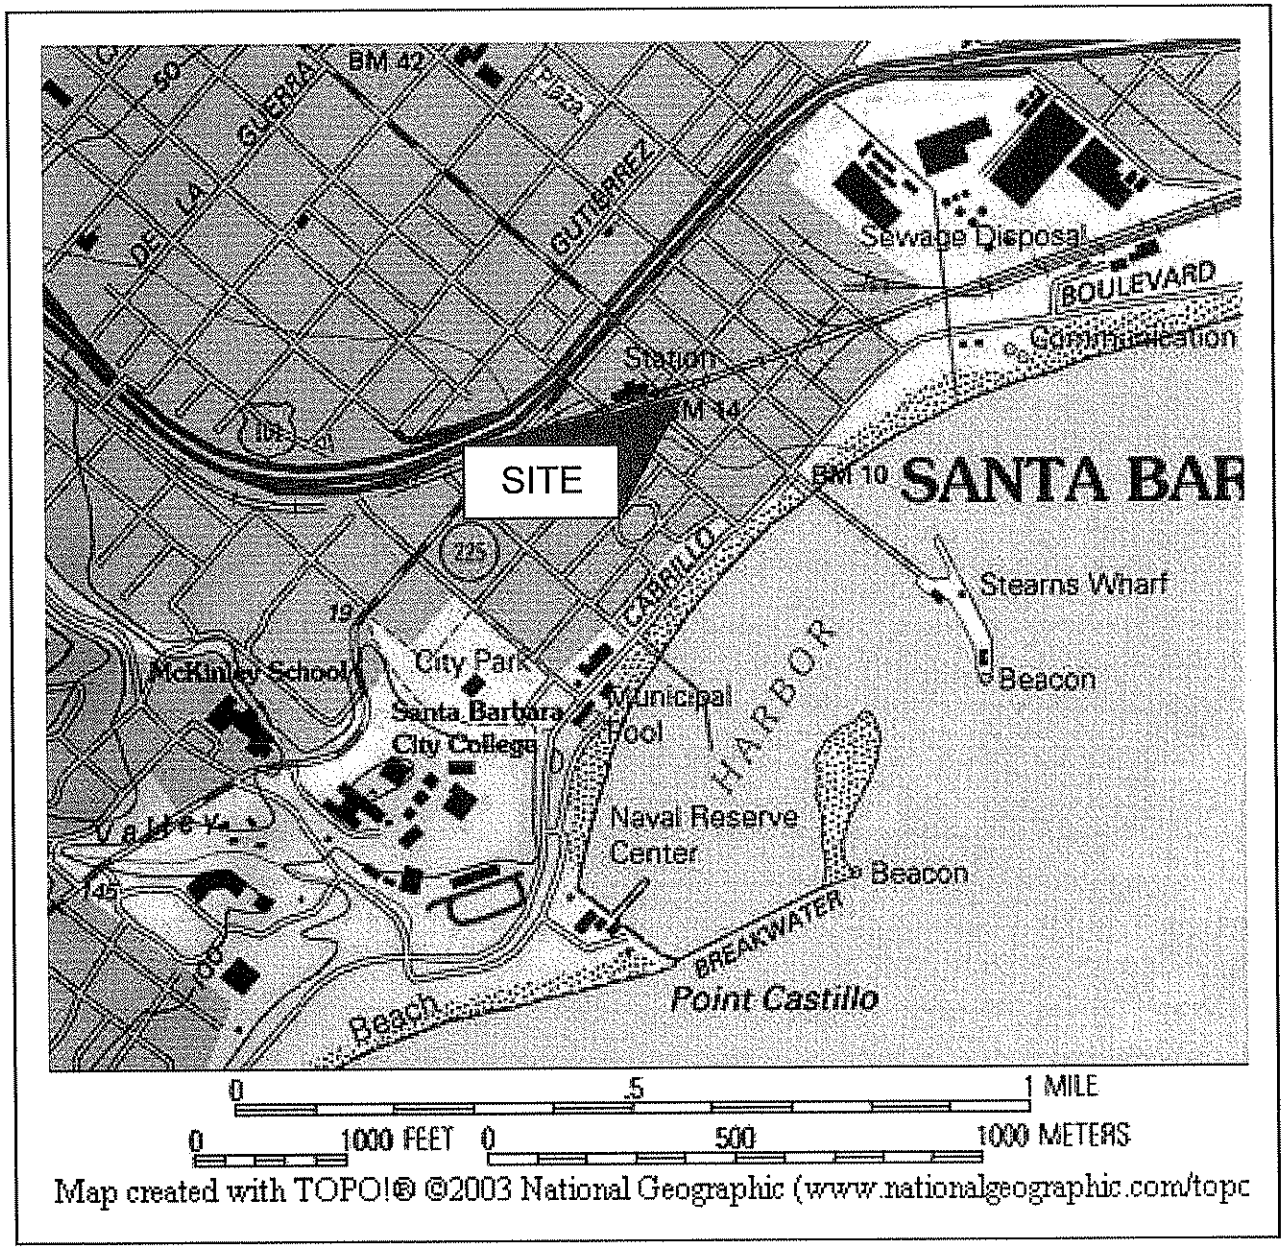

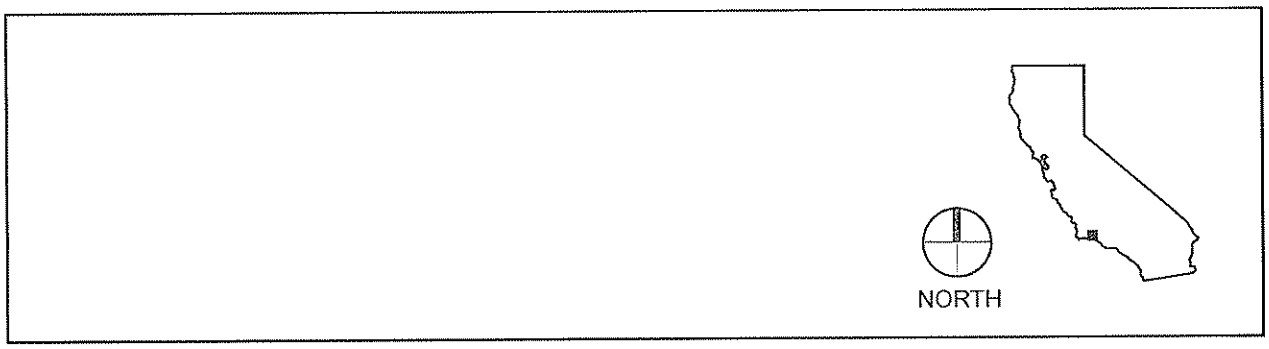

Vicinity Map

Figure 1

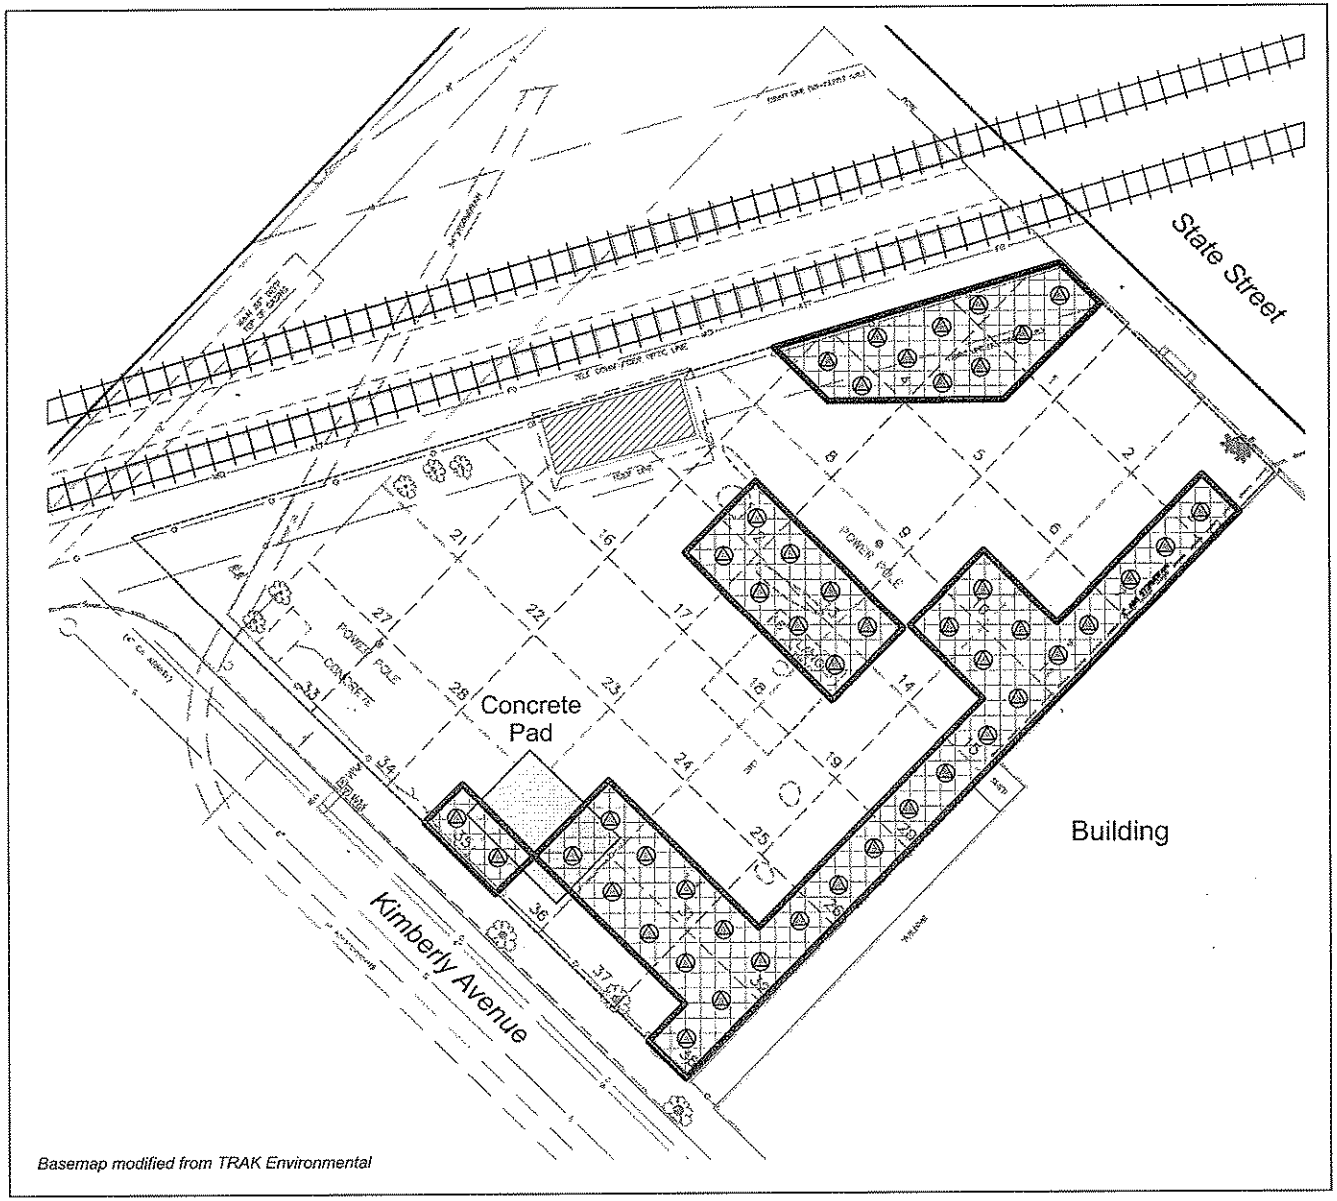

Legend

- Subject Property Boundary
- Signalman's Building
- Proposed Excavation Area
- Confirmation Soil Sample Location

Confirmation soil samples will be collected at a rate of one sample per 100 square feet of sidewall or excavation bottom. The excavation bottom confirmation soil sample locations are depicted on this figure. The sidewall confirmation soil sample locations are not depicted.

0 30 60
Scale in feet

North

Proposed Excavation Areas and Confirmation Soil Sample Location Map	
125 State Street Santa Barbara, California	Figure

Appendix 6

Confirmation Sampling and Backfill Analytical Reports

Oilfield Environmental and Compliance, INC.

Shawn Decker
Rincon Consultants
790 East Santa Clara
Ventura, CA 93455

28 April 2010

RE: 125 State Street - Santa Barbara

Work Order: 1001330

Dear Client:

Enclosed is an analytical report for the above referenced project. The samples included in this report were received on 15-Apr-10 16:50 and analyzed in accordance with the attached chain-of-custody.

Unless otherwise noted, all analytical testing was accomplished in accordance with the guidelines established in our Quality Assurance Manual, applicable standard operating procedures, and other related documentation. The results in this analytical report are limited to the samples tested and any reproduction thereof must be made in its entirety.

If you have any questions regarding this report, please do not hesitate to contact the undersigned.

Sincerely,

Lisa Race

Laboratory Manager

TEL: (805) 922-4772
307 Roemer Way, Suite 300, Santa Maria, CA 93454 www.oecusa.com FAX: (805) 925-3376

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street - Santa Barbara	
790 East Santa Clara	Project Number: 08-25430 -125 State Street	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	28-Apr-10 14:03

ANALYTICAL REPORT FOR SAMPLES

Sample ID	Laboratory ID	Matrix	Date Sampled	Date Received
Fill -1	1001330-01	Solid	14-Apr-10 14:00	15-Apr-10 16:50

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street - Santa Barbara	
790 East Santa Clara	Project Number: 08-25430 -125 State Street	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	28-Apr-10 14:03

Fill -1
1001330-01 (Solid)

Analyte	Result	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Wet Chemistry by EPA or APHA Standard Methods									
pH	**8.40**	0.100	pH Units	1	A004288	19-Apr-10	19-Apr-10	9045	HoldX
Total Metals by EPA 6000/7000 Series Methods									
Antimony	ND	5.0	mg/kg	5	A004294	21-Apr-10	22-Apr-10	EPA 6020	
Arsenic	**4.9**	0.99	"	"	"	"	"	"	
Barium	**8.3**	0.50	"	"	"	"	"	"	
Beryllium	ND	2.5	"	"	"	"	"	"	
Cadmium	ND	0.99	"	"	"	"	"	"	
Chromium	**7.8**	0.99	"	"	"	"	"	"	
Cobalt	**1.0**	0.99	"	"	"	"	"	"	
Copper	ND	0.99	"	"	"	"	"	"	
Lead	**2.0**	0.99	"	"	"	"	"	"	
Mercury	ND	0.097	"	1	A004293	21-Apr-10	22-Apr-10	EPA 7471A	
Molybdenum	ND	0.99	"	5	A004294	21-Apr-10	22-Apr-10	EPA 6020	
Nickel	**2.6**	0.99	"	"	"	"	"	"	
Selenium	ND	5.0	"	"	"	"	"	"	
Silver	ND	0.99	"	"	"	"	"	"	
Thallium	ND	5.0	"	"	"	"	"	"	
Vanadium	**13**	5.0	"	"	"	"	"	"	
Zinc	**5.5**	2.5	"	"	"	"	"	"	
Organochlorine Pesticides by EPA Method 8081A									
alpha-BHC	ND	0.0030	mg/kg	1	A004242	16-Apr-10	22-Apr-10	EPA 8081A	
alpha-Chlordane	ND	0.0030	"	"	"	"	"	"	
Aldrin	ND	0.0030	"	"	"	"	"	"	
beta-BHC	ND	0.0030	"	"	"	"	"	"	
delta-BHC	ND	0.0030	"	"	"	"	"	"	
4,4'-DDD	ND	0.0030	"	"	"	"	"	"	
4,4'-DDE	ND	0.0030	"	"	"	"	"	"	
4,4'-DDT	ND	0.0030	"	"	"	"	"	"	
Dieldrin	ND	0.0030	"	"	"	"	"	"	
Endosulfan I	ND	0.0030	"	"	"	"	"	"	
Endosulfan II	ND	0.0030	"	"	"	"	"	"	
Endosulfan sulfate	ND	0.0030	"	"	"	"	"	"	
Endrin	ND	0.0030	"	"	"	"	"	"	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street - Santa Barbara	
790 East Santa Clara	Project Number: 08-25430 -125 State Street	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	28-Apr-10 14:03

Fill -1

1001330-01 (Solid)

Analyte	Result	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Organochlorine Pesticides by EPA Method 8081A									
Endrin aldehyde	ND	0.0030	mg/kg	1	A004242	16-Apr-10	22-Apr-10	EPA 8081A	
Endrin ketone	ND	0.0030	"	"	"	"	"	"	
gamma-BHC	ND	0.0030	"	"	"	"	"	"	
gamma-Chlordane	ND	0.0030	"	"	"	"	"	"	
Heptachlor	ND	0.0030	"	"	"	"	"	"	
Heptachlor epoxide	ND	0.0030	"	"	"	"	"	"	
Methoxychlor	ND	0.0030	"	"	"	"	"	"	
Chlordane (tech)	ND	0.020	"	"	"	"	"	"	
Toxaphene	ND	0.020	"	"	"	"	"	"	
Surrogate: Decachlorobiphenyl		*77.2 %*	*50-150*		"	"	"	"	
Surrogate: 2,4,5,6 Tetrachloro-m-xylene		*94.1 %*	*50-150*		"	"	"	"	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street - Santa Barbara	
790 East Santa Clara	Project Number: 08-25430 -125 State Street	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	28-Apr-10 14:03

Wet Chemistry by EPA or APHA Standard Methods - Quality Control

Analyte	Result	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
Batch A004288 - EPA 9045 pH Prep										
LCS (A004288-BS1)				Prepared & Analyzed: 19-Apr-10						
pH	4.00	0.100	pH Units	4.00		100	90-110		10	
LCS (A004288-BS2)				Prepared & Analyzed: 19-Apr-10						
pH	7.02	0.100	pH Units	7.00		100	90-110		10	
LCS (A004288-BS3)				Prepared & Analyzed: 19-Apr-10						
pH	9.97	0.100	pH Units	10.0		99.7	90-110		10	
Duplicate (A004288-DUP1)		**Source: 1001330-01**		Prepared & Analyzed: 19-Apr-10						
pH	8.39	0.100	pH Units		8.40			0.119	10	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street - Santa Barbara	
790 East Santa Clara	Project Number: 08-25430 -125 State Street	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	28-Apr-10 14:03

Total Metals by EPA 6000/7000 Series Methods - Quality Control

Analyte	Result	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
Batch A004293 - EPA 7471A Prep										
Blank (A004293-BLK1)				Prepared: 21-Apr-10 Analyzed: 22-Apr-10						
Mercury	ND	0.10	mg/kg							
LCS (A004293-BS1)				Prepared: 21-Apr-10 Analyzed: 22-Apr-10						
Mercury	1.66	0.10	mg/kg	1.67		99.8	85-115		20	
LCS Dup (A004293-BSD1)				Prepared: 21-Apr-10 Analyzed: 22-Apr-10						
Mercury	1.69	0.10	mg/kg	1.67		102	85-115	1.69	20	
Duplicate (A004293-DUP1)		**Source: 1001330-01**		Prepared: 21-Apr-10 Analyzed: 22-Apr-10						
Mercury	ND	0.099	mg/kg		ND				20	
Matrix Spike (A004293-MS1)		**Source: 1001330-01**		Prepared: 21-Apr-10 Analyzed: 22-Apr-10						
Mercury	1.65	0.098	mg/kg	1.64	ND	101	75-125		20	
Matrix Spike Dup (A004293-MSD1)		**Source: 1001330-01**		Prepared: 21-Apr-10 Analyzed: 22-Apr-10						
Mercury	1.69	0.10	mg/kg	1.66	ND	102	75-125	0.819	20	
Batch A004294 - EPA 3050B										
Blank (A004294-BLK1)				Prepared: 21-Apr-10 Analyzed: 22-Apr-10						
Antimony	ND	1.0	mg/kg							
Arsenic	ND	0.20	"							
Barium	ND	0.10	"							
Beryllium	ND	0.50	"							
Cadmium	ND	0.20	"							
Chromium	ND	0.20	"							
Cobalt	ND	0.20	"							
Copper	ND	0.20	"							
Lead	ND	0.20	"							
Molybdenum	ND	0.20	"							
Nickel	ND	0.20	"							
Selenium	ND	1.0	"							
Silver	ND	0.20	"							
Thallium	ND	1.0	"							
Vanadium	ND	1.0	"							
Zinc	ND	0.50	"							

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street - Santa Barbara	
790 East Santa Clara	Project Number: 08-25430 -125 State Street	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	28-Apr-10 14:03

Total Metals by EPA 6000/7000 Series Methods - Quality Control

Analyte	Result	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
Batch A004294 - EPA 3050B										
LCS (A004294-BS1)				Prepared: 21-Apr-10 Analyzed: 22-Apr-10						
Antimony	14.8	1.0	mg/kg	15.0		98.3	85-115		20	
Arsenic	16.1	0.20	"	15.0		108	85-115		20	
Barium	13.7	0.10	"	15.0		91.4	85-115		20	
Beryllium	16.2	0.50	"	15.0		108	85-115		20	
Cadmium	15.1	0.20	"	15.0		101	85-115		20	
Chromium	14.6	0.20	"	15.0		97.2	85-115		20	
Cobalt	13.8	0.20	"	15.0		92.2	85-115		20	
Copper	14.6	0.20	"	15.0		97.7	85-115		20	
Lead	13.2	0.20	"	15.0		88.2	85-115		20	
Molybdenum	14.1	0.20	"	15.0		93.9	85-115		20	
Nickel	14.2	0.20	"	15.0		94.7	85-115		20	
Selenium	16.4	1.0	"	15.0		109	85-115		20	
Silver	14.4	0.20	"	15.0		96.0	85-115		20	
Thallium	13.8	1.0	"	15.0		92.3	85-115		20	
Vanadium	13.9	1.0	"	15.0		92.5	85-115		20	
Zinc	16.7	0.50	"	15.0		112	85-115		20	
LCS Dup (A004294-BSD1)				Prepared: 21-Apr-10 Analyzed: 22-Apr-10						
Antimony	15.6	1.0	mg/kg	15.0		104	85-115	5.59	20	
Arsenic	17.4	0.20	"	15.0		116	85-115	7.56	20	QM-09
Barium	15.1	0.10	"	15.0		101	85-115	9.78	20	
Beryllium	16.5	0.50	"	15.0		110	85-115	2.11	20	
Cadmium	16.0	0.20	"	15.0		107	85-115	5.98	20	
Chromium	15.6	0.20	"	15.0		104	85-115	6.46	20	
Cobalt	15.1	0.20	"	15.0		100	85-115	8.51	20	
Copper	15.8	0.20	"	15.0		105	85-115	7.40	20	
Lead	14.8	0.20	"	15.0		98.4	85-115	11.0	20	
Molybdenum	15.5	0.20	"	15.0		103	85-115	9.27	20	
Nickel	15.2	0.20	"	15.0		101	85-115	6.60	20	
Selenium	18.5	1.0	"	15.0		123	85-115	12.3	20	QM-09
Silver	15.6	0.20	"	15.0		104	85-115	7.68	20	
Thallium	15.2	1.0	"	15.0		101	85-115	9.06	20	
Vanadium	14.8	1.0	"	15.0		98.4	85-115	6.24	20	
Zinc	17.1	0.50	"	15.0		114	85-115	2.31	20	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street - Santa Barbara	
790 East Santa Clara	Project Number: 08-25430 -125 State Street	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	28-Apr-10 14:03

Total Metals by EPA 6000/7000 Series Methods - Quality Control

Analyte	Result	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
Batch A004294 - EPA 3050B										
Duplicate (A004294-DUP1)		**Source: 1001330-01**		Prepared: 21-Apr-10 Analyzed: 22-Apr-10						
Antimony	ND	4.9	mg/kg		ND				20	
Arsenic	4.80	0.99	"		4.86			1.23	20	
Barium	13.0	0.49	"		8.28			44.2	20	QR-03
Beryllium	ND	2.5	"		ND				20	
Cadmium	ND	0.99	"		ND				20	
Chromium	7.62	0.99	"		7.79			2.26	20	
Cobalt	1.44	0.99	"		1.03			33.5	20	QR-03
Copper	0.812	0.99	"		0.737			9.71	20	
Lead	2.16	0.99	"		1.98			8.91	20	
Molybdenum	0.686	0.99	"		0.652			5.15	20	
Nickel	3.52	0.99	"		2.56			31.8	20	QR-03
Selenium	ND	4.9	"		ND				20	
Silver	ND	0.99	"		ND				20	
Thallium	ND	4.9	"		ND				20	
Vanadium	4.73	4.9	"		12.7			91.5	20	QR-03
Zinc	7.60	2.5	"		5.50			32.1	20	QR-03
Matrix Spike (A004294-MS1)		**Source: 1001330-01**		Prepared: 21-Apr-10 Analyzed: 22-Apr-10						
Antimony	160	20	mg/kg	298	ND	53.6	0-102		20	
Arsenic	303	4.0	"	298	4.86	99.9	64-130		20	
Barium	312	2.0	"	298	8.28	102	47-151		20	
Beryllium	319	9.9	"	298	ND	107	67-139		20	
Cadmium	293	4.0	"	298	ND	98.2	70-129		20	
Chromium	315	4.0	"	298	7.79	103	56-139		20	
Cobalt	297	4.0	"	298	1.03	99.1	70-125		20	
Copper	288	4.0	"	298	0.737	96.5	59-144		20	
Lead	298	4.0	"	298	1.98	99.2	63-136		20	
Molybdenum	286	4.0	"	298	0.652	95.8	56-123		20	
Nickel	287	4.0	"	298	2.56	95.4	63-133		20	
Selenium	307	20	"	298	ND	103	59-138		20	
Silver	251	4.0	"	298	ND	84.3	24-153		20	
Thallium	283	20	"	298	ND	94.8	66-125		20	
Vanadium	304	20	"	298	12.7	97.5	67-129		20	
Zinc	286	9.9	"	298	5.50	94.2	44-149		20	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street - Santa Barbara	
790 East Santa Clara	Project Number: 08-25430 -125 State Street	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	28-Apr-10 14:03

Total Metals by EPA 6000/7000 Series Methods - Quality Control

Analyte	Result	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
Batch A004294 - EPA 3050B										
Matrix Spike Dup (A004294-MSD1)		**Source: 1001330-01**		Prepared: 21-Apr-10 Analyzed: 22-Apr-10						
Antimony	7.31	0.99	mg/kg	296	ND	2.47	0-102	182	20	QR-02
Arsenic	294	3.9	"	296	4.86	97.7	64-130	2.25	20	
Barium	309	2.0	"	296	8.28	102	47-151	0.152	20	
Beryllium	306	9.9	"	296	ND	103	67-139	3.36	20	
Cadmium	296	3.9	"	296	ND	100	70-129	1.91	20	
Chromium	311	3.9	"	296	7.79	102	56-139	0.621	20	
Cobalt	296	3.9	"	296	1.03	99.8	70-125	0.711	20	
Copper	280	3.9	"	296	0.737	94.3	59-144	2.30	20	
Lead	289	3.9	"	296	1.98	96.9	63-136	2.44	20	
Molybdenum	282	3.9	"	296	0.652	95.0	56-123	0.867	20	
Nickel	284	3.9	"	296	2.56	95.0	63-133	0.361	20	
Selenium	304	20	"	296	ND	103	59-138	0.425	20	
Silver	256	3.9	"	296	ND	86.4	24-153	2.46	20	
Thallium	284	20	"	296	ND	96.1	66-125	1.37	20	
Vanadium	308	20	"	296	12.7	99.9	67-129	2.44	20	
Zinc	283	9.9	"	296	5.50	93.7	44-149	0.468	20	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street - Santa Barbara	
790 East Santa Clara	Project Number: 08-25430 -125 State Street	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	28-Apr-10 14:03

Organochlorine Pesticides by EPA Method 8081A - Quality Control

Analyte	Result	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
Batch A004242 - EPA 3550B										
Blank (A004242-BLK1)				Prepared: 16-Apr-10 Analyzed: 21-Apr-10						
alpha-BHC	ND	0.0030	mg/kg							
alpha-Chlordane	ND	0.0030	"							
Aldrin	ND	0.0030	"							
beta-BHC	ND	0.0030	"							
delta-BHC	ND	0.0030	"							
4,4'-DDD	ND	0.0030	"							
4,4'-DDE	ND	0.0030	"							
4,4'-DDT	ND	0.0030	"							
Dieldrin	ND	0.0030	"							
Endosulfan I	ND	0.0030	"							
Endosulfan II	ND	0.0030	"							
Endosulfan sulfate	ND	0.0030	"							
Endrin	ND	0.0030	"							
Endrin aldehyde	ND	0.0030	"							
Endrin ketone	ND	0.0030	"							
gamma-BHC	ND	0.0030	"							
gamma-Chlordane	ND	0.0030	"							
Heptachlor	ND	0.0030	"							
Heptachlor epoxide	ND	0.0030	"							
Methoxychlor	ND	0.0030	"							
Chlordane (tech)	ND	0.020	"							
Toxaphene	ND	0.020	"							
Surrogate: Decachlorobiphenyl	*0.00616*		"	*0.00833*		*73.9*	*50-150*			
Surrogate: 2,4,5,6 Tetrachloro-m-xylene	*0.00776*		"	*0.00833*		*93.1*	*50-150*			
LCS (A004242-BS1)				Prepared: 16-Apr-10 Analyzed: 21-Apr-10						
alpha-BHC	0.00496	0.0030	mg/kg	0.00667		74.4	50-150		25	
alpha-Chlordane	0.00483	0.0030	"	0.00667		72.5	50-150		25	
Aldrin	0.00449	0.0030	"	0.00667		67.4	50-150		25	
beta-BHC	0.00531	0.0030	"	0.00667		79.6	50-150		25	
delta-BHC	0.00549	0.0030	"	0.00667		82.3	50-150		25	
4,4'-DDD	0.00588	0.0030	"	0.00667		88.3	50-150		25	
4,4'-DDE	0.00554	0.0030	"	0.00667		83.1	50-150		25	
4,4'-DDT	0.00487	0.0030	"	0.00667		73.0	50-150		25	
Dieldrin	0.00460	0.0030	"	0.00667		69.0	50-150		25	
Endosulfan I	0.00445	0.0030	"	0.00667		66.7	50-150		25	
Endosulfan II	0.00439	0.0030	"	0.00667		65.8	50-150		25	
Endosulfan sulfate	0.00460	0.0030	"	0.00667		69.0	50-150		25	
Endrin	0.00435	0.0030	"	0.00667		65.3	50-150		25	
Endrin aldehyde	0.00535	0.0030	"	0.00667		80.3	50-150		25	
Endrin ketone	0.00484	0.0030	"	0.00667		72.6	50-150		25	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street - Santa Barbara	
790 East Santa Clara	Project Number: 08-25430 -125 State Street	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	28-Apr-10 14:03

Organochlorine Pesticides by EPA Method 8081A - Quality Control

Analyte	Result	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
Batch A004242 - EPA 3550B										
LCS (A004242-BS1)				Prepared: 16-Apr-10 Analyzed: 21-Apr-10						
gamma-BHC	0.00503	0.0030	"	0.00667		75.5	50-150		25	
gamma-Chlordane	0.00467	0.0030	"	0.00667		70.1	50-150		25	
Heptachlor	0.00454	0.0030	"	0.00667		68.1	50-150		25	
Heptachlor epoxide	0.00454	0.0030	"	0.00667		68.1	50-150		25	
Methoxychlor	0.00529	0.0030	"	0.00667		79.3	50-150		25	
Surrogate: Decachlorobiphenyl	*0.00596*		"	*0.00833*		*71.5*	*50-150*			
Surrogate: 2,4,5,6 Tetrachloro-m-xylene	*0.00763*		"	*0.00833*		*91.5*	*50-150*			
LCS Dup (A004242-BSD1)				Prepared: 16-Apr-10 Analyzed: 21-Apr-10						
alpha-BHC	0.00468	0.0030	mg/kg	0.00667		70.2	50-150	5.87	25	
alpha-Chlordane	0.00447	0.0030	"	0.00667		67.0	50-150	7.84	25	
Aldrin	0.00431	0.0030	"	0.00667		64.7	50-150	4.05	25	
beta-BHC	0.00514	0.0030	"	0.00667		77.1	50-150	3.23	25	
delta-BHC	0.00517	0.0030	"	0.00667		77.6	50-150	5.83	25	
4,4'-DDD	0.00566	0.0030	"	0.00667		84.9	50-150	3.92	25	
4,4'-DDE	0.00557	0.0030	"	0.00667		83.5	50-150	0.553	25	
4,4'-DDT	0.00485	0.0030	"	0.00667		72.8	50-150	0.283	25	
Dieldrin	0.00475	0.0030	"	0.00667		71.2	50-150	3.16	25	
Endosulfan I	0.00432	0.0030	"	0.00667		64.8	50-150	2.99	25	
Endosulfan II	0.00427	0.0030	"	0.00667		64.1	50-150	2.71	25	
Endosulfan sulfate	0.00455	0.0030	"	0.00667		68.2	50-150	1.11	25	
Endrin	0.00410	0.0030	"	0.00667		61.5	50-150	5.90	25	
Endrin aldehyde	0.00518	0.0030	"	0.00667		77.7	50-150	3.30	25	
Endrin ketone	0.00456	0.0030	"	0.00667		68.5	50-150	5.83	25	
gamma-BHC	0.00479	0.0030	"	0.00667		71.9	50-150	4.93	25	
gamma-Chlordane	0.00451	0.0030	"	0.00667		67.7	50-150	3.49	25	
Heptachlor	0.00439	0.0030	"	0.00667		65.8	50-150	3.45	25	
Heptachlor epoxide	0.00439	0.0030	"	0.00667		65.9	50-150	3.33	25	
Methoxychlor	0.00524	0.0030	"	0.00667		78.5	50-150	0.934	25	
Surrogate: Decachlorobiphenyl	*0.00588*		"	*0.00833*		*70.6*	*50-150*			
Surrogate: 2,4,5,6 Tetrachloro-m-xylene	*0.00734*		"	*0.00833*		*88.0*	*50-150*			

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street - Santa Barbara	
790 East Santa Clara	Project Number: 08-25430 -125 State Street	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	28-Apr-10 14:03

Organochlorine Pesticides by EPA Method 8081A - Quality Control

Analyte	Result	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
Batch A004242 - EPA 3550B										
Duplicate (A004242-DUP1)		**Source: 1001318-01**		Prepared: 16-Apr-10 Analyzed: 21-Apr-10						
alpha-BHC	ND	0.0030	mg/kg		ND				25	
alpha-Chlordane	ND	0.0030	"		ND				25	
Aldrin	ND	0.0030	"		ND				25	
beta-BHC	ND	0.0030	"		ND				25	
delta-BHC	ND	0.0030	"		ND				25	
4,4'-DDD	ND	0.0030	"		ND				25	
4,4'-DDE	ND	0.0030	"		ND				25	
4,4'-DDT	ND	0.0030	"		ND				25	
Dieldrin	ND	0.0030	"		ND				25	
Endosulfan I	ND	0.0030	"		ND				25	
Endosulfan II	ND	0.0030	"		ND				25	
Endosulfan sulfate	ND	0.0030	"		ND				25	
Endrin	ND	0.0030	"		ND				25	
Endrin aldehyde	ND	0.0030	"		ND				25	
Endrin ketone	ND	0.0030	"		ND				25	
gamma-BHC	ND	0.0030	"		ND				25	
gamma-Chlordane	ND	0.0030	"		ND				25	
Heptachlor	ND	0.0030	"		ND				25	
Heptachlor epoxide	ND	0.0030	"		ND				25	
Methoxychlor	ND	0.0030	"		ND				25	
Surrogate: Decachlorobiphenyl	*0.00613*		"	*0.00833*		*73.5*	*50-150*			
Surrogate: 2,4,5,6 Tetrachloro-m-xylene	*0.00765*		"	*0.00833*		*91.9*	*50-150*			

Notes and Definitions

QR-03	The RPD value for the sample duplicate or MS/MSD was outside of QC acceptance limits due to matrix interference. QC batch accepted based on LCS and/or LCSD recovery and/or RPD values.
QR-02	The RPD result exceeded the QC control limits; however, both percent recoveries were acceptable. Sample results for the QC batch were accepted based on percent recoveries and completeness of QC data.
QM-09	The spike recovery was outside acceptance limits for the LCSD. The batch was accepted based on acceptable LCS recovery.
HoldX	Sample holding time expired.
DET	Analyte DETECTED
ND	Analyte NOT DETECTED at or above the reporting limit
NR	Not Reported
dry	Sample results reported on a dry weight basis
RPD	Relative Percent Difference

EMSL Analytical, Inc
2235 Polvorosa Ave , Suite 230, San Leandro, CA 94577
Phone: (510) 895-3675 Fax: (510) 895-3680 Email: milpitaslab@emsl.com

Attn: **Lisa Race**
Oilfield Environmental and Compliance
307 Roemer Way
Suite 300
Santa Maria, CA 93454

Fax: (805) 925-3376 Phone: (805) 922-4772
Project: **1001330**
125 State St.

Customer ID: OILF50
Customer PO: 1001330
Received: 04/16/10 9:15 AM
EMSL Order: 091003433

EMSL Proj:
Analysis Date: 4/25/2010

Test Report: Asbestos Analysis of Bulk Materials via EPA 600/R-93/116 Method using Polarized Light Microscopy

			Non-Asbestos			Asbestos
Sample	**Description**	**Appearance**	**%**	**Fibrous**	**% Non-Fibrous**	**% Type**
1001330-01-Non Soil *091003433-0001*		Tan Non-Fibrous Homogeneous			100% Non-fibrous (other)	**None Detected**

Analyst(s)

Grant Mays (1)

Baojia Ke, Laboratory Manager
or other approved signatory

Due to magnification limitations inherent in PLM, asbestos fibers in dimensions below the resolution capability of PLM may not be detected. Samples reported as <1% or none detected may require additional testing by TEM to confirm asbestos quantities. The above test report relates only to the items tested and may not be reproduced in any form without the express written approval of EMSL Analytical, Inc. EMSL's liability is limited to the cost of analysis. EMSL bears no responsibility for sample collection activities or analytical method limitations. Interpretation and use of test results are the responsibility of the client.Samples received in good condition unless otherwise noted.
Samples analyzed by EMSL Analytical, Inc 2235 Polvorosa Ave , Suite 230, San LeandroCA NVLAP Lab Code 101048-3, MA AA000201, WA C2007

THIS IS THE LAST PAGE OF THE REPORT.

SUBCONTRACT ORDER

Oilfield Environmental and Compliance

1001330

09100 3433

SENDING LABORATORY:

Oilfield Environmental and Compliance
307 Roemer Way, Ste. 300
Santa Maria, CA 93454
Phone: 805.922.4772
Fax: 805.925.3376
Project Manager: Lisa Race

Project: 125 Slade St

RECEIVING LABORATORY:

EMSL Analytical, Inc.
2235 Polvorosa Drive Suite 230
San Leandro, CA 94577
Phone :(888) 455-3675
Fax: (510) 895-3680

TAT: 4/23/10 12:00pm

Analysis	Due	Expires	Laboratory ID	Comments
Sample ID: 1001330-01	**Solid**	**Sampled:14-Apr-10 14:00**	[redacted]	**Fill -1**
Asbestos (non-soil)- Bulk PLM	23-Apr-10 16:00	28-Apr-10 14:00		
Containers Supplied:				

Sherry Mobley 4/16/10

Released By | Date | Received By | Date

Released By | Date | Received By | Date

ASSOCIATED LABORATORIES
806 North Batavia - Orange, California 92868 - 714/771-6900

FAX 714/538-1209

CLIENT Oilfield Environmental and Compliance (12549)
ATTN: Lisa Race
307 Roemer Way
Suite 300
Santa Maria, CA 93454

LAB REQUEST 253251

REPORTED 04/26/2010

RECEIVED 04/16/2010

PROJECT #1001330
125 State St.

SUBMITTER Client

COMMENTS

This laboratory request covers the following listed samples which were analyzed for the parameters indicated on the attached Analytical Result Report. All analyses were conducted using the appropriate methods as indicated on the report. This cover letter is an integral part of the final report.

Order No.	Client Sample Identification
1073223	1001330-01
1073224	Laboratory Method Blank

Thank you for the opportunity to be of service to your company. Please feel free to call if there are any questions regarding this report or if we can be of further service.

ASSOCIATED LABORATORIES by,

Edward S. Behare, Ph.D.
Vice President

NOTE: Unless notified in writing, all samples will be discarded by appropriate disposal protocol 30 days from date reported.

The reports of the Associated Laboratories are confidential property of our clients and may not be reproduced or used for publication in part or in full without our written permission. This is for the mutual protection of the public, our clients, and ourselves.

TESTING & CONSULTING
Chemical
Microbiological
Environmental

Order #: 1073223
Matrix: SOLID
Date Sampled: 04/14/2010
Time Sampled: 14:00
Sampled By:

Client: Oilfield Environmental and Compliance
Client Sample ID: 1001330-01
Sample Description: Fill-1

Analyte	Result	DF	DLR	Units	Date/Analyst	
8141 Organophosphate Pesticides						
Azinophos Methyl (Guthion)	ND	1	1.0	mg/Kg	04/22/10	GH
Bolstar	ND	1	0.1	mg/Kg	04/22/10	GH
Chlorpyrifos(Dursban)	ND	1	0.2	mg/Kg	04/22/10	GH
Coumaphos	ND	1	1.0	mg/Kg	04/22/10	GH
Demeton(Systox)-O	ND	1	0.17	mg/Kg	04/22/10	GH
Demeton(Systox)-S	ND	1	0.17	mg/Kg	04/22/10	GH
Diazinon	ND	1	0.4	mg/Kg	04/22/10	GH
Dichlorvos	ND	1	0.07	mg/Kg	04/22/10	GH
Disulfoton (Disyston)	ND	1	0.13	mg/Kg	04/22/10	GH
Ethoprop	ND	1	0.17	mg/Kg	04/22/10	GH
Fensulfothion	ND	1	1.0	mg/Kg	04/22/10	GH
Fenthion	ND	1	0.07	mg/Kg	04/22/10	GH
Malathion	ND	1	0.02	mg/Kg	04/22/10	GH
Merphos	ND	1	0.17	mg/Kg	04/22/10	GH
Mevinphos (Phosdrin)	ND	1	0.2	mg/Kg	04/22/10	GH
Naled (Dibrom)	ND	1	0.07	mg/Kg	04/22/10	GH
Parathion Ethyl	ND	1	0.02	mg/Kg	04/22/10	GH
Parathion Methyl	ND	1	0.02	mg/Kg	04/22/10	GH
Phorate (Thimet)	ND	1	0.1	mg/Kg	04/22/10	GH
Ronnel	ND	1	0.2	mg/Kg	04/22/10	GH
Stirophos (Tetrachlorvinphos)	ND	1	3.35	mg/Kg	04/22/10	GH
Tokuthion (Protothiofos)	ND	1	0.33	mg/Kg	04/22/10	GH
Trichloronate	ND	1	0.1	mg/Kg	04/22/10	GH
Surrogates				**Units**	**Control Limits**	
TBP (sur)	57			%	50 - 145	
TPP (sur)	81			%	50 - 145	

8151A Phenoxy Acid Herbicides

2,4,5-T	ND	1	0.13	mg/Kg	04/21/10	SD
2,4,5-TP (Silvex)	ND	1	0.11	mg/Kg	04/21/10	SD
2,4-D	ND	1	0.80	mg/Kg	04/21/10	SD
2,4-DB	ND	1	0.61	mg/Kg	04/21/10	SD
Dalapon	ND	1	3.89	mg/Kg	04/21/10	SD
Dicamba	ND	1	0.18	mg/Kg	04/21/10	SD
Dichloroprop	ND	1	0.44	mg/Kg	04/21/10	SD

DLR = Detection limit for reporting purposes, ND = Not Detected below indicated detection limit, DF = Dilution Factor

Order #: 1073223
Matrix: SOLID
Date Sampled: 04/14/2010
Time Sampled: 14:00
Sampled By:

Client: Oilfield Environmental and Compliance
Client Sample ID: 1001330-01
Sample Description: Fill-1

Analyte	Result	DF	DLR	Units	Date/Analyst	
8151A Phenoxy Acid Herbicides						
Dinoseb	ND	1	0.05	mg/Kg	04/21/10	SD
MCPA	ND	1	167	mg/Kg	04/21/10	SD
MCPP	ND	1	129	mg/Kg	04/21/10	SD
Surrogates				**Units**	**Control Limits**	
DCAA (sur)	87			%	50 - 145	

DLR = Detection limit for reporting purposes, ND = Not Detected below indicated detection limit, DF = Dilution Factor

Oilfield Environmental and Compliance, INC.

Shawn Decker
Rincon Consultants
790 East Santa Clara
Ventura, CA 93455

12 May 2010

RE: 125 State Street Excavation

Work Order: 1001529

Dear Client:

Enclosed is an analytical report for the above referenced project. The samples included in this report were received on 04-May-10 12:32 and analyzed in accordance with the attached chain-of-custody.

Unless otherwise noted, all analytical testing was accomplished in accordance with the guidelines established in our Quality Assurance Manual, applicable standard operating procedures, and other related documentation. The results in this analytical report are limited to the samples tested and any reproduction thereof must be made in its entirety.

If you have any questions regarding this report, please do not hesitate to contact the undersigned.

Sincerely,

Lisa Race

Laboratory Manager

TEL: (805) 922-4772
307 Roemer Way, Suite 300, Santa Maria, CA 93454 www.oecusa.com FAX: (805) 925-3376

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara	Project Number: 08-25430	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	12-May-10 07:38

ANALYTICAL REPORT FOR SAMPLES

Sample ID	Laboratory ID	Matrix	Date Sampled	Date Received
CS1	1001529-01	Solid	03-May-10 13:30	04-May-10 12:32
CS2	1001529-02	Solid	03-May-10 13:40	04-May-10 12:32
CS3	1001529-03	Solid	03-May-10 13:50	04-May-10 12:32
CS4	1001529-04	Solid	03-May-10 14:00	04-May-10 12:32
CS5	1001529-05	Solid	03-May-10 14:10	04-May-10 12:32
CS6	1001529-06	Solid	03-May-10 14:20	04-May-10 12:32
CS7	1001529-07	Solid	03-May-10 14:30	04-May-10 12:32
CS8	1001529-08	Solid	03-May-10 14:40	04-May-10 12:32
CS9	1001529-09	Solid	03-May-10 14:50	04-May-10 12:32
CS10	1001529-10	Solid	03-May-10 15:00	04-May-10 12:32
CS11	1001529-11	Solid	03-May-10 15:10	04-May-10 12:32
CS12	1001529-12	Solid	03-May-10 15:20	04-May-10 12:32
CS13	1001529-13	Solid	04-May-10 08:00	04-May-10 12:32
CS14	1001529-14	Solid	04-May-10 08:05	04-May-10 12:32
CS15	1001529-15	Solid	04-May-10 08:10	04-May-10 12:32
CS16	1001529-16	Solid	04-May-10 08:15	04-May-10 12:32
CS17	1001529-17	Solid	04-May-10 08:20	04-May-10 12:32
CS18	1001529-18	Solid	04-May-10 08:25	04-May-10 12:32
CS19	1001529-19	Solid	04-May-10 08:30	04-May-10 12:32
CS20	1001529-20	Solid	04-May-10 08:35	04-May-10 12:32
CS21	1001529-21	Solid	04-May-10 08:40	04-May-10 12:32
CS22	1001529-22	Solid	04-May-10 08:45	04-May-10 12:32

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara	Project Number: 08-25430	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	12-May-10 07:38

CS1
1001529-01 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**65**	0.47	0.93	mg/kg	5	A005046	04-May-10	05-May-10	EPA 6020	N-02
STLC Metals by 6000/7000 Series Methods										
Lead	**6.5**	0.025	0.050	mg/L	50	A005131	10-May-10	11-May-10	STLC/EPA 6020	N-06

CS2
1001529-02 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**68**	0.44	0.88	mg/kg	5	A005046	04-May-10	05-May-10	EPA 6020	N-02
STLC Metals by 6000/7000 Series Methods										
Lead	**4.0**	0.025	0.050	mg/L	50	A005131	10-May-10	11-May-10	STLC/EPA 6020	

CS3
1001529-03 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**38**	0.44	0.87	mg/kg	5	A005046	04-May-10	05-May-10	EPA 6020	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara	Project Number: 08-25430	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	12-May-10 07:38

CS4

1001529-04 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**43**	0.49	0.97	mg/kg	5	A005046	04-May-10	05-May-10	EPA 6020	

CS5

1001529-05 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**180**	0.88	1.8	mg/kg	10	A005046	04-May-10	05-May-10	EPA 6020	N-02, N-03
STLC Metals by 6000/7000 Series Methods										
Lead	**17**	0.050	0.10	mg/L	100	A005131	10-May-10	11-May-10	STLC/EPA 6020	N-06

CS6

1001529-06 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**290**	2.0	3.9	mg/kg	20	A005046	04-May-10	05-May-10	EPA 6020	N-02, N-03
STLC Metals by 6000/7000 Series Methods										
Lead	**24**	0.050	0.10	mg/L	100	A005131	10-May-10	11-May-10	STLC/EPA 6020	N-06

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara	Project Number: 08-25430	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	12-May-10 07:38

CS7

1001529-07 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**210**	1.9	3.8	mg/kg	20	A005046	04-May-10	05-May-10	EPA 6020	N-02, N-03
STLC Metals by 6000/7000 Series Methods										
Lead	**12**	0.050	0.10	mg/L	100	A005131	10-May-10	11-May-10	STLC/EPA 6020	N-06

CS8

1001529-08 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**470**	2.0	4.0	mg/kg	20	A005046	04-May-10	05-May-10	EPA 6020	N-02, N-03
STLC Metals by 6000/7000 Series Methods										
Lead	**38**	0.10	0.20	mg/L	200	A005131	10-May-10	11-May-10	STLC/EPA 6020	N-06

CS9

1001529-09 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**330**	1.8	3.6	mg/kg	20	A005046	04-May-10	05-May-10	EPA 6020	N-02, N-03
STLC Metals by 6000/7000 Series Methods										
Lead	**12**	0.050	0.10	mg/L	100	A005131	10-May-10	11-May-10	STLC/EPA 6020	N-06

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara	Project Number: 08-25430	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	12-May-10 07:38

CS10

1001529-10 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**91**	0.44	0.88	mg/kg	5	A005046	04-May-10	05-May-10	EPA 6020	N-02
STLC Metals by 6000/7000 Series Methods										
Lead	**6.5**	0.025	0.050	mg/L	50	A005131	10-May-10	11-May-10	STLC/EPA 6020	N-06

CS11

1001529-11 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**1900**	9.7	19	mg/kg	100	A005046	04-May-10	05-May-10	EPA 6020	N-01, N-03
STLC Metals by 6000/7000 Series Methods										
Lead	**29**	0.10	0.20	mg/L	200	A005131	10-May-10	11-May-10	STLC/EPA 6020	N-06

CS12

1001529-12 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**80**	0.47	0.95	mg/kg	5	A005046	04-May-10	05-May-10	EPA 6020	N-02
STLC Metals by 6000/7000 Series Methods										
Lead	**4.1**	0.025	0.050	mg/L	50	A005131	10-May-10	11-May-10	STLC/EPA 6020	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara	Project Number: 08-25430	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	12-May-10 07:38

CS13

1001529-13 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**44**	0.45	0.89	mg/kg	5	A005048	04-May-10	05-May-10	EPA 6020	

CS14

1001529-14 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**28**	0.48	0.97	mg/kg	5	A005048	04-May-10	05-May-10	EPA 6020	

CS15

1001529-15 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**9.7**	0.48	0.96	mg/kg	5	A005048	04-May-10	05-May-10	EPA 6020	

CS16

1001529-16 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**10**	0.46	0.92	mg/kg	5	A005048	04-May-10	05-May-10	EPA 6020	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara	Project Number: 08-25430	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	12-May-10 07:38

CS17

1001529-17 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**11**	0.48	0.95	mg/kg	5	A005048	04-May-10	05-May-10	EPA 6020	

CS18

1001529-18 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**30**	0.46	0.91	mg/kg	5	A005048	04-May-10	05-May-10	EPA 6020	

CS19

1001529-19 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**44**	0.47	0.95	mg/kg	5	A005048	04-May-10	05-May-10	EPA 6020	

CS20

1001529-20 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**35**	0.42	0.84	mg/kg	5	A005048	04-May-10	05-May-10	EPA 6020	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara	Project Number: 08-25430	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	12-May-10 07:38

CS21

1001529-21 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**62**	0.46	0.92	mg/kg	5	A005048	04-May-10	05-May-10	EPA 6020	N-02
STLC Metals by 6000/7000 Series Methods										
Lead	**16**	0.050	0.10	mg/L	100	A005131	10-May-10	11-May-10	STLC/EPA 6020	N-06

CS22

1001529-22 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**360**	1.7	3.4	mg/kg	20	A005048	04-May-10	05-May-10	EPA 6020	N-02, N-03
STLC Metals by 6000/7000 Series Methods										
Lead	**32**	0.10	0.20	mg/L	200	A005131	10-May-10	11-May-10	STLC/EPA 6020	N-06

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara	Project Number: 08-25430	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	12-May-10 07:38

Total Metals by EPA 6000/7000 Series Methods - Quality Control

Analyte	Result	Method Limit	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
Batch A005046 - EPA 3050B											
Blank (A005046-BLK1)					Prepared: 04-May-10 Analyzed: 05-May-10						
Lead	ND	0.10	0.20	mg/kg							
LCS (A005046-BS1)					Prepared: 04-May-10 Analyzed: 05-May-10						
Lead	14.3	0.10	0.20	mg/kg	15.0		95.1	85-115		20	
LCS Dup (A005046-BSD1)					Prepared: 04-May-10 Analyzed: 05-May-10						
Lead	14.2	0.10	0.20	mg/kg	15.0		94.3	85-115	0.786	20	
Duplicate (A005046-DUP1)	**Source: 1001529-01**				Prepared: 04-May-10 Analyzed: 05-May-10						
Lead	93.7	0.47	0.94	mg/kg		65.0			36.1	20	QM-04
Matrix Spike (A005046-MS1)	**Source: 1001529-01**				Prepared: 04-May-10 Analyzed: 05-May-10						
Lead	575	4.7	9.4	mg/kg	282	65.0	181	61-138		20	QM-08
Matrix Spike Dup (A005046-MSD1)	**Source: 1001529-01**				Prepared: 04-May-10 Analyzed: 05-May-10						
Lead	389	2.0	3.9	mg/kg	295	65.0	110	61-138	48.6	20	QR-04
Batch A005048 - EPA 3050B											
Blank (A005048-BLK1)					Prepared: 04-May-10 Analyzed: 05-May-10						
Lead	ND	0.10	0.20	mg/kg							
LCS (A005048-BS1)					Prepared: 04-May-10 Analyzed: 05-May-10						
Lead	14.1	0.10	0.20	mg/kg	15.0		93.8	85-115		20	
LCS Dup (A005048-BSD1)					Prepared: 04-May-10 Analyzed: 05-May-10						
Lead	14.1	0.10	0.20	mg/kg	15.0		94.2	85-115	0.462	20	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara	Project Number: 08-25430	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	12-May-10 07:38

Total Metals by EPA 6000/7000 Series Methods - Quality Control

Analyte	Result	Method Limit	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
Batch A005048 - EPA 3050B											
Duplicate (A005048-DUP1)		**Source: 1001529-13**			Prepared: 04-May-10 Analyzed: 05-May-10						
Lead	49.4	0.45	0.90	mg/kg		44.1			11.4	20	
Matrix Spike (A005048-MS1)		**Source: 1001529-13**			Prepared: 04-May-10 Analyzed: 05-May-10						
Lead	322	1.9	3.8	mg/kg	282	44.1	98.3	61-138		20	
Matrix Spike Dup (A005048-MSD1)		**Source: 1001529-13**			Prepared: 04-May-10 Analyzed: 05-May-10						
Lead	296	1.7	3.4	mg/kg	254	44.1	98.9	61-138	0.629	20	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara	Project Number: 08-25430	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	12-May-10 07:38

STLC Metals by 6000/7000 Series Methods - Quality Control

Analyte	Result	Method Limit	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
Batch A005131 - EPA 3005A Leachate											
Blank (A005131-BLK1)					Prepared: 10-May-10 Analyzed: 11-May-10						
Lead	ND	0.00050	0.0010	mg/L							
LCS (A005131-BS1)					Prepared: 10-May-10 Analyzed: 11-May-10						
Lead	0.150	0.00050	0.0010	mg/L	0.150		100	85-115		20	
LCS Dup (A005131-BSD1)					Prepared: 10-May-10 Analyzed: 11-May-10						
Lead	0.150	0.00050	0.0010	mg/L	0.150		99.9	85-115	0.392	20	
Duplicate (A005131-DUP1)	**Source: 1001529-01**				Prepared: 10-May-10 Analyzed: 11-May-10						
Lead	6.41	0.025	0.050	mg/L		6.52			1.65	20	
Matrix Spike (A005131-MS1)	**Source: 1001529-01**				Prepared: 10-May-10 Analyzed: 11-May-10						
Lead	11.9	0.050	0.10	mg/L	6.00	6.52	89.6	64-153		20	
Matrix Spike Dup (A005131-MSD1)	**Source: 1001529-01**				Prepared: 10-May-10 Analyzed: 11-May-10						
Lead	12.5	0.050	0.10	mg/L	6.00	6.52	98.9	64-153	9.92	20	

Notes and Definitions

QR-04	The RPD exceeded the QC control limits.
QM-08	The spike recovery was outside acceptance limits for the MS and/or MSD. The QC Batch was accepted based on LCS/LCSD percent recoveries and RPD values.
QM-04	Visual evaluation of the sample indicates the RPD is above the control limit due to a non-homogeneous sample matrix.
N-06	STLC analyte concentration exceeds STLC limit.
N-03	Analyte concentration above 20 X TCLP.
N-02	Analyte concentration below TTLC but above 10 X STLC.
N-01	Analyte concentration exceeds TTLC.
DET	Analyte DETECTED
ND	Analyte NOT DETECTED at or above the reporting limit
NR	Not Reported
dry	Sample results reported on a dry weight basis
RPD	Relative Percent Difference

Oilfield Environmental and Compliance
307 Roemer Way Suite 300, Santa Maria CA 93454
phone: (805) 922-4772 fax: (805) 925-3376 www.oecusa.com

Highway 33, McKittrick CA
phone: (661) 762-9143

CHAIN OF CUSTODY

Company: Rincon Consultants, Inc.
Address: 790 East Santa Clara Street
City/State/ZIP: Ventura, CA 93001
Phone: 8056411000 Fax: 8056411072 E-mail: schecker@rinconconsult
Report To: Rincon Sampler: Shawn Decker
Send report via- FAX- ☐ PDF- ☒ Coll/LUFT EDF- ☐ EDD- ☐
Turnaround Time: 10 Days- ☐ 5 Days- ☐ 72 hr- ☐ 48 hr- ☐ 24 hr- ☒ ASAP- ☐

Project Name/#: 125 State 08-25430
Site: 125 State Street, Santa Barbara, CA

Special Instructions: Δ-0000 5/6/10 RESULTS TUES 5/11/10

OEC Sample ID	Date/Time Sampled	Matrix	# of Cont.	Client Sample ID	Total Lead Compound	8260B
1001529-1A	5-3-10/13:30	Soil	1	CS1	X	Δ
2A	13:40			CS2	X	Δ
3A	13:50			CS3	X	
4A	14:00			CS4	X	
5A	14:10			CS5	X	Δ
6A	14:20			CS6	X	Δ
7A	14:30			CS7	X	Δ
8A	14:40			CS8	X	Δ
9A	14:50			CS9	X	Δ
10A	15:00			CS10	X	Δ
11A	15:10			CS11	X	Δ
12A	15:20			CS12	X	Δ

Relinquished By: [signature]	Date: 5-4-10	Time: 0940
Received By: [signature]	Date: 5-4-10	Time: 0940
Relinquished By: [signature]	Date: 5-4-10	Time: 1232
Received By: [signature]	Date: 5-4-10	Time: 1232
Relinquished By:	Date:	Time:
Received By:	Date:	Time:

Comments/PO#: see quote from John Hatzman for 125 State rush turnaround

Oilfield Environmental and Compliance

307 Roemer Way Suite 300, Santa Maria CA 93454
phone: (805) 922-4772 fax: (805) 925-3376 www.oecusa.com

Highway 33, McKittrick CA
phone: (661) 762-9143

CHAIN OF CUSTODY

Company: Rincon Consultants, Inc.
Address: 790 East Santa Clara Street
City/State/ZIP: Ventura, CA 93001
Phone: 8056411000 Fax: 8056411072 E-mail: sdulls@rincon-consultants.com

Project Name/#: 125 State 08-25430
Site: 125 State Street, Santa Barbara, CA

Report To:
Sampler:
Send report via- FAX- ☐ PDF- ☒ Coll/LUFT EDF- ☐ EDD- ☐
Turnaround Time: 10 Days- ☐ 5 Days- ☐ 72 hr- ☐ 48 hr- ☐ 24 hr- ☒ ASAP- ☐

Analysis Requested

OEC Sample ID	Date/Time Sampled	Matrix	# of Cont.	Client Sample ID	Total Lead (200.7/6010)	Stockpile									Special Instructions:
1001529-13A	5-4-10/8:00	Soil	1	CS13	X										
14A	8:05			CS14	X										
15A	8:10			CS15	X										
16A	8:15			CS16	X										
17A	8:20			CS17	X										
18A	8:25			CS18	X										
19A	8:30			CS19	X										
20A	8:35			CS20	X										
21A	8:40			CS21	X	△									
22A	8:45			CS22	X	△									

Relinquished By:	[signature]	Date: 5-4-10	Time: 0940
Received By:	[signature]	Date: 5-4-10	Time: 0940
Relinquished By:	[signature]	Date: 5-4-10	Time: 1232
Received By:	Lynnette Yeo	Date: 5-4-10	Time: 1232
Relinquished By:		Date:	Time:
Received By:		Date:	Time:

Comments/PO#: Pricing from John Hetzman quote

Oilfield Environmental and Compliance
307 Roemer Way Suite 300, Santa Maria CA 93454
phone: (805) 922-4772 fax: (805) 925-3376 www.oecusa.com

Highway 33, McKittrick CA
phone: (661) 762-9143

CHAIN OF CUSTODY

Company: Rincon Consultants, Inc.
Address: 790 East Santa Clara Street
City/State/ZIP: Ventura, CA 93001
Phone: 805 6411000 Fax: 805 6411072 E-mail: sdalks@rinconconsultants.com

Project Name/#: 125 State 08-25430
Site: 125 State Street, Santa Barbara, CA

Report To: Sampler:
Send report via- FAX- ☐ PDF- ☒ Colt/LUFT EDF- ☐ EDD- ☐
Turnaround Time: 10 Days- ☐ 5 Days- ☐ 72 hr- ☐ 48 hr- ☐ 24 hr- ☒ ASAP- ☐

OEC Sample ID	Date/Time Sampled	Matrix	# of Cont.	Client Sample ID	Analysis Requested: Total Lead (6010/7000)	Special Instructions:
1001529-13A	5-4-10/8:00	Soil	1	CS13	X	
14A	8:05			CS14	X	
15A	8:10			CS15	X	
16A	8:15			CS16	X	
17A	8:20			CS17	X	
18A	8:25			CS18	X	
19A	8:30			CS19	X	
20A	8:35			CS20	X	
21A	8:40			CS21	X	
22A	8:45			CS22	X	

Relinquished By:		Date: 5-4-10	Time: 0940
Received By:		Date: 5-4-10	Time: 0940
Relinquished By:		Date: 5-4-10	Time: 1232
Received By:	Lynnette Yeo	Date: 5-4-10	Time: 1232
Relinquished By:		Date:	Time:
Received By:		Date:	Time:

Comments/PO#: Pricing from John Heterman quote

Oilfield Environmental and Compliance
307 Roemer Way Suite 300, Santa Maria CA 93454
phone: (805) 922-4772 fax: (805) 925-3376 www.oecusa.com

Highway 33, McKittrick CA
phone: (661) 762-9143

CHAIN OF CUSTODY

Company: Rincon Consultants, Inc.
Address: 790 East Santa Clara Street
City/State/ZIP: Ventura, CA 93001
Phone: 8056411000 Fax: 8056411072 E-mail: schecke@rinconconsult
Report To: Rincon Sampler: Shawn Decker
Send report via- FAX- ☐ PDF- ☒ Colt/LUFT EDF- ☐ EDD- ☐
Turnaround Time: 10 Days- ☐ 5 Days- ☐ 72 hr- ☐ 48 hr- ☐ 24 hr- ☒ ASAP- ☐

Project Name/#: 125 State 08-25430
Site: 125 State Street, Santa Barbara, CA

OEC Sample ID	Date/Time Sampled	Matrix	# of Cont.	Client Sample ID	Total Lead Compounds										Special Instructions:
1001529-1A	5-3-10/13:30	Soil	1	CS1	X										
2A	13:40			CS2	X										
3A	13:50			CS3	X										
4A	14:00			CS4	X										
5A	14:10			CS5	X										
6A	14:20			CS6	X										
7A	14:30			CS7	X										
8A	14:40			CS8	X										
9A	14:50			CS9	X										
10A	15:00			CS10	X										
11A	15:10			CS11	X										
12A	15:20			CS12	X										

Relinquished By:	Date: 5-4-10	Time: 0940
Received By:	Date: 5-4-10	Time: 0940
Relinquished By:	Date: 5-4-10	Time: 1232
Received By:	Date: 5-4-10	Time: 1232
Relinquished By:	Date:	Time:
Received By:	Date:	Time:

Comments/PO#: see quote from John Hutzman for 125 State rush turnaround

OEC SAMPLE RECEIPT

Rev. 01/15/10

CLIENT: Rincon OEC ID #: 1001529 Temp: 1 °C

Acceptable Range: 0°C to 6°C

COC RECEIVED DATE/TIME: 5-4-10 1232

RECEIPT LOGIN DATE/TIME: 5-4-10 1322

REFRIGERATOR(s): _____

SAMPLE TRANSPORT, RECEIPT, CONDITION & PRESERVATION:

		Yes	No	N/A
☑ OEC Courier/Sampler	COC document(s) received with samples	☑	☐*	☐
☐ Delivery(Other than OEC Courier)	Correct containers for analysis requested	☑	☐*	☐
☑ Samples Received on Ice	Container(s) intact and in good condition	☑	☐*	☐
☐ Samples Received Outside Temp. Range*	Container label(s) consistent with COC	☑	☐*	☐
☐ Samples Direct from field (Outside Temp)	OEC preservative added (**note std ID)	☐**	☐	☑
☐ After-Hours Outside Drop-off [Brought Inside]	Proper preservation on sample label(s)	☐	☐	☑
(Initials/Date/Time):	VOA containers free of headspace	☐	☐*	☑
	Tedlar Bags free of condensation	☐	☐*	☑

(*) PROBLEM CHAIN FORM NEEDED

Custody Seals (circle): Present / Absent

Samples / Coolers Intact / Broken*

Method of Shipment & Tracking #(if applicable):

(**) OEC Preservative ID:

Dissolved Metals Filtration: (Date/Init/Preserve ID)

CONTAINERS, COC CHANGES AND/OR CORRECTIONS

CHANGES AUTHORIZED BY:

OEC ID	Client ID ***If blank, refer to CoC	Container Description	Preservative	ResCl /pH	Matrix	Date/Time Sampled ***	Comments / Remarks / Condition Notes, Etc.
1-22A		1-8oz glass ea.	—	—	Solid		

RECEIPT LOGIN BY: GM

RECEIPT REVIEWED BY: [signature]

Oilfield Environmental and Compliance, INC.

Shawn Decker
Rincon Consultants
790 East Santa Clara Street
Santa Barbara, CA 93001

11 June 2010

RE: 125 State Street Excavation

Work Order: 1001544

Dear Client:

Enclosed is an analytical report for the above referenced project. The samples included in this report were received on 05-May-10 13:00 and analyzed in accordance with the attached chain-of-custody.

Unless otherwise noted, all analytical testing was accomplished in accordance with the guidelines established in our Quality Assurance Manual, applicable standard operating procedures, and other related documentation. The results in this analytical report are limited to the samples tested and any reproduction thereof must be made in its entirety.

If you have any questions regarding this report, please do not hesitate to contact the undersigned.

Sincerely,

Lisa Race

Laboratory Manager

TEL: (805) 922-4772
307 Roemer Way, Suite 300, Santa Maria, CA 93454 www.oecusa.com FAX: (805) 925-3376

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara Street	Project Number: 08-25430	**Reported:**
Santa Barbara CA, 93001	Project Manager: Shawn Decker	11-Jun-10 14:28

ANALYTICAL REPORT FOR SAMPLES

Sample ID	Laboratory ID	Matrix	Date Sampled	Date Received
CS 23	1001544-01	Solid	04-May-10 13:00	05-May-10 13:00
CS 24	1001544-02	Solid	04-May-10 13:10	05-May-10 13:00
CS 25	1001544-03	Solid	04-May-10 13:20	05-May-10 13:00
CS 26	1001544-04	Solid	04-May-10 13:30	05-May-10 13:00
CS 27	1001544-05	Solid	04-May-10 13:40	05-May-10 13:00
CS 28	1001544-06	Solid	04-May-10 13:50	05-May-10 13:00
CS 29	1001544-07	Solid	04-May-10 14:00	05-May-10 13:00
CS 30	1001544-08	Solid	04-May-10 14:10	05-May-10 13:00
CS 31	1001544-09	Solid	04-May-10 14:20	05-May-10 13:00
CS 32	1001544-10	Solid	04-May-10 14:30	05-May-10 13:00
CS 33	1001544-11	Solid	04-May-10 14:40	05-May-10 13:00
CS 34	1001544-12	Solid	04-May-10 14:50	05-May-10 13:00
CS 35	1001544-13	Solid	04-May-10 15:00	05-May-10 13:00
CS 36	1001544-14	Solid	04-May-10 15:10	05-May-10 13:00

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara Street	Project Number: 08-25430	**Reported:**
Santa Barbara CA, 93001	Project Manager: Shawn Decker	11-Jun-10 14:28

CS 23

1001544-01 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**20**	0.47	0.93	mg/kg	5	A005074	06-May-10	06-May-10	EPA 6020	

CS 24

1001544-02 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**220**	1.8	3.6	mg/kg	20	A005074	06-May-10	06-May-10	EPA 6020	N-02, N-03
STLC Metals by 6000/7000 Series Methods										
Lead	**10**	0.050	0.10	mg/L	100	A005132	10-May-10	12-May-10	STLC/EPA 6020	N-06

CS 25

1001544-03 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**250**	1.9	3.8	mg/kg	20	A005074	06-May-10	06-May-10	EPA 6020	N-02, N-03
STLC Metals by 6000/7000 Series Methods										
Lead	**40**	0.25	0.50	mg/L	500	A005132	10-May-10	12-May-10	STLC/EPA 6020	N-06
TCLP Metals by 6000/7000 Series Methods										
Lead	**2.0**	0.0050	0.010	mg/L	10	A006154	09-Jun-10	10-Jun-10	EPA 1311/EPA 6020	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara Street	Project Number: 08-25430	**Reported:**
Santa Barbara CA, 93001	Project Manager: Shawn Decker	11-Jun-10 14:28

CS 26

1001544-04 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**55**	0.49	0.97	mg/kg	5	A005074	06-May-10	06-May-10	EPA 6020	N-02
STLC Metals by 6000/7000 Series Methods										
Lead	**3.8**	0.010	0.020	mg/L	20	A005132	10-May-10	12-May-10	STLC/EPA 6020	

CS 27

1001544-05 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**67**	0.48	0.97	mg/kg	5	A005074	06-May-10	06-May-10	EPA 6020	N-02
STLC Metals by 6000/7000 Series Methods										
Lead	**4.4**	0.010	0.020	mg/L	20	A005132	10-May-10	12-May-10	STLC/EPA 6020	

CS 28

1001544-06 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**240**	1.9	3.8	mg/kg	20	A005074	06-May-10	06-May-10	EPA 6020	N-02, N-03
STLC Metals by 6000/7000 Series Methods										
Lead	**13**	0.050	0.10	mg/L	100	A005132	10-May-10	12-May-10	STLC/EPA 6020	N-06

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara Street	Project Number: 08-25430	**Reported:**
Santa Barbara CA, 93001	Project Manager: Shawn Decker	11-Jun-10 14:28

CS 29

1001544-07 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**140**	0.93	1.9	mg/kg	10	A005074	06-May-10	06-May-10	EPA 6020	N-02, N-03
STLC Metals by 6000/7000 Series Methods										
Lead	**14**	0.050	0.10	mg/L	100	A005132	10-May-10	12-May-10	STLC/EPA 6020	N-06
TCLP Metals by 6000/7000 Series Methods										
Lead	**0.23**	0.0050	0.010	mg/L	10	A006154	09-Jun-10	10-Jun-10	EPA 1311/EPA 6020	

CS 30

1001544-08 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**120**	0.47	0.94	mg/kg	5	A005074	06-May-10	06-May-10	EPA 6020	N-02, N-03
STLC Metals by 6000/7000 Series Methods										
Lead	**4.9**	0.010	0.020	mg/L	20	A005132	10-May-10	12-May-10	STLC/EPA 6020	

CS 31

1001544-09 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**1400**	9.0	18	mg/kg	100	A005074	06-May-10	06-May-10	EPA 6020	N-01, N-03
STLC Metals by 6000/7000 Series Methods										
Lead	**38**	0.10	0.20	mg/L	200	A005132	10-May-10	12-May-10	STLC/EPA 6020	N-06

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara Street	Project Number: 08-25430	**Reported:**
Santa Barbara CA, 93001	Project Manager: Shawn Decker	11-Jun-10 14:28

CS 32

1001544-10 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**320**	1.8	3.6	mg/kg	20	A005074	06-May-10	06-May-10	EPA 6020	N-02, N-03
STLC Metals by 6000/7000 Series Methods										
Lead	**19**	0.050	0.10	mg/L	100	A005132	10-May-10	12-May-10	STLC/EPA 6020	N-06

CS 33

1001544-11 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**67**	0.47	0.93	mg/kg	5	A005074	06-May-10	06-May-10	EPA 6020	N-02
STLC Metals by 6000/7000 Series Methods										
Lead	**12**	0.050	0.10	mg/L	100	A005132	10-May-10	12-May-10	STLC/EPA 6020	N-06

CS 34

1001544-12 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**5.8**	0.48	0.97	mg/kg	5	A005074	06-May-10	06-May-10	EPA 6020	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara Street	Project Number: 08-25430	**Reported:**
Santa Barbara CA, 93001	Project Manager: Shawn Decker	11-Jun-10 14:28

CS 35
1001544-13 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**440**	1.8	3.6	mg/kg	20	A005074	06-May-10	06-May-10	EPA 6020	N-02, N-03
STLC Metals by 6000/7000 Series Methods										
Lead	**42**	0.10	0.20	mg/L	200	A005132	10-May-10	12-May-10	STLC/EPA 6020	N-06
TCLP Metals by 6000/7000 Series Methods										
Lead	**4.9**	0.010	0.020	mg/L	20	A006154	09-Jun-10	11-Jun-10	EPA 1311/EPA 6020	

CS 36
1001544-14 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**240**	1.8	3.5	mg/kg	20	A005074	06-May-10	06-May-10	EPA 6020	N-02, N-03
STLC Metals by 6000/7000 Series Methods										
Lead	**12**	0.050	0.10	mg/L	100	A005132	10-May-10	12-May-10	STLC/EPA 6020	N-06

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara Street	Project Number: 08-25430	**Reported:**
Santa Barbara CA, 93001	Project Manager: Shawn Decker	11-Jun-10 14:28

Total Metals by EPA 6000/7000 Series Methods - Quality Control

Analyte	Result	Method Limit	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
Batch A005074 - EPA 3050B											
Blank (A005074-BLK1)					Prepared & Analyzed: 06-May-10						
Lead	ND	0.10	0.20	mg/kg							
LCS (A005074-BS1)					Prepared & Analyzed: 06-May-10						
Lead	14.6	0.10	0.20	mg/kg	15.0		97.5	85-115		20	
LCS Dup (A005074-BSD1)					Prepared & Analyzed: 06-May-10						
Lead	14.5	0.10	0.20	mg/kg	15.0		96.6	85-115	0.904	20	
Duplicate (A005074-DUP1)	**Source: 1001544-01**				Prepared & Analyzed: 06-May-10						
Lead	21.6	0.47	0.95	mg/kg		20.2			6.32	20	
Matrix Spike (A005074-MS1)	**Source: 1001544-01**				Prepared & Analyzed: 06-May-10						
Lead	293	1.9	3.7	mg/kg	280	20.2	97.6	61-138		20	
Matrix Spike Dup (A005074-MSD1)	**Source: 1001544-01**				Prepared & Analyzed: 06-May-10						
Lead	309	1.9	3.9	mg/kg	292	20.2	98.8	61-138	1.23	20	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara Street	Project Number: 08-25430	**Reported:**
Santa Barbara CA, 93001	Project Manager: Shawn Decker	11-Jun-10 14:28

STLC Metals by 6000/7000 Series Methods - Quality Control

Analyte	Result	Method Limit	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
Batch A005132 - EPA 3005A Leachate											
Blank (A005132-BLK1)					Prepared: 10-May-10 Analyzed: 11-May-10						
Lead	ND	0.00050	0.0010	mg/L							
LCS (A005132-BS1)					Prepared: 10-May-10 Analyzed: 11-May-10						
Lead	0.149	0.00050	0.0010	mg/L	0.150		99.2	85-115		20	
LCS Dup (A005132-BSD1)					Prepared: 10-May-10 Analyzed: 11-May-10						
Lead	0.149	0.00050	0.0010	mg/L	0.150		99.3	85-115	0.129	20	
Duplicate (A005132-DUP1)	**Source: 1001544-02**				Prepared: 10-May-10 Analyzed: 12-May-10						
Lead	11.4	0.050	0.10	mg/L		10.3			9.88	20	
Matrix Spike (A005132-MS1)	**Source: 1001544-02**				Prepared: 10-May-10 Analyzed: 12-May-10						
Lead	17.9	0.050	0.10	mg/L	6.00	10.3	126	64-153		20	
Matrix Spike Dup (A005132-MSD1)	**Source: 1001544-02**				Prepared: 10-May-10 Analyzed: 12-May-10						
Lead	20.0	0.050	0.10	mg/L	6.00	10.3	161	64-153	24.7	20	QM-05

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara Street	Project Number: 08-25430	**Reported:**
Santa Barbara CA, 93001	Project Manager: Shawn Decker	11-Jun-10 14:28

TCLP Metals by 6000/7000 Series Methods - Quality Control

Analyte	Result	Method Limit	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
Batch A006154 - EPA 3005A Leachate											
Blank (A006154-BLK1)					Prepared: 09-Jun-10 Analyzed: 10-Jun-10						
Lead	ND	0.00050	0.0010	mg/L							
LCS (A006154-BS1)					Prepared: 09-Jun-10 Analyzed: 10-Jun-10						
Lead	0.158	0.00050	0.0010	mg/L	0.150		105	85-115		20	
LCS Dup (A006154-BSD1)					Prepared: 09-Jun-10 Analyzed: 10-Jun-10						
Lead	0.153	0.00050	0.0010	mg/L	0.150		102	85-115	3.14	20	
Duplicate (A006154-DUP1)	**Source: 1001582-17**				Prepared: 09-Jun-10 Analyzed: 10-Jun-10						
Lead	0.736	0.0050	0.010	mg/L		0.736			0.0109	20	
Matrix Spike (A006154-MS1)	**Source: 1001582-17**				Prepared: 09-Jun-10 Analyzed: 10-Jun-10						
Lead	7.19	0.020	0.040	mg/L	6.00	0.736	108	64-153		20	
Matrix Spike Dup (A006154-MSD1)	**Source: 1001582-17**				Prepared: 09-Jun-10 Analyzed: 10-Jun-10						
Lead	7.08	0.020	0.040	mg/L	6.00	0.736	106	64-153	1.74	20	

Notes and Definitions

QM-05	The spike recovery was outside acceptance limits for the MS and/or MSD due to matrix interference. The LCS and/or LCSD were within acceptance limits showing that the laboratory is in control and the data is acceptable.
N-06	STLC analyte concentration exceeds STLC limit.
N-03	Analyte concentration above 20 X TCLP.
N-02	Analyte concentration below TTLC but above 10 X STLC.
N-01	Analyte concentration exceeds TTLC.
DET	Analyte DETECTED
ND	Analyte NOT DETECTED at or above the reporting limit
NR	Not Reported
dry	Sample results reported on a dry weight basis
RPD	Relative Percent Difference

Oilfield Environmental and Compliance
307 Roemer Way Suite 300, Santa Maria CA 93454
phone: (805) 922-4772 fax: (805) 925-3376 www.oecusa.com

Highway 33, McKittrick CA
phone: (661) 762-9143

CHAIN OF CUSTODY

Page 1 of 2

Company: Rincon Consultants, Inc.
Address: 790 East Santa Clara Street
City/State/ZIP: Ventura, CA 93001
Phone: 805 641 1000 Fax: 805 641 1072 E-mail: sdecker@rinconconsultants.com

Project Name/#: 125 State Street 08-25430
Site: 125 State St, Santa Barbara, CA

Report To: Sampler:
Send report via- FAX- ☐ PDF- ☒ Colt/LUFT EDF- ☐ EDD- ☐
Turnaround Time: 10 Days- ☐ 5 Days- ☐ 72 hr- ☐ 48 hr- ☐ 24 hr- ☒ ASAP- ☐

Analysis Requested

OEC Sample ID	Date/Time Sampled	Matrix	# of Cont.	Client Sample ID	Total Lead 6000/7000	TCLP Pb	TCLP Pb								Special Instructions:
1001544-1A	5-4-10/13:00	Soil	1	CS23	X										MDL
-2A	13:10			CS24	X	△									
-3A	13:20			CS25	X	△	⊗								
-4A	13:30			CS26	X	△									
-5A	13:40			CS27	X	△									
-6A	13:50			CS28	X	△									
-7A	14:00			CS29	X	△	⊗								
-8A	14:10			CS30	X	△									
-9A	14:20			CS31	X	△									
-10A	14:30			CS32	X	△									
-11A	14:40			CS33	X	△									
-12A	14:50			CS34	X										

Relinquished By: [signature]	Date: 5-5-10	Time: 1130	
Received By: [signature]	Date: 5-5-10	Time: 1130	
Relinquished By: [signature]	Date: 5-5-10	Time: 1300	
Received By: Lynnette Yeo	Date: 5-5-10	Time: 1300	
Relinquished By:	Date:	Time:	
Received By:	Date:	Time:	

Comments/PO#: Bill per 125 State Quote
[illegible] 5/1/10 (BL)

Oilfield Environmental and Compliance

307 Roemer Way Suite 300, Santa Maria CA 93454
phone: (805) 922-4772 fax: (805) 925-3376 www.oecusa.com

Highway 33, McKittrick CA
phone: (661) 762-9143

CHAIN OF CUSTODY

Page 2 of 2

Company: Rincon Consultants, Inc.
Address: 790 East Santa Clara Street
City/State/ZIP: Ventura, CA 93001
Phone: 8056411000 Fax: 8056411072 E-mail: sdecker@rinconconsultants.com
Report To: Rincon Sampler: Shawn Decker
Send report via- FAX- ☐ PDF- ☒ Coit/LUFT EDF- ☐ EDD- ☐
Turnaround Time: 10 Days- ☐ 5 Days- ☐ 72 hr- ☐ 48 hr- ☐ 24 hr- ☒ ASAP- ☐

Project Name/#: 125 State 08-25450
Site: 125 State St., Santa Barbara, CA

OEC Sample ID	Date/Time Sampled	Matrix	# of Cont.	Client Sample ID	Total Lead 6000/7000	Barium	TCLP								Special Instructions:
1001544-13A	5-4-10/1500	Soil	1	CS35	X	Δ	⊗								MDL
-14A	↓ 1510			CS36	X	Δ									

Relinquished By: [signature] Date: 5-5-10 Time: 1130
Received By: [signature] Date: 5-5-10 Time: 1130
Relinquished By: [signature] Date: 5-5-10 Time: 1300
Received By: [signature] Date: 5-5-10 Time: 1300
Relinquished By: Date: Time:
Received By: Date: Time:

Comments/PO#: Bill per 125 State quote

Δ-add-on 5/7/10

Oilfield Environmental and Compliance
307 Roemer Way Suite 300, Santa Maria CA 93454
phone: (805) 922-4772 fax: (805) 925-3376 www.oecusa.com

Highway 33, McKittrick CA
phone: (661) 762-9143

CHAIN OF CUSTODY

Page 1 of 2

Company: Rincon Consultants, Inc.
Address: 790 East Santa Clara Street
City/State/ZIP: Ventura, CA 93001
Phone: 805 641 1000 Fax: 805 641 1072 E-mail: sdecker@rinconconsultants.com

Project Name/#: 125 State Street 08-25430
Site: 125 State St, Santa Barbara, CA

Report To: Sampler:
Send report via- FAX- ☐ PDF- ☒ Colt/LUFT EDF- ☐ EDD- ☐
Turnaround Time: 10 Days- ☐ 5 Days- ☐ 72 hr- ☐ 48 hr- ☐ 24 hr- ☒ ASAP- ☐

OEC Sample ID	Date/Time Sampled	Matrix	# of Cont.	Client Sample ID	Total Lead 6000/7000	STLC Pb								Special Instructions:
1001544-1A	5-4-10/13:00	Soil	1	CS23	X									MDL
-2A	13:10			CS24	X	△								
-3A	13:20			CS25	X	△								
-4A	13:30			CS26	X	△								
-5A	13:40			CS27	X	△								
-6A	13:50			CS28	X	△								
-7A	14:00			CS29	X	△								
-8A	14:10			CS30	X	△								
-9A	14:20			CS31	X	△								
-10A	14:30			CS32	X	△								
-11A	14:40			CS33	X	△								
-12A	14:50			CS34	X									

Relinquished By: [signature]	Date: 5-5-10	Time: 1130	Comments/PO#: Bill per 125 State Quote
Received By: [signature]	Date: 5-5-10	Time: 1130	[illegible] 5/7/10
Relinquished By: [signature]	Date: 5-5-10	Time: 1300	
Received By: Lynnette Yeo	Date: 5-5-10	Time: 1300	
Relinquished By:	Date:	Time:	
Received By:	Date:	Time:	

Oilfield Environmental and Compliance
307 Roemer Way Suite 300, Santa Maria CA 93454
phone: (805) 922-4772 fax: (805) 925-3376 www.oecusa.com

Highway 33, McKittrick CA
phone: (661) 762-9143

CHAIN OF CUSTODY

Company: Rincon Consultants, Inc.
Address: 790 East Santa Clara Street
City/State/ZIP: Ventura, CA 93001
Phone: 8056411000 Fax: 8056411072 E-mail: sdecker@rinconconsultants.com
Report To: Rincon Sampler: Shawn Decker
Send report via- FAX- ☐ PDF- ☒ Colt/LUFT EDF- ☐ EDD- ☐
Turnaround Time: 10 Days- ☐ 5 Days- ☐ 72 hr- ☐ 48 hr- ☐ 24 hr- ☒ ASAP- ☐

Project Name/#: 125 State 08-25450
Site: 125 State St., Santa Barbara, CA

OEC Sample ID	Date/Time Sampled	Matrix	# of Cont.	Client Sample ID	Total Lead 6000/7000	Barium	Special Instructions:
1001544-13	5-4-10/1500	Soil	1	C535	X	Δ	MDL
-14A	↓ 1510			C536	X	Δ	

Relinquished By: [signature] Date: 5-5-10 Time: 1130
Received By: [signature] Date: 5-5-10 Time: 1130
Relinquished By: [signature] Date: 5-5-10 Time: 1300
Received By: [signature] Date: 5-5-10 Time: 1300
Relinquished By: Date: Time:
Received By: Date: Time:

Comments/PO#: Bill per 125 State quote
Δ - add-on 5/7/10

Oilfield Environmental and Compliance

307 Roemer Way Suite 300, Santa Maria CA 93454
phone: (805) 922-4772 fax: (805) 925-3376 www.oecusa.com

Highway 33, McKittrick CA
phone: (661) 762-9143

CHAIN OF CUSTODY

Page 1 of 2

Company: Rincon Consultants, Inc.
Address: 790 East Santa Clara Street
City/State/ZIP: Ventura, CA 93001
Phone: 805 641 1000 Fax: 805 641 1072 E-mail: sdecker@rinconconsultants.com

Project Name/#: 125 State Street 08-25430
Site: 125 State St, Santa Barbara, CA

Report To: Sampler:
Send report via- FAX- ☐ PDF- ☒ Colt/LUFT EDF- ☐ EDD- ☐
Turnaround Time: 10 Days- ☐ 5 Days- ☐ 72 hr- ☐ 48 hr- ☐ 24 hr- ☒ ASAP- ☐

Analysis Requested: Total Lead 6000/7000

Special Instructions:

OEC Sample ID	Date/Time Sampled	Matrix	# of Cont.	Client Sample ID	Total Lead 6000/7000										Special Instructions
1001544-1A	5-4-10/13:00	Soil	1	CS23	X										MDL
-2A	13:10			CS24	X										
-3A	13:20			CS25	X										
-4A	13:30			CS26	X										
-5A	13:40			CS27	X										
-6A	13:50			CS28	X										
-7A	14:00			CS29	X										
-8A	14:10			CS30	X										
-9A	14:20			CS31	X										
-10A	14:30			CS32	X										
-11A	14:40			CS33	X										
-12A	14:50			CS34	X										

Relinquished By: [signature]	Date: 5-5-10	Time: 1130
Received By: [signature]	Date: 5-5-10	Time: 1130
Relinquished By: [signature]	Date: 5-5-10	Time: 1300
Received By: Lynnette Yeo	Date: 5-5-10	Time: 1300
Relinquished By:	Date:	Time:
Received By:	Date:	Time:

Comments/PO#: Bill per 125 State Quote

Oilfield Environmental and Compliance
307 Roemer Way Suite 300, Santa Maria CA 93454
phone: (805) 922-4772 fax: (805) 925-3376 www.oecusa.com

Highway 33, McKittrick CA
phone: (661) 762-9143

CHAIN OF CUSTODY

Company: Rincon Consultants, Inc.
Address: 790 East Santa Clara Street
City/State/ZIP: Ventura, CA 93001
Phone: 8056411000 Fax: 8056411072 E-mail: sdecker@rinconconsultants.com
Report To: Rincon Sampler: Shawn Decker
Send report via- FAX- ☐ PDF- ☒ Col/LUFT EDF- ☐ EDD- ☐
Turnaround Time: 10 Days- ☐ 5 Days- ☐ 72 hr- ☐ 48 hr- ☐ 24 hr- ☒ ASAP- ☐

Project Name/#: 125 State 08-25450
Site: 125 State St., Santa Barbara, CA

OEC Sample ID	Date/Time Sampled	Matrix	# of Cont.	Client Sample ID	Total Lead 6000/7000										Special Instructions:
1001544-13A	5-4-10/15:00	Soil	1	CS35	X										MDL
-14A	↓ 15:10			CS36	X										

Relinquished By:		Date: 5-5-10	Time: 1130
Received By:		Date: 5-5-10	Time: 1130
Relinquished By:		Date: 5-5-10	Time: 1300
Received By:		Date: 5-5-10	Time: 1300
Relinquished By:		Date:	Time:
Received By:		Date:	Time:

Comments/PO#: Bill per 125 State quote

OEC SAMPLE RECEIPT

Rev. 01/15/10

CLIENT: Rincon OEC ID #: 1001540 Temp: 0 °C
Acceptable Range: 0°C to 6°C

COC RECEIVED DATE/TIME: 5/5/10 1300 RECEIPT LOGIN DATE/TIME: 5-5-10 1350 REFRIGERATOR(s): 1

SAMPLE TRANSPORT, RECEIPT, CONDITION & PRESERVATION:

		Yes	No	N/A
☒ OEC Courier/Sampler	COC document(s) received with samples	☒	☐*	☐
☐ Delivery(Other than OEC Courier)	Correct containers for analysis requested	☒	☐*	☐
☒ Samples Received on Ice	Container(s) intact and in good condition	☒	☐*	☐
☐ Samples Received Outside Temp. Range*	Container label(s) consistent with COC	☒	☐*	☐
☐ Samples Direct from field (Outside Temp)	OEC preservative added (**note std ID)	☐**	☐	☒
☐ After-Hours Outside Drop-off [Brought Inside]	Proper preservation on sample label(s)	☐	☐	☒
(Initials/Date/Time):	VOA containers free of headspace	☐	☐*	☒
	Tedlar Bags free of condensation	☐	☐*	☒

(*) PROBLEM CHAIN FORM NEEDED

Custody Seals (circle): Present (Absent)
Samples / Coolers Intact / Broken*
Method of Shipment & Tracking #(if applicable):
(**) OEC Preservative ID:
Dissolved Metals Filtration: (Date/Init/Preserve ID)

CONTAINERS, COC CHANGES AND/OR CORRECTIONS — CHANGES AUTHORIZED BY:

OEC ID	Client ID ***If blank, refer to CoC	Container Description	Preservative	ResCl /pH	Matrix	Date/Time Sampled ***	Comments / Remarks / Condition Notes, Etc.
1-14A		1-8oz glass ea	–	–	solid		

RECEIPT LOGIN BY: Ly RECEIPT REVIEWED BY: SM

Oilfield Environmental and Compliance, INC.

Shawn Decker
Rincon Consultants
790 East Santa Clara Street
Santa Barbara, CA 93001

11 June 2010

RE: 125 State Street Excavation

Work Order: 1001582

Dear Client:

Enclosed is an analytical report for the above referenced project. The samples included in this report were received on 06-May-10 16:20 and analyzed in accordance with the attached chain-of-custody.

Unless otherwise noted, all analytical testing was accomplished in accordance with the guidelines established in our Quality Assurance Manual, applicable standard operating procedures, and other related documentation. The results in this analytical report are limited to the samples tested and any reproduction thereof must be made in its entirety.

If you have any questions regarding this report, please do not hesitate to contact the undersigned.

Sincerely,

Lisa Race

Laboratory Manager

TEL: (805) 922-4772
307 Roemer Way, Suite 300, Santa Maria, CA 93454 www.oecusa.com FAX: (805) 925-3376

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara Street	Project Number: 08-25430	**Reported:**
Santa Barbara CA, 93001	Project Manager: Shawn Decker	11-Jun-10 14:31

ANALYTICAL REPORT FOR SAMPLES

Sample ID	Laboratory ID	Matrix	Date Sampled	Date Received
CS37	1001582-01	Solid	06-May-10 13:00	06-May-10 16:20
CS38	1001582-02	Solid	06-May-10 13:05	06-May-10 16:20
CS39	1001582-03	Solid	06-May-10 13:10	06-May-10 16:20
CS40	1001582-04	Solid	06-May-10 13:15	06-May-10 16:20
CS41	1001582-05	Solid	06-May-10 13:20	06-May-10 16:20
CS42	1001582-06	Solid	06-May-10 13:25	06-May-10 16:20
CS43	1001582-07	Solid	06-May-10 13:30	06-May-10 16:20
CS44	1001582-08	Solid	06-May-10 13:35	06-May-10 16:20
CS45	1001582-09	Solid	06-May-10 13:40	06-May-10 16:20
CS46	1001582-10	Solid	06-May-10 13:45	06-May-10 16:20
CS47	1001582-11	Solid	06-May-10 13:50	06-May-10 16:20
CS53	1001582-12	Solid	06-May-10 14:00	06-May-10 16:20
CS54	1001582-13	Solid	06-May-10 08:30	06-May-10 16:20
CS55	1001582-14	Solid	05-May-10 16:00	06-May-10 16:20
CS56	1001582-15	Solid	06-May-10 14:05	06-May-10 16:20
CS57	1001582-16	Solid	05-May-10 16:05	06-May-10 16:20
CS58	1001582-17	Solid	06-May-10 13:30	06-May-10 16:20
CS59	1001582-18	Solid	06-May-10 13:35	06-May-10 16:20
CS60	1001582-19	Solid	06-May-10 14:30	06-May-10 16:20
CS61	1001582-20	Solid	06-May-10 14:35	06-May-10 16:20
CS62	1001582-21	Solid	06-May-10 14:40	06-May-10 16:20

CS37

1001582-01 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**44**	0.50	1.0	mg/kg	5	A005095	07-May-10	07-May-10	EPA 6020	

CS38

1001582-02 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**6.6**	0.47	0.95	mg/kg	5	A005095	07-May-10	07-May-10	EPA 6020	

CS39

1001582-03 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**6.9**	0.45	0.89	mg/kg	5	A005095	07-May-10	07-May-10	EPA 6020	

CS40

1001582-04 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**6.6**	0.48	0.96	mg/kg	5	A005095	07-May-10	07-May-10	EPA 6020	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara Street	Project Number: 08-25430	**Reported:**
Santa Barbara CA, 93001	Project Manager: Shawn Decker	11-Jun-10 14:31

CS41

1001582-05 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**220**	1.7	3.4	mg/kg	20	A005095	07-May-10	07-May-10	EPA 6020	N-02, N-03
STLC Metals by 6000/7000 Series Methods										
Lead	**17**	0.050	0.10	mg/L	50	A005143	11-May-10	12-May-10	STLC/EPA 6020	N-06

CS42

1001582-06 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**180**	0.97	1.9	mg/kg	10	A005095	07-May-10	07-May-10	EPA 6020	N-02, N-03
STLC Metals by 6000/7000 Series Methods										
Lead	**8.0**	0.025	0.050	mg/L	50	A005143	11-May-10	12-May-10	STLC/EPA 6020	N-06

CS43

1001582-07 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**74**	0.48	0.97	mg/kg	5	A005095	07-May-10	07-May-10	EPA 6020	N-02
STLC Metals by 6000/7000 Series Methods										
Lead	**9.4**	0.025	0.050	mg/L	50	A005143	11-May-10	12-May-10	STLC/EPA 6020	N-06

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara Street	Project Number: 08-25430	**Reported:**
Santa Barbara CA, 93001	Project Manager: Shawn Decker	11-Jun-10 14:31

CS44

1001582-08 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**110**	0.48	0.97	mg/kg	5	A005095	07-May-10	07-May-10	EPA 6020	N-02, N-03
STLC Metals by 6000/7000 Series Methods										
Lead	**9.9**	0.050	0.10	mg/L	100	A005143	11-May-10	12-May-10	STLC/EPA 6020	N-06

CS45

1001582-09 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**25**	0.43	0.87	mg/kg	5	A005095	07-May-10	07-May-10	EPA 6020	

CS46

1001582-10 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**46**	0.46	0.92	mg/kg	5	A005095	07-May-10	07-May-10	EPA 6020	

CS47

1001582-11 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**9.6**	0.42	0.84	mg/kg	5	A005095	07-May-10	07-May-10	EPA 6020	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara Street	Project Number: 08-25430	**Reported:**
Santa Barbara CA, 93001	Project Manager: Shawn Decker	11-Jun-10 14:31

CS53
1001582-12 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**10**	0.49	0.99	mg/kg	5	A005096	07-May-10	07-May-10	EPA 6020	

CS54
1001582-13 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**4.2**	0.47	0.93	mg/kg	5	A005096	07-May-10	07-May-10	EPA 6020	

CS55
1001582-14 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**5.6**	0.46	0.91	mg/kg	5	A005096	07-May-10	07-May-10	EPA 6020	

CS56
1001582-15 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**300**	1.9	3.7	mg/kg	20	A005096	07-May-10	07-May-10	EPA 6020	N-02, N-03
STLC Metals by 6000/7000 Series Methods										
Lead	**25**	0.10	0.20	mg/L	200	A005143	11-May-10	12-May-10	STLC/EPA 6020	N-06

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara Street	Project Number: 08-25430	**Reported:**
Santa Barbara CA, 93001	Project Manager: Shawn Decker	11-Jun-10 14:31

CS57
1001582-16 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**13**	0.47	0.94	mg/kg	5	A005096	07-May-10	07-May-10	EPA 6020	

CS58
1001582-17 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**290**	1.8	3.7	mg/kg	20	A005096	07-May-10	07-May-10	EPA 6020	N-02, N-03
STLC Metals by 6000/7000 Series Methods										
Lead	**38**	0.10	0.20	mg/L	200	A005143	11-May-10	12-May-10	STLC/EPA 6020	N-06
TCLP Metals by 6000/7000 Series Methods										
Lead	**0.74**	0.0050	0.010	mg/L	10	A006154	09-Jun-10	10-Jun-10	EPA 1311/EPA 6020	

CS59
1001582-18 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**370**	2.0	3.9	mg/kg	20	A005096	07-May-10	07-May-10	EPA 6020	N-02, N-03
STLC Metals by 6000/7000 Series Methods										
Lead	**49**	0.25	0.50	mg/L	500	A005143	11-May-10	12-May-10	STLC/EPA 6020	N-06
TCLP Metals by 6000/7000 Series Methods										
Lead	**1.8**	0.0050	0.010	mg/L	10	A006154	09-Jun-10	10-Jun-10	EPA 1311/EPA 6020	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara Street	Project Number: 08-25430	**Reported:**
Santa Barbara CA, 93001	Project Manager: Shawn Decker	11-Jun-10 14:31

CS60
1001582-19 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**17**	0.47	0.95	mg/kg	5	A005096	07-May-10	07-May-10	EPA 6020	

CS61
1001582-20 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**380**	1.9	3.8	mg/kg	20	A005096	07-May-10	07-May-10	EPA 6020	N-02, N-03
STLC Metals by 6000/7000 Series Methods										
Lead	**16**	0.050	0.10	mg/L	100	A005143	11-May-10	12-May-10	STLC/EPA 6020	N-06

CS62
1001582-21 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**79**	0.49	0.98	mg/kg	5	A005096	07-May-10	07-May-10	EPA 6020	N-02
STLC Metals by 6000/7000 Series Methods										
Lead	**5.2**	0.025	0.050	mg/L	50	A005143	11-May-10	12-May-10	STLC/EPA 6020	N-06

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara Street	Project Number: 08-25430	**Reported:**
Santa Barbara CA, 93001	Project Manager: Shawn Decker	11-Jun-10 14:31

Total Metals by EPA 6000/7000 Series Methods - Quality Control

Analyte	Result	Method Limit	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
Batch A005095 - EPA 3050B											
Blank (A005095-BLK1)					Prepared & Analyzed: 07-May-10						
Lead	ND	0.10	0.20	mg/kg							
LCS (A005095-BS1)					Prepared & Analyzed: 07-May-10						
Lead	15.0	0.10	0.20	mg/kg	15.0		100	85-115		20	
LCS Dup (A005095-BSD1)					Prepared & Analyzed: 07-May-10						
Lead	15.1	0.10	0.20	mg/kg	15.0		101	85-115	0.608	20	
Duplicate (A005095-DUP1)	**Source: 1001582-01**				Prepared & Analyzed: 07-May-10						
Lead	39.3	0.47	0.95	mg/kg		43.5			10.2	20	
Matrix Spike (A005095-MS1)	**Source: 1001582-01**				Prepared & Analyzed: 07-May-10						
Lead	331	2.0	3.9	mg/kg	296	43.5	97.3	61-138		20	
Matrix Spike Dup (A005095-MSD1)	**Source: 1001582-01**				Prepared & Analyzed: 07-May-10						
Lead	313	1.9	3.7	mg/kg	280	43.5	96.2	61-138	1.09	20	
Batch A005096 - EPA 3050B											
Blank (A005096-BLK1)					Prepared & Analyzed: 07-May-10						
Lead	ND	0.10	0.20	mg/kg							
LCS (A005096-BS1)					Prepared & Analyzed: 07-May-10						
Lead	15.2	0.10	0.20	mg/kg	15.0		101	85-115		20	
LCS Dup (A005096-BSD1)					Prepared & Analyzed: 07-May-10						
Lead	15.1	0.10	0.20	mg/kg	15.0		101	85-115	0.338	20	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara Street	Project Number: 08-25430	**Reported:**
Santa Barbara CA, 93001	Project Manager: Shawn Decker	11-Jun-10 14:31

Total Metals by EPA 6000/7000 Series Methods - Quality Control

Analyte	Result	Method Limit	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
Batch A005096 - EPA 3050B											
Duplicate (A005096-DUP1)		**Source: 1001582-12**			Prepared & Analyzed: 07-May-10						
Lead	8.37	0.46	0.92	mg/kg		10.0			18.1	20	
Matrix Spike (A005096-MS1)		**Source: 1001582-12**			Prepared & Analyzed: 07-May-10						
Lead	283	1.8	3.7	mg/kg	274	10.0	99.5	61-138		20	
Matrix Spike Dup (A005096-MSD1)		**Source: 1001582-12**			Prepared & Analyzed: 07-May-10						
Lead	298	1.9	3.8	mg/kg	285	10.0	101	61-138	1.40	20	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara Street	Project Number: 08-25430	**Reported:**
Santa Barbara CA, 93001	Project Manager: Shawn Decker	11-Jun-10 14:31

STLC Metals by 6000/7000 Series Methods - Quality Control

Analyte	Result	Method Limit	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
Batch A005143 - EPA 3005A Leachate											
Blank (A005143-BLK1)					Prepared: 11-May-10 Analyzed: 12-May-10						
Lead	ND	0.00050	0.0010	mg/L							
LCS (A005143-BS1)					Prepared: 11-May-10 Analyzed: 12-May-10						
Lead	0.148	0.00050	0.0010	mg/L	0.150		98.7	85-115		20	
LCS Dup (A005143-BSD1)					Prepared: 11-May-10 Analyzed: 12-May-10						
Lead	0.149	0.00050	0.0010	mg/L	0.150		99.3	85-115	0.597	20	
Duplicate (A005143-DUP1)	**Source: 1001582-05**				Prepared: 11-May-10 Analyzed: 12-May-10						
Lead	17.4	0.050	0.10	mg/L		16.9			3.20	20	
Matrix Spike (A005143-MS1)	**Source: 1001582-05**				Prepared: 11-May-10 Analyzed: 12-May-10						
Lead	25.8	0.050	0.10	mg/L	6.00	16.9	149	64-153		20	
Matrix Spike Dup (A005143-MSD1)	**Source: 1001582-05**				Prepared: 11-May-10 Analyzed: 12-May-10						
Lead	25.9	0.050	0.10	mg/L	6.00	16.9	151	64-153	1.21	20	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara Street	Project Number: 08-25430	**Reported:**
Santa Barbara CA, 93001	Project Manager: Shawn Decker	11-Jun-10 14:31

TCLP Metals by 6000/7000 Series Methods - Quality Control

Analyte	Result	Method Limit	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
Batch A006154 - EPA 3005A Leachate											
Blank (A006154-BLK1)					Prepared: 09-Jun-10 Analyzed: 10-Jun-10						
Lead	ND	0.00050	0.0010	mg/L							
LCS (A006154-BS1)					Prepared: 09-Jun-10 Analyzed: 10-Jun-10						
Lead	0.158	0.00050	0.0010	mg/L	0.150		105	85-115		20	
LCS Dup (A006154-BSD1)					Prepared: 09-Jun-10 Analyzed: 10-Jun-10						
Lead	0.153	0.00050	0.0010	mg/L	0.150		102	85-115	3.14	20	
Duplicate (A006154-DUP1)		**Source: 1001582-17**			Prepared: 09-Jun-10 Analyzed: 10-Jun-10						
Lead	0.736	0.0050	0.010	mg/L		0.736			0.0109	20	
Matrix Spike (A006154-MS1)		**Source: 1001582-17**			Prepared: 09-Jun-10 Analyzed: 10-Jun-10						
Lead	7.19	0.020	0.040	mg/L	6.00	0.736	108	64-153		20	
Matrix Spike Dup (A006154-MSD1)		**Source: 1001582-17**			Prepared: 09-Jun-10 Analyzed: 10-Jun-10						
Lead	7.08	0.020	0.040	mg/L	6.00	0.736	106	64-153	1.74	20	

Notes and Definitions

N-06	STLC analyte concentration exceeds STLC limit.
N-03	Analyte concentration above 20 X TCLP.
N-02	Analyte concentration below TTLC but above 10 X STLC.
DET	Analyte DETECTED
ND	Analyte NOT DETECTED at or above the reporting limit
NR	Not Reported
dry	Sample results reported on a dry weight basis
RPD	Relative Percent Difference

Oilfield Environmental and Compliance
307 Roemer Way Suite 300, Santa Maria CA 93454
phone: (805) 922-4772 fax: (805) 925-3376 www.oecusa.com

Highway 33, McKittrick CA
phone: (661) 762-9143

CHAIN OF CUSTODY

Company: Rincon Consultants, Inc.
Address: 790 East Santa Clara Street
City/State/ZIP: Ventura, CA 93001
Phone: 805 6411000 Fax: 805 6411072 E-mail: shawn@rinconconsultants.com
Report To: Rincon Sampler: Shawn Decker
Send report via- FAX- ☐ PDF- ☒ Colt/LUFT EDF- ☐ EDD- ☐
Turnaround Time: 10 Days- ☐ 5 Days- ☐ 72 hr- ☐ 48 hr- ☐ 24 hr- ☒ ASAP- ☐

Project Name/#: 125 State 08-25430
Site: 125 State Street, Santa Barbara, CA

OEC Sample ID	Date/Time Sampled	Matrix	# of Cont.	Client Sample ID	Total Lead 6000/7000	5520	TCLP								Special Instructions:
1001582-12A	5-6-10/14:00	Soil	1	CS53	X										⊗ ADD-ON 4/24/10 MDL
13A	5-6-10/8:30			CS54	X										
14A	5-5-10/16:00			CS55	X										
15A	5-6-10/14:05			CS56	X	△									
16A	5-5-10/16:05			CS57	X										
17A	5-6-10/13:30			CS58	X	△	⊗								
18A	5-6-10/13:35			CS59	X	△	⊗								
19A	5-6-10/14:30			CS60	X										
20A	5-6-10/14:35			CS61	X	△									
21A	5-6-10/14:40			CS62	X	△									

Relinquished By:	Date: 5-6-10	Time: 1501
Received By:	Date: 5/6/10	Time: 1501
Relinquished By:	Date: 5/6/10	Time: 1620
Received By:	Date: 5-6-10	Time: 1620
Relinquished By:	Date:	Time:
Received By:	Date:	Time:

Comments/PO#: △ ADD-ON 5/7/10

Oilfield Environmental and Compliance
307 Roemer Way Suite 300, Santa Maria CA 93454
phone: (805) 922-4772 fax: (805) 925-3376 www.oecusa.com

Highway 33, McKittrick CA
phone: (661) 762-9143

CHAIN OF CUSTODY

Company: Rincon Consultants, Inc.
Address: 790 East Santa Clara Street
City/State/ZIP: Ventura, CA 93001
Phone: 805 641 1000 Fax: 805 641 1072 E-mail: shecker@rinconconsultants.com
Report To: Rincon Sampler: Shawn Decker
Send report via- FAX- ☐ PDF- ☒ Colt/LUFT EDF- ☐ EDD- ☐
Turnaround Time: 10 Days- ☐ 5 Days- ☐ 72 hr- ☐ 48 hr- ☐ 24 hr- ☒ ASAP- ☐

Project Name/#: 125 State 08-25430
Site: 125 State Street, Santa Barbara, CA

OEC Sample ID	Date/Time Sampled	Matrix	# of Cont.	Client Sample ID	Total Lead 6000/7000	STLC Pb									Special Instructions:
10015821A	5-6-10/13:00	Soil	1	CS37	X										MDL
2A	13:05			CS38	X										
3A	13:10			CS39	X										
4A	13:15			CS40	X										
5A	13:20			CS41	X	Δ									
6A	13:25			CS42	X	Δ									
7A	13:30			CS43	X	Δ									
8A	13:35			CS44	X	Δ									
9A	13:40			CS45	X										
10A	13:45			CS46	X										
11A	13:50			CS47	X										

Relinquished By:	Date: 5-6-10	Time: 1501
Received By:	Date: 5/6/10	Time: 1501
Relinquished By:	Date: 5/6/10	Time: 1620
Received By:	Date: 5-6-10	Time: 1620
Relinquished By:	Date:	Time:
Received By:	Date:	Time:

Comments/PO#: Price per 125 State Quote

Δ-ADD-5-7-10

Oilfield Environmental and Compliance
307 Roemer Way Suite 300, Santa Maria CA 93454
phone: (805) 922-4772 fax: (805) 925-3376 www.oecusa.com
Highway 33, McKittrick CA
phone: (661) 762-9143

CHAIN OF CUSTODY

Company: Rincon Consultants, Inc.
Address: 790 East Santa Clara Street
City/State/ZIP: Ventura, CA 93001
Phone: 805 6411000 Fax: 805 6411072 E-mail: [illegible]
Report To: Rincon Sampler: Shawn Decker
Send report via- FAX- ☐ PDF- ☒ Colt/LUFT EDF- ☐ EDD- ☐
Turnaround Time: 10 Days- ☐ 5 Days- ☐ 72 hr- ☐ 48 hr- ☐ 24 hr- ☒ ASAP- ☐

Project Name/#: 125 State 08-25430
Site: 125 State Street, Santa Barbara, CA

OEC Sample ID	Date/Time Sampled	Matrix	# of Cont.	Client Sample ID	Total Lead 6000/7000	5520									Special Instructions:
1001582-12A	5-6-10/14:00	Soil	1	CS53	X										MDL
13A	5-6-10/8:30			CS54	X										
14A	5-5-10/16:00			CS55	X										
15A	5-6-10/14:05			CS56	X	△									
16A	5-5-10/16:05			CS57	X										
17A	5-6-10/13:30			CS58	X	△									
18A	5-6-10/13:35			CS59	X	△									
19A	5-6-10/14:30			CS60	X										
20A	5-6-10/14:35			CS61	X	△									
21A	5-6-10/14:40			CS62	X	△									

Relinquished By: [signature]	Date: 5-6-10	Time: 1501	
Received By: [signature]	Date: 5/6/10	Time: 1501	
Relinquished By: [signature]	Date: 5/6/10	Time: 1620	
Received By: [signature]	Date: 5-6-10	Time: 1620	
Relinquished By:	Date:	Time:	
Received By:	Date:	Time:	

Comments/PO#: Δ 100.0 5/6/10

Oilfield Environmental and Compliance

707 Roemer Way Suite 300, Santa Maria CA 93454
phone: (805) 922-4772 fax: (805) 925-3376 www.oecusa.com

Highway 33, McKittrick CA
phone: (661) 762-9143

CHAIN OF CUSTODY

Rincon Consultants, Inc.
90 East Santa Clara Street
State/ZIP: Ventura, CA 93001
Phone: 805 641 1000 Fax: 805 641 1072 E-mail: sdecker@rincon-ms.com
Report To: Rincon Sampler: Shawn Decker
Send report via- FAX- ☐ PDF- ☒ Colt/LUFT EDF- ☐ EDD- ☐
Turnaround Time: 10 Days- ☐ 5 Days- ☐ 72 hr- ☐ 48 hr- ☐ 24 hr- ☒ ASAP- ☐

Project Name/#: 125 State 08-25430
Site: 125 State Street, Santa Barbara, CA

OEC Sample ID	Date/Time Sampled	Matrix	# of Cont.	Client Sample ID	Analysis Requested: Total Lead 6000/7000									Special Instructions:
10015821A	5-6-10/13:00	Soil	1	CS37	X									MDL
2A	13:05			CS38	X									
3A	13:10			CS39	X									
4A	13:15			CS40	X									
5A	13:20			CS41	X									
6A	13:25			CS42	X									
7A	13:30			CS43	X									
8A	13:35			CS44	X									
9A	13:40			CS45	X									
10A	13:45			CS46	X									
11A	13:50			CS47	X									
~~12A~~	~~13:55~~	~~Soil~~	~~1~~	~~CS48~~	~~X~~									~~MDL~~

Relinquished By:	Date: 5-6-10	Time: 1501
Received By:	Date: 5/6/10	Time: 1501
Relinquished By:	Date: 5/6/10	Time: 1620
Received By:	Date: 5-6-10	Time: 1620
Relinquished By:	Date:	Time:
Received By:	Date:	Time:

Comments/PO#: Price per 125 State Quote

Oilfield Environmental and Compliance
307 Roemer Way Suite 300, Santa Maria CA 93454
phone: (805) 922-4772 fax: (805) 925-3376 www.oecusa.com
Highway 33, McKittrick CA
phone: (661) 762-9143

CHAIN OF CUSTODY

Company: Rincon Consultants, Inc.
Address: 790 East Santa Clara Street
City/State/ZIP: Ventura, CA 93001
Phone: 805 6411000 Fax: 805 6411072 E-mail: [illegible]@rinconconsultants.com
Report To: Rincon Sampler: Shawn Decker
Send report via- FAX- ☐ PDF- ☒ Colt/LUFT EDF- ☐ EDD- ☐
Turnaround Time: 10 Days- ☐ 5 Days- ☐ 72 hr- ☐ 48 hr- ☐ 24 hr- ☒ ASAP- ☐

Project Name/#: 125 State 08-25430
Site: 125 State Street, Santa Barbara, CA

OEC Sample ID	Date/Time Sampled	Matrix	# of Cont.	Client Sample ID	Total Lead 6000/7000	Special Instructions:
1001582-12A	5-6-10/14:00	Soil	1	CS53	X	MDL
13A	5-6-10/8:30			CS54	X	
14A	5-5-10/16:00			CS55	X	
15A	5-6-10/14:05			CS56	X	
16A	5-5-10/16:05			CS57	X	
17A	5-6-10/13:30			CS58	X	
18A	5-6-10/13:35			CS59	X	
19A	5-6-10/14:30			CS60	X	
20A	5-6-10/14:35			CS61	X	
21A	5-6-10/14:40			CS62	X	

Relinquished By: [signature]	Date: 5-6-10	Time: 1501	Comments/PO#:
Received By: [signature]	Date: 5/6/10	Time: 1501	
Relinquished By: [signature]	Date: 5/6/10	Time: 1620	
Received By: [signature]	Date: 5-6-10	Time: 1620	
Relinquished By:	Date:	Time:	
Received By:	Date:	Time:	

OEC SAMPLE RECEIPT

Rev 01/15/10

CLIENT: Rincon

OEC ID #: 1001582

Temp: 1 °C
Acceptable Range: 0°C to 6°C

COC RECEIVED DATE/TIME: 5/6/10 1620

RECEIPT LOGIN DATE/TIME: 5/6/10 1645

REFRIGERATOR(s): 1

SAMPLE TRANSPORT, RECEIPT, CONDITION & PRESERVATION:

		Yes	No	N/A
☒ OEC Courier/Sampler	COC document(s) received with samples	☒	☐*	☐
☐ Delivery(Other than OEC Courier)	Correct containers for analysis requested	☒	☐*	☐
☒ Samples Received on Ice	Container(s) intact and in good condition	☒	☐*	☐
☐ Samples Received Outside Temp. Range*	Container label(s) consistent with COC	☐	☐*	☐
☐ Samples Direct from field (Outside Temp)	OEC preservative added (**note std ID)	☐**	☐	☒
☐ After-Hours Outside Drop-off [Brought Inside]	Proper preservation on sample label(s)	☐	☐	☒
(Initials/Date/Time):	VOA containers free of headspace	☐	☐*	☒
	Tedlar Bags free of condensation	☐	☐*	☒

(*) PROBLEM CHAIN FORM NEEDED

Custody Seals (circle): Present (Absent)

Samples / Coolers Intact / Broken*

Method of Shipment & Tracking #(if applicable).

(**) OEC Preservative ID:

Dissolved Metals Filtration: (Date/Init/Preserve ID)

CONTAINERS, COC CHANGES AND/OR CORRECTIONS

CHANGES AUTHORIZED BY:

OEC ID	Client ID ***If blank, refer to CoC	Container Description	Preservative	ResCl /pH	Matrix	Date/Time Sampled ***	Comments / Remarks / Condition Notes, Etc.
1-21A		1-8oz glass	—	—	Solid		

RECEIPT LOGIN BY: [signature]

RECEIPT REVIEWED BY: SM

Oilfield Environmental and Compliance, INC.

Shawn Decker
Rincon Consultants
790 East Santa Clara
Ventura, CA 93455

18 May 2010

RE: 125 State Street Excavation

Work Order: 1001596

Dear Client:

Enclosed is an analytical report for the above referenced project. The samples included in this report were received on 07-May-10 16:10 and analyzed in accordance with the attached chain-of-custody.

Unless otherwise noted, all analytical testing was accomplished in accordance with the guidelines established in our Quality Assurance Manual, applicable standard operating procedures, and other related documentation. The results in this analytical report are limited to the samples tested and any reproduction thereof must be made in its entirety.

If you have any questions regarding this report, please do not hesitate to contact the undersigned.

Sincerely,

Lisa Race

Laboratory Manager

TEL: (805) 922-4772
307 Roemer Way, Suite 300, Santa Maria, CA 93454 www.oecusa.com FAX: (805) 925-3376

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara	Project Number: 08-25430	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	18-May-10 10:34

ANALYTICAL REPORT FOR SAMPLES

Sample ID	Laboratory ID	Matrix	Date Sampled	Date Received
CS72	1001596-01	Solid	07-May-10 12:00	07-May-10 16:10
CS74	1001596-02	Solid	07-May-10 12:10	07-May-10 16:10

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara	Project Number: 08-25430	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	18-May-10 10:34

CS72
1001596-01 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**180**	0.95	1.9	mg/kg	10	A005119	10-May-10	10-May-10	EPA 6020	N-02, N-03
STLC Metals by 6000/7000 Series Methods										
Lead	**2.7**	0.010	0.020	mg/L	20	A005218	14-May-10	17-May-10	STLC/EPA 6020	

CS74
1001596-02 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**20**	0.44	0.88	mg/kg	5	A005119	10-May-10	10-May-10	EPA 6020	

Oilfield Environmental and Compliance, INC.

Rincon Consultants 790 East Santa Clara Ventura CA, 93455	Project: 125 State Street Excavation Project Number: 08-25430 Project Manager: Shawn Decker	**Reported:** 18-May-10 10:34

Total Metals by EPA 6000/7000 Series Methods - Quality Control

Analyte	Result	Method Limit	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
Batch A005119 - EPA 3050B											
Blank (A005119-BLK1)					Prepared & Analyzed: 10-May-10						
Lead	ND	0.10	0.20	mg/kg							
LCS (A005119-BS1)					Prepared & Analyzed: 10-May-10						
Lead	14.8	0.10	0.20	mg/kg	15.0		98.7	85-115		20	
LCS Dup (A005119-BSD1)					Prepared & Analyzed: 10-May-10						
Lead	14.8	0.10	0.20	mg/kg	15.0		98.6	85-115	0.157	20	
Duplicate (A005119-DUP1)	**Source: 1001596-01**				Prepared & Analyzed: 10-May-10						
Lead	71.6	0.49	0.98	mg/kg		177			84.8	20	QM-04
Matrix Spike (A005119-MS1)	**Source: 1001596-01**				Prepared & Analyzed: 10-May-10						
Lead	351	1.8	3.5	mg/kg	265	177	65.5	61-138		20	
Matrix Spike Dup (A005119-MSD1)	**Source: 1001596-01**				Prepared & Analyzed: 10-May-10						
Lead	390	2.0	4.0	mg/kg	297	177	71.7	61-138	9.08	20	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara	Project Number: 08-25430	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	18-May-10 10:34

STLC Metals by 6000/7000 Series Methods - Quality Control

Analyte	Result	Method Limit	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
Batch A005218 - EPA 3005A Leachate											
Blank (A005218-BLK1)					Prepared: 14-May-10 Analyzed: 17-May-10						
Lead	ND	0.00050	0.0010	mg/L							
LCS (A005218-BS1)					Prepared: 14-May-10 Analyzed: 17-May-10						
Lead	0.143	0.00050	0.0010	mg/L	0.150		95.3	85-115		20	
LCS Dup (A005218-BSD1)					Prepared: 14-May-10 Analyzed: 17-May-10						
Lead	0.142	0.00050	0.0010	mg/L	0.150		94.8	85-115	0.583	20	
Duplicate (A005218-DUP1)		**Source: 1001596-01**			Prepared: 14-May-10 Analyzed: 17-May-10						
Lead	2.63	0.010	0.020	mg/L		2.71			2.96	20	
Matrix Spike (A005218-MS1)		**Source: 1001596-01**			Prepared: 14-May-10 Analyzed: 17-May-10						
Lead	9.34	0.020	0.040	mg/L	6.00	2.71	110	64-153		20	
Matrix Spike Dup (A005218-MSD1)		**Source: 1001596-01**			Prepared: 14-May-10 Analyzed: 17-May-10						
Lead	9.35	0.020	0.040	mg/L	6.00	2.71	111	64-153	0.116	20	

Notes and Definitions

QM-04	Visual evaluation of the sample indicates the RPD is above the control limit due to a non-homogeneous sample matrix.
N-03	Analyte concentration above 20 X TCLP.
N-02	Analyte concentration below TTLC but above 10 X STLC.
DET	Analyte DETECTED
ND	Analyte NOT DETECTED at or above the reporting limit
NR	Not Reported
dry	Sample results reported on a dry weight basis
RPD	Relative Percent Difference

Oilfield Environmental and Compliance

307 Roemer Way Suite 300, Santa Maria CA 93454
phone: (805) 922-4772 fax: (805) 925-3376 www.oecusa.com

Highway 33, McKittrick CA
phone: (661) 762-9143

CHAIN OF CUSTODY

Page 1 of 1

Company: Rincon Consultants, Inc.
Address: 790 East Santa Clara Street
City/State/ZIP: Ventura, CA 93001
Phone: 805 641 1000 Fax: 805 641 1072 E-mail: sdeakes@rinconconsultants.com
Report To: Rincon Sampler: SD
Send report via- FAX- ☐ PDF- ☒ Colt/LUFT EDF- ☐ EDD- ☐
Turnaround Time: 10 Days- ☐ 5 Days- ☐ 72 hr- ☐ 48 hr- ☐ 24 hr- ☒ ASAP- ☐

Project Name/#: 125 State 08-25430
Site: 125 State Street, Santa Barbara, CA

OEC Sample ID	Date/Time Sampled	Matrix	# of Cont.	Client Sample ID	Total Lead 6000/7000	SVOC 8									Special Instructions:
1001596-1A	5-7-10/12:00	Soil	1	CS72	X	X									MDL
-2A	12:10	↓	↓	CS74	X										↓

Relinquished By:		Date: 5-7-10	Time: 1448
Received By:		Date: 5/7/10	Time: 1448
Relinquished By:		Date: 5/7/10	Time: 1610
Received By:	Lynnette Yeo	Date: 5-7-10	Time: 1610
Relinquished By:		Date:	Time:
Received By:		Date:	Time:

Comments/PO#: Price per 125 State Quote
A-000-00 5/11/10

Oilfield Environmental and Compliance
307 Roemer Way Suite 300, Santa Maria CA 93454
phone: (805) 922-4772 fax: (805) 925-3376 www.oecusa.com

Highway 33, McKittrick CA
phone: (661) 762-9143

CHAIN OF CUSTODY

Page 1 of 1

Company: Rincon Consultants, Inc.
Address: 790 East Santa Clara Street
City/State/ZIP: Ventura, CA 93001
Phone: 805 641 1000 Fax: 805 641 1072 E-mail: sdeckler@rinconconsultants.com
Report To: Rincon Sampler: SD
Send report via- FAX- ☐ PDF- ☒ Colt/LUFT EDF- ☐ EDD- ☐
Turnaround Time: 10 Days- ☐ 5 Days- ☐ 72 hr- ☐ 48 hr- ☐ 24 hr- ☒ ASAP- ☐

Project Name/#: 125 State 08-25430
Site: 125 State Street, Santa Barbara, CA

OEC Sample ID	Date/Time Sampled	Matrix	# of Cont.	Client Sample ID	Total Lead 6000/7000	Special Instructions:
1001596-1A	5-7-10/12:00	Soil	1	CS72	X	MDL
-2A	12:10			CS74	X	

Relinquished By:		Date: 5-7-10	Time: 1448
Received By:		Date: 5/7/10	Time: 1448
Relinquished By:		Date: 5/7/10	Time: 1610
Received By:	Lynnette Yeo	Date: 5-7-10	Time: 1610
Relinquished By:		Date:	Time:
Received By:		Date:	Time:

Comments/PO#: Price per 125 State Quote

OEC SAMPLE RECEIPT

Rev 01/15/10

CLIENT: Rincon

OEC ID #: 1001596

Temp: 1 °C
Acceptable Range: 0°C to 6°C

COC RECEIVED DATE/TIME: 5-7-10 1610

RECEIPT LOGIN DATE/TIME: 5-7-10 1628

REFRIGERATOR(s): 1

SAMPLE TRANSPORT, RECEIPT, CONDITION & PRESERVATION:		Yes	No	N/A	(*) PROBLEM CHAIN FORM NEEDED
☒ OEC Courier/Sampler	COC document(s) received with samples	☒	☐*	☐	Custody Seals (circle): Present / Absent
☐ Delivery(Other than OEC Courier)	Correct containers for analysis requested	☒	☐*	☐	Samples / Coolers
☒ Samples Received on Ice	Container(s) intact and in good condition	☒	☐*	☐	Intact / Broken*
☐ Samples Received Outside Temp. Range*	Container label(s) consistent with COC	☒	☐*	☐	Method of Shipment & Tracking #(if applicable):
☐ Samples Direct from field (Outside Temp)	OEC preservative added (**note std ID)	☐**	☐	☒	
☐ After-Hours Outside Drop-off [Brought Inside]	Proper preservation on sample label(s)	☐	☐	☒	(**) OEC Preservative ID:
(Initials/Date/Time):	VOA containers free of headspace	☐	☐*	☒	Dissolved Metals Filtration: (Date/Init/Preserve ID)
	Tedlar Bags free of condensation	☐	☐*	☒	

CONTAINERS, COC CHANGES AND/OR CORRECTIONS — CHANGES AUTHORIZED BY:

OEC ID	Client ID ***If blank, refer to CoC	Container Description	Preservative	ResCl /pH	Matrix	Date/Time Sampled ***	Comments / Remarks / Condition Notes, Etc.
1-2A		1-8 oz glass ea	–	–	solid		

RECEIPT LOGIN BY: Ly

RECEIPT REVIEWED BY: SM

Oilfield Environmental and Compliance, INC.

Shawn Decker
Rincon Consultants
790 East Santa Clara
Ventura, CA 93455

18 May 2010

RE: 125 State Street Excavation

Work Order: 1001619

Dear Client:

Enclosed is an analytical report for the above referenced project. The samples included in this report were received on 10-May-10 15:45 and analyzed in accordance with the attached chain-of-custody.

Unless otherwise noted, all analytical testing was accomplished in accordance with the guidelines established in our Quality Assurance Manual, applicable standard operating procedures, and other related documentation. The results in this analytical report are limited to the samples tested and any reproduction thereof must be made in its entirety.

If you have any questions regarding this report, please do not hesitate to contact the undersigned.

Sincerely,

Lisa Race

Laboratory Manager

TEL: (805) 922-4772
307 Roemer Way, Suite 300, Santa Maria, CA 93454 www.oecusa.com FAX: (805) 925-3376

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara	Project Number: 08-25430	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	18-May-10 10:37

ANALYTICAL REPORT FOR SAMPLES

Sample ID	Laboratory ID	Matrix	Date Sampled	Date Received
CS63	1001619-01	Solid	10-May-10 14:00	10-May-10 15:45
CS64	1001619-02	Solid	10-May-10 14:05	10-May-10 15:45
CS67	1001619-03	Solid	10-May-10 14:10	10-May-10 15:45
CS76	1001619-04	Solid	10-May-10 14:15	10-May-10 15:45
CS83	1001619-05	Solid	10-May-10 14:20	10-May-10 15:45
CS84	1001619-06	Solid	10-May-10 14:25	10-May-10 15:45
CS85	1001619-07	Solid	10-May-10 14:30	10-May-10 15:45

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara	Project Number: 08-25430	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	18-May-10 10:37

CS63
1001619-01 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**38**	0.46	0.92	mg/kg	5	A005144	11-May-10	11-May-10	EPA 6020	

CS64
1001619-02 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**17**	0.49	0.98	mg/kg	5	A005144	11-May-10	11-May-10	EPA 6020	

CS67
1001619-03 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**140**	0.96	1.9	mg/kg	10	A005144	11-May-10	11-May-10	EPA 6020	N-02, N-03
STLC Metals by 6000/7000 Series Methods										
Lead	**5.2**	0.025	0.050	mg/L	50	A005218	14-May-10	17-May-10	STLC/EPA 6020	N-06

CS76
1001619-04 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**25**	0.45	0.90	mg/kg	5	A005144	11-May-10	11-May-10	EPA 6020	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara	Project Number: 08-25430	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	18-May-10 10:37

CS83

1001619-05 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**46**	0.47	0.94	mg/kg	5	A005144	11-May-10	11-May-10	EPA 6020	

CS84

1001619-06 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**9.1**	0.48	0.96	mg/kg	5	A005144	11-May-10	11-May-10	EPA 6020	

CS85

1001619-07 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**5.8**	0.49	0.99	mg/kg	5	A005144	11-May-10	11-May-10	EPA 6020	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara	Project Number: 08-25430	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	18-May-10 10:37

Total Metals by EPA 6000/7000 Series Methods - Quality Control

Analyte	Result	Method Limit	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
Batch A005144 - EPA 3050B											
Blank (A005144-BLK1)					Prepared & Analyzed: 11-May-10						
Lead	ND	0.10	0.20	mg/kg							
LCS (A005144-BS1)					Prepared & Analyzed: 11-May-10						
Lead	14.7	0.10	0.20	mg/kg	15.0		98.0	85-115		20	
LCS Dup (A005144-BSD1)					Prepared & Analyzed: 11-May-10						
Lead	14.9	0.10	0.20	mg/kg	15.0		99.2	85-115	1.17	20	
Duplicate (A005144-DUP1)	**Source: 1001619-01**				Prepared & Analyzed: 11-May-10						
Lead	88.4	0.48	0.95	mg/kg		38.1			79.6	20	QM-04
Matrix Spike (A005144-MS1)	**Source: 1001619-01**				Prepared & Analyzed: 11-May-10						
Lead	302	1.8	3.6	mg/kg	269	38.1	98.0	61-138		20	
Matrix Spike Dup (A005144-MSD1)	**Source: 1001619-01**				Prepared & Analyzed: 11-May-10						
Lead	325	1.9	3.8	mg/kg	284	38.1	101	61-138	3.08	20	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara	Project Number: 08-25430	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	18-May-10 10:37

STLC Metals by 6000/7000 Series Methods - Quality Control

Analyte	Result	Method Limit	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
Batch A005218 - EPA 3005A Leachate											
Blank (A005218-BLK1)					Prepared: 14-May-10 Analyzed: 17-May-10						
Lead	ND	0.00050	0.0010	mg/L							
LCS (A005218-BS1)					Prepared: 14-May-10 Analyzed: 17-May-10						
Lead	0.143	0.00050	0.0010	mg/L	0.150		95.3	85-115		20	
LCS Dup (A005218-BSD1)					Prepared: 14-May-10 Analyzed: 17-May-10						
Lead	0.142	0.00050	0.0010	mg/L	0.150		94.8	85-115	0.583	20	
Duplicate (A005218-DUP1)		**Source: 1001596-01**			Prepared: 14-May-10 Analyzed: 17-May-10						
Lead	2.63	0.010	0.020	mg/L		2.71			2.96	20	
Matrix Spike (A005218-MS1)		**Source: 1001596-01**			Prepared: 14-May-10 Analyzed: 17-May-10						
Lead	9.34	0.020	0.040	mg/L	6.00	2.71	110	64-153		20	
Matrix Spike Dup (A005218-MSD1)		**Source: 1001596-01**			Prepared: 14-May-10 Analyzed: 17-May-10						
Lead	9.35	0.020	0.040	mg/L	6.00	2.71	111	64-153	0.116	20	

Notes and Definitions

QM-04	Visual evaluation of the sample indicates the RPD is above the control limit due to a non-homogeneous sample matrix.
N-06	STLC analyte concentration exceeds STLC limit.
N-03	Analyte concentration above 20 X TCLP.
N-02	Analyte concentration below TTLC but above 10 X STLC.
DET	Analyte DETECTED
ND	Analyte NOT DETECTED at or above the reporting limit
NR	Not Reported
dry	Sample results reported on a dry weight basis
RPD	Relative Percent Difference

Oilfield Environmental and Compliance
307 Roemer Way Suite 300, Santa Maria CA 93454
phone: (805) 922-4772 fax: (805) 925-3376 www.oecusa.com

Highway 33, McKittrick CA
phone: (661) 762-9143

CHAIN OF CUSTODY

Page 1 of 1

Company: Rincon Consultants, Inc.
Address: 790 East Santa Clara Street
City/State/ZIP: Ventura, CA 93001
Phone: 805 641 1000 Fax: 805 641 1072 E-mail: sdecker@rincon-consultants.com
Report To: Rincon Sampler: Shawn Decker
Send report via- FAX- ☐ PDF- ☒ Coit/LUFT EDF- ☐ EDD- ☐
Turnaround Time: 10 Days- ☐ 5 Days- ☐ 72 hr- ☐ 48 hr- ☐ 24 hr- ☒ ASAP- ☐

Project Name/#: 125 State 08-25430
Site: 125 State Street, Santa Barbara, CA

OEC Sample ID	Date/Time Sampled	Matrix	# of Cont.	Client Sample ID	Total Lead 6010/7000	Special Instructions:
1001619-1A	5-10-10/14:00	Soil	1	CS63	X	MDL
2A	14:05			CS64	X	
3A	14:10			CS67	X	
4A	14:15			CS76	X	
5A	14:20			CS83	X	
6A	14:25			CS84	X	
7A	14:30			CS85	X	

Relinquished By:		Date: 5-10-10	Time: 14:30
Received By:		Date: 5-10-10	Time: 14:30
Relinquished By:		Date: 5/10/10	Time: 1545
Received By:	Sherry Mobley	Date: 5/10/10	Time: 1545
Relinquished By:		Date:	Time:
Received By:		Date:	Time:

Comments/PO#: Price per 125 State Quote
Add on 5/10/10

Oilfield Environmental and Compliance

307 Roemer Way Suite 300, Santa Maria CA 93454
phone: (805) 922-4772 fax: (805) 925-3376 www.oecusa.com

Highway 33, McKittrick CA
phone: (661) 762-9143

CHAIN OF CUSTODY

Page 1 of 1

Company: Rincon Consultants, Inc.
Address: 790 East Santa Clara Street
City/State/ZIP: Ventura, CA 93001
Phone: 805 641 1000 Fax: 805 641 1072 E-mail: sdecker@rincon-consultants.com
Report To: Rincon Sampler: Shawn Decker
Send report via- FAX- ☐ PDF- ☒ Colt/LUFT EDF- ☐ EDD- ☐
Turnaround Time: 10 Days- ☐ 5 Days- ☐ 72 hr- ☐ 48 hr- ☐ 24 hr- ☒ ASAP- ☐

Project Name/#: 125 State 08-25430
Site: 125 State Street, Santa Barbara, CA

OEC Sample ID	Date/Time Sampled	Matrix	# of Cont.	Client Sample ID	Total Lead 6000/7000	Special Instructions:
1001619-1A	5-10-10/14:00	Soil	1	CS63	X	MDL
2A	14:05			CS64	X	
3A	14:10			CS67	X	
4A	14:15			CS76	X	
5A	14:20			CS83	X	
6A	14:25			CS84	X	
7A	14:30			CS85	X	

Relinquished By: [signature]	Date: 5-10-10	Time: 14:30
Received By: [signature]	Date: 5-10-10	Time: 14:30
Relinquished By: [signature]	Date: 5/10/10	Time: 1545
Received By: Sherry Mobley	Date: 5/10/10	Time: 1545
Relinquished By:	Date:	Time:
Received By:	Date:	Time:

Comments/PO#: Price per 125 State Quote

OEC SAMPLE RECEIPT

Rev 01/15/10

CLIENT: Rincon

OEC ID #: 100 1619

Temp: 1 °C
Acceptable Range: 0°C to 6°C

COC RECEIVED DATE/TIME: 5/10/10 1545

RECEIPT LOGIN DATE/TIME: 5-10-10 1558

REFRIGERATOR(s): 1

SAMPLE TRANSPORT, RECEIPT, CONDITION & PRESERVATION:

		Yes	No	N/A
☑ OEC Courier/Sampler	COC document(s) received with samples	☑	☐*	☐
☐ Delivery(Other than OEC Courier)	Correct containers for analysis requested	☑	☐*	☐
☑ Samples Received on Ice	Container(s) intact and in good condition	☑	☐*	☐
☐ Samples Received Outside Temp. Range*	Container label(s) consistent with COC	☑	☐*	☐
☐ Samples Direct from field (Outside Temp)	OEC preservative added (**note std ID)	☐**	☐	☑
☐ After-Hours Outside Drop-off [Brought Inside]	Proper preservation on sample label(s)	☐	☐	☑
(Initials/Date/Time):	VOA containers free of headspace	☐	☐*	☑
	Tedlar Bags free of condensation	☐	☐*	☑

(*) PROBLEM CHAIN FORM NEEDED

Custody Seals (circle): Present / Absent

Samples / Coolers Intact / Broken*

Method of Shipment & Tracking #(if applicable):

(**) OEC Preservative ID:

Dissolved Metals Filtration: (Date/Init/Preserve ID)

CONTAINERS, COC CHANGES AND/OR CORRECTIONS

CHANGES AUTHORIZED BY:

OEC ID	Client ID ***If blank, refer to CoC	Container Description	Preservative	ResCl /pH	Matrix	Date/Time Sampled ***	Comments / Remarks / Condition Notes, Etc.
1-7A		1-16oz glass	—	—	Solid		

RECEIPT LOGIN BY: SM

RECEIPT REVIEWED BY: [signature]

Oilfield Environmental and Compliance, INC.

Shawn Decker
Rincon Consultants
790 East Santa Clara
Ventura, CA 93455

18 May 2010

RE: 125 State Street Excavation

Work Order: 1001627

Dear Client:

Enclosed is an analytical report for the above referenced project. The samples included in this report were received on 11-May-10 16:30 and analyzed in accordance with the attached chain-of-custody.

Unless otherwise noted, all analytical testing was accomplished in accordance with the guidelines established in our Quality Assurance Manual, applicable standard operating procedures, and other related documentation. The results in this analytical report are limited to the samples tested and any reproduction thereof must be made in its entirety.

If you have any questions regarding this report, please do not hesitate to contact the undersigned.

Sincerely,

Lisa Race

Laboratory Manager

TEL: (805) 922-4772
307 Roemer Way, Suite 300, Santa Maria, CA 93454 www.oecusa.com FAX: (805) 925-3376

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara	Project Number: 08-25430	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	18-May-10 10:40

ANALYTICAL REPORT FOR SAMPLES

Sample ID	Laboratory ID	Matrix	Date Sampled	Date Received
CS48	1001627-01	Solid	11-May-10 13:00	11-May-10 16:30
CS49	1001627-02	Solid	11-May-10 13:05	11-May-10 16:30
CS50	1001627-03	Solid	11-May-10 13:10	11-May-10 16:30
CS51	1001627-04	Solid	11-May-10 13:15	11-May-10 16:30
CS65	1001627-05	Solid	11-May-10 13:20	11-May-10 16:30
CS66	1001627-06	Solid	11-May-10 13:25	11-May-10 16:30
CS68	1001627-07	Solid	11-May-10 13:30	11-May-10 16:30
CS69	1001627-08	Solid	11-May-10 13:35	11-May-10 16:30
CS73	1001627-09	Solid	11-May-10 13:40	11-May-10 16:30
CS75	1001627-10	Solid	11-May-10 13:45	11-May-10 16:30
CS76	1001627-11	Solid	11-May-10 14:30	11-May-10 16:30
CS78	1001627-12	Solid	11-May-10 14:35	11-May-10 16:30
CS79	1001627-13	Solid	11-May-10 14:40	11-May-10 16:30
CS81	1001627-14	Solid	11-May-10 14:45	11-May-10 16:30
CS82	1001627-15	Solid	11-May-10 14:50	11-May-10 16:30

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara	Project Number: 08-25430	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	18-May-10 10:40

CS48

1001627-01 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**12**	0.45	0.90	mg/kg	5	A005164	12-May-10	12-May-10	EPA 6020	

CS49

1001627-02 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**36**	0.47	0.95	mg/kg	5	A005164	12-May-10	12-May-10	EPA 6020	

CS50

1001627-03 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**16**	0.49	0.97	mg/kg	5	A005164	12-May-10	12-May-10	EPA 6020	

CS51

1001627-04 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**110**	0.49	0.97	mg/kg	5	A005164	12-May-10	12-May-10	EPA 6020	N-02, N-03
STLC Metals by 6000/7000 Series Methods										
Lead	**2.6**	0.0050	0.010	mg/L	10	A005218	14-May-10	17-May-10	STLC/EPA 6020	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara	Project Number: 08-25430	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	18-May-10 10:40

CS65
1001627-05 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**150**	0.90	1.8	mg/kg	10	A005164	12-May-10	12-May-10	EPA 6020	N-02, N-03
STLC Metals by 6000/7000 Series Methods										
Lead	**20**	0.050	0.10	mg/L	100	A005218	14-May-10	17-May-10	STLC/EPA 6020	N-06

CS66
1001627-06 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**48**	0.42	0.84	mg/kg	5	A005164	12-May-10	12-May-10	EPA 6020	

CS68
1001627-07 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**100**	0.46	0.91	mg/kg	5	A005164	12-May-10	12-May-10	EPA 6020	N-02, N-03
STLC Metals by 6000/7000 Series Methods										
Lead	**2.6**	0.0050	0.010	mg/L	10	A005218	14-May-10	17-May-10	STLC/EPA 6020	

CS69
1001627-08 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**4.8**	0.50	0.99	mg/kg	5	A005164	12-May-10	12-May-10	EPA 6020	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara	Project Number: 08-25430	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	18-May-10 10:40

CS73

1001627-09 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**260**	0.97	1.9	mg/kg	10	A005164	12-May-10	12-May-10	EPA 6020	N-02, N-03
STLC Metals by 6000/7000 Series Methods										
Lead	**4.4**	0.010	0.020	mg/L	20	A005218	14-May-10	17-May-10	STLC/EPA 6020	

CS75

1001627-10 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**20**	0.42	0.85	mg/kg	5	A005164	12-May-10	12-May-10	EPA 6020	

CS76

1001627-11 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**8.1**	0.49	0.99	mg/kg	5	A005164	12-May-10	12-May-10	EPA 6020	

CS78

1001627-12 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**100**	0.49	0.98	mg/kg	5	A005164	12-May-10	12-May-10	EPA 6020	N-02, N-03
STLC Metals by 6000/7000 Series Methods										
Lead	**2.8**	0.010	0.020	mg/L	20	A005218	14-May-10	17-May-10	STLC/EPA 6020	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara	Project Number: 08-25430	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	18-May-10 10:40

CS79
1001627-13 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**23**	0.47	0.93	mg/kg	5	A005164	12-May-10	12-May-10	EPA 6020	

CS81
1001627-14 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**6.0**	0.43	0.86	mg/kg	5	A005164	12-May-10	12-May-10	EPA 6020	

CS82
1001627-15 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**6.6**	0.46	0.93	mg/kg	5	A005164	12-May-10	12-May-10	EPA 6020	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara	Project Number: 08-25430	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	18-May-10 10:40

Total Metals by EPA 6000/7000 Series Methods - Quality Control

Analyte	Result	Method Limit	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
Batch A005164 - EPA 3050B											
Blank (A005164-BLK1)					Prepared & Analyzed: 12-May-10						
Lead	ND	0.10	0.20	mg/kg							
LCS (A005164-BS1)					Prepared & Analyzed: 12-May-10						
Lead	14.4	0.10	0.20	mg/kg	15.0		96.3	85-115		20	
LCS Dup (A005164-BSD1)					Prepared & Analyzed: 12-May-10						
Lead	14.4	0.10	0.20	mg/kg	15.0		96.2	85-115	0.0755	20	
Duplicate (A005164-DUP1)	**Source: 1001627-01**				Prepared & Analyzed: 12-May-10						
Lead	13.3	0.45	0.91	mg/kg		12.4			6.98	20	
Matrix Spike (A005164-MS1)	**Source: 1001627-01**				Prepared & Analyzed: 12-May-10						
Lead	296	1.9	3.8	mg/kg	288	12.4	98.4	61-138		20	
Matrix Spike Dup (A005164-MSD1)	**Source: 1001627-01**				Prepared & Analyzed: 12-May-10						
Lead	277	1.8	3.6	mg/kg	273	12.4	97.0	61-138	1.38	20	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara	Project Number: 08-25430	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	18-May-10 10:40

STLC Metals by 6000/7000 Series Methods - Quality Control

Analyte	Result	Method Limit	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
Batch A005218 - EPA 3005A Leachate											
Blank (A005218-BLK1)					Prepared: 14-May-10 Analyzed: 17-May-10						
Lead	ND	0.00050	0.0010	mg/L							
LCS (A005218-BS1)					Prepared: 14-May-10 Analyzed: 17-May-10						
Lead	0.143	0.00050	0.0010	mg/L	0.150		95.3	85-115		20	
LCS Dup (A005218-BSD1)					Prepared: 14-May-10 Analyzed: 17-May-10						
Lead	0.142	0.00050	0.0010	mg/L	0.150		94.8	85-115	0.583	20	
Duplicate (A005218-DUP1)		**Source: 1001596-01**			Prepared: 14-May-10 Analyzed: 17-May-10						
Lead	2.63	0.010	0.020	mg/L		2.71			2.96	20	
Matrix Spike (A005218-MS1)		**Source: 1001596-01**			Prepared: 14-May-10 Analyzed: 17-May-10						
Lead	9.34	0.020	0.040	mg/L	6.00	2.71	110	64-153		20	
Matrix Spike Dup (A005218-MSD1)		**Source: 1001596-01**			Prepared: 14-May-10 Analyzed: 17-May-10						
Lead	9.35	0.020	0.040	mg/L	6.00	2.71	111	64-153	0.116	20	

Notes and Definitions

N-06	STLC analyte concentration exceeds STLC limit.
N-03	Analyte concentration above 20 X TCLP.
N-02	Analyte concentration below TTLC but above 10 X STLC.
DET	Analyte DETECTED
ND	Analyte NOT DETECTED at or above the reporting limit
NR	Not Reported
dry	Sample results reported on a dry weight basis
RPD	Relative Percent Difference

Oilfield Environmental and Compliance
307 Roemer Way Suite 300, Santa Maria CA 93454
phone: (805) 922-4772 fax: (805) 925-3376 www.oecusa.com

Highway 33, McKittrick CA
phone: (661) 762-9143

CHAIN OF CUSTODY

Company: Rincon Consultants, Inc.
Address: 790 East Santa Clara Street
City/State/ZIP: Ventura, CA 93001
Phone: 805 6411000 Fax: 805 6411072 E-mail: [illegible]
Report To: Rincon Sampler: Shawn Decker
Send report via- FAX- ☐ PDF- ☒ Colt/LUFT EDF- ☐ EDD- ☐
Turnaround Time: 10 Days- ☐ 5 Days- ☐ 72 hr- ☐ 48 hr- ☐ 24 hr- ☒ ASAP- ☐

Project Name/#: 125 State 08-25450
Site: 125 State St., Santa Barbara, CA

OEC Sample ID	Date/Time Sampled	Matrix	# of Cont.	Client Sample ID	Total Lead 6000/7000	Analysis Requested	Special Instructions:
1001627-1A	5-11-10/13:00	Soil	1	CS 48	X		MDL
2A	13:05			CS49	X		
3A	13:10			CS50	X		
4A	13:15			CS51	X	Δ	
5A	13:20			CS65	X	Δ	
6A	13:25			CS66	X		
7A	13:30			CS68	X	Δ	
8A	13:35			CS69	X		
9A	13:40			CS73	X	Δ	
10A	13:45			CS75	X		
~~11A~~	~~13:50~~			~~CS77~~ dm	X		Not rec'd dm
~~12A~~	~~13:55~~			~~CS86~~ dm	X		

Relinquished By: [signature]	Date: 5-11-10	Time: 1505	
Received By: [signature]	Date: 5/11/10	Time: 1505	
Relinquished By: [signature]	Date: 5/11/10	Time: 1630	
Received By: [signature]	Date: 5-11-10	Time: 1630	
Relinquished By:	Date:	Time:	
Received By:	Date:	Time:	

Comments/PO#: Bill per 125 State Quote
[signature] 5/12/10

Oilfield Environmental and Compliance
307 Roemer Way Suite 300, Santa Maria CA 93454
phone: (805) 922-4772 fax: (805) 925-3376 www.oecusa.com

Highway 33, McKittrick CA
phone: (661) 762-9143

CHAIN OF CUSTODY

Company: Rincon Consultants, Inc.
Address: 790 East Santa Clara Street
City/State/ZIP: Ventura, CA 93001
Phone: 805 641 1000 Fax: 805 641 1072 E-mail: sdecker@rinconconsult.com
Report To: Rincon Sampler: Shawn Decker
Send report via- FAX- ☐ PDF- ☐ Colt/LUFT EDF- ☐ EDD- ☐
Turnaround Time: 10 Days- ☐ 5 Days- ☐ 72 hr- ☐ 48 hr- ☐ 24 hr- ☐ ASAP- ☐

Project Name/#: 125 State 08-25430
Site: 125 State Street

OEC Sample ID	Date/Time Sampled	Matrix	# of Cont.	Client Sample ID	Total Lead 6000 or 7000	Staged	Special Instructions:
1001627-~~10A~~ 11A	5-11-10/14:30	Soil	1	C576	X		MDL
12A ~~14A~~	14:35			C578	X	Δ	
13A ~~15A~~	14:40			C579	X		
14A ~~16A~~	14:45			C581	X		
15A ~~17A~~	14:50			C582	X		

Relinquished By:		Date: 5-11-10	Time: 1505
Received By:		Date: 5/11/10	Time: 1505
Relinquished By:		Date: 5/11/10	Time: 1630
Received By:		Date: 5-11-10	Time: 1630
Relinquished By:		Date:	Time:
Received By:		Date:	Time:

Comments/PO#:

Δ-400.00 5/12/10

Oilfield Environmental and Compliance
307 Roemer Way Suite 300, Santa Maria CA 93454
phone: (805) 922-4772 fax: (805) 925-3376 www.oecusa.com

Highway 33, McKittrick CA
phone: (661) 762-9143

CHAIN OF CUSTODY

Company: Rincon Consultants, Inc.
Address: 790 East Santa Clara Street
City/State/ZIP: Ventura, CA 93001
Phone: 805 6411000 Fax: 805 6411072 E-mail: [illegible]
Report To: Rincon Sampler: Shawn Decker
Send report via- FAX- ☐ PDF- ☒ Colt/LUFT EDF- ☐ EDD- ☐
Turnaround Time: 10 Days- ☐ 5 Days- ☐ 72 hr- ☐ 48 hr- ☐ 24 hr- ☒ ASAP- ☐

Project Name/#: 125 State 08-25450
Site: 125 State St., Santa Barbara, CA

OEC Sample ID	Date/Time Sampled	Matrix	# of Cont.	Client Sample ID	Total Lead 6000/7000										Special Instructions:
1001627-1A	5-11-10/13:00	Soil	1	CS 48	X										MDL
2A	13:05			CS49	X										
3A	13:10			CS50	X										
4A	13:15			CS51	X										
5A	13:20			CS65	X										
6A	13:25			CS66	X										
7A	13:30			CS68	X										
8A	13:35			CS69	X										
9A	13:40			CS73	X										
10A	13:45			CS75	X										
~~11A~~	~~13:50~~			~~CS77~~ DM	X										Not rec'd DM
~~12A~~	~~13:55~~			~~CS86~~ DM	X										

Relinquished By: [signature]	Date: 5-11-10	Time: 1505
Received By: [signature]	Date: 5/11/10	Time: 1505
Relinquished By: [signature]	Date: 5/11/10	Time: 1630
Received By: [signature]	Date: 5-11-10	Time: 1630
Relinquished By:	Date:	Time:
Received By:	Date:	Time:

Comments/PO#: Bill per 125 State Quote

Oilfield Environmental and Compliance
307 Roemer Way Suite 300, Santa Maria CA 93454
phone: (805) 922-4772 fax: (805) 925-3376 www.oecusa.com

Highway 33, McKittrick CA
phone: (661) 762-9143

CHAIN OF CUSTODY

Company: Rincon Consultants, Inc.
Address: 790 East Santa Clara Street
City/State/ZIP: Ventura, CA 93001
Phone: 805 641 1000 Fax: 805 641 1072 E-mail: sdecker@rinconconsultants.com
Report To: Rincon Sampler: Shandon Decker
Send report via- FAX- ☐ PDF- ☐ Colt/LUFT EDF- ☐ EDD- ☐
Turnaround Time: 10 Days- ☐ 5 Days- ☐ 72 hr- ☐ 48 hr- ☐ 24 hr- ☐ ASAP- ☐

Project Name/#: 125 State 08-5430
Site: 125 State Street

OEC Sample ID	Date/Time Sampled	Matrix	# of Cont.	Client Sample ID	Analysis Requested: Total Lead 6000 or 7000	Special Instructions:
1001627-~~12A~~ 11A	5-11-10/14:30	Soil	1	C576	X	MDL
12A ~~14A~~	14:35			C578	X	
13A ~~15A~~	14:40			C579	X	
14A ~~16A~~	14:45			C581	X	
15A ~~17A~~	14:50			C582	X	

Relinquished By:	Date: 5-11-10	Time: 1505	Comments/PO#:
Received By:	Date: 5/11/10	Time: 1505	
Relinquished By:	Date: 5/11/10	Time: 1630	
Received By:	Date: 5-11-10	Time: 1630	
Relinquished By:	Date:	Time:	
Received By:	Date:	Time:	

OEC SAMPLE RECEIPT

Rev 01/15/10

CLIENT: RINCON OEC ID #: 1001627 Temp: 2 °C
Acceptable Range: 0°C to 6°C

COC RECEIVED DATE/TIME: 5/11/10 1630 RECEIPT LOGIN DATE/TIME: 5-11-10 1715 REFRIGERATOR(s): 1

SAMPLE TRANSPORT, RECEIPT, CONDITION & PRESERVATION:		Yes	No	N/A	(*) PROBLEM CHAIN FORM NEEDED
☒ OEC Courier/Sampler	COC document(s) received with samples	☒	☐*	☐	Custody Seals (circle): Present / Absent
☐ Delivery(Other than OEC Courier)	Correct containers for analysis requested	☒	☐*	☐	Samples / Coolers
☒ Samples Received on Ice	Container(s) intact and in good condition	☒	☐*	☐	Intact / Broken*
☐ Samples Received Outside Temp. Range*	Container label(s) consistent with COC	☒	☐*	☐	Method of Shipment & Tracking #(if applicable):
☐ Samples Direct from field (Outside Temp)	OEC preservative added (**note std ID)	☐**	☐	☒	
☐ After-Hours Outside Drop-off [Brought Inside]	Proper preservation on sample label(s)	☐	☐	☒	(**) OEC Preservative ID:
(Initials/Date/Time):	VOA containers free of headspace	☐	☐*	☒	Dissolved Metals Filtration: (Date/Init/Preserve ID)
	Tedlar Bags free of condensation	☐	☐*	☒	

CONTAINERS, COC CHANGES AND/OR CORRECTIONS CHANGES AUTHORIZED BY:

OEC ID	Client ID ***If blank, refer to CoC	Container Description	Preservative	ResCl /pH	Matrix	Date/Time Sampled ***	Comments / Remarks / Condition Notes, Etc.
1-15A		1-8 oz glass	—	—	Solid		

RECEIPT LOGIN BY: SM RECEIPT REVIEWED BY: LY

OEC PROBLEM CHAIN

CLIENT: Rincon

OEC ID #: 1001627

ISSUES RECORDED BY (DATE/TIME/INITIALS): 5/11/10 1705 AM

ISSUE(S): PLEASE PROVIDE DETAILS OF ISSUE(S) BELOW – Samples/Containers Affected, as necessary.

- ☐ Samples Received Outside Temp. Range (see below)
- ☐ Incorrect containers for analysis requested
- ☑ OTHER: (if multiple, identify with numbers)
- ☐ NO COC document(s) received with samples
- ☐ Container label(s) NOT consistent with COC
- ☐ Container(s) NOT intact or in good condition
- ☐ Custody Seals Broken

Sample - Client ID CS77 + CS86 were not received by lab.

RESOLUTIONS: MINIMUM INFO: Issue#[if necessary] – Description – Contact Type (Verbal, email, etc.) – Client Authorization Contact – Date/Time/Initials

Called Shawn Decker to notify.
Shawn called - checked truck samples there, will send with samples tomorrow 5/12/10.

FINAL RESOLUTION OF ISSUES BY (DATE/TIME/INITIALS): 5/11/10 1705 AM

09/09/08

Oilfield Environmental and Compliance, INC.

Shawn Decker
Rincon Consultants
790 East Santa Clara
Ventura, CA 93455

25 May 2010

RE: 125 State Street Excavation

Work Order: 1001659

Dear Client:

Enclosed is an analytical report for the above referenced project. The samples included in this report were received on 12-May-10 16:20 and analyzed in accordance with the attached chain-of-custody.

Unless otherwise noted, all analytical testing was accomplished in accordance with the guidelines established in our Quality Assurance Manual, applicable standard operating procedures, and other related documentation. The results in this analytical report are limited to the samples tested and any reproduction thereof must be made in its entirety.

If you have any questions regarding this report, please do not hesitate to contact the undersigned.

Sincerely,

Vanessa Miller

Project Manager Assistant

TEL: (805) 922-4772
307 Roemer Way, Suite 300, Santa Maria, CA 93454 www.oecusa.com FAX: (805) 925-3376

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara	Project Number: 08-25430	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	25-May-10 16:45

ANALYTICAL REPORT FOR SAMPLES

Sample ID	Laboratory ID	Matrix	Date Sampled	Date Received
CS52	1001659-01	Solid	12-May-10 13:00	12-May-10 16:20
CS70	1001659-02	Solid	12-May-10 13:05	12-May-10 16:20
CS71	1001659-03	Solid	12-May-10 13:10	12-May-10 16:20
CS80	1001659-04	Solid	12-May-10 13:15	12-May-10 16:20
CS86	1001659-05	Solid	11-May-10 00:00	12-May-10 16:20
CS77	1001659-06	Solid	11-May-10 00:00	12-May-10 16:20

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara	Project Number: 08-25430	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	25-May-10 16:45

CS52

1001659-01 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**270**	1.9	3.7	mg/kg	20	A005192	13-May-10	13-May-10	EPA 6020	
STLC Metals by 6000/7000 Series Methods										
Lead	**61**	0.25	0.50	mg/L	500	A005336	21-May-10	25-May-10	STLC/EPA 6020	

CS70

1001659-02 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**5.8**	0.48	0.96	mg/kg	5	A005192	13-May-10	13-May-10	EPA 6020	

CS71

1001659-03 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**7.6**	0.49	0.98	mg/kg	5	A005192	13-May-10	13-May-10	EPA 6020	

CS80

1001659-04 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**19**	0.47	0.95	mg/kg	5	A005192	13-May-10	13-May-10	EPA 6020	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara	Project Number: 08-25430	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	25-May-10 16:45

CS86

1001659-05 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**7.4**	0.46	0.92	mg/kg	5	A005192	13-May-10	13-May-10	EPA 6020	

CS77

1001659-06 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**48**	0.49	0.98	mg/kg	5	A005192	13-May-10	13-May-10	EPA 6020	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara	Project Number: 08-25430	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	25-May-10 16:45

Total Metals by EPA 6000/7000 Series Methods - Quality Control

Analyte	Result	Method Limit	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
Batch A005192 - EPA 3050B											
Blank (A005192-BLK1)					Prepared & Analyzed: 13-May-10						
Lead	ND	0.10	0.20	mg/kg							
LCS (A005192-BS1)					Prepared & Analyzed: 13-May-10						
Lead	14.6	0.10	0.20	mg/kg	15.0		97.4	85-115		20	
LCS Dup (A005192-BSD1)					Prepared & Analyzed: 13-May-10						
Lead	14.7	0.10	0.20	mg/kg	15.0		98.2	85-115	0.797	20	
Duplicate (A005192-DUP1)	**Source: 1001659-01**				Prepared & Analyzed: 13-May-10						
Lead	211	2.0	4.0	mg/kg		275			26.1	20	QM-04
Matrix Spike (A005192-MS1)	**Source: 1001659-01**				Prepared & Analyzed: 13-May-10						
Lead	627	4.8	9.5	mg/kg	286	275	123	61-138		20	
Matrix Spike Dup (A005192-MSD1)	**Source: 1001659-01**				Prepared & Analyzed: 13-May-10						
Lead	667	4.8	9.6	mg/kg	287	275	137	61-138	10.4	20	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara	Project Number: 08-25430	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	25-May-10 16:45

STLC Metals by 6000/7000 Series Methods - Quality Control

Analyte	Result	Method Limit	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
Batch A005336 - EPA 3005A Leachate											
Blank (A005336-BLK1)					Prepared: 21-May-10 Analyzed: 25-May-10						
Lead	ND	0.00050	0.0010	mg/L							
LCS (A005336-BS1)					Prepared: 21-May-10 Analyzed: 25-May-10						
Lead	0.154	0.00050	0.0010	mg/L	0.150		103	85-115		20	
LCS Dup (A005336-BSD1)					Prepared: 21-May-10 Analyzed: 25-May-10						
Lead	0.146	0.00050	0.0010	mg/L	0.150		97.6	85-115	5.39	20	

Notes and Definitions

QM-04	Visual evaluation of the sample indicates the RPD is above the control limit due to a non-homogeneous sample matrix.
DET	Analyte DETECTED
ND	Analyte NOT DETECTED at or above the reporting limit
NR	Not Reported
dry	Sample results reported on a dry weight basis
RPD	Relative Percent Difference

Oilfield Environmental and Compliance
307 Roemer Way Suite 300, Santa Maria CA 93454
phone: (805) 922-4772 fax: (805) 925-3376 www.oecusa.com
Highway 33, McKittrick CA
phone: (661) 762-9143

CHAIN OF CUSTODY

Company: Rincon Consultants, Inc.
Address: 790 East Santa Clara Street
City/State/ZIP: Ventura, CA 93001
Phone: 805 6411000 Fax: 805 6411072 E-mail: sdeckes@rinconconsultants.com
Report To: Rincon Sampler: Shawn Deckes
Send report via- FAX- ☐ PDF- ☒ Colt/LUFT EDF- ☐ EDD- ☐
Turnaround Time: 10 Days- ☐ 5 Days- ☐ 72 hr- ☐ 48 hr- ☐ 24 hr- ☒ ASAP- ☐

Project Name/#: 125 State 08-25430
Site: 125 State Street, Santa Barbara, CA

OEC Sample ID	Date/Time Sampled	Matrix	# of Cont.	Client Sample ID	Analysis Requested: Total Lead 6010/7000	Special Instructions:
1001659-1A	5-12-10/13:00	Soil	1	CS52	X	MDL
-2A	13:05			CS70	X	
-3A	13:10			CS71	X	
-4A	13:15			CS80	X	
-5A	5-11-10			CS86	X	
-6A	5-11-10			CS77	X	

Relinquished By: [signature] Date: 5-12-10 Time:
Received By: [signature] Date: 5/12/10 Time: 1449
Relinquished By: [signature] Date: 5/12/10 Time: 1620
Received By: Sherry Mobley Date: 5/12/10 Time: 1620
Relinquished By: Date: Time:
Received By: Date: Time:

Comments/PO#: Bill per 125 State Quote

OEC SAMPLE RECEIPT

Rev 00/15/10

CLIENT: Rincon

OEC ID #: 1001659

Temp: 4 °C
Acceptable Range: 0°C to 6°C

COC RECEIVED DATE/TIME: 5/12/10 1620

RECEIPT LOGIN DATE/TIME: 5/12/10 1645

REFRIGERATOR(s): 1

SAMPLE TRANSPORT, RECEIPT, CONDITION & PRESERVATION:

		Yes	No	N/A	(*) PROBLEM CHAIN FORM NEEDED
☑ OEC Courier/Sampler	COC document(s) received with samples	☑	☐*	☐	Custody Seals (circle): Present / Absent
☐ Delivery(Other than OEC Courier)	Correct containers for analysis requested	☑	☐*	☐	Samples / Coolers
☑ Samples Received on Ice	Container(s) intact and in good condition	☑	☐*	☐	Intact / Broken*
☐ Samples Received Outside Temp. Range*	Container label(s) consistent with COC	☑	☐*	☐	Method of Shipment & Tracking #(if applicable):
☐ Samples Direct from field (Outside Temp)	OEC preservative added (**note std ID)	☐**	☐	☑	
☐ After-Hours Outside Drop-off [Brought Inside]	Proper preservation on sample label(s)	☐	☐	☑	(**) OEC Preservative ID:
(Initials/Date/Time):	VOA containers free of headspace	☐	☐*	☑	Dissolved Metals Filtration: (Date/Init/Preserve ID)
	Tedlar Bags free of condensation	☐	☐*	☑	

CONTAINERS, COC CHANGES AND/OR CORRECTIONS

CHANGES AUTHORIZED BY:

OEC ID	Client ID ***If blank, refer to CoC	Container Description	Preservative	ResCl /pH	Matrix	Date/Time Sampled ***	Comments / Remarks / Condition Notes, Etc.
1-6A		1-8oz glass	—	—	Solid		

RECEIPT LOGIN BY: SM

RECEIPT REVIEWED BY: [signature]

Oilfield Environmental and Compliance
307 Roemer Way Suite 300, Santa Maria CA 93454
phone: (805) 922-4772 fax: (805) 925-3376 www.oecusa.com

Highway 33, McKittrick CA
phone: (661) 762-9143

CHAIN OF CUSTODY

Page 1 of 1

Company: Rincon Consultants, Inc.
Address: 790 East Santa Clara Street
City/State/ZIP: Ventura, CA 93001
Phone: 805 6411000 Fax: 805 6411072 E-mail: sdeckes@rinconconsultants.com
Report To: Rincon Sampler: Shawn Deckes
Send report via- FAX- ☐ PDF- ☒ Colt/LUFT EDF- ☐ EDD- ☐
Turnaround Time: 10 Days- ☐ 5 Days- ☐ 72 hr- ☐ 48 hr- ☐ 24 hr- ☒ ASAP- ☐

Project Name/#: 125 State 08-25430
Site: 125 State Street, Santa Barbara, CA

OEC Sample ID	Date/Time Sampled	Matrix	# of Cont.	Client Sample ID	Total Lead 6000/7000	SEC Pb									Special Instructions:
1001659-1A	5-12-10/13:00	Soil	1	CS52	X	Δ									MDL
-2A	13:05	↓	↓	CS70	X										↓
-3A	13:10			CS71	X										
-4A	13:15			CS80	X										
-5A	5-11-10			CS86	X										
-6A	5-11-10			CS77	X										

Relinquished By:	Date: 5-12-10	Time:
Received By:	Date: 5/12/10	Time: 1449
Relinquished By:	Date: 5/12/10	Time: 1620
Received By: Sheryl Mobley	Date: 5/12/10	Time: 1620
Relinquished By:	Date:	Time:
Received By:	Date:	Time:

Comments/PO#: Bill per 125 State Quote
Δ-400 @ 5/14/10

Oilfield Environmental and Compliance, INC.

Shawn Decker
Rincon Consultants
790 East Santa Clara Street
Santa Barbara, CA 93001

08 June 2010

RE: 125 State Street Excavation

Work Order: 1001681

Dear Client:

Enclosed is an analytical report for the above referenced project. The samples included in this report were received on 13-May-10 17:05 and analyzed in accordance with the attached chain-of-custody.

Unless otherwise noted, all analytical testing was accomplished in accordance with the guidelines established in our Quality Assurance Manual, applicable standard operating procedures, and other related documentation. The results in this analytical report are limited to the samples tested and any reproduction thereof must be made in its entirety.

If you have any questions regarding this report, please do not hesitate to contact the undersigned.

Sincerely,

Vanessa Miller

Project Manager Assistant

TEL: (805) 922-4772
307 Roemer Way, Suite 300, Santa Maria, CA 93454 www.oecusa.com FAX: (805) 925-3376

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara Street	Project Number: 08-25430	**Reported:**
Santa Barbara CA, 93001	Project Manager: Shawn Decker	08-Jun-10 17:00

ANALYTICAL REPORT FOR SAMPLES

Sample ID	Laboratory ID	Matrix	Date Sampled	Date Received
CS87	1001681-01	Solid	13-May-10 13:00	13-May-10 17:05
CS88	1001681-02	Solid	13-May-10 13:05	13-May-10 17:05
CS89	1001681-03	Solid	13-May-10 13:10	13-May-10 17:05
CS90	1001681-04	Solid	13-May-10 13:15	13-May-10 17:05
CS91	1001681-05	Solid	13-May-10 13:20	13-May-10 17:05
CS92	1001681-06	Solid	13-May-10 13:25	13-May-10 17:05
CS93	1001681-07	Solid	13-May-10 13:30	13-May-10 17:05
CS95	1001681-08	Solid	13-May-10 13:35	13-May-10 17:05
CS96	1001681-09	Solid	13-May-10 13:40	13-May-10 17:05
CS97	1001681-10	Solid	13-May-10 13:45	13-May-10 17:05

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara Street	Project Number: 08-25430	**Reported:**
Santa Barbara CA, 93001	Project Manager: Shawn Decker	08-Jun-10 17:00

CS87

1001681-01 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**9.9**	0.47	0.95	mg/kg	5	A005204	14-May-10	14-May-10	EPA 6020	

CS88

1001681-02 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**40**	0.50	0.99	mg/kg	5	A005204	14-May-10	14-May-10	EPA 6020	

CS89

1001681-03 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**8.1**	0.49	0.98	mg/kg	5	A005204	14-May-10	14-May-10	EPA 6020	

CS90

1001681-04 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**8.5**	0.47	0.94	mg/kg	5	A005204	14-May-10	14-May-10	EPA 6020	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara Street	Project Number: 08-25430	**Reported:**
Santa Barbara CA, 93001	Project Manager: Shawn Decker	08-Jun-10 17:00

CS91
1001681-05 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**7.0**	0.42	0.85	mg/kg	5	A005204	14-May-10	14-May-10	EPA 6020	

CS92
1001681-06 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**14**	0.49	0.97	mg/kg	5	A005204	14-May-10	14-May-10	EPA 6020	

CS93
1001681-07 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**9.5**	0.45	0.90	mg/kg	5	A005204	14-May-10	14-May-10	EPA 6020	

CS95
1001681-08 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**70**	0.47	0.95	mg/kg	5	A005204	14-May-10	14-May-10	EPA 6020	N-02
STLC Metals by 6000/7000 Series Methods										
Lead	**1.6**	0.0050	0.010	mg/L	10	A006138	08-Jun-10	08-Jun-10	STLC/EPA 6020	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara Street	Project Number: 08-25430	**Reported:**
Santa Barbara CA, 93001	Project Manager: Shawn Decker	08-Jun-10 17:00

CS96
1001681-09 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**28**	0.46	0.92	mg/kg	5	A005204	14-May-10	14-May-10	EPA 6020	

CS97
1001681-10 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**94**	0.48	0.96	mg/kg	5	A005204	14-May-10	14-May-10	EPA 6020	N-02
STLC Metals by 6000/7000 Series Methods										
Lead	**3.9**	0.025	0.050	mg/L	50	A006138	08-Jun-10	08-Jun-10	STLC/EPA 6020	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara Street	Project Number: 08-25430	**Reported:**
Santa Barbara CA, 93001	Project Manager: Shawn Decker	08-Jun-10 17:00

Total Metals by EPA 6000/7000 Series Methods - Quality Control

Analyte	Result	Method Limit	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
Batch A005204 - EPA 3050B											
Blank (A005204-BLK1)					Prepared & Analyzed: 14-May-10						
Lead	ND	0.10	0.20	mg/kg							
LCS (A005204-BS1)					Prepared & Analyzed: 14-May-10						
Lead	15.0	0.10	0.20	mg/kg	15.0		99.7	85-115		20	
LCS Dup (A005204-BSD1)					Prepared & Analyzed: 14-May-10						
Lead	14.8	0.10	0.20	mg/kg	15.0		98.5	85-115	1.24	20	
Duplicate (A005204-DUP1)	**Source: 1001681-01**				Prepared & Analyzed: 14-May-10						
Lead	9.54	0.47	0.94	mg/kg		9.91			3.83	20	
Matrix Spike (A005204-MS1)	**Source: 1001681-01**				Prepared & Analyzed: 14-May-10						
Lead	301	1.9	3.8	mg/kg	282	9.91	103	61-138		20	
Matrix Spike Dup (A005204-MSD1)	**Source: 1001681-01**				Prepared & Analyzed: 14-May-10						
Lead	312	2.0	4.0	mg/kg	296	9.91	102	61-138	0.820	20	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara Street	Project Number: 08-25430	**Reported:**
Santa Barbara CA, 93001	Project Manager: Shawn Decker	08-Jun-10 17:00

STLC Metals by 6000/7000 Series Methods - Quality Control

Analyte	Result	Method Limit	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
Batch A006138 - EPA 3005A Leachate											
Blank (A006138-BLK1)					Prepared & Analyzed: 08-Jun-10						
Lead	ND	0.00050	0.0010	mg/L							
LCS (A006138-BS1)					Prepared & Analyzed: 08-Jun-10						
Lead	0.147	0.00050	0.0010	mg/L	0.150		97.8	85-115		20	
LCS Dup (A006138-BSD1)					Prepared & Analyzed: 08-Jun-10						
Lead	0.148	0.00050	0.0010	mg/L	0.150		98.5	85-115	0.758	20	
Duplicate (A006138-DUP1)		**Source: 1001681-08**			Prepared & Analyzed: 08-Jun-10						
Lead	1.74	0.0050	0.010	mg/L		1.56			11.4	20	
Matrix Spike (A006138-MS1)		**Source: 1001681-08**			Prepared & Analyzed: 08-Jun-10						
Lead	8.19	0.020	0.040	mg/L	6.00	1.56	111	64-153		20	
Matrix Spike Dup (A006138-MSD1)		**Source: 1001681-08**			Prepared & Analyzed: 08-Jun-10						
Lead	8.42	0.020	0.040	mg/L	6.00	1.56	114	64-153	3.50	20	

Notes and Definitions

N-02	Analyte concentration below TTLC but above 10 X STLC.
DET	Analyte DETECTED
ND	Analyte NOT DETECTED at or above the reporting limit
NR	Not Reported
dry	Sample results reported on a dry weight basis
RPD	Relative Percent Difference

Oilfield Environmental and Compliance

307 Roemer Way Suite 300, Santa Maria CA 93454
phone: (805) 922-4772 fax: (805) 925-3376 www.oecusa.com

Highway 33, McKittrick CA
phone: (661) 762-9143

CHAIN OF CUSTODY

Page 1 of 1

Company: Rincon Consultants, Inc.
Address: 790 East Santa Clara
City/State/ZIP: Ventura, CA 93001
Phone: 805 641 1000 Fax: 805 641 1072 E-mail: sdecker@rinconconsultants.com
Report To: Rincon Sampler: Shawn Decker
Send report via- FAX- ☐ PDF- ☒ Colt/LUFT EDF- ☐ EDD- ☐
Turnaround Time: 10 Days- ☐ 5 Days- ☐ 72 hr- ☐ 48 hr- ☐ 24 hr- ☒ ASAP- ☐

Project Name/#: 125 State 08-25430
Site: 125 State Street, Santa Barbara, CA

OEC Sample ID	Date/Time Sampled	Matrix	# of Cont.	Client Sample ID	Total Lead 6000/7000										Special Instructions:
1001681-1A	5-13-10/13:00	Soil	1	CS87	X										MDL
-2A	13:05			CS88	X										
-3A	13:10			CS89	X										
-4A	13:15			CS90	X										
-5A	13:20			CS91	X										
-6A	13:25			CS92	X										
-7A	13:30			CS93	X										
-8A	13:35			CS95	X										
-9A	13:40			CS96	X										
-10A	13:45			CS97	X										

Relinquished By:	Date: 5-13-10	Time: 1515
Received By:	Date: 5/13/10	Time: 1515
Relinquished By:	Date: 5/13/10	Time: 1705
Received By:	Date: 5-13-10	Time: 1705
Relinquished By:	Date:	Time:
Received By:	Date:	Time:

Comments/PO#: Bill per 125 State Quote

OEC SAMPLE RECEIPT

Rev. 01/15/10

CLIENT: Rincon OEC ID #: 1001681 Temp: 5 °C
Acceptable Range: 0°C to 6°C

COC RECEIVED DATE/TIME: 5/13/10 1705 RECEIPT LOGIN DATE/TIME: 5-13-10 1725 REFRIGERATOR(s): 1

SAMPLE TRANSPORT, RECEIPT, CONDITION & PRESERVATION:		Yes	No	N/A	(*) PROBLEM CHAIN FORM NEEDED
☒ OEC Courier/Sampler	COC document(s) received with samples	☒	☐*	☐	Custody Seals (circle): Present / Absent
☐ Delivery(Other than OEC Courier)	Correct containers for analysis requested	☒	☐*	☐	Samples / Coolers
☒ Samples Received on Ice	Container(s) intact and in good condition	☒	☐*	☐	Intact / Broken*
☐ Samples Received Outside Temp. Range*	Container label(s) consistent with COC	☒	☐*	☐	Method of Shipment & Tracking #(if applicable):
☐ Samples Direct from field (Outside Temp)	OEC preservative added (**note std ID)	☐**	☐	☒	
☐ After-Hours Outside Drop-off [Brought Inside]	Proper preservation on sample label(s)	☐	☐	☒	(**) OEC Preservative ID:
(Initials/Date/Time):	VOA containers free of headspace	☐	☐*	☒	Dissolved Metals Filtration: (Date/Init/Preserve ID)
	Tedlar Bags free of condensation	☐	☐*	☒	

CONTAINERS, COC CHANGES AND/OR CORRECTIONS CHANGES AUTHORIZED BY:

OEC ID	Client ID ***If blank, refer to CoC	Container Description	Preservative	ResCl /pH	Matrix	Date/Time Sampled ***	Comments / Remarks / Condition Notes, Etc.
1-10A		1-8oz glass ea	—	-	solid		

RECEIPT LOGIN BY: Ly RECEIPT REVIEWED BY: [signature]

Oilfield Environmental and Compliance
307 Roemer Way Suite 300, Santa Maria CA 93454
phone: (805) 922-4772 fax: (805) 925-3376 www.oecusa.com

Highway 33, McKittrick CA
phone: (661) 762-9143

CHAIN OF CUSTODY

Page 1 of 1

Company: Rincon Consultants, Inc.
Address: 790 East Santa Clara
City/State/ZIP: Ventura, CA 93001
Phone: 805 641 1000 Fax: 805 641 1072 E-mail: sdecker@rinconconsultants.com
Report To: Rincon Sampler: Shawn Decker
Send report via- FAX- ☐ PDF- ☒ Colt/LUFT EDF- ☐ EDD- ☐
Turnaround Time: 10 Days- ☐ 5 Days- ☐ 72 hr- ☐ 48 hr- ☐ 24 hr- ☒ ASAP- ☐

Project Name/#: 125 State 08-25430
Site: 125 State Street, Santa Barbara, CA

OEC Sample ID	Date/Time Sampled	Matrix	# of Cont.	Client Sample ID	Total Lead 6000/7000	STLC Pb	Special Instructions:
1001681-1A	5-13-10/13:00	Soil	1	CS87	X		MDL
-2A	13:05			CS88	X		
-3A	13:10			CS89	X		
-4A	13:15			CS90	X		
-5A	13:20			CS91	X		
-6A	13:25			CS92	X		
-7A	13:30			CS93	X		
-8A	13:35			CS95	X	Δ	
-9A	13:40			CS96	X		
-10A	13:45			CS97	X	Δ	

Relinquished By:	Date: 5-13-10	Time: 1515
Received By:	Date: 5/13/10	Time: 1515
Relinquished By:	Date: 5/13/10	Time: 1705
Received By:	Date: 5-13-10	Time: 1705
Relinquished By:	Date:	Time:
Received By:	Date:	Time:

Comments/PO#: Bill per 125 State Quote

Δ Per S. Decker 05/28 - STD TAT

Oilfield Environmental and Compliance, INC.

Shawn Decker
Rincon Consultants
790 East Santa Clara Street
Santa Barbara, CA 93001

11 June 2010

RE: 125 State Street Excavation

Work Order: 1001699

Dear Client:

Enclosed is an analytical report for the above referenced project. The samples included in this report were received on 14-May-10 16:13 and analyzed in accordance with the attached chain-of-custody.

Unless otherwise noted, all analytical testing was accomplished in accordance with the guidelines established in our Quality Assurance Manual, applicable standard operating procedures, and other related documentation. The results in this analytical report are limited to the samples tested and any reproduction thereof must be made in its entirety.

If you have any questions regarding this report, please do not hesitate to contact the undersigned.

Sincerely,

Lisa Race

Laboratory Manager

TEL: (805) 922-4772
307 Roemer Way, Suite 300, Santa Maria, CA 93454 www.oecusa.com FAX: (805) 925-3376

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara Street	Project Number: 08-25430	**Reported:**
Santa Barbara CA, 93001	Project Manager: Shawn Decker	11-Jun-10 14:33

ANALYTICAL REPORT FOR SAMPLES

Sample ID	Laboratory ID	Matrix	Date Sampled	Date Received
CS94	1001699-01	Solid	14-May-10 13:00	14-May-10 16:13
CS98	1001699-02	Solid	14-May-10 13:05	14-May-10 16:13
CS99	1001699-03	Solid	14-May-10 13:10	14-May-10 16:13
CS100	1001699-04	Solid	14-May-10 13:15	14-May-10 16:13

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara Street	Project Number: 08-25430	**Reported:**
Santa Barbara CA, 93001	Project Manager: Shawn Decker	11-Jun-10 14:33

CS94

1001699-01 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**50**	0.45	0.90	mg/kg	5	A005238	17-May-10	17-May-10	EPA 6020	N-02
STLC Metals by 6000/7000 Series Methods										
Lead	**2.3**	0.0050	0.010	mg/L	10	A005362	24-May-10	25-May-10	STLC/EPA 6020	

CS98

1001699-02 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**170**	0.96	1.9	mg/kg	10	A005238	17-May-10	17-May-10	EPA 6020	N-02, N-03
STLC Metals by 6000/7000 Series Methods										
Lead	**12**	0.050	0.10	mg/L	100	A005362	24-May-10	25-May-10	STLC/EPA 6020	N-06
TCLP Metals by 6000/7000 Series Methods										
Lead	**0.85**	0.0050	0.010	mg/L	10	A006154	09-Jun-10	10-Jun-10	EPA 1311/EPA 6020	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara Street	Project Number: 08-25430	**Reported:**
Santa Barbara CA, 93001	Project Manager: Shawn Decker	11-Jun-10 14:33

CS99
1001699-03 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**210**	0.98	2.0	mg/kg	10	A005238	17-May-10	17-May-10	EPA 6020	N-02, N-03
STLC Metals by 6000/7000 Series Methods										
Lead	**19**	0.050	0.10	mg/L	100	A005362	24-May-10	25-May-10	STLC/EPA 6020	N-06
TCLP Metals by 6000/7000 Series Methods										
Lead	**2.5**	0.0050	0.010	mg/L	10	A006154	09-Jun-10	10-Jun-10	EPA 1311/EPA 6020	

CS100
1001699-04 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**380**	1.7	3.5	mg/kg	20	A005238	17-May-10	17-May-10	EPA 6020	N-02, N-03
STLC Metals by 6000/7000 Series Methods										
Lead	**30**	0.10	0.20	mg/L	200	A005362	24-May-10	25-May-10	STLC/EPA 6020	N-06
TCLP Metals by 6000/7000 Series Methods										
Lead	**1.2**	0.0050	0.010	mg/L	10	A006154	09-Jun-10	10-Jun-10	EPA 1311/EPA 6020	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara Street	Project Number: 08-25430	**Reported:**
Santa Barbara CA, 93001	Project Manager: Shawn Decker	11-Jun-10 14:33

Total Metals by EPA 6000/7000 Series Methods - Quality Control

Analyte	Result	Method Limit	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
Batch A005238 - EPA 3050B											
Blank (A005238-BLK1)					Prepared & Analyzed: 17-May-10						
Lead	ND	0.10	0.20	mg/kg							
LCS (A005238-BS1)					Prepared & Analyzed: 17-May-10						
Lead	14.9	0.10	0.20	mg/kg	15.0		99.6	85-115		20	
LCS Dup (A005238-BSD1)					Prepared & Analyzed: 17-May-10						
Lead	15.0	0.10	0.20	mg/kg	15.0		99.9	85-115	0.289	20	
Duplicate (A005238-DUP1)	**Source: 1001699-01**				Prepared & Analyzed: 17-May-10						
Lead	42.0	0.45	0.89	mg/kg		50.4			18.2	20	
Matrix Spike (A005238-MS1)	**Source: 1001699-01**				Prepared & Analyzed: 17-May-10						
Lead	302	1.8	3.5	mg/kg	263	50.4	95.7	61-138		20	
Matrix Spike Dup (A005238-MSD1)	**Source: 1001699-01**				Prepared & Analyzed: 17-May-10						
Lead	309	1.7	3.5	mg/kg	260	50.4	99.3	61-138	3.67	20	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara Street	Project Number: 08-25430	**Reported:**
Santa Barbara CA, 93001	Project Manager: Shawn Decker	11-Jun-10 14:33

STLC Metals by 6000/7000 Series Methods - Quality Control

Analyte	Result	Method Limit	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
Batch A005362 - EPA 3005A Leachate											
Blank (A005362-BLK1)					Prepared: 24-May-10 Analyzed: 25-May-10						
Lead	ND	0.00050	0.0010	mg/L							
LCS (A005362-BS1)					Prepared: 24-May-10 Analyzed: 25-May-10						
Lead	0.150	0.00050	0.0010	mg/L	0.150		99.7	85-115		20	
LCS Dup (A005362-BSD1)					Prepared: 24-May-10 Analyzed: 25-May-10						
Lead	0.150	0.00050	0.0010	mg/L	0.150		99.7	85-115	0.0127	20	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara Street	Project Number: 08-25430	**Reported:**
Santa Barbara CA, 93001	Project Manager: Shawn Decker	11-Jun-10 14:33

TCLP Metals by 6000/7000 Series Methods - Quality Control

Analyte	Result	Method Limit	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
Batch A006154 - EPA 3005A Leachate											
Blank (A006154-BLK1)					Prepared: 09-Jun-10 Analyzed: 10-Jun-10						
Lead	ND	0.00050	0.0010	mg/L							
LCS (A006154-BS1)					Prepared: 09-Jun-10 Analyzed: 10-Jun-10						
Lead	0.158	0.00050	0.0010	mg/L	0.150		105	85-115		20	
LCS Dup (A006154-BSD1)					Prepared: 09-Jun-10 Analyzed: 10-Jun-10						
Lead	0.153	0.00050	0.0010	mg/L	0.150		102	85-115	3.14	20	
Duplicate (A006154-DUP1)	**Source: 1001582-17**				Prepared: 09-Jun-10 Analyzed: 10-Jun-10						
Lead	0.736	0.0050	0.010	mg/L		0.736			0.0109	20	
Matrix Spike (A006154-MS1)	**Source: 1001582-17**				Prepared: 09-Jun-10 Analyzed: 10-Jun-10						
Lead	7.19	0.020	0.040	mg/L	6.00	0.736	108	64-153		20	
Matrix Spike Dup (A006154-MSD1)	**Source: 1001582-17**				Prepared: 09-Jun-10 Analyzed: 10-Jun-10						
Lead	7.08	0.020	0.040	mg/L	6.00	0.736	106	64-153	1.74	20	

Notes and Definitions

N-06	STLC analyte concentration exceeds STLC limit.
N-03	Analyte concentration above 20 X TCLP.
N-02	Analyte concentration below TTLC but above 10 X STLC.
DET	Analyte DETECTED
ND	Analyte NOT DETECTED at or above the reporting limit
NR	Not Reported
dry	Sample results reported on a dry weight basis
RPD	Relative Percent Difference

Oilfield Environmental and Compliance
307 Roemer Way Suite 300, Santa Maria CA 93454
phone: (805) 922-4772 fax: (805) 925-3376 www.oecusa.com

Highway 33, McKittrick CA
phone: (661) 762-9143

CHAIN OF CUSTODY

Page 1 of 1

Company: Rincon Consultants, Inc.
Address: 790 East Santa Clara Street
City/State/ZIP: Santa Barbara, CA 93001
Phone: 805 641 1000 Fax: 805 641 1072 E-mail: sdecker@rinconconsultants.com
Report To: Rincon Sampler: Shawn Deckes
Send report via- FAX- ☐ PDF- ☒ Coll/LUFT EDF- ☐ EDD- ☐
Turnaround Time: 10 Days- ☐ 5 Days- ☐ 72 hr- ☐ 48 hr- ☐ 24 hr- ☒ ASAP- ☐

Project Name/#: 125 State 08-25430
Site: 125 State Street, Santa Barbara, CA

OEC Sample ID	Date/Time Sampled	Matrix	# of Cont.	Client Sample ID	Total Lead 6000/7000	5520	TPH DRO	Special Instructions:
1001699-1A	5-14-10/13:00	Soil	1	CS94	X	△		MDL
2A	13:05			CS98	X	△	⊗	
3A	13:10			CS99	X	△	⊗	
4A	13:15			CS100	X	△	⊗	

Relinquished By:	Date: 5-14-10	Time: 1438	
Received By:	Date: 5/14/10	Time: 1438	
Relinquished By:	Date: 5/14/10	Time: 1613	
Received By:	Date: 5-14-10	Time: 1613	
Relinquished By:	Date:	Time:	
Received By:	Date:	Time:	

Comments/PO#: Bill per 125 State Quote

△-200 on 5/20/10

⊗-200 on 6/24/10

Oilfield Environmental and Compliance
307 Roemer Way Suite 300, Santa Maria CA 93454
phone: (805) 922-4772 fax: (805) 925-3376 www.oecusa.com

Highway 33, McKittrick CA
phone: (661) 762-9143

CHAIN OF CUSTODY

Page 1 of 1

Company: Rincon Consultants, Inc.
Address: 790 East Santa Clara Street
City/State/ZIP: Santa Barbara, CA 93001
Phone: 805 641 1000 Fax: 805 641 1072 E-mail: sdecker@rinconconsultants.com
Report To: Rincon Sampler: Shawn Decker
Send report via- FAX- ☐ PDF- ☒ Colt/LUFT EDF- ☐ EDD- ☐
Turnaround Time: 10 Days- ☐ 5 Days- ☐ 72 hr- ☐ 48 hr- ☐ 24 hr- ☒ ASAP- ☐

Project Name/#: 125 State 08-25430
Site: 125 State Street, Santa Barbara, CA

OEC Sample ID	Date/Time Sampled	Matrix	# of Cont.	Client Sample ID	Total Lead 6000/7000	Zinc	Special Instructions:
1001699-1A	5-14-10/13:00	Soil	1	CS94	X	Δ	MDL
2A	13:05			CS98	X	Δ	
3A	13:10			CS99	X	Δ	
4A	13:15			CS100	X	Δ	

Relinquished By:		Date: 5-14-10	Time: 1438
Received By:		Date: 5/14/10	Time: 1438
Relinquished By:		Date: 5/14/10	Time: 1613
Received By:		Date: 5-14-10	Time: 1613
Relinquished By:		Date:	Time:
Received By:		Date:	Time:

Comments/PO#: Bill per 125 State Quote

Δ-add on 5/20/10

Oilfield Environmental and Compliance
307 Roemer Way Suite 300, Santa Maria CA 93454
phone: (805) 922-4772 fax: (805) 925-3376 www.oecusa.com

Highway 33, McKittrick CA
phone: (661) 762-9143

CHAIN OF CUSTODY

Page 1 of 1

Company: Rincon Consultants, Inc.
Address: 790 East Santa Clara Street
City/State/ZIP: Santa Barbara, CA 93001
Phone: 805 641 1000 Fax: 805 641 1072 E-mail: sdecker@rinconconsultants.com
Report To: Rincon Sampler: Shawn Decker
Send report via- FAX- ☐ PDF- ☒ Colt/LUFT EDF- ☐ EDD- ☐
Turnaround Time: 10 Days- ☐ 5 Days- ☐ 72 hr- ☐ 48 hr- ☐ 24 hr- ☒ ASAP- ☐

Project Name/#: 125 State 08-25430
Site: 125 State Street, Santa Barbara, CA

OEC Sample ID	Date/Time Sampled	Matrix	# of Cont.	Client Sample ID	Analysis Requested: Total Lead 6000/7000	Special Instructions:
1001699-1A	5-14-10/13:00	Soil	1	CS94	X	MDL
2A	13:05			CS98	X	
3A	13:10			CS99	X	
4A	13:15			CS100	X	

Relinquished By:	Date: 5-14-10	Time: 1438	Comments/PO#: Bill per 125 State Quote
Received By:	Date: 5/14/10	Time: 1438	
Relinquished By:	Date: 5/14/10	Time: 1613	
Received By:	Date: 5-14-10	Time: 1613	
Relinquished By:	Date:	Time:	
Received By:	Date:	Time:	

OEC SAMPLE RECEIPT

Rev. 01/15/10

CLIENT: Rincon OEC ID #: 1001699 Temp: 4 °C

Acceptable Range: 0°C to 6°C

COC RECEIVED DATE/TIME: 5-14-10 1613

RECEIPT LOGIN DATE/TIME: 5-14-10 1628

REFRIGERATOR(s): 1

SAMPLE TRANSPORT, RECEIPT, CONDITION & PRESERVATION:		Yes	No	N/A	(*) PROBLEM CHAIN FORM NEEDED
☒ OEC Courier/Sampler	COC document(s) received with samples	☒	☐*	☐	Custody Seals (circle): Present / Absent
☐ Delivery(Other than OEC Courier)	Correct containers for analysis requested	☒	☐*	☐	Samples / Coolers
☒ Samples Received on Ice	Container(s) intact and in good condition	☒	☐*	☐	Intact / Broken*
☐ Samples Received Outside Temp. Range*	Container label(s) consistent with COC	☒	☐*	☐	Method of Shipment & Tracking #(if applicable):
☐ Samples Direct from field (Outside Temp)	OEC preservative added (**note std ID)	☐**	☐	☒	
☐ After-Hours Outside Drop-off [Brought Inside]	Proper preservation on sample label(s)	☐	☐	☒	(**) OEC Preservative ID:
(Initials/Date/Time):	VOA containers free of headspace	☐	☐*	☒	Dissolved Metals Filtration: (Date/Init/Preserve ID)
	Tedlar Bags free of condensation	☐	☐*	☒	

CONTAINERS, COC CHANGES AND/OR CORRECTIONS — CHANGES AUTHORIZED BY:

OEC ID	Client ID ***If blank, refer to CoC	Container Description	Preservative	ResCl /pH	Matrix	Date/Time Sampled ***	Comments / Remarks / Condition Notes, Etc.
1-4A		1-8oz glass ea	-	-	solid		

RECEIPT LOGIN BY: Hy RECEIPT REVIEWED BY: SM

Oilfield Environmental and Compliance, INC.

Shawn Decker
Rincon Consultants
790 East Santa Clara Street
Santa Barbara, CA 93001

08 June 2010

RE: 125 State Street Excavation

Work Order: 1001715

Dear Client:

Enclosed is an analytical report for the above referenced project. The samples included in this report were received on 17-May-10 17:00 and analyzed in accordance with the attached chain-of-custody.

Unless otherwise noted, all analytical testing was accomplished in accordance with the guidelines established in our Quality Assurance Manual, applicable standard operating procedures, and other related documentation. The results in this analytical report are limited to the samples tested and any reproduction thereof must be made in its entirety.

If you have any questions regarding this report, please do not hesitate to contact the undersigned.

Sincerely,

Vanessa Miller

Project Manager Assistant

TEL: (805) 922-4772
307 Roemer Way, Suite 300, Santa Maria, CA 93454 www.oecusa.com FAX: (805) 925-3376

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara Street	Project Number: 08-25430	**Reported:**
Santa Barbara CA, 93001	Project Manager: Shawn Decker	08-Jun-10 16:24

ANALYTICAL REPORT FOR SAMPLES

Sample ID	Laboratory ID	Matrix	Date Sampled	Date Received
CS101	1001715-01	Solid	17-May-10 14:30	17-May-10 17:00
CS102	1001715-02	Solid	17-May-10 14:35	17-May-10 17:00
CS103	1001715-03	Solid	17-May-10 14:40	17-May-10 17:00
CS104	1001715-04	Solid	17-May-10 14:45	17-May-10 17:00

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara Street	Project Number: 08-25430	**Reported:**
Santa Barbara CA, 93001	Project Manager: Shawn Decker	08-Jun-10 16:24

CS101

1001715-01 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**270**	2.0	3.9	mg/kg	20	A005260	18-May-10	18-May-10	EPA 6020	N-02, N-03
STLC Metals by 6000/7000 Series Methods										
Lead	**9.1**	0.050	0.10	mg/L	100	A006138	08-Jun-10	08-Jun-10	STLC/EPA 6020	N-06

CS102

1001715-02 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**180**	1.9	3.8	mg/kg	20	A005260	18-May-10	18-May-10	EPA 6020	N-02, N-03
STLC Metals by 6000/7000 Series Methods										
Lead	**37**	0.25	0.50	mg/L	500	A006138	08-Jun-10	08-Jun-10	STLC/EPA 6020	N-06

CS103

1001715-03 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**6.3**	0.47	0.93	mg/kg	5	A005260	18-May-10	18-May-10	EPA 6020	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara Street	Project Number: 08-25430	**Reported:**
Santa Barbara CA, 93001	Project Manager: Shawn Decker	08-Jun-10 16:24

CS104

1001715-04 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**90**	0.50	0.99	mg/kg	5	A005260	18-May-10	18-May-10	EPA 6020	N-02
STLC Metals by 6000/7000 Series Methods										
Lead	**14**	0.050	0.10	mg/L	100	A006138	08-Jun-10	08-Jun-10	STLC/EPA 6020	N-06

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara Street	Project Number: 08-25430	**Reported:**
Santa Barbara CA, 93001	Project Manager: Shawn Decker	08-Jun-10 16:24

Total Metals by EPA 6000/7000 Series Methods - Quality Control

Analyte	Result	Method Limit	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
Batch A005260 - EPA 3050B											
Blank (A005260-BLK1)					Prepared & Analyzed: 18-May-10						
Lead	ND		0.20	mg/kg							
LCS (A005260-BS1)					Prepared & Analyzed: 18-May-10						
Lead	14.6		0.20	mg/kg	15.0		97.4	85-115		20	
LCS Dup (A005260-BSD1)					Prepared & Analyzed: 18-May-10						
Lead	14.7		0.20	mg/kg	15.0		97.8	85-115	0.412	20	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara Street	Project Number: 08-25430	**Reported:**
Santa Barbara CA, 93001	Project Manager: Shawn Decker	08-Jun-10 16:24

STLC Metals by 6000/7000 Series Methods - Quality Control

Analyte	Result	Method Limit	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
Batch A006138 - EPA 3005A Leachate											
Blank (A006138-BLK1)					Prepared & Analyzed: 08-Jun-10						
Lead	ND		0.0010	mg/L							
LCS (A006138-BS1)					Prepared & Analyzed: 08-Jun-10						
Lead	0.147		0.0010	mg/L	0.150		97.8	85-115		20	
LCS Dup (A006138-BSD1)					Prepared & Analyzed: 08-Jun-10						
Lead	0.148		0.0010	mg/L	0.150		98.5	85-115	0.758	20	
Duplicate (A006138-DUP1)		**Source: 1001681-08**			Prepared & Analyzed: 08-Jun-10						
Lead	1.74		0.010	mg/L		1.56			11.4	20	
Matrix Spike (A006138-MS1)		**Source: 1001681-08**			Prepared & Analyzed: 08-Jun-10						
Lead	8.19		0.040	mg/L	6.00	1.56	111	64-153		20	
Matrix Spike Dup (A006138-MSD1)		**Source: 1001681-08**			Prepared & Analyzed: 08-Jun-10						
Lead	8.42		0.040	mg/L	6.00	1.56	114	64-153	3.50	20	

Notes and Definitions

N-06	STLC analyte concentration exceeds STLC limit.
N-03	Analyte concentration above 20 X TCLP.
N-02	Analyte concentration below TTLC but above 10 X STLC.
DET	Analyte DETECTED
ND	Analyte NOT DETECTED at or above the reporting limit
NR	Not Reported
dry	Sample results reported on a dry weight basis
RPD	Relative Percent Difference

Oilfield Environmental and Compliance

307 Roemer Way Suite 300, Santa Maria CA 93454
phone: (805) 922-4772 fax: (805) 925-3376 www.oecusa.com

Highway 33, McKittrick CA
phone: (661) 762-9143

CHAIN OF CUSTODY

Page 1 of 1

Company: Rincon Consultants, Inc.
Address: 790 East Santa Clara Street
City/State/ZIP: Ventura, CA 93001
Phone: 8056411000 Fax: 8056411072 E-mail: shelle@rinconcnsltnts.com
Report To: Rincon Sampler: Shawna Decker
Send report via- FAX- ☐ PDF- ☒ Colt/LUFT EDF- ☐ EDD- ☐
Turnaround Time: 10 Days- ☐ 5 Days- ☐ 72 hr- ☐ 48 hr- ☐ 24 hr- ☒ ASAP- ☐

Project Name/#: 08-25430 125 State
Site: 125 State Street, Santa Barbara, CA

OEC Sample ID	Date/Time Sampled	Matrix	# of Cont.	Client Sample ID	Total Lead 6000/7000	Special Instructions:
1001715-1A	5-17-10/14:30	Soil	1	CS101	X	MDL
-2A	14:35			CS102	X	
-3A	14:40			CS103	X	
-4A	14:45			CS104	X	

Relinquished By:	Date: 5-17-10	Time: 1505	
Received By:	Date: 5/17/10	Time: 1505	
Relinquished By:	Date: 5/17/10	Time: 1700	
Received By:	Date: 5-17-10	Time: 1700	
Relinquished By:	Date:	Time:	
Received By:	Date:	Time:	

Comments/PO#: Price per 125 State Quote

OEC SAMPLE RECEIPT

Rev. 01/15/10

CLIENT: Rincon OEC ID #: 1001715 Temp: 3 °C

Acceptable Range: 0°C to 6°C

COC RECEIVED DATE/TIME: 5-17-10 1700

RECEIPT LOGIN DATE/TIME: 5-17-10 1712

REFRIGERATOR(s): 1

SAMPLE TRANSPORT, RECEIPT, CONDITION & PRESERVATION:		Yes	No	N/A	(*) PROBLEM CHAIN FORM NEEDED
☒ OEC Courier/Sampler	COC document(s) received with samples	☒	☐*	☐	Custody Seals (circle): Present / Absent
☐ Delivery(Other than OEC Courier)	Correct containers for analysis requested	☒	☐*	☐	Samples / Coolers
☒ Samples Received on Ice	Container(s) intact and in good condition	☒	☐*	☐	Intact / Broken*
☐ Samples Received Outside Temp. Range*	Container label(s) consistent with COC	☒	☐*	☐	Method of Shipment & Tracking #(if applicable):
☐ Samples Direct from field (Outside Temp)	OEC preservative added (**note std ID)	☐**	☐	☒	
☐ After-Hours Outside Drop-off [Brought Inside]	Proper preservation on sample label(s)	☐	☐	☒	(**) OEC Preservative ID:
(Initials/Date/Time):	VOA containers free of headspace	☐	☐*	☒	Dissolved Metals Filtration: (Date/Init/Preserve ID)
	Tedlar Bags free of condensation	☐	☐*	☒	

CONTAINERS, COC CHANGES AND/OR CORRECTIONS — CHANGES AUTHORIZED BY:

OEC ID	Client ID ***If blank, refer to CoC	Container Description	Preservative	ResCl /pH	Matrix	Date/Time Sampled ***	Comments / Remarks / Condition Notes, Etc.
1-4A		1-8oz glass ea	—	—	Solid		

RECEIPT LOGIN BY: hy RECEIPT REVIEWED BY: [signature]

Oilfield Environmental and Compliance, INC.

Shawn Decker
Rincon Consultants
790 East Santa Clara Street
Santa Barbara, CA 93001

04 June 2010

RE: 125 State Street Excavation

Work Order: 1001716

Dear Client:

Enclosed is an analytical report for the above referenced project. The samples included in this report were received on 17-May-10 17:00 and analyzed in accordance with the attached chain-of-custody.

Unless otherwise noted, all analytical testing was accomplished in accordance with the guidelines established in our Quality Assurance Manual, applicable standard operating procedures, and other related documentation. The results in this analytical report are limited to the samples tested and any reproduction thereof must be made in its entirety.

If you have any questions regarding this report, please do not hesitate to contact the undersigned.

Sincerely,

Vanessa Miller

Project Manager Assistant

TEL: (805) 922-4772
307 Roemer Way, Suite 300, Santa Maria, CA 93454 www.oecusa.com FAX: (805) 925-3376

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara Street	Project Number: 08-25430	**Reported:**
Santa Barbara CA, 93001	Project Manager: Shawn Decker	04-Jun-10 15:11

ANALYTICAL REPORT FOR SAMPLES

Sample ID	Laboratory ID	Matrix	Date Sampled	Date Received
VS1	1001716-01	Solid	17-May-10 13:00	17-May-10 17:00
VS2	1001716-02	Solid	17-May-10 13:10	17-May-10 17:00
VS3	1001716-03	Solid	17-May-10 13:20	17-May-10 17:00
VS4	1001716-04	Solid	17-May-10 13:30	17-May-10 17:00
VS5	1001716-05	Solid	17-May-10 13:40	17-May-10 17:00
VS6	1001716-06	Solid	17-May-10 13:50	17-May-10 17:00
VS7	1001716-07	Solid	17-May-10 14:00	17-May-10 17:00
VS8	1001716-08	Solid	17-May-10 14:10	17-May-10 17:00
VS9	1001716-09	Solid	17-May-10 14:20	17-May-10 17:00
VS10	1001716-10	Solid	17-May-10 14:30	17-May-10 17:00
VS11	1001716-11	Solid	17-May-10 14:40	17-May-10 17:00
VS12	1001716-12	Solid	17-May-10 14:50	17-May-10 17:00

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara Street	Project Number: 08-25430	**Reported:**
Santa Barbara CA, 93001	Project Manager: Shawn Decker	04-Jun-10 15:11

VS1
1001716-01 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
TEPH by GC FID										
TPH Diesel (C13-C22)	ND	2.6	10	mg/kg	1	A005323	21-May-10	25-May-10	EPA 8015	
TPH Motor Oil (C23-C40)	ND	6.9	50	"	"	"	"	"	"	
Surrogate: o-Terphenyl			*113 %*	*50-150*		"	"	"	"	

VS2
1001716-02 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
TEPH by GC FID										
TPH Diesel (C13-C22)	ND	2.6	10	mg/kg	1	A005323	21-May-10	25-May-10	EPA 8015	
TPH Motor Oil (C23-C40)	**170**	6.9	50	"	"	"	"	"	"	
Surrogate: o-Terphenyl			*112 %*	*50-150*		"	"	"	"	
Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring										**R-01**
Acenaphthene	ND	0.0094	0.010	mg/kg	1	A005285	19-May-10	20-May-10	EPA 8270M	
Acenaphthylene	**0.011**	0.0070	0.010	"	"	"	"	"	"	
Anthracene	ND	0.0084	0.010	"	"	"	"	"	"	
Benz(a)anthracene	**0.058**	0.0060	0.010	"	"	"	"	"	"	
Benzo (b) fluoranthene	**0.078**	0.0080	0.010	"	"	"	"	"	"	
Benzo (k) fluoranthene	**0.045**	0.0060	0.010	"	"	"	"	"	"	
Benzo (a) pyrene	**0.045**	0.0052	0.010	"	"	"	"	"	"	
Benzo (g,h,i) perylene	**0.025**	0.010	0.020	"	"	"	"	"	"	
Chrysene	**0.081**	0.0060	0.010	"	"	"	"	"	"	
Dibenz (a,h) anthracene	ND	0.010	0.020	"	"	"	"	"	"	
Fluoranthene	**0.094**	0.0060	0.010	"	"	"	"	"	"	
Fluorene	ND	0.0060	0.010	"	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	**0.025**	0.0070	0.010	"	"	"	"	"	"	
Naphthalene	ND	0.010	0.020	"	"	"	"	"	"	
Phenanthrene	ND	0.0094	0.010	"	"	"	"	"	"	
Pyrene	**0.086**	0.0060	0.010	"	"	"	"	"	"	
Surrogate: p-Terphenyl-d14			*112 %*	*29-165*		"	"	"	"	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara Street	Project Number: 08-25430	**Reported:**
Santa Barbara CA, 93001	Project Manager: Shawn Decker	04-Jun-10 15:11

VS3

1001716-03 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
TEPH by GC FID										
TPH Diesel (C13-C22)	ND	2.6	10	mg/kg	1	A005323	21-May-10	25-May-10	EPA 8015	
TPH Motor Oil (C23-C40)	ND	6.9	50	"	"	"	"	"	"	
Surrogate: o-Terphenyl			*109 %*	*50-150*		"	"	"	"	
Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring										**O-05**
Acenaphthene	ND	0.0047	0.0050	mg/kg	1	A006011	01-Jun-10	02-Jun-10	EPA 8270M	
Acenaphthylene	ND	0.0035	0.0050	"	"	"	"	"	"	
Anthracene	ND	0.0042	0.0050	"	"	"	"	"	"	
Benz(a)anthracene	ND	0.0030	0.0050	"	"	"	"	"	"	
Benzo (b) fluoranthene	ND	0.0040	0.0050	"	"	"	"	"	"	
Benzo (k) fluoranthene	ND	0.0030	0.0050	"	"	"	"	"	"	
Benzo (a) pyrene	ND	0.0026	0.0050	"	"	"	"	"	"	
Benzo (g,h,i) perylene	ND	0.0050	0.010	"	"	"	"	"	"	
Chrysene	ND	0.0030	0.0050	"	"	"	"	"	"	
Dibenz (a,h) anthracene	ND	0.0050	0.010	"	"	"	"	"	"	
Fluoranthene	ND	0.0030	0.0050	"	"	"	"	"	"	
Fluorene	ND	0.0030	0.0050	"	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	ND	0.0035	0.0050	"	"	"	"	"	"	
Naphthalene	ND	0.0050	0.010	"	"	"	"	"	"	
Phenanthrene	ND	0.0047	0.0050	"	"	"	"	"	"	
Pyrene	ND	0.0030	0.0050	"	"	"	"	"	"	
Surrogate: p-Terphenyl-d14			*93.8 %*	*29-165*		"	"	"	"	

VS4

1001716-04 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
TEPH by GC FID										
TPH Diesel (C13-C22)	ND	2.6	10	mg/kg	1	A005323	21-May-10	25-May-10	EPA 8015	
TPH Motor Oil (C23-C40)	**170**	6.9	50	"	"	"	"	"	"	
Surrogate: o-Terphenyl			*110 %*	*50-150*		"	"	"	"	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara Street	Project Number: 08-25430	**Reported:**
Santa Barbara CA, 93001	Project Manager: Shawn Decker	04-Jun-10 15:11

VS5

1001716-05 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
TEPH by GC FID										
TPH Diesel (C13-C22)	ND	2.6	10	mg/kg	1	A005323	21-May-10	25-May-10	EPA 8015	
TPH Motor Oil (C23-C40)	**120**	6.9	50	"	"	"	"	"	"	
Surrogate: o-Terphenyl			*82.3 %*	*50-150*		"	"	"	"	
Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring										
Acenaphthene	ND	0.0094	0.010	mg/kg	1	A005285	19-May-10	20-May-10	EPA 8270M	
Acenaphthylene	ND	0.0070	0.010	"	"	"	"	"	"	
Anthracene	ND	0.0084	0.010	"	"	"	"	"	"	
Benz(a)anthracene	**0.013**	0.0060	0.010	"	"	"	"	"	"	
Benzo (b) fluoranthene	**0.019**	0.0080	0.010	"	"	"	"	"	"	
Benzo (k) fluoranthene	**0.013**	0.0060	0.010	"	"	"	"	"	"	
Benzo (a) pyrene	**0.019**	0.0052	0.010	"	"	"	"	"	"	
Benzo (g,h,i) perylene	**0.021**	0.010	0.020	"	"	"	"	"	"	
Chrysene	**0.017**	0.0060	0.010	"	"	"	"	"	"	
Dibenz (a,h) anthracene	ND	0.010	0.020	"	"	"	"	"	"	
Fluoranthene	**0.023**	0.0060	0.010	"	"	"	"	"	"	
Fluorene	ND	0.0060	0.010	"	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	**0.019**	0.0070	0.010	"	"	"	"	"	"	
Naphthalene	ND	0.010	0.020	"	"	"	"	"	"	
Phenanthrene	**0.013**	0.0094	0.010	"	"	"	"	"	"	
Pyrene	**0.023**	0.0060	0.010	"	"	"	"	"	"	
Surrogate: p-Terphenyl-d14			*118 %*	*29-165*		"	"	"	"	

VS6

1001716-06 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
TEPH by GC FID										
TPH Diesel (C13-C22)	ND	2.6	10	mg/kg	1	A005323	21-May-10	25-May-10	EPA 8015	
TPH Motor Oil (C23-C40)	**110**	6.9	50	"	"	"	"	"	"	
Surrogate: o-Terphenyl			*111 %*	*50-150*		"	"	"	"	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara Street	Project Number: 08-25430	**Reported:**
Santa Barbara CA, 93001	Project Manager: Shawn Decker	04-Jun-10 15:11

VS7
1001716-07 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
TEPH by GC FID										
TPH Diesel (C13-C22)	ND	2.6	10	mg/kg	1	A005323	21-May-10	25-May-10	EPA 8015	
TPH Motor Oil (C23-C40)	ND	6.9	50	"	"	"	"	"	"	
Surrogate: o-Terphenyl			*124 %*	*50-150*		"	"	"	"	
Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring										
Acenaphthene	ND	0.0047	0.0050	mg/kg	1	A005285	19-May-10	19-May-10	EPA 8270M	
Acenaphthylene	**0.0050**	0.0035	0.0050	"	"	"	"	"	"	
Anthracene	ND	0.0042	0.0050	"	"	"	"	"	"	
Benz(a)anthracene	**0.015**	0.0030	0.0050	"	"	"	"	"	"	
Benzo (b) fluoranthene	**0.024**	0.0040	0.0050	"	"	"	"	"	"	
Benzo (k) fluoranthene	**0.014**	0.0030	0.0050	"	"	"	"	"	"	
Benzo (a) pyrene	**0.020**	0.0026	0.0050	"	"	"	"	"	"	
Benzo (g,h,i) perylene	**0.021**	0.0050	0.010	"	"	"	"	"	"	
Chrysene	**0.018**	0.0030	0.0050	"	"	"	"	"	"	
Dibenz (a,h) anthracene	ND	0.0050	0.010	"	"	"	"	"	"	
Fluoranthene	**0.024**	0.0030	0.0050	"	"	"	"	"	"	
Fluorene	ND	0.0030	0.0050	"	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	**0.018**	0.0035	0.0050	"	"	"	"	"	"	
Naphthalene	ND	0.0050	0.010	"	"	"	"	"	"	
Phenanthrene	**0.0067**	0.0047	0.0050	"	"	"	"	"	"	
Pyrene	**0.024**	0.0030	0.0050	"	"	"	"	"	"	
Surrogate: p-Terphenyl-d14			*116 %*	*29-165*		"	"	"	"	

VS8
1001716-08 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
TEPH by GC FID										
TPH Diesel (C13-C22)	ND	2.6	10	mg/kg	1	A005323	21-May-10	25-May-10	EPA 8015	
TPH Motor Oil (C23-C40)	ND	6.9	50	"	"	"	"	"	"	
Surrogate: o-Terphenyl			*111 %*	*50-150*		"	"	"	"	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara Street	Project Number: 08-25430	**Reported:**
Santa Barbara CA, 93001	Project Manager: Shawn Decker	04-Jun-10 15:11

VS9

1001716-09 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
TEPH by GC FID										
TPH Diesel (C13-C22)	ND	2.6	10	mg/kg	1	A005323	21-May-10	25-May-10	EPA 8015	
TPH Motor Oil (C23-C40)	ND	6.9	50	"	"	"	"	"	"	
Surrogate: o-Terphenyl			*112 %*	*50-150*		"	"	"	"	
Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring										**O-05**
Acenaphthene	ND	0.0047	0.0050	mg/kg	1	A006011	01-Jun-10	02-Jun-10	EPA 8270M	
Acenaphthylene	ND	0.0035	0.0050	"	"	"	"	"	"	
Anthracene	ND	0.0042	0.0050	"	"	"	"	"	"	
Benz(a)anthracene	**0.0077**	0.0030	0.0050	"	"	"	"	"	"	
Benzo (b) fluoranthene	**0.015**	0.0040	0.0050	"	"	"	"	"	"	
Benzo (k) fluoranthene	**0.016**	0.0030	0.0050	"	"	"	"	"	"	
Benzo (a) pyrene	**0.019**	0.0026	0.0050	"	"	"	"	"	"	
Benzo (g,h,i) perylene	**0.021**	0.0050	0.010	"	"	"	"	"	"	
Chrysene	**0.012**	0.0030	0.0050	"	"	"	"	"	"	
Dibenz (a,h) anthracene	ND	0.0050	0.010	"	"	"	"	"	"	
Fluoranthene	**0.016**	0.0030	0.0050	"	"	"	"	"	"	
Fluorene	ND	0.0030	0.0050	"	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	**0.015**	0.0035	0.0050	"	"	"	"	"	"	
Naphthalene	ND	0.0050	0.010	"	"	"	"	"	"	
Phenanthrene	**0.0050**	0.0047	0.0050	"	"	"	"	"	"	
Pyrene	**0.017**	0.0030	0.0050	"	"	"	"	"	"	
Surrogate: p-Terphenyl-d14			*81.2 %*	*29-165*		"	"	"	"	

VS10

1001716-10 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
TEPH by GC FID										
TPH Diesel (C13-C22)	**110**	2.6	10	mg/kg	1	A005323	21-May-10	25-May-10	EPA 8015	
TPH Motor Oil (C23-C40)	**990**	6.9	50	"	"	"	"	"	"	
Surrogate: o-Terphenyl			*94.3 %*	*50-150*		"	"	"	"	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara Street	Project Number: 08-25430	**Reported:**
Santa Barbara CA, 93001	Project Manager: Shawn Decker	04-Jun-10 15:11

VS11
1001716-11 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
TEPH by GC FID										
TPH Diesel (C13-C22)	ND	2.6	10	mg/kg	1	A005323	21-May-10	25-May-10	EPA 8015	
TPH Motor Oil (C23-C40)	**99**	6.9	50	"	"	"	"	"	"	
Surrogate: o-Terphenyl			*73.8 %*	*50-150*		"	"	"	"	

VS12
1001716-12 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
TEPH by GC FID										
TPH Diesel (C13-C22)	**11**	2.6	10	mg/kg	1	A005372	25-May-10	25-May-10	EPA 8015	
TPH Motor Oil (C23-C40)	**340**	6.9	50	"	"	"	"	"	"	
Surrogate: o-Terphenyl			*107 %*	*50-150*		"	"	"	"	
Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring										**O-05**
Acenaphthene	ND	0.0094	0.010	mg/kg	1	A006011	01-Jun-10	02-Jun-10	EPA 8270M	
Acenaphthylene	ND	0.0070	0.010	"	"	"	"	"	"	
Anthracene	ND	0.0084	0.010	"	"	"	"	"	"	
Benz(a)anthracene	**0.016**	0.0060	0.010	"	"	"	"	"	"	
Benzo (b) fluoranthene	**0.022**	0.0080	0.010	"	"	"	"	"	"	
Benzo (k) fluoranthene	**0.027**	0.0060	0.010	"	"	"	"	"	"	
Benzo (a) pyrene	**0.027**	0.0052	0.010	"	"	"	"	"	"	
Benzo (g,h,i) perylene	**0.025**	0.010	0.020	"	"	"	"	"	"	
Chrysene	**0.026**	0.0060	0.010	"	"	"	"	"	"	
Dibenz (a,h) anthracene	ND	0.010	0.020	"	"	"	"	"	"	
Fluoranthene	**0.035**	0.0060	0.010	"	"	"	"	"	"	
Fluorene	ND	0.0060	0.010	"	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	**0.019**	0.0070	0.010	"	"	"	"	"	"	
Naphthalene	ND	0.010	0.020	"	"	"	"	"	"	
Phenanthrene	**0.011**	0.0094	0.010	"	"	"	"	"	"	
Pyrene	**0.041**	0.0060	0.010	"	"	"	"	"	"	
Surrogate: p-Terphenyl-d14			*85.0 %*	*29-165*		"	"	"	"	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara Street	Project Number: 08-25430	**Reported:**
Santa Barbara CA, 93001	Project Manager: Shawn Decker	04-Jun-10 15:11

TEPH by GC FID - Quality Control

Analyte	Result	Method Limit	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
Batch A005323 - EPA 3550B											
Blank (A005323-BLK1)					Prepared & Analyzed: 21-May-10						
TPH Diesel (C13-C22)	ND		10	mg/kg							
TPH Motor Oil (C23-C40)	ND		50	"							
Surrogate: o-Terphenyl	*57.8*			"	*50.0*		*116*	*50-150*			
LCS (A005323-BS1)					Prepared & Analyzed: 21-May-10						
TPH Diesel (C13-C22)	493		10	mg/kg	500		98.6	70-130		20	
Surrogate: o-Terphenyl	*51.0*			"	*50.0*		*102*	*50-150*			
LCS Dup (A005323-BSD1)					Prepared & Analyzed: 21-May-10						
TPH Diesel (C13-C22)	550		10	mg/kg	500		110	70-130	10.8	20	
Surrogate: o-Terphenyl	*54.0*			"	*50.0*		*108*	*50-150*			
Duplicate (A005323-DUP1)		**Source: 1001707-01**			Prepared: 21-May-10 Analyzed: 25-May-10						
TPH Diesel (C13-C22)	ND		10	mg/kg		ND				20	
TPH Motor Oil (C23-C40)	12.7		50	"		7.65			49.4	20	QR-04
Surrogate: o-Terphenyl	*62.0*			"	*50.0*		*124*	*50-150*			
Matrix Spike (A005323-MS1)		**Source: 1001707-01**			Prepared: 21-May-10 Analyzed: 25-May-10						
TPH Diesel (C13-C22)	473		10	mg/kg	500	ND	94.6	70-130		20	
Surrogate: o-Terphenyl	*53.2*			"	*50.0*		*106*	*50-150*			
Matrix Spike Dup (A005323-MSD1)		**Source: 1001707-01**			Prepared: 21-May-10 Analyzed: 25-May-10						
TPH Diesel (C13-C22)	467		10	mg/kg	500	ND	93.5	70-130	1.21	20	
Surrogate: o-Terphenyl	*53.2*			"	*50.0*		*106*	*50-150*			
Batch A005372 - EPA 3550B											
Blank (A005372-BLK1)					Prepared & Analyzed: 25-May-10						
TPH Diesel (C13-C22)	ND		10	mg/kg							
TPH Motor Oil (C23-C40)	ND		50	"							
Surrogate: o-Terphenyl	*51.2*			"	*50.0*		*102*	*50-150*			

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara Street	Project Number: 08-25430	**Reported:**
Santa Barbara CA, 93001	Project Manager: Shawn Decker	04-Jun-10 15:11

TEPH by GC FID - Quality Control

Analyte	Result	Method Limit	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
Batch A005372 - EPA 3550B											
LCS (A005372-BS1)					Prepared & Analyzed: 25-May-10						
TPH Diesel (C13-C22)	430		10	mg/kg	500		86.0	70-130		20	
Surrogate: o-Terphenyl	*45.5*			"	*50.0*		*91.1*	*50-150*			
LCS Dup (A005372-BSD1)					Prepared & Analyzed: 25-May-10						
TPH Diesel (C13-C22)	437		10	mg/kg	500		87.4	70-130	1.69	20	
Surrogate: o-Terphenyl	*46.9*			"	*50.0*		*93.8*	*50-150*			
Duplicate (A005372-DUP1)		**Source: 1001717-01**			Prepared: 25-May-10 Analyzed: 27-May-10						
TPH Diesel (C13-C22)	ND		10	mg/kg		ND				20	
TPH Motor Oil (C23-C40)	ND		50	"		11.2				20	
Surrogate: o-Terphenyl	*51.7*			"	*50.0*		*103*	*50-150*			
Matrix Spike (A005372-MS1)		**Source: 1001717-01**			Prepared: 25-May-10 Analyzed: 27-May-10						
TPH Diesel (C13-C22)	458		10	mg/kg	500	ND	91.5	70-130		20	
Surrogate: o-Terphenyl	*47.7*			"	*50.0*		*95.4*	*50-150*			
Matrix Spike Dup (A005372-MSD1)		**Source: 1001717-01**			Prepared: 25-May-10 Analyzed: 27-May-10						
TPH Diesel (C13-C22)	442		10	mg/kg	500	ND	88.4	70-130	3.42	20	
Surrogate: o-Terphenyl	*46.0*			"	*50.0*		*91.9*	*50-150*			

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara Street	Project Number: 08-25430	**Reported:**
Santa Barbara CA, 93001	Project Manager: Shawn Decker	04-Jun-10 15:11

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring - Quality Control

Analyte	Result	Method Limit	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
Batch A005285 - EPA 3550B MS											
Blank (A005285-BLK1)					Prepared & Analyzed: 19-May-10						
Acenaphthene	ND		0.0050	mg/kg							
Acenaphthylene	ND		0.0050	"							
Anthracene	ND		0.0050	"							
Benz(a)anthracene	ND		0.0050	"							
Benzo (b) fluoranthene	ND		0.0050	"							
Benzo (k) fluoranthene	ND		0.0050	"							
Benzo (a) pyrene	ND		0.0050	"							
Benzo (g,h,i) perylene	ND		0.010	"							
Chrysene	ND		0.0050	"							
Dibenz (a,h) anthracene	ND		0.010	"							
Fluoranthene	ND		0.0050	"							
Fluorene	ND		0.0050	"							
Indeno (1,2,3-cd) pyrene	ND		0.0050	"							
Naphthalene	ND		0.010	"							
Phenanthrene	ND		0.0050	"							
Pyrene	ND		0.0050	"							
Surrogate: p-Terphenyl-d14	*0.0307*			"	*0.0267*		*115*	*29-165*			
LCS (A005285-BS1)					Prepared & Analyzed: 19-May-10						
Acenaphthene	0.0227		0.0050	mg/kg	0.0267		85.0	40-120		30	
Acenaphthylene	0.0220		0.0050	"	0.0267		82.5	40-120		30	
Anthracene	0.0270		0.0050	"	0.0267		101	40-120		30	
Benz(a)anthracene	0.0317		0.0050	"	0.0267		119	40-120		30	
Benzo (b) fluoranthene	0.0267		0.0050	"	0.0267		100	40-120		30	
Benzo (k) fluoranthene	0.0290		0.0050	"	0.0267		109	40-120		30	
Benzo (a) pyrene	0.0290		0.0050	"	0.0267		109	40-120		30	
Benzo (g,h,i) perylene	0.0303		0.010	"	0.0267		114	40-120		30	
Chrysene	0.0300		0.0050	"	0.0267		112	40-120		30	
Dibenz (a,h) anthracene	0.0317		0.010	"	0.0267		119	40-120		30	
Fluoranthene	0.0307		0.0050	"	0.0267		115	40-120		30	
Fluorene	0.0230		0.0050	"	0.0267		86.2	40-120		30	
Indeno (1,2,3-cd) pyrene	0.0313		0.0050	"	0.0267		118	40-120		30	
Naphthalene	0.0190		0.010	"	0.0267		71.2	40-120		30	
Phenanthrene	0.0277		0.0050	"	0.0267		104	40-120		30	
Pyrene	0.0310		0.0050	"	0.0267		116	40-120		30	
Surrogate: p-Terphenyl-d14	*0.0310*			"	*0.0267*		*116*	*29-165*			

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara Street	Project Number: 08-25430	**Reported:**
Santa Barbara CA, 93001	Project Manager: Shawn Decker	04-Jun-10 15:11

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring - Quality Control

Analyte	Result	Method Limit	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
Batch A005285 - EPA 3550B MS											
LCS Dup (A005285-BSD1)					Prepared & Analyzed: 19-May-10						
Acenaphthene	0.0240		0.0050	mg/kg	0.0267		90.0	40-120	5.71	30	
Acenaphthylene	0.0237		0.0050	"	0.0267		88.8	40-120	7.30	30	
Anthracene	0.0270		0.0050	"	0.0267		101	40-120	0.00	30	
Benz(a)anthracene	0.0317		0.0050	"	0.0267		119	40-120	0.00	30	
Benzo (b) fluoranthene	0.0317		0.0050	"	0.0267		119	40-120	17.1	30	
Benzo (k) fluoranthene	0.0307		0.0050	"	0.0267		115	40-120	5.59	30	
Benzo (a) pyrene	0.0300		0.0050	"	0.0267		112	40-120	3.39	30	
Benzo (g,h,i) perylene	0.0317		0.010	"	0.0267		119	40-120	4.30	30	
Chrysene	0.0303		0.0050	"	0.0267		114	40-120	1.10	30	
Dibenz (a,h) anthracene	0.0303		0.010	"	0.0267		114	40-120	4.30	30	
Fluoranthene	0.0290		0.0050	"	0.0267		109	40-120	5.59	30	
Fluorene	0.0227		0.0050	"	0.0267		85.0	40-120	1.46	30	
Indeno (1,2,3-cd) pyrene	0.0310		0.0050	"	0.0267		116	40-120	1.07	30	
Naphthalene	0.0193		0.010	"	0.0267		72.5	40-120	1.74	30	
Phenanthrene	0.0270		0.0050	"	0.0267		101	40-120	2.44	30	
Pyrene	0.0290		0.0050	"	0.0267		109	40-120	6.67	30	
Surrogate: p-Terphenyl-d14	*0.0290*			*"*	*0.0267*		*109*	*29-165*			
Duplicate (A005285-DUP1)		**Source: 1001672-13**			Prepared & Analyzed: 19-May-10						
Acenaphthene	ND		0.0050	mg/kg		ND				30	
Acenaphthylene	ND		0.0050	"		ND				30	
Anthracene	ND		0.0050	"		ND				30	
Benz(a)anthracene	ND		0.0050	"		ND				30	
Benzo (b) fluoranthene	ND		0.0050	"		ND				30	
Benzo (k) fluoranthene	ND		0.0050	"		ND				30	
Benzo (a) pyrene	ND		0.0050	"		ND				30	
Benzo (g,h,i) perylene	ND		0.010	"		ND				30	
Chrysene	ND		0.0050	"		ND				30	
Dibenz (a,h) anthracene	ND		0.010	"		ND				30	
Fluoranthene	ND		0.0050	"		ND				30	
Fluorene	ND		0.0050	"		ND				30	
Indeno (1,2,3-cd) pyrene	ND		0.0050	"		ND				30	
Naphthalene	ND		0.010	"		ND				30	
Phenanthrene	ND		0.0050	"		ND				30	
Pyrene	ND		0.0050	"		ND				30	
Surrogate: p-Terphenyl-d14	*0.0303*			*"*	*0.0266*		*114*	*29-165*			

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara Street	Project Number: 08-25430	**Reported:**
Santa Barbara CA, 93001	Project Manager: Shawn Decker	04-Jun-10 15:11

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring - Quality Control

Analyte	Result	Method Limit	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
Batch A005285 - EPA 3550B MS											
Matrix Spike (A005285-MS1)	**Source: 1001672-13**				Prepared & Analyzed: 19-May-10						
Acenaphthene	0.0143		0.0050	mg/kg	0.0266	ND	53.7	0-131		30	
Acenaphthylene	0.0130		0.0050	"	0.0266	ND	48.8	0-125		30	
Anthracene	0.0183		0.0050	"	0.0266	ND	68.8	0-144		30	
Benz(a)anthracene	0.0303		0.0050	"	0.0266	ND	114	27-161		30	
Benzo (b) fluoranthene	0.0237		0.0050	"	0.0266	ND	88.8	36-147		30	
Benzo (k) fluoranthene	0.0260		0.0050	"	0.0266	ND	97.5	47-137		30	
Benzo (a) pyrene	0.0260		0.0050	"	0.0266	ND	97.5	21-152		30	
Benzo (g,h,i) perylene	0.0250		0.010	"	0.0266	ND	93.7	37-145		30	
Chrysene	0.0290		0.0050	"	0.0266	ND	109	45-134		30	
Dibenz (a,h) anthracene	0.0286		0.010	"	0.0266	ND	108	36-159		30	
Fluoranthene	0.0270		0.0050	"	0.0266	ND	101	36-137		30	
Fluorene	0.0160		0.0050	"	0.0266	ND	60.0	0-135		30	
Indeno (1,2,3-cd) pyrene	0.0300		0.0050	"	0.0266	ND	112	32-163		30	
Naphthalene	0.0113		0.010	"	0.0266	ND	42.5	0-111		30	
Phenanthrene	0.0203		0.0050	"	0.0266	ND	76.3	4-141		30	
Pyrene	0.0270		0.0050	"	0.0266	ND	101	32-143		30	
Surrogate: p-Terphenyl-d14	*0.0310*			"	*0.0266*		*116*	*29-165*			
Matrix Spike Dup (A005285-MSD1)	**Source: 1001672-13**				Prepared & Analyzed: 19-May-10						
Acenaphthene	0.0136		0.0050	mg/kg	0.0266	ND	51.2	0-131	4.99	30	
Acenaphthylene	0.0123		0.0050	"	0.0266	ND	46.2	0-125	5.50	30	
Anthracene	0.0166		0.0050	"	0.0266	ND	62.5	0-144	9.76	30	
Benz(a)anthracene	0.0306		0.0050	"	0.0266	ND	115	27-161	0.860	30	
Benzo (b) fluoranthene	0.0246		0.0050	"	0.0266	ND	92.5	36-147	3.91	30	
Benzo (k) fluoranthene	0.0239		0.0050	"	0.0266	ND	90.0	47-137	8.23	30	
Benzo (a) pyrene	0.0233		0.0050	"	0.0266	ND	87.5	21-152	11.0	30	
Benzo (g,h,i) perylene	0.0219		0.010	"	0.0266	ND	82.5	37-145	13.0	30	
Chrysene	0.0276		0.0050	"	0.0266	ND	104	45-134	4.94	30	
Dibenz (a,h) anthracene	0.0279		0.010	"	0.0266	ND	105	36-159	2.59	30	
Fluoranthene	0.0253		0.0050	"	0.0266	ND	95.0	36-137	6.60	30	
Fluorene	0.0186		0.0050	"	0.0266	ND	70.0	0-135	15.2	30	
Indeno (1,2,3-cd) pyrene	0.0289		0.0050	"	0.0266	ND	109	32-163	3.62	30	
Naphthalene	0.0120		0.010	"	0.0266	ND	45.0	0-111	5.48	30	
Phenanthrene	0.0243		0.0050	"	0.0266	ND	91.2	4-141	17.7	30	
Pyrene	0.0249		0.0050	"	0.0266	ND	93.7	32-143	7.92	30	
Surrogate: p-Terphenyl-d14	*0.0309*			"	*0.0266*		*116*	*29-165*			

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara Street	Project Number: 08-25430	**Reported:**
Santa Barbara CA, 93001	Project Manager: Shawn Decker	04-Jun-10 15:11

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring - Quality Control

Analyte	Result	Method Limit	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
Batch A006011 - EPA 3550B MS											
Blank (A006011-BLK1)					Prepared: 01-Jun-10 Analyzed: 02-Jun-10						**C-05**
Acenaphthene	ND		0.0050	mg/kg							
Acenaphthylene	ND		0.0050	"							
Anthracene	ND		0.0050	"							
Benz(a)anthracene	ND		0.0050	"							
Benzo (b) fluoranthene	ND		0.0050	"							
Benzo (k) fluoranthene	ND		0.0050	"							
Benzo (a) pyrene	ND		0.0050	"							
Benzo (g,h,i) perylene	ND		0.010	"							
Chrysene	ND		0.0050	"							
Dibenz (a,h) anthracene	ND		0.010	"							
Fluoranthene	ND		0.0050	"							
Fluorene	ND		0.0050	"							
Indeno (1,2,3-cd) pyrene	ND		0.0050	"							
Naphthalene	ND		0.010	"							
Phenanthrene	ND		0.0050	"							
Pyrene	ND		0.0050	"							
Surrogate: p-Terphenyl-d14	*0.0427*			"	*0.0267*		*160*	*29-165*			
LCS (A006011-BS1)					Prepared: 01-Jun-10 Analyzed: 02-Jun-10						**C-05**
Acenaphthene	0.0197		0.0050	mg/kg	0.0267		73.8	40-120		30	
Acenaphthylene	0.0190		0.0050	"	0.0267		71.2	40-120		30	
Anthracene	0.0260		0.0050	"	0.0267		97.5	40-120		30	
Benz(a)anthracene	0.0273		0.0050	"	0.0267		102	40-120		30	
Benzo (b) fluoranthene	0.0243		0.0050	"	0.0267		91.2	40-120		30	
Benzo (k) fluoranthene	0.0303		0.0050	"	0.0267		114	40-120		30	
Benzo (a) pyrene	0.0220		0.0050	"	0.0267		82.5	40-120		30	
Benzo (g,h,i) perylene	0.0107		0.010	"	0.0267		40.0	40-120		30	
Chrysene	0.0280		0.0050	"	0.0267		105	40-120		30	
Dibenz (a,h) anthracene	0.0300		0.010	"	0.0267		112	40-120		30	
Fluoranthene	0.0520		0.0050	"	0.0267		195	40-120		30	QM-14
Fluorene	0.0203		0.0050	"	0.0267		76.2	40-120		30	
Indeno (1,2,3-cd) pyrene	0.0280		0.0050	"	0.0267		105	40-120		30	
Naphthalene	0.0177		0.010	"	0.0267		66.2	40-120		30	
Phenanthrene	0.0223		0.0050	"	0.0267		83.7	40-120		30	
Pyrene	0.0520		0.0050	"	0.0267		195	40-120		30	QM-14
Surrogate: p-Terphenyl-d14	*0.0560*			"	*0.0267*		*210*	*29-165*			

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara Street	Project Number: 08-25430	**Reported:**
Santa Barbara CA, 93001	Project Manager: Shawn Decker	04-Jun-10 15:11

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring - Quality Control

Analyte	Result	Method Limit	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
Batch A006011 - EPA 3550B MS											
LCS Dup (A006011-BSD1)					Prepared: 01-Jun-10 Analyzed: 02-Jun-10						**C-05**
Acenaphthene	0.0167		0.0050	mg/kg	0.0267		62.5	40-120	16.5	30	
Acenaphthylene	0.0160		0.0050	"	0.0267		60.0	40-120	17.1	30	
Anthracene	0.0223		0.0050	"	0.0267		83.7	40-120	15.2	30	
Benz(a)anthracene	0.0260		0.0050	"	0.0267		97.5	40-120	5.00	30	
Benzo (b) fluoranthene	0.0237		0.0050	"	0.0267		88.8	40-120	2.78	30	
Benzo (k) fluoranthene	0.0300		0.0050	"	0.0267		112	40-120	1.10	30	
Benzo (a) pyrene	0.0217		0.0050	"	0.0267		81.3	40-120	1.53	30	
Benzo (g,h,i) perylene	0.0110		0.010	"	0.0267		41.2	40-120	3.08	30	
Chrysene	0.0273		0.0050	"	0.0267		102	40-120	2.41	30	
Dibenz (a,h) anthracene	0.0280		0.010	"	0.0267		105	40-120	6.90	30	
Fluoranthene	0.0340		0.0050	"	0.0267		128	40-120	41.9	30	QM-14
Fluorene	0.0180		0.0050	"	0.0267		67.5	40-120	12.2	30	
Indeno (1,2,3-cd) pyrene	0.0283		0.0050	"	0.0267		106	40-120	1.18	30	
Naphthalene	0.0110		0.010	"	0.0267		41.2	40-120	46.5	30	QR-02
Phenanthrene	0.0193		0.0050	"	0.0267		72.5	40-120	14.4	30	
Pyrene	0.0347		0.0050	"	0.0267		130	40-120	40.0	30	QM-14
Surrogate: p-Terphenyl-d14	*0.0377*			"	*0.0267*		*141*	*29-165*			
Duplicate (A006011-DUP1)		**Source: 1001716-03**			Prepared: 01-Jun-10 Analyzed: 02-Jun-10						
Acenaphthene	ND		0.0050	mg/kg		ND				30	
Acenaphthylene	ND		0.0050	"		ND				30	
Anthracene	ND		0.0050	"		ND				30	
Benz(a)anthracene	ND		0.0050	"		ND				30	
Benzo (b) fluoranthene	ND		0.0050	"		ND				30	
Benzo (k) fluoranthene	ND		0.0050	"		ND				30	
Benzo (a) pyrene	ND		0.0050	"		ND				30	
Benzo (g,h,i) perylene	ND		0.010	"		ND				30	
Chrysene	ND		0.0050	"		ND				30	
Dibenz (a,h) anthracene	ND		0.010	"		ND				30	
Fluoranthene	ND		0.0050	"		ND				30	
Fluorene	ND		0.0050	"		ND				30	
Indeno (1,2,3-cd) pyrene	ND		0.0050	"		ND				30	
Naphthalene	ND		0.010	"		ND				30	
Phenanthrene	ND		0.0050	"		ND				30	
Pyrene	ND		0.0050	"		ND				30	
Surrogate: p-Terphenyl-d14	*0.0250*			"	*0.0267*		*93.7*	*29-165*			

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara Street	Project Number: 08-25430	**Reported:**
Santa Barbara CA, 93001	Project Manager: Shawn Decker	04-Jun-10 15:11

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring - Quality Control

Analyte	Result	Method Limit	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
Batch A006011 - EPA 3550B MS											
Matrix Spike (A006011-MS1)		**Source: 1001716-03**			Prepared: 01-Jun-10 Analyzed: 02-Jun-10						
Acenaphthene	0.0190		0.0050	mg/kg	0.0267	ND	71.2	0-131		30	
Acenaphthylene	0.0200		0.0050	"	0.0267	ND	75.0	0-125		30	
Anthracene	0.0237		0.0050	"	0.0267	ND	88.8	0-144		30	
Benz(a)anthracene	0.0230		0.0050	"	0.0267	ND	86.2	27-161		30	
Benzo (b) fluoranthene	0.0230		0.0050	"	0.0267	ND	86.2	36-147		30	
Benzo (k) fluoranthene	0.0283		0.0050	"	0.0267	ND	106	47-137		30	
Benzo (a) pyrene	0.0267		0.0050	"	0.0267	ND	100	21-152		30	
Benzo (g,h,i) perylene	0.0260		0.010	"	0.0267	ND	97.5	37-145		30	
Chrysene	0.0233		0.0050	"	0.0267	ND	87.5	45-134		30	
Dibenz (a,h) anthracene	0.0263		0.010	"	0.0267	ND	98.7	36-159		30	
Fluoranthene	0.0267		0.0050	"	0.0267	ND	100	36-137		30	
Fluorene	0.0217		0.0050	"	0.0267	ND	81.3	0-135		30	
Indeno (1,2,3-cd) pyrene	0.0253		0.0050	"	0.0267	ND	95.0	32-163		30	
Naphthalene	0.0197		0.010	"	0.0267	ND	73.8	0-111		30	
Phenanthrene	0.0207		0.0050	"	0.0267	ND	77.5	4-141		30	
Pyrene	0.0267		0.0050	"	0.0267	ND	100	32-143		30	
Surrogate: p-Terphenyl-d14	*0.0230*			"	*0.0267*		*86.2*	*29-165*			
Matrix Spike Dup (A006011-MSD1)		**Source: 1001716-03**			Prepared: 01-Jun-10 Analyzed: 02-Jun-10						
Acenaphthene	0.0203		0.0050	mg/kg	0.0266	ND	76.3	0-131	6.71	30	
Acenaphthylene	0.0203		0.0050	"	0.0266	ND	76.3	0-125	1.59	30	
Anthracene	0.0240		0.0050	"	0.0266	ND	90.0	0-144	1.33	30	
Benz(a)anthracene	0.0240		0.0050	"	0.0266	ND	90.0	27-161	4.19	30	
Benzo (b) fluoranthene	0.0227		0.0050	"	0.0266	ND	85.0	36-147	1.53	30	
Benzo (k) fluoranthene	0.0276		0.0050	"	0.0266	ND	104	47-137	2.45	30	
Benzo (a) pyrene	0.0256		0.0050	"	0.0266	ND	96.3	21-152	3.89	30	
Benzo (g,h,i) perylene	0.0243		0.010	"	0.0266	ND	91.2	37-145	6.69	30	
Chrysene	0.0243		0.0050	"	0.0266	ND	91.2	45-134	4.13	30	
Dibenz (a,h) anthracene	0.0230		0.010	"	0.0266	ND	86.3	36-159	13.6	30	
Fluoranthene	0.0266		0.0050	"	0.0266	ND	100	36-137	0.0667	30	
Fluorene	0.0223		0.0050	"	0.0266	ND	83.7	0-135	2.96	30	
Indeno (1,2,3-cd) pyrene	0.0237		0.0050	"	0.0266	ND	88.8	32-163	6.87	30	
Naphthalene	0.0190		0.010	"	0.0266	ND	71.2	0-111	3.51	30	
Phenanthrene	0.0210		0.0050	"	0.0266	ND	78.8	4-141	1.53	30	
Pyrene	0.0263		0.0050	"	0.0266	ND	98.8	32-143	1.32	30	
Surrogate: p-Terphenyl-d14	*0.0173*			"	*0.0266*		*65.0*	*29-165*			

Notes and Definitions

R-01	The Reporting Limit has been raised to account for matrix interference.
QR-04	The RPD exceeded the QC control limits.
QR-02	The RPD result exceeded the QC control limits; however, both percent recoveries were acceptable. Sample results for the QC batch were accepted based on percent recoveries and completeness of QC data.
QM-14	Spike recovery fails high. Sample results are ND. Data results are not impacted.
O-05	This sample was extracted outside of the EPA recommended holding time.
C-05	To reduce matrix interference, the sample extract has undergone GPC clean-up, method 3640, which is specific to contamination from high molecular weight material.
DET	Analyte DETECTED
ND	Analyte NOT DETECTED at or above the reporting limit
NR	Not Reported
dry	Sample results reported on a dry weight basis
RPD	Relative Percent Difference

Oilfield Environmental and Compliance
307 Roemer Way Suite 300, Santa Maria CA 93454
phone: (805) 922-4772 fax: (805) 925-3376 www.oecusa.com

Highway 33, McKittrick CA
phone: (661) 762-9143

CHAIN OF CUSTODY

Page 1 of 1

Company: Rincon Consultants, Inc.
Address: 790 East Santa Clara Street
City/State/ZIP: Ventura, CA 93001
Phone: 805 641 1000 Fax: 805 641 1072 E-mail: shedd@rinconconsultants.com
Report To: Rincon Sampler: Shawn Decker
Send report via- FAX- ☐ PDF- ☒ Colt/LUFT EDF- ☐ EDD- ☐
Turnaround Time: 10 Days- ☐ 5 Days- ☒ 72 hr- ☐ 48 hr- ☐ 24 hr- ☐ ASAP- ☐

Project Name/#: 125 State 08-2543
Site: 125 State Street, Santa Barbara, CA

OEC Sample ID	Date/Time Sampled	Matrix	# of Cont.	Client Sample ID	TPH 8015M	PNA 8270C									Special Instructions:
1001716-1A	5/17/10-13:00	Soil	1	VS1	X										MDL
-2A	13:10			VS2	X	X									
-3A	13:20			VS3	X										
-4A	13:30			VS4	X										
-5A	13:40			VS5	X	X									
-6A	13:50			VS6	X										
-7A	14:00			~~VS~~ VS7	X	X									
-8A	14:10			VS8	X										
-9A	14:20			VS9	X										
-10A	14:30			VS10	X										
-11A	14:40			VS11	X										
-12A	14:50			VS12	X										

Relinquished By:		Date: 5-17-10	Time: 1505
Received By:		Date: 5/17/10	Time: 1505
Relinquished By:		Date: 5/17/10	Time: 1700
Received By:		Date: 5-17-10	Time: 1700
Relinquished By:		Date:	Time:
Received By:		Date:	Time:

Comments/PO#: Price per 125 State Quote

OEC SAMPLE RECEIPT

Rev. 01/15/10

CLIENT: Rincon OEC ID #: 1001716 Temp: 3 °C
Acceptable Range: 0°C to 6°C

COC RECEIVED DATE/TIME: 5/17/10 1700 RECEIPT LOGIN DATE/TIME: 5/17/10 1725 REFRIGERATOR(s): 1

SAMPLE TRANSPORT, RECEIPT, CONDITION & PRESERVATION:		Yes	No	N/A	(*) PROBLEM CHAIN FORM NEEDED
☒ OEC Courier/Sampler	COC document(s) received with samples	☒	☐*	☐	Custody Seals (circle): Present / Absent
☐ Delivery(Other than OEC Courier)	Correct containers for analysis requested	☒	☐*	☐	Samples / Coolers
☒ Samples Received on Ice	Container(s) intact and in good condition	☒	☐*	☐	Intact / Broken*
☐ Samples Received Outside Temp. Range*	Container label(s) consistent with COC	☒	☐*	☐	Method of Shipment & Tracking #(if applicable):
☐ Samples Direct from field (Outside Temp)	OEC preservative added (**note std ID)	☐**	☐	☒	
☐ After-Hours Outside Drop-off [Brought Inside]	Proper preservation on sample label(s)	☐	☐	☒	(**) OEC Preservative ID:
(Initials/Date/Time):	VOA containers free of headspace	☐	☐*	☒	Dissolved Metals Filtration: (Date/Init/Preserve ID)
	Tedlar Bags free of condensation	☐	☐*	☒	

CONTAINERS, COC CHANGES AND/OR CORRECTIONS CHANGES AUTHORIZED BY:

OEC ID	Client ID ***If blank, refer to CoC	Container Description	Preservative	ResCl /pH	Matrix	Date/Time Sampled ***	Comments / Remarks / Condition Notes, Etc.
1-12A		1-8oz jar each	—	—	solid		

RECEIPT LOGIN BY: [signature] RECEIPT REVIEWED BY: [signature] Page 1 of 1

Oilfield Environmental and Compliance
307 Roemer Way Suite 300, Santa Maria CA 93454
phone: (805) 922-4772 fax: (805) 925-3376 www.oecusa.com

Highway 33, McKittrick CA
phone: (661) 762-9143

CHAIN OF CUSTODY

Page 1 of 1

Company: Rincon Consultants, Inc.
Address: 790 East Santa Clara Street
City/State/ZIP: Ventura, CA 93001
Phone: 805 641 1000 Fax: 805 641 1072 E-mail: sdecker@rinconconsultants.com
Report To: Rincon Sampler: Shawn Decker
Send report via- FAX- ☐ PDF- ☒ Colt/LUFT EDF- ☐ EDD- ☐
Turnaround Time: 10 Days- ☐ 5 Days- ☒ 72 hr- ☐ 48 hr- ☐ 24 hr- ☐ ASAP- ☐

Project Name/#: 125 State 08-2543 0
Site: 125 State Street, Santa Barbara, CA

OEC Sample ID	Date/Time Sampled	Matrix	# of Cont.	Client Sample ID	TPH 8015M	PNA 8270C									Special Instructions:
1001716-1A	5/17/10-13:00	Soil	1	VS1	X										MDL
-2A	13:10			VS2	X	X									
-3A	13:20			VS3	X	Δ									
-4A	13:30			VS4	X										
-5A	13:40			VS5	X	X									
-6A	13:50			VS6	X										
-7A	14:00			VS7	X	X									
-8A	14:10			VS8	X										
-9A	14:20			VS9	X	Δ									
-10A	14:30			VS10	X										
-11A	14:40			VS11	X										
-12A	14:50			VS12	X	Δ									

Relinquished By:	[signature]	Date: 5-17-10	Time: 1505
Received By:	[signature]	Date: 5/17/10	Time: 1505
Relinquished By:	[signature]	Date: 5/17/10	Time: 1700
Received By:	[signature]	Date: 5-17-10	Time: 1700
Relinquished By:		Date:	Time:
Received By:		Date:	Time:

Comments/PO#: Price per 125 State Quote

Δ Add-on per Shawn Decker 05/28/10 cm

Oilfield Environmental and Compliance, INC.

Shawn Decker
Rincon Consultants
790 East Santa Clara Street
Santa Barbara, CA 93001

08 June 2010

RE: 125 State Street Excavation

Work Order: 1001732

Dear Client:

Enclosed is an analytical report for the above referenced project. The samples included in this report were received on 18-May-10 17:19 and analyzed in accordance with the attached chain-of-custody.

Unless otherwise noted, all analytical testing was accomplished in accordance with the guidelines established in our Quality Assurance Manual, applicable standard operating procedures, and other related documentation. The results in this analytical report are limited to the samples tested and any reproduction thereof must be made in its entirety.

If you have any questions regarding this report, please do not hesitate to contact the undersigned.

Sincerely,

Vanessa Miller

Project Manager Assistant

TEL: (805) 922-4772
307 Roemer Way, Suite 300, Santa Maria, CA 93454 www.oecusa.com FAX: (805) 925-3376

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara Street	Project Number: 08-25430	**Reported:**
Santa Barbara CA, 93001	Project Manager: Shawn Decker	08-Jun-10 16:07

ANALYTICAL REPORT FOR SAMPLES

Sample ID	Laboratory ID	Matrix	Date Sampled	Date Received
CS105	1001732-01	Solid	18-May-10 08:00	18-May-10 17:19
CS106	1001732-02	Solid	18-May-10 08:30	18-May-10 17:19
Fill 2	1001732-03	Solid	18-May-10 09:15	18-May-10 17:19

CS105

1001732-01 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**66**	0.50	1.0	mg/kg	5	A005293	19-May-10	19-May-10	EPA 6020	N-02
STLC Metals by 6000/7000 Series Methods										
Lead	**2.7**	0.0050	0.010	mg/L	10	A006138	08-Jun-10	08-Jun-10	STLC/EPA 6020	

CS106

1001732-02 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**67**	0.50	1.0	mg/kg	5	A005293	19-May-10	19-May-10	EPA 6020	N-02
STLC Metals by 6000/7000 Series Methods										
Lead	**0.36**	0.0050	0.010	mg/L	10	A006138	08-Jun-10	08-Jun-10	STLC/EPA 6020	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara Street	Project Number: 08-25430	**Reported:**
Santa Barbara CA, 93001	Project Manager: Shawn Decker	08-Jun-10 16:07

Fill 2

1001732-03 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Wet Chemistry by EPA or APHA Standard Methods										
pH	**8.24**	0.0500	0.100	pH Units	1	A005292	18-May-10	18-May-10	9045	
Total Metals by EPA 6000/7000 Series Methods										
Antimony	ND	2.4	4.7	mg/kg	5	A005291	19-May-10	19-May-10	EPA 6020	
Arsenic	**4.6**	0.47	0.94	"	"	"	"	"	"	
Barium	**11**	0.24	0.47	"	"	"	"	"	"	
Beryllium	ND	0.94	2.4	"	"	"	"	"	"	
Cadmium	ND	0.47	0.94	"	"	"	"	"	"	
Chromium	**7.1**	0.47	0.94	"	"	"	"	"	"	
Cobalt	**1.7**	0.47	0.94	"	"	"	"	"	"	
Copper	**0.66**	0.47	0.94	"	"	"	"	"	"	J
Lead	**1.8**	0.47	0.94	"	"	"	"	"	"	
Mercury	ND	0.010	0.096	"	1	A005289	19-May-10	20-May-10	EPA 7471A	
Molybdenum	ND	0.47	0.94	"	5	A005291	19-May-10	19-May-10	EPA 6020	
Nickel	**4.8**	0.47	0.94	"	"	"	"	"	"	
Selenium	ND	2.4	4.7	"	"	"	"	"	"	
Silver	ND	0.47	0.94	"	"	"	"	"	"	
Thallium	ND	2.4	4.7	"	"	"	"	"	"	
Vanadium	**11**	2.4	4.7	"	"	"	"	"	"	
Zinc	**8.5**	0.94	2.4	"	"	"	"	"	"	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara Street	Project Number: 08-25430	**Reported:**
Santa Barbara CA, 93001	Project Manager: Shawn Decker	08-Jun-10 16:07

Wet Chemistry by EPA or APHA Standard Methods - Quality Control

Analyte	Result	Method Limit	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
Batch A005292 - EPA 9045 pH Prep											
LCS (A005292-BS1)					Prepared & Analyzed: 18-May-10						
pH	4.00	0.0500	0.100	pH Units	4.00		100	90-110		10	
LCS (A005292-BS2)					Prepared & Analyzed: 18-May-10						
pH	6.94	0.0500	0.100	pH Units	7.00		99.1	90-110		10	
LCS (A005292-BS3)					Prepared & Analyzed: 18-May-10						
pH	10.1	0.0500	0.100	pH Units	10.0		101	90-110		10	
Duplicate (A005292-DUP1)		**Source: 1001732-03**			Prepared & Analyzed: 18-May-10						
pH	8.31	0.0500	0.100	pH Units		8.24			0.846	10	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara Street	Project Number: 08-25430	**Reported:**
Santa Barbara CA, 93001	Project Manager: Shawn Decker	08-Jun-10 16:07

Total Metals by EPA 6000/7000 Series Methods - Quality Control

Analyte	Result	Method Limit	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
Batch A005289 - EPA 7471A Prep											
Blank (A005289-BLK1)					Prepared: 19-May-10 Analyzed: 20-May-10						
Mercury	ND	0.011	0.10	mg/kg							
LCS (A005289-BS1)					Prepared: 19-May-10 Analyzed: 20-May-10						
Mercury	1.70	0.011	0.10	mg/kg	1.67		102	85-115		20	
LCS Dup (A005289-BSD1)					Prepared: 19-May-10 Analyzed: 20-May-10						
Mercury	1.71	0.011	0.10	mg/kg	1.67		103	85-115	0.734	20	
Duplicate (A005289-DUP1)		**Source: 1001661-02**			Prepared: 19-May-10 Analyzed: 20-May-10						
Mercury	ND	0.0094	0.087	mg/kg		ND				20	
Batch A005291 - EPA 3050B											
Blank (A005291-BLK1)					Prepared & Analyzed: 19-May-10						
Antimony	ND	0.50	1.0	mg/kg							
Arsenic	ND	0.10	0.20	"							
Barium	ND	0.050	0.10	"							
Beryllium	ND	0.20	0.50	"							
Cadmium	ND	0.10	0.20	"							
Chromium	ND	0.10	0.20	"							
Cobalt	ND	0.10	0.20	"							
Copper	ND	0.10	0.20	"							
Lead	ND	0.10	0.20	"							
Molybdenum	ND	0.10	0.20	"							
Nickel	ND	0.10	0.20	"							
Selenium	ND	0.50	1.0	"							
Silver	ND	0.10	0.20	"							
Thallium	ND	0.50	1.0	"							
Vanadium	ND	0.50	1.0	"							
Zinc	0.237	0.20	0.50	"							J

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara Street	Project Number: 08-25430	**Reported:**
Santa Barbara CA, 93001	Project Manager: Shawn Decker	08-Jun-10 16:07

Total Metals by EPA 6000/7000 Series Methods - Quality Control

Analyte	Result	Method Limit	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
Batch A005291 - EPA 3050B											
LCS (A005291-BS1)					Prepared & Analyzed: 19-May-10						
Antimony	10.1	0.50	1.0	mg/kg	15.0		67.2	85-115		20	QL-02
Arsenic	13.6	0.10	0.20	"	15.0		90.8	85-115		20	
Barium	14.1	0.050	0.10	"	15.0		93.7	85-115		20	
Beryllium	14.6	0.20	0.50	"	15.0		97.2	85-115		20	
Cadmium	14.7	0.10	0.20	"	15.0		97.9	85-115		20	
Chromium	14.6	0.10	0.20	"	15.0		97.1	85-115		20	
Cobalt	14.4	0.10	0.20	"	15.0		95.9	85-115		20	
Copper	14.0	0.10	0.20	"	15.0		93.2	85-115		20	
Lead	13.5	0.10	0.20	"	15.0		90.1	85-115		20	
Molybdenum	14.0	0.10	0.20	"	15.0		93.4	85-115		20	
Nickel	13.8	0.10	0.20	"	15.0		92.0	85-115		20	
Selenium	13.6	0.50	1.0	"	15.0		91.0	85-115		20	
Silver	13.8	0.10	0.20	"	15.0		92.2	85-115		20	
Thallium	14.1	0.50	1.0	"	15.0		94.3	85-115		20	
Vanadium	14.7	0.50	1.0	"	15.0		97.9	85-115		20	
Zinc	14.6	0.20	0.50	"	15.0		97.2	85-115		20	
LCS Dup (A005291-BSD1)					Prepared & Analyzed: 19-May-10						
Antimony	11.0	0.50	1.0	mg/kg	15.0		73.2	85-115	8.48	20	QL-02
Arsenic	14.0	0.10	0.20	"	15.0		93.2	85-115	2.51	20	
Barium	13.3	0.050	0.10	"	15.0		88.8	85-115	5.41	20	
Beryllium	15.1	0.20	0.50	"	15.0		101	85-115	3.51	20	
Cadmium	14.2	0.10	0.20	"	15.0		94.9	85-115	3.13	20	
Chromium	14.5	0.10	0.20	"	15.0		96.6	85-115	0.496	20	
Cobalt	14.5	0.10	0.20	"	15.0		96.7	85-115	0.891	20	
Copper	13.9	0.10	0.20	"	15.0		92.9	85-115	0.316	20	
Lead	13.8	0.10	0.20	"	15.0		91.8	85-115	1.94	20	
Molybdenum	12.9	0.10	0.20	"	15.0		86.1	85-115	8.21	20	
Nickel	14.3	0.10	0.20	"	15.0		95.3	85-115	3.54	20	
Selenium	13.0	0.50	1.0	"	15.0		86.7	85-115	4.78	20	
Silver	14.0	0.10	0.20	"	15.0		93.6	85-115	1.41	20	
Thallium	14.3	0.50	1.0	"	15.0		95.2	85-115	1.02	20	
Vanadium	14.3	0.50	1.0	"	15.0		95.1	85-115	2.87	20	
Zinc	15.7	0.20	0.50	"	15.0		105	85-115	7.28	20	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara Street	Project Number: 08-25430	**Reported:**
Santa Barbara CA, 93001	Project Manager: Shawn Decker	08-Jun-10 16:07

Total Metals by EPA 6000/7000 Series Methods - Quality Control

Analyte	Result	Method Limit	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
Batch A005291 - EPA 3050B											
Duplicate (A005291-DUP1)		**Source: 1001661-02**			Prepared & Analyzed: 19-May-10						
Antimony	4.45	2.5	5.0	mg/kg		5.97			29.0	20	QM-04, J
Arsenic	2.15	0.50	0.99	"		ND				20	
Barium	52.9	0.25	0.50	"		33.1			46.1	20	QM-04
Beryllium	ND	0.99	2.5	"		ND				20	
Cadmium	ND	0.50	0.99	"		0.603				20	
Chromium	13.5	0.50	0.99	"		13.5			0.121	20	
Cobalt	4.70	0.50	0.99	"		4.55			3.10	20	
Copper	2.90	0.50	0.99	"		2.59			11.4	20	
Lead	4.42	0.50	0.99	"		4.29			2.95	20	
Molybdenum	ND	0.50	0.99	"		ND				20	
Nickel	10.7	0.50	0.99	"		9.27			14.1	20	
Selenium	ND	2.5	5.0	"		ND				20	
Silver	ND	0.50	0.99	"		ND				20	
Thallium	ND	2.5	5.0	"		ND				20	
Vanadium	18.3	2.5	5.0	"		21.8			17.3	20	
Zinc	11.7	0.99	2.5	"		10.8			7.50	20	
Batch A005293 - EPA 3050B											
Blank (A005293-BLK1)					Prepared & Analyzed: 19-May-10						
Lead	ND	0.10	0.20	mg/kg							
LCS (A005293-BS1)					Prepared & Analyzed: 19-May-10						
Lead	14.3	0.10	0.20	mg/kg	15.0		95.2	85-115		20	
LCS Dup (A005293-BSD1)					Prepared & Analyzed: 19-May-10						
Lead	14.2	0.10	0.20	mg/kg	15.0		94.4	85-115	0.855	20	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara Street	Project Number: 08-25430	**Reported:**
Santa Barbara CA, 93001	Project Manager: Shawn Decker	08-Jun-10 16:07

Total Metals by EPA 6000/7000 Series Methods - Quality Control

Analyte	Result	Method Limit	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
Batch A005293 - EPA 3050B											
Duplicate (A005293-DUP1)		**Source: 1001732-02**			Prepared & Analyzed: 19-May-10						
Lead	14.0	0.50	1.0	mg/kg		67.3			131	20	QM-04
Matrix Spike (A005293-MS1)		**Source: 1001732-02**			Prepared & Analyzed: 19-May-10						
Lead	286	2.0	3.9	mg/kg	295	67.3	74.0	61-138		20	
Matrix Spike Dup (A005293-MSD1)		**Source: 1001732-02**			Prepared & Analyzed: 19-May-10						
Lead	288	2.0	4.0	mg/kg	299	67.3	74.0	61-138	0.118	20	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara Street	Project Number: 08-25430	**Reported:**
Santa Barbara CA, 93001	Project Manager: Shawn Decker	08-Jun-10 16:07

STLC Metals by 6000/7000 Series Methods - Quality Control

Analyte	Result	Method Limit	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
Batch A006138 - EPA 3005A Leachate											
Blank (A006138-BLK1)					Prepared & Analyzed: 08-Jun-10						
Lead	ND	0.00050	0.0010	mg/L							
LCS (A006138-BS1)					Prepared & Analyzed: 08-Jun-10						
Lead	0.147	0.00050	0.0010	mg/L	0.150		97.8	85-115		20	
LCS Dup (A006138-BSD1)					Prepared & Analyzed: 08-Jun-10						
Lead	0.148	0.00050	0.0010	mg/L	0.150		98.5	85-115	0.758	20	
Duplicate (A006138-DUP1)		**Source: 1001681-08**			Prepared & Analyzed: 08-Jun-10						
Lead	1.74	0.0050	0.010	mg/L		1.56			11.4	20	
Matrix Spike (A006138-MS1)		**Source: 1001681-08**			Prepared & Analyzed: 08-Jun-10						
Lead	8.19	0.020	0.040	mg/L	6.00	1.56	111	64-153		20	
Matrix Spike Dup (A006138-MSD1)		**Source: 1001681-08**			Prepared & Analyzed: 08-Jun-10						
Lead	8.42	0.020	0.040	mg/L	6.00	1.56	114	64-153	3.50	20	

Notes and Definitions

QM-04	Visual evaluation of the sample indicates the RPD is above the control limit due to a non-homogeneous sample matrix.
QL-02	The spike recovery is outside the control limits.
N-02	Analyte concentration below TTLC but above 10 X STLC.
J	Detected but below the RL/PQL; therefore, result is an estimated concentration .
DET	Analyte DETECTED
ND	Analyte NOT DETECTED at or above the reporting limit
NR	Not Reported
dry	Sample results reported on a dry weight basis
RPD	Relative Percent Difference

EMSL Analytical, Inc
2235 Polvorosa Ave , Suite 230, San Leandro, CA 94577
Phone: (510) 895-3675 Fax: (510) 895-3680 Email: milpitaslab@emsl.com

Attn: **Lisa Race**
Oilfield Environmental and Compliance
307 Roemer Way
Suite 300
Santa Maria, CA 93454

Fax: (805) 925-3376 Phone: (805) 922-4772

Project: **1001732**
Project: 125 State St., Santa Barbara, CA.

Customer ID:	OILF50
Customer PO:	1001732
Received:	05/20/10 9:00 AM
EMSL Order:	091004513
EMSL Proj:	
Analysis Date:	5/27/2010

Test Report: PLM Analysis of Bulk Samples for Asbestos via EPA 600/R-93/116 Method with CARB 435 Prep (Milling) Level A for 0.25% Target Analytical Sensitivity

			Non-Asbestos		Asbestos
Sample	**Description**	**Appearance**	**% Fibrous**	**% Non-Fibrous**	**% Type**
1001732-03		Brown		100.00% Non-fibrous (other)	**None Detected**
091004513-0001		Non-Fibrous Homogeneous			

Analyst(s)

Nonette Patron (1)

Baojia Ke, Laboratory Manager
or other approved signatory

This report relates only to the samples listed above and may not be reproduced except in full, without EMSL's written approval. This report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. EMSL is not responsible for sample collection activities or method limitations. Some samples may contain asbestos fibers below the resolution limit of PLM. EMSL recommends that samples reported as none detected or less than the limit of detection undergo additional analysis via TEM.Samples received in good condition unless otherwise noted.
Samples analyzed by EMSL Analytical, Inc 2235 Polvorosa Ave , Suite 230, San LeandroCA

THIS IS THE LAST PAGE OF THE REPORT.

091004513

SUBCONTRACT ORDER

Oilfield Environmental and Compliance

1001732

091004513

SENDING LABORATORY:

Oilfield Environmental and Compliance
307 Roemer Way, Ste. 300
Santa Maria, CA 93454
Phone: 805.922.4772
Fax: 805.925.3376
Project Manager: Lisa Race

Project: 125 State St. Santa Barbara

RECEIVING LABORATORY:

EMSL Analytical, Inc.
2235 Polvorosa Drive Suite 230
San Leandro, CA 94577
Phone :(888) 455-3675
Fax: (510) 895-3680

TAT - 5/26/10 by 3pm

Analysis	Due	Expires	Laboratory ID	Comments
Sample ID: 1001732-03	**Solid**	**Sampled:18-May-10 09:15**	[redacted]	**Fill 2**
Asbestos (Soil) - PLM CARB	20-May-10 16:00	01-Jun-10 09:15		
Containers Supplied:				

Released By	Date	Received By	Date
Sherry Mobley	5/19/10	DM	5/20/10 9:00 D/O

Page 1 of 1

Oilfield Environmental and Compliance
307 Roemer Way Suite 300, Santa Maria CA 93454
phone: (805) 922-4772 fax: (805) 925-3376 www.oecusa.com

Highway 33, McKittrick CA
phone: (661) 762-9143

CHAIN OF CUSTODY

Page 1 of 1

Company: Rincon Consultants, Inc.
Address: 790 East Santa Clara Street
City/State/ZIP: Santa Barbara, CA 93001
Phone: 8056411000 Fax: 8056411072 E-mail: sdecker@rinconconsultants.com
Report To: Rincon Sampler: Shawn Decker
Send report via- FAX- ☐ PDF- ☒ Colt/LUFT EDF- ☐ EDD- ☐
Turnaround Time: 10 Days- ☐ 5 Days- ☐ 72 hr- ☐ 48 hr- ☐ 24 hr- ☐ ASAP- ☐

Project Name/#: 125 State 08-25450
Site: 125 State Street, Santa Barbara, CA

OEC Sample ID	Date/Time Sampled	Matrix	# of Cont.	Client Sample ID	Total Lead 6000/7000	Metals 6000/7000	pH	Asbestos	Special Instructions:
1001752-1A	5-18-10/8:00	Soil	1	CS105	X				MDL rush
-2A	8:30			CS106	X				
-3A	9:15			FILL2		X	X	X	standard turnaround

Relinquished By:		Date: 5-18-10	Time: 1533
Received By:		Date: 5/18/10	Time: 1533
Relinquished By:		Date: 5/18/10	Time: 1719
Received By:		Date: 5-18-10	Time: 1719
Relinquished By:		Date:	Time:
Received By:		Date:	Time:

Comments/PO#: Price per 125 State quote
standard turnaround (5 days) on sample FILL2

OEC SAMPLE RECEIPT

Rev. 01/15/10

CLIENT: Rincon

OEC ID #: 1001732

Temp: 1 °C

Acceptable Range: 0°C to 6°C

COC RECEIVED DATE/TIME: 5-18-10 1719

RECEIPT LOGIN DATE/TIME: 5-18-10 1535

REFRIGERATOR(s): 1

SAMPLE TRANSPORT, RECEIPT, CONDITION & PRESERVATION:		Yes	No	N/A	(*) PROBLEM CHAIN FORM NEEDED	
☒ OEC Courier/Sampler	COC document(s) received with samples	☒	☐*	☐	Custody Seals (circle):	Present / Absent
☐ Delivery(Other than OEC Courier)	Correct containers for analysis requested	☒	☐*	☐		Samples / Coolers
☒ Samples Received on Ice	Container(s) intact and in good condition	☒	☐*	☐		Intact / Broken*
☐ Samples Received Outside Temp. Range*	Container label(s) consistent with COC	☒	☐*	☐	Method of Shipment & Tracking #(if applicable):	
☐ Samples Direct from field (Outside Temp)	OEC preservative added (**note std ID)	☐**	☐	☒		
☐ After-Hours Outside Drop-off [Brought Inside]	Proper preservation on sample label(s)	☐	☐	☒	(**) OEC Preservative ID:	
(Initials/Date/Time):	VOA containers free of headspace	☐	☐*	☒	Dissolved Metals Filtration: (Date/Init/Preserve ID)	
	Tedlar Bags free of condensation	☐	☐*	☒		

CONTAINERS, COC CHANGES AND/OR CORRECTIONS — CHANGES AUTHORIZED BY:

OEC ID	Client ID ***If blank, refer to CoC	Container Description	Preservative	ResCl /pH	Matrix	Date/Time Sampled ***	Comments / Remarks / Condition Notes, Etc.
1-3A		1-8oz glass ea	-	-	Solid		

RECEIPT LOGIN BY: Ly

RECEIPT REVIEWED BY: SM

Oilfield Environmental and Compliance, INC.

Shawn Decker
Rincon Consultants
790 East Santa Clara
Ventura, CA 93455

01 June 2010

RE: 125 State Street Excavation

Work Order: 1001734

Dear Client:

Enclosed is an analytical report for the above referenced project. The samples included in this report were received on 18-May-10 17:19 and analyzed in accordance with the attached chain-of-custody.

Unless otherwise noted, all analytical testing was accomplished in accordance with the guidelines established in our Quality Assurance Manual, applicable standard operating procedures, and other related documentation. The results in this analytical report are limited to the samples tested and any reproduction thereof must be made in its entirety.

If you have any questions regarding this report, please do not hesitate to contact the undersigned.

Sincerely,

Lisa Race

Laboratory Manager

TEL: (805) 922-4772
307 Roemer Way, Suite 300, Santa Maria, CA 93454 www.oecusa.com FAX: (805) 925-3376

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara	Project Number: 08-25430	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	01-Jun-10 12:29

ANALYTICAL REPORT FOR SAMPLES

Sample ID	Laboratory ID	Matrix	Date Sampled	Date Received
GW 1	1001734-01	Water	18-May-10 14:00	18-May-10 17:19

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara	Project Number: 08-25430	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	01-Jun-10 12:29

GW 1

1001734-01 (Water)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Dissolved Metals by EPA 6000/7000 Series Methods										
Lead	ND	0.00050	0.0010	mg/L	1	A005360	24-May-10	29-May-10	EPA 6020	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara	Project Number: 08-25430	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	01-Jun-10 12:29

Total Dissolved Metals by EPA 6000/7000 Series Methods - Quality Control

Analyte	Result	Method Limit	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
Batch A005360 - EPA 3005A											
Blank (A005360-BLK1)					Prepared: 24-May-10 Analyzed: 29-May-10						
Lead	ND	0.00050	0.0010	mg/L							
LCS (A005360-BS1)					Prepared: 24-May-10 Analyzed: 29-May-10						
Lead	0.164	0.00050	0.0010	mg/L	0.150		109	85-115		20	
LCS Dup (A005360-BSD1)					Prepared: 24-May-10 Analyzed: 29-May-10						
Lead	0.164	0.00050	0.0010	mg/L	0.150		109	85-115	0.288	20	
Duplicate (A005360-DUP1)	**Source: 1001657-01**				Prepared: 24-May-10 Analyzed: 29-May-10						
Lead	ND	0.00050	0.0010	mg/L		ND				20	
Matrix Spike (A005360-MS1)	**Source: 1001657-01**				Prepared: 24-May-10 Analyzed: 29-May-10						
Lead	7.16	0.020	0.040	mg/L	6.00	ND	119	50-154		20	
Matrix Spike Dup (A005360-MSD1)	**Source: 1001657-01**				Prepared: 24-May-10 Analyzed: 29-May-10						
Lead	7.09	0.020	0.040	mg/L	6.00	ND	118	50-154	0.922	20	

Notes and Definitions

DET	Analyte DETECTED
ND	Analyte NOT DETECTED at or above the reporting limit
NR	Not Reported
dry	Sample results reported on a dry weight basis
RPD	Relative Percent Difference

Oilfield Environmental and Compliance
307 Roemer Way Suite 300, Santa Maria CA 93454
phone: (805) 922-4772 fax: (805) 925-3376 www.oecusa.com

Highway 33, McKittrick CA
phone: (661) 762-9143

CHAIN OF CUSTODY

Page 1 of 1

Company: Rincon Consultants, Inc.
Address: 790 East Santa Clara Street
City/State/ZIP: Ventura, CA 93001
Phone: 8056411000 Fax: 8056411072 E-mail: sdecker@rinconconsultants.com
Report To: Rincon Sampler: Shawn Decker
Send report via- FAX- ☐ PDF- ☒ Colt/LUFT EDF- ☐ EDD- ☐
Turnaround Time 10 Days- ☐ 5 Days- ☒ 72 hr- ☐ 48 hr- ☐ 24 hr- ☐ ASAP- ☐

Project Name/#: 125 State 08-2540
Site: 125 State Street, Santa Barbara, CA

OEC Sample ID	Date/Time Sampled	Matrix	# of Cont.	Client Sample ID	Dissolved Lead 6000/7000	Special Instructions:
1001734-1A	5-18-10/14:00	water	1	GW1	X	MDL

Relinquished By: [signature] Date: 5-18-10 Time: 1533
Received By: [signature] Date: 5-18-10 Time: 1533
Relinquished By: [signature] Date: 5/18/10 Time: 1719
Received By: [signature] Date: 5-18-10 Time: 1719
Relinquished By: Date: Time:
Received By: Date: Time:

Comments/PO#: Price per 125 State Quote

OEC SAMPLE RECEIPT

Rev. 01/15/10

CLIENT: Rincon OEC ID #: 1001734 Temp: 1 °C

Acceptable Range: 0°C to 6°C

COC RECEIVED DATE/TIME: 5-18-10 1719

RECEIPT LOGIN DATE/TIME: 5-18-10 1740

REFRIGERATOR(s): 2

SAMPLE TRANSPORT, RECEIPT, CONDITION & PRESERVATION:		Yes	No	N/A	(*) PROBLEM CHAIN FORM NEEDED
☒ OEC Courier/Sampler	COC document(s) received with samples	☒	☐*	☐	Custody Seals (circle): Present / Absent
☐ Delivery(Other than OEC Courier)	Correct containers for analysis requested	☒	☐*	☐	Samples / Coolers
☒ Samples Received on Ice	Container(s) intact and in good condition	☒	☐*	☐	Intact / Broken*
☐ Samples Received Outside Temp. Range*	Container label(s) consistent with COC	☒	☐*	☐	Method of Shipment & Tracking #(if applicable):
☐ Samples Direct from field (Outside Temp)	OEC preservative added (**note std ID)	☒**	☐ (hy)	☒	
☐ After-Hours Outside Drop-off [Brought Inside]	Proper preservation on sample label(s)	☐	☐	☒	(**) OEC Preservative ID: 0040806
(Initials/Date/Time):	VOA containers free of headspace	☐	☐*	☒	Dissolved Metals Filtration: (Date/Init/Preserve ID)
	Tedlar Bags free of condensation	☐	☐*	☒	5-20-10 hy

CONTAINERS, COC CHANGES AND/OR CORRECTIONS — CHANGES AUTHORIZED BY:

OEC ID	Client ID ***If blank, refer to CoC	Container Description	Preservative	ResCl /pH	Matrix	Date/Time Sampled ***	Comments / Remarks / Condition Notes, Etc.
1A		500mL poly	–	–	aq		
1B-E		4 digitubes	HNO_3	–	↓		filtered & preserved

RECEIPT LOGIN BY: hy RECEIPT REVIEWED BY: [signature]

Oilfield Environmental and Compliance, INC.

Shawn Decker
Rincon Consultants
790 East Santa Clara
Ventura, CA 93455

02 June 2010

RE: 125 State Street Excavation

Work Order: 1001754

Dear Client:

Enclosed is an analytical report for the above referenced project. The samples included in this report were received on 20-May-10 14:00 and analyzed in accordance with the attached chain-of-custody.

Unless otherwise noted, all analytical testing was accomplished in accordance with the guidelines established in our Quality Assurance Manual, applicable standard operating procedures, and other related documentation. The results in this analytical report are limited to the samples tested and any reproduction thereof must be made in its entirety.

If you have any questions regarding this report, please do not hesitate to contact the undersigned.

Sincerely,

Vanessa Miller

Project Manager Assistant

TEL: (805) 922-4772
307 Roemer Way, Suite 300, Santa Maria, CA 93454 www.oecusa.com FAX: (805) 925-3376

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara	Project Number: 08-25430	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	02-Jun-10 14:01

ANALYTICAL REPORT FOR SAMPLES

Sample ID	Laboratory ID	Matrix	Date Sampled	Date Received
Fill 3	1001754-01	Solid	19-May-10 08:30	20-May-10 14:00
Fill 4	1001754-02	Solid	20-May-10 08:30	20-May-10 14:00

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara	Project Number: 08-25430	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	02-Jun-10 14:01

Fill 3

1001754-01 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Wet Chemistry by EPA or APHA Standard Methods										
pH	**8.66**	0.0500	0.100	pH Units	1	A005346	20-May-10	20-May-10	9045	
Total Metals by EPA 6000/7000 Series Methods										
Antimony	ND	2.5	4.9	mg/kg	5	A005381	26-May-10	29-May-10	EPA 6020	
Arsenic	**6.7**	0.49	0.99	"	"	"	"	"	"	
Barium	**15**	0.25	0.49	"	"	"	"	"	"	
Beryllium	ND	0.99	2.5	"	"	"	"	"	"	
Cadmium	ND	0.49	0.99	"	"	"	"	"	"	
Chromium	**9.4**	0.49	0.99	"	"	"	"	"	"	
Cobalt	**2.0**	0.49	0.99	"	"	"	"	"	"	
Copper	**0.80**	0.49	0.99	"	"	"	"	"	"	J
Lead	**2.6**	0.49	0.99	"	"	"	"	"	"	
Mercury	ND	0.011	0.098	"	1	A005405	26-May-10	28-May-10	EPA 7471A	
Molybdenum	**0.86**	0.49	0.99	"	5	A005381	26-May-10	29-May-10	EPA 6020	J
Nickel	**5.3**	0.49	0.99	"	"	"	"	"	"	
Selenium	ND	2.5	4.9	"	"	"	"	"	"	
Silver	ND	0.49	0.99	"	"	"	"	"	"	
Thallium	ND	2.5	4.9	"	"	"	"	"	"	
Vanadium	**8.9**	2.5	4.9	"	"	"	"	"	"	
Zinc	**13**	0.99	2.5	"	"	"	"	"	"	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara	Project Number: 08-25430	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	02-Jun-10 14:01

Fill 4

1001754-02 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Wet Chemistry by EPA or APHA Standard Methods										
pH	**9.25**	0.0500	0.100	pH Units	1	A005346	20-May-10	20-May-10	9045	
Total Metals by EPA 6000/7000 Series Methods										
Antimony	ND	2.5	5.0	mg/kg	5	A005381	26-May-10	29-May-10	EPA 6020	
Arsenic	**7.5**	0.50	0.99	"	"	"	"	"	"	
Barium	**15**	0.25	0.50	"	"	"	"	"	"	
Beryllium	ND	0.99	2.5	"	"	"	"	"	"	
Cadmium	ND	0.50	0.99	"	"	"	"	"	"	
Chromium	**10**	0.50	0.99	"	"	"	"	"	"	
Cobalt	**1.9**	0.50	0.99	"	"	"	"	"	"	
Copper	**0.97**	0.50	0.99	"	"	"	"	"	"	J
Lead	**3.0**	0.50	0.99	"	"	"	"	"	"	
Mercury	ND	0.011	0.10	"	1	A005405	26-May-10	28-May-10	EPA 7471A	
Molybdenum	ND	0.50	0.99	"	5	A005381	26-May-10	29-May-10	EPA 6020	
Nickel	**5.1**	0.50	0.99	"	"	"	"	"	"	
Selenium	ND	2.5	5.0	"	"	"	"	"	"	
Silver	ND	0.50	0.99	"	"	"	"	"	"	
Thallium	ND	2.5	5.0	"	"	"	"	"	"	
Vanadium	**10**	2.5	5.0	"	"	"	"	"	"	
Zinc	**11**	0.99	2.5	"	"	"	"	"	"	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara	Project Number: 08-25430	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	02-Jun-10 14:01

Wet Chemistry by EPA or APHA Standard Methods - Quality Control

Analyte	Result	Method Limit	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
Batch A005346 - EPA 9045 pH Prep											
LCS (A005346-BS1)					Prepared & Analyzed: 20-May-10						
pH	4.00	0.0500	0.100	pH Units	4.00		100	90-110		10	
LCS (A005346-BS2)					Prepared & Analyzed: 20-May-10						
pH	6.99	0.0500	0.100	pH Units	7.00		99.9	90-110		10	
LCS (A005346-BS3)					Prepared & Analyzed: 20-May-10						
pH	9.98	0.0500	0.100	pH Units	10.0		99.8	90-110		10	
Duplicate (A005346-DUP1)		**Source: 1001760-19**			Prepared & Analyzed: 20-May-10						
pH	8.23	0.0500	0.100	pH Units		8.25			0.243	10	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara	Project Number: 08-25430	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	02-Jun-10 14:01

Total Metals by EPA 6000/7000 Series Methods - Quality Control

Analyte	Result	Method Limit	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
Batch A005381 - EPA 3050B											
Blank (A005381-BLK1)					Prepared: 26-May-10 Analyzed: 29-May-10						
Antimony	ND	0.50	1.0	mg/kg							
Arsenic	ND	0.10	0.20	"							
Barium	ND	0.050	0.10	"							
Beryllium	ND	0.20	0.50	"							
Cadmium	ND	0.10	0.20	"							
Chromium	ND	0.10	0.20	"							
Cobalt	ND	0.10	0.20	"							
Copper	ND	0.10	0.20	"							
Lead	ND	0.10	0.20	"							
Molybdenum	ND	0.10	0.20	"							
Nickel	ND	0.10	0.20	"							
Selenium	ND	0.50	1.0	"							
Silver	ND	0.10	0.20	"							
Thallium	ND	0.50	1.0	"							
Vanadium	ND	0.50	1.0	"							
Zinc	ND	0.20	0.50	"							
LCS (A005381-BS1)					Prepared: 26-May-10 Analyzed: 29-May-10						
Antimony	14.2	0.50	1.0	mg/kg	15.0		94.6	85-115		20	
Arsenic	16.6	0.10	0.20	"	15.0		111	85-115		20	
Barium	16.2	0.050	0.10	"	15.0		108	85-115		20	
Beryllium	15.9	0.20	0.50	"	15.0		106	85-115		20	
Cadmium	16.7	0.10	0.20	"	15.0		111	85-115		20	
Chromium	15.3	0.10	0.20	"	15.0		102	85-115		20	
Cobalt	16.3	0.10	0.20	"	15.0		108	85-115		20	
Copper	15.1	0.10	0.20	"	15.0		100	85-115		20	
Lead	15.0	0.10	0.20	"	15.0		99.9	85-115		20	
Molybdenum	15.2	0.10	0.20	"	15.0		101	85-115		20	
Nickel	15.6	0.10	0.20	"	15.0		104	85-115		20	
Selenium	16.4	0.50	1.0	"	15.0		109	85-115		20	
Silver	16.1	0.10	0.20	"	15.0		108	85-115		20	
Thallium	16.7	0.50	1.0	"	15.0		111	85-115		20	
Vanadium	15.5	0.50	1.0	"	15.0		103	85-115		20	
Zinc	15.9	0.20	0.50	"	15.0		106	85-115		20	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara	Project Number: 08-25430	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	02-Jun-10 14:01

Total Metals by EPA 6000/7000 Series Methods - Quality Control

Analyte	Result	Method Limit	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
Batch A005381 - EPA 3050B											
LCS Dup (A005381-BSD1)					Prepared: 26-May-10 Analyzed: 29-May-10						
Antimony	14.2	0.50	1.0	mg/kg	15.0		94.4	85-115	0.200	20	
Arsenic	17.1	0.10	0.20	"	15.0		114	85-115	2.54	20	
Barium	16.9	0.050	0.10	"	15.0		113	85-115	4.39	20	
Beryllium	15.6	0.20	0.50	"	15.0		104	85-115	1.33	20	
Cadmium	17.1	0.10	0.20	"	15.0		114	85-115	2.39	20	
Chromium	16.0	0.10	0.20	"	15.0		106	85-115	4.13	20	
Cobalt	16.5	0.10	0.20	"	15.0		110	85-115	1.58	20	
Copper	15.5	0.10	0.20	"	15.0		103	85-115	2.90	20	
Lead	15.3	0.10	0.20	"	15.0		102	85-115	1.90	20	
Molybdenum	15.7	0.10	0.20	"	15.0		105	85-115	3.68	20	
Nickel	15.4	0.10	0.20	"	15.0		103	85-115	1.40	20	
Selenium	17.0	0.50	1.0	"	15.0		114	85-115	3.73	20	
Silver	16.4	0.10	0.20	"	15.0		110	85-115	1.78	20	
Thallium	16.8	0.50	1.0	"	15.0		112	85-115	0.724	20	
Vanadium	15.5	0.50	1.0	"	15.0		103	85-115	0.0304	20	
Zinc	16.1	0.20	0.50	"	15.0		107	85-115	1.16	20	
Duplicate (A005381-DUP1)		**Source: 1001800-01**			Prepared: 26-May-10 Analyzed: 29-May-10						
Antimony	ND	2.5	4.9	mg/kg		ND				20	
Arsenic	3.80	0.49	0.99	"		4.77			22.7	20	QR-03
Barium	64.6	0.25	0.49	"		56.4			13.6	20	
Beryllium	ND	0.99	2.5	"		ND				20	
Cadmium	0.771	0.49	0.99	"		0.875			12.7	20	J
Chromium	59.7	0.49	0.99	"		83.5			33.2	20	QR-03
Cobalt	12.7	0.49	0.99	"		20.7			48.3	20	QR-03
Copper	29.1	0.49	0.99	"		33.3			13.6	20	
Lead	15.1	0.49	0.99	"		21.4			34.6	20	QR-03
Molybdenum	0.554	0.49	0.99	"		ND				20	J
Nickel	77.9	0.49	0.99	"		199			87.6	20	QR-03
Selenium	ND	2.5	4.9	"		ND				20	
Silver	ND	0.49	0.99	"		ND				20	
Thallium	ND	2.5	4.9	"		ND				20	
Vanadium	48.6	2.5	4.9	"		45.9			5.70	20	
Zinc	86.1	0.99	2.5	"		84.8			1.59	20	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara	Project Number: 08-25430	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	02-Jun-10 14:01

Total Metals by EPA 6000/7000 Series Methods - Quality Control

Analyte	Result	Method Limit	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
Batch A005381 - EPA 3050B											
Matrix Spike (A005381-MS1)	**Source: 1001800-01**				Prepared: 26-May-10 Analyzed: 29-May-10						
Antimony	65.2	9.9	20	mg/kg	298	ND	21.9	0-88		20	
Arsenic	404	2.0	4.0	"	298	4.77	134	73-124		20	QM-05
Barium	211	0.99	2.0	"	298	56.4	51.7	18-166		20	
Beryllium	368	4.0	9.9	"	298	ND	123	76-132		20	
Cadmium	381	2.0	4.0	"	298	0.875	128	82-118		20	QM-05
Chromium	384	2.0	4.0	"	298	83.5	101	58-139		20	
Cobalt	350	2.0	4.0	"	298	20.7	110	85-114		20	
Copper	383	2.0	4.0	"	298	33.3	117	64-138		20	
Lead	320	2.0	4.0	"	298	21.4	100	61-138		20	
Molybdenum	303	2.0	4.0	"	298	ND	101	67-112		20	
Nickel	400	2.0	4.0	"	298	199	67.2	68-132		20	QM-08
Selenium	421	9.9	20	"	298	ND	141	66-132		20	QM-05
Silver	308	2.0	4.0	"	298	ND	103	18-153		20	
Thallium	338	9.9	20	"	298	ND	113	78-114		20	
Vanadium	367	9.9	20	"	298	45.9	108	80-119		20	
Zinc	488	4.0	9.9	"	298	84.8	135	40-153		20	
Matrix Spike Dup (A005381-MSD1)	**Source: 1001800-01**				Prepared: 26-May-10 Analyzed: 29-May-10						
Antimony	69.3	10	20	mg/kg	299	ND	23.1	0-88	5.59	20	
Arsenic	387	2.0	4.0	"	299	4.77	128	73-124	4.79	20	QM-05
Barium	215	1.0	2.0	"	299	56.4	53.0	18-166	2.42	20	
Beryllium	385	4.0	10	"	299	ND	129	76-132	4.11	20	
Cadmium	365	2.0	4.0	"	299	0.875	122	82-118	4.64	20	QM-05
Chromium	389	2.0	4.0	"	299	83.5	102	58-139	1.25	20	
Cobalt	353	2.0	4.0	"	299	20.7	111	85-114	0.642	20	
Copper	373	2.0	4.0	"	299	33.3	113	64-138	3.37	20	
Lead	335	2.0	4.0	"	299	21.4	105	61-138	4.36	20	
Molybdenum	289	2.0	4.0	"	299	ND	96.5	67-112	5.04	20	
Nickel	446	2.0	4.0	"	299	199	82.2	68-132	20.0	20	
Selenium	401	10	20	"	299	ND	134	66-132	5.23	20	QM-05
Silver	324	2.0	4.0	"	299	ND	108	18-153	4.59	20	
Thallium	324	10	20	"	299	ND	108	78-114	4.50	20	
Vanadium	393	10	20	"	299	45.9	116	80-119	7.25	20	
Zinc	513	4.0	10	"	299	84.8	143	40-153	5.59	20	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara	Project Number: 08-25430	**Reported:**
Ventura CA, 93455	Project Manager: Shawn Decker	02-Jun-10 14:01

Total Metals by EPA 6000/7000 Series Methods - Quality Control

Analyte	Result	Method Limit	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
Batch A005405 - EPA 7471A Prep											
Blank (A005405-BLK1)					Prepared: 27-May-10 Analyzed: 28-May-10						
Mercury	ND	0.011	0.10	mg/kg							
LCS (A005405-BS1)					Prepared: 27-May-10 Analyzed: 28-May-10						
Mercury	1.68	0.011	0.10	mg/kg	1.67		101	85-115		20	
LCS Dup (A005405-BSD1)					Prepared: 27-May-10 Analyzed: 28-May-10						
Mercury	1.69	0.011	0.10	mg/kg	1.67		101	85-115	0.109	20	
Duplicate (A005405-DUP1)	**Source: 1001800-01**				Prepared: 27-May-10 Analyzed: 28-May-10						
Mercury	0.189	0.011	0.098	mg/kg		0.184			2.87	20	
Matrix Spike (A005405-MS1)	**Source: 1001800-01**				Prepared: 27-May-10 Analyzed: 28-May-10						
Mercury	1.83	0.011	0.099	mg/kg	1.66	0.184	99.7	75-125		20	
Matrix Spike Dup (A005405-MSD1)	**Source: 1001800-01**				Prepared: 27-May-10 Analyzed: 28-May-10						
Mercury	1.80	0.011	0.099	mg/kg	1.65	0.184	98.0	75-125	1.70	20	

Notes and Definitions

QR-03	The RPD value for the sample duplicate or MS/MSD was outside of QC acceptance limits due to matrix interference. QC batch accepted based on LCS and/or LCSD recovery and/or RPD values.
QM-08	The spike recovery was outside acceptance limits for the MS and/or MSD. The QC Batch was accepted based on LCS/LCSD percent recoveries and RPD values.
QM-05	The spike recovery was outside acceptance limits for the MS and/or MSD due to matrix interference. The LCS and/or LCSD were within acceptance limits showing that the laboratory is in control and the data is acceptable.
J	Detected but below the RL/PQL; therefore, result is an estimated concentration .
DET	Analyte DETECTED
ND	Analyte NOT DETECTED at or above the reporting limit
NR	Not Reported
dry	Sample results reported on a dry weight basis
RPD	Relative Percent Difference

EMSL Analytical, Inc
2235 Polvorosa Ave , Suite 230, San Leandro, CA 94577
Phone: (510) 895-3675 Fax: (510) 895-3680 Email: milpitaslab@emsl.com

Attn: **Lisa Race**
Oilfield Environmental and Compliance
307 Roemer Way
Suite 300
Santa Maria, CA 93454

Fax: (805) 925-3376 Phone: (805) 922-4772
Project: **125 State St.**
08-25430

Customer ID: OILF50
Customer PO: 08-25430
Received: 05/21/10 9:00 AM
EMSL Order: 091004529

EMSL Proj:
Analysis Date: 5/28/2010

Test Report: PLM Analysis of Bulk Samples for Asbestos via EPA 600/R-93/116 Method with CARB 435 Prep (Milling) Level A for 0.25% Target Analytical Sensitivity

			Non-Asbestos		Asbestos
Sample	**Description**	**Appearance**	**% Fibrous**	**% Non-Fibrous**	**% Type**
1001754-01, asbestos soil *091004529-0001*		Tan Non-Fibrous Homogeneous		100.00% Non-fibrous (other)	**None Detected**
1001754-02, asbestos soil *091004529-0002*		Tan Non-Fibrous Homogeneous		100.00% Non-fibrous (other)	**None Detected**

Analyst(s)
Rui Cindy Geng (2)

Baojia Ke, Laboratory Manager
or other approved signatory

This report relates only to the samples listed above and may not be reproduced except in full, without EMSL's written approval. This report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. EMSL is not responsible for sample collection activities or method limitations. Some samples may contain asbestos fibers below the resolution limit of PLM. EMSL recommends that samples reported as none detected or less than the limit of detection undergo additional analysis via TEM.Samples received in good condition unless otherwise noted.
Samples analyzed by EMSL Analytical, Inc 2235 Polvorosa Ave , Suite 230, San LeandroCA

THIS IS THE LAST PAGE OF THE REPORT.

091004529

SUBCONTRACT ORDER

Oilfield Environmental and Compliance

091004529

1001754

SENDING LABORATORY:

Oilfield Environmental and Compliance
307 Roemer Way, Ste. 300
Santa Maria, CA 93454 Project: 125 State St
08-25430
Phone: 805.922.4772
Fax: 805.925.3376
Project Manager: Lisa Race

RECEIVING LABORATORY:

EMSL Analytical, Inc.
2235 Polvorosa Drive Suite 230
San Leandro, CA 94577
Phone :(888) 455-3675
Fax: (510) 895-3680

TAT: 5 days

Analysis	Due	Expires	Laboratory ID	Comments
Sample ID: 1001754-01	**Solid**	**Sampled:20-May-10 08:30**	[redacted]	**Fill 3**
Asbestos (Soil) - PLM CARB	27-May-10 16:00	03-Jun-10 08:30		
Containers Supplied:				
Sample ID: 1001754-02	**Solid**	**Sampled:20-May-10 08:30**	[redacted]	**Fill 4**
Asbestos (Soil) - PLM CARB	27-May-10 16:00	03-Jun-10 08:30		
Containers Supplied:				

Released By	Date	Received By	Date
Lynnette Yeo	5-20-10	Jm	5/21/10 D/0

Oilfield Environmental and Compliance
307 Roemer Way Suite 300, Santa Maria CA 93454
phone: (805) 922-4772 fax: (805) 925-3376 www.oecusa.com

Highway 33, McKittrick CA
phone: (661) 762-9143

CHAIN OF CUSTODY

Page 1 of 1

Company: Rincon Consultants, Inc.
Address: 790 East Santa Clara Street
City/State/ZIP: Ventura, CA 93001
Phone: 8056411000 Fax: 8056411072 E-mail: shelsler@rinconconsultants.com
Report To: Rincon Sampler: SD
Send report via- FAX- ☐ PDF- ☒ Colt/LUFT EDF- ☐ EDD- ☐
Turnaround Time: 10 Days- ☐ 5 Days- ☒ 72 hr- ☐ 48 hr- ☐ 24 hr- ☐ ASAP- ☐

Project Name/#: 125 State 08-25430
Site: 125 State Street, Santa Barbara, CA

OEC Sample ID	Date/Time Sampled	Matrix	# of Cont.	Client Sample ID	Metals 6000/7000	pH	Asbestos								Special Instructions:
10017541A	5-19-10/8:30	Soil	1	FILL3	X	X	X								MDL
2A	5-20-10/8:30	Soil	1	FILL4	X	X	X								MDL

Relinquished By: [signature]	Date: 5-20-10	Time: 1202	
Received By: [signature]	Date: 5/20/10	Time: 1202	
Relinquished By: [signature]	Date: 5/20/10	Time: 1400	
Received By: Lynnette Yeo	Date: 5-20-10	Time: 1400	
Relinquished By:	Date:	Time:	
Received By:	Date:	Time:	

Comments/PO#: Price per 125 State Quote

OEC SAMPLE RECEIPT

Rev. 01/15/10

CLIENT: Ancon

OEC ID #: 1001754

Temp: 3 °C

Acceptable Range: 0°C to 6°C

COC RECEIVED DATE/TIME: 5/20/10 1400

RECEIPT LOGIN DATE/TIME: 5/20/10 1422

REFRIGERATOR(s): 1

SAMPLE TRANSPORT, RECEIPT, CONDITION & PRESERVATION:

		Yes	No	N/A
☑ OEC Courier/Sampler	COC document(s) received with samples	☑	☐*	☐
☐ Delivery(Other than OEC Courier)	Correct containers for analysis requested	☑	☐*	☐
☑ Samples Received on Ice	Container(s) intact and in good condition	☑	☐*	☐
☐ Samples Received Outside Temp. Range*	Container label(s) consistent with COC	☑	☐*	☐
☐ Samples Direct from field (Outside Temp)	OEC preservative added (**note std ID)	☐**	☐	☑
☐ After-Hours Outside Drop-off [Brought Inside]	Proper preservation on sample label(s)	☐	☐	☑
(Initials/Date/Time):	VOA containers free of headspace	☐	☐*	☑
	Tedlar Bags free of condensation	☐	☐*	☑

(*) PROBLEM CHAIN FORM NEEDED

Custody Seals (circle): Present / Absent

Samples / Coolers Intact / Broken*

Method of Shipment & Tracking #(if applicable):

(**) OEC Preservative ID:

Dissolved Metals Filtration: (Date/Init/Preserve ID)

CONTAINERS, COC CHANGES AND/OR CORRECTIONS

CHANGES AUTHORIZED BY:

OEC ID	Client ID ***If blank, refer to CoC	Container Description	Preservative	ResCl /pH	Matrix	Date/Time Sampled ***	Comments / Remarks / Condition Notes, Etc.
1-2A		1-8oz glass ea	—	—	Solid		
1-2B		1-4oz glass ea	—	—	Solid		Asbestos Sub to EMSL

RECEIPT LOGIN BY: SM

RECEIPT REVIEWED BY: [illegible]

Oilfield Environmental and Compliance, INC.

Shawn Decker
Rincon Consultants
790 East Santa Clara Street
Santa Barbara, CA 93001

16 July 2010

RE: 125 State Street Excavation

Work Order: 1001715

Dear Client:

Enclosed is an analytical report for the above referenced project. The samples included in this report were received on 17-May-10 17:00 and analyzed in accordance with the attached chain-of-custody.

Unless otherwise noted, all analytical testing was accomplished in accordance with the guidelines established in our Quality Assurance Manual, applicable standard operating procedures, and other related documentation. The results in this analytical report are limited to the samples tested and any reproduction thereof must be made in its entirety.

If you have any questions regarding this report, please do not hesitate to contact the undersigned.

Sincerely,

Vanessa Miller

Project Manager Assistant

TEL: (805) 922-4772
307 Roemer Way, Suite 300, Santa Maria, CA 93454 www.oecusa.com FAX: (805) 925-3376

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara Street	Project Number: 08-25430	**Reported:**
Santa Barbara CA, 93001	Project Manager: Shawn Decker	16-Jul-10 15:02

ANALYTICAL REPORT FOR SAMPLES

Sample ID	Laboratory ID	Matrix	Date Sampled	Date Received
CS101	1001715-01	Solid	17-May-10 14:30	17-May-10 17:00
CS102	1001715-02	Solid	17-May-10 14:35	17-May-10 17:00
CS103	1001715-03	Solid	17-May-10 14:40	17-May-10 17:00
CS104	1001715-04	Solid	17-May-10 14:45	17-May-10 17:00

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara Street	Project Number: 08-25430	**Reported:**
Santa Barbara CA, 93001	Project Manager: Shawn Decker	16-Jul-10 15:02

CS101

1001715-01 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**270**	2.0	3.9	mg/kg	20	A005260	18-May-10	18-May-10	EPA 6020	N-02, N-03
STLC Metals by 6000/7000 Series Methods										
Lead	**9.1**	0.050	0.10	mg/L	100	A006138	08-Jun-10	08-Jun-10	STLC/EPA 6020	N-06
TCLP Metals by 6000/7000 Series Methods										
Lead	**0.064**	0.0050	0.010	mg/L	10	A007253	15-Jul-10	16-Jul-10	EPA 1311/EPA 6020	

CS102

1001715-02 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**180**	1.9	3.8	mg/kg	20	A005260	18-May-10	18-May-10	EPA 6020	N-02, N-03
STLC Metals by 6000/7000 Series Methods										
Lead	**37**	0.25	0.50	mg/L	500	A006138	08-Jun-10	08-Jun-10	STLC/EPA 6020	N-06
TCLP Metals by 6000/7000 Series Methods										
Lead	**0.024**	0.0050	0.010	mg/L	10	A007253	15-Jul-10	16-Jul-10	EPA 1311/EPA 6020	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara Street	Project Number: 08-25430	**Reported:**
Santa Barbara CA, 93001	Project Manager: Shawn Decker	16-Jul-10 15:02

CS103

1001715-03 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**6.3**	0.47	0.93	mg/kg	5	A005260	18-May-10	18-May-10	EPA 6020	

CS104

1001715-04 (Solid)

Analyte	Result	Method Limit	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Total Metals by EPA 6000/7000 Series Methods										
Lead	**90**	0.50	0.99	mg/kg	5	A005260	18-May-10	18-May-10	EPA 6020	N-02
STLC Metals by 6000/7000 Series Methods										
Lead	**14**	0.050	0.10	mg/L	100	A006138	08-Jun-10	08-Jun-10	STLC/EPA 6020	N-06
TCLP Metals by 6000/7000 Series Methods										
Lead	**0.021**	0.0050	0.010	mg/L	10	A007253	15-Jul-10	16-Jul-10	EPA 1311/EPA 6020	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara Street	Project Number: 08-25430	**Reported:**
Santa Barbara CA, 93001	Project Manager: Shawn Decker	16-Jul-10 15:02

Total Metals by EPA 6000/7000 Series Methods - Quality Control

Analyte	Result	Method Limit	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
Batch A005260 - EPA 3050B											
Blank (A005260-BLK1)					Prepared & Analyzed: 18-May-10						
Lead	ND		0.20	mg/kg							
LCS (A005260-BS1)					Prepared & Analyzed: 18-May-10						
Lead	14.6		0.20	mg/kg	15.0		97.4	85-115			
LCS Dup (A005260-BSD1)					Prepared & Analyzed: 18-May-10						
Lead	14.7		0.20	mg/kg	15.0		97.8	85-115	0.412	20	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara Street	Project Number: 08-25430	**Reported:**
Santa Barbara CA, 93001	Project Manager: Shawn Decker	16-Jul-10 15:02

STLC Metals by 6000/7000 Series Methods - Quality Control

Analyte	Result	Method Limit	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
Batch A006138 - EPA 3005A Leachate											
Blank (A006138-BLK1)					Prepared & Analyzed: 08-Jun-10						
Lead	ND		0.0010	mg/L							
LCS (A006138-BS1)					Prepared & Analyzed: 08-Jun-10						
Lead	0.147		0.0010	mg/L	0.150		97.8	85-115			
LCS Dup (A006138-BSD1)					Prepared & Analyzed: 08-Jun-10						
Lead	0.148		0.0010	mg/L	0.150		98.5	85-115	0.758	20	
Duplicate (A006138-DUP1)		**Source: 1001681-08**			Prepared & Analyzed: 08-Jun-10						
Lead	1.74		0.010	mg/L		1.56			11.4	20	
Matrix Spike (A006138-MS1)		**Source: 1001681-08**			Prepared & Analyzed: 08-Jun-10						
Lead	8.19		0.040	mg/L	6.00	1.56	111	64-153			
Matrix Spike Dup (A006138-MSD1)		**Source: 1001681-08**			Prepared & Analyzed: 08-Jun-10						
Lead	8.42		0.040	mg/L	6.00	1.56	114	64-153	3.50	20	

Oilfield Environmental and Compliance, INC.

Rincon Consultants	Project: 125 State Street Excavation	
790 East Santa Clara Street	Project Number: 08-25430	**Reported:**
Santa Barbara CA, 93001	Project Manager: Shawn Decker	16-Jul-10 15:02

TCLP Metals by 6000/7000 Series Methods - Quality Control

Analyte	Result	Method Limit	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
Batch A007253 - EPA 3005A Leachate											
Blank (A007253-BLK1)					Prepared: 15-Jul-10 Analyzed: 16-Jul-10						
Lead	ND		0.0010	mg/L							
Blank (A007253-BLK2)					Prepared: 15-Jul-10 Analyzed: 16-Jul-10						
Lead	ND		0.010	mg/L							
LCS (A007253-BS1)					Prepared: 15-Jul-10 Analyzed: 16-Jul-10						
Lead	0.152		0.0010	mg/L	0.150		101	85-115			
LCS (A007253-BS2)					Prepared: 15-Jul-10 Analyzed: 16-Jul-10						
Lead	3.34		0.020	mg/L	3.00		111	85-115			
LCS Dup (A007253-BSD1)					Prepared: 15-Jul-10 Analyzed: 16-Jul-10						
Lead	0.152		0.0010	mg/L	0.150		102	85-115	0.343	20	
Duplicate (A007253-DUP1)	**Source: 1002169-09**				Prepared: 15-Jul-10 Analyzed: 16-Jul-10						
Lead	0.0385		0.010	mg/L		0.0362			6.10	20	
Matrix Spike (A007253-MS1)	**Source: 1002169-09**				Prepared: 15-Jul-10 Analyzed: 16-Jul-10						
Lead	6.36		0.040	mg/L	6.00	0.0362	105	64-153			
Matrix Spike Dup (A007253-MSD1)	**Source: 1002169-09**				Prepared: 15-Jul-10 Analyzed: 16-Jul-10						
Lead	6.57		0.040	mg/L	6.00	0.0362	109	64-153	3.29	20	

Notes and Definitions

N-06	STLC analyte concentration exceeds STLC limit.
N-03	Analyte concentration above 20 X TCLP.
N-02	Analyte concentration below TTLC but above 10 X STLC.
DET	Analyte DETECTED
ND	Analyte NOT DETECTED at or above the reporting limit
NR	Not Reported
dry	Sample results reported on a dry weight basis
RPD	Relative Percent Difference

Oilfield Environmental and Compliance
307 Roemer Way Suite 300, Santa Maria CA 93454
phone: (805) 922-4772 fax: (805) 925-3376 www.oecusa.com

Highway 33, McKittrick CA
phone: (661) 762-9143

CHAIN OF CUSTODY

Page 1 of 1

Company: Rincon Consultants, Inc.
Address: 790 East Santa Clara Street
City/State/ZIP: Ventura, CA 93001
Phone: 8056411000 Fax: 8056411072 E-mail: shelle@rinconconsults.com
Report To: Rincon Sampler: Shawna Decker
Send report via- FAX- ☐ PDF- ☒ Colt/LUFT EDF- ☐ EDD- ☐
Turnaround Time: 10 Days- ☐ 5 Days- ☐ 72 hr- ☐ 48 hr- ☐ 24 hr- ☒ ASAP- ☐

Project Name/#: 08-25430 125 State
Site: 125 State Street, Santa Barbara, CA

OEC Sample ID	Date/Time Sampled	Matrix	# of Cont.	Client Sample ID	Total Lead 6000/7000	Special Instructions:
1001715-1A	5-17-10/14:30	Soil	1	CS101	X	MDL
-2A	14:35			CS102	X	
-3A	14:40			CS103	X	
-4A	14:45			CS104	X	

Relinquished By: [signature] Date: 5-17-10 Time: 1505
Received By: [signature] Date: 5/17/10 Time: 1505
Relinquished By: [signature] Date: 5/17/10 Time: 1700
Received By: [signature] Date: 5-17-10 Time: 1700
Relinquished By: Date: Time:
Received By: Date: Time:

Comments/PO#: Price per 125 State Quote

OEC SAMPLE RECEIPT

Rev. 01/15/10

CLIENT: Rincon OEC ID #: 1001715 Temp: 3 °C

Acceptable Range: 0°C to 6°C

COC RECEIVED DATE/TIME: 5-17-10 1700

RECEIPT LOGIN DATE/TIME: 5-17-10 1712

REFRIGERATOR(s): 1

SAMPLE TRANSPORT, RECEIPT, CONDITION & PRESERVATION:		Yes	No	N/A	(*) PROBLEM CHAIN FORM NEEDED
☒ OEC Courier/Sampler	COC document(s) received with samples	☒	☐*	☐	Custody Seals (circle): Present / Absent
☐ Delivery(Other than OEC Courier)	Correct containers for analysis requested	☒	☐*	☐	Samples / Coolers
☒ Samples Received on Ice	Container(s) intact and in good condition	☒	☐*	☐	Intact / Broken*
☐ Samples Received Outside Temp. Range*	Container label(s) consistent with COC	☒	☐*	☐	Method of Shipment & Tracking #(if applicable):
☐ Samples Direct from field (Outside Temp)	OEC preservative added (**note std ID)	☐**	☐	☒	
☐ After-Hours Outside Drop-off [Brought Inside]	Proper preservation on sample label(s)	☐	☐	☒	(**) OEC Preservative ID:
(Initials/Date/Time):	VOA containers free of headspace	☐	☐*	☒	Dissolved Metals Filtration: (Date/Init/Preserve ID)
	Tedlar Bags free of condensation	☐	☐*	☒	

CONTAINERS, COC CHANGES AND/OR CORRECTIONS — CHANGES AUTHORIZED BY:

OEC ID	Client ID ***If blank, refer to CoC	Container Description	Preservative	ResCl /pH	Matrix	Date/Time Sampled ***	Comments / Remarks / Condition Notes, Etc.
1-4A		1-8oz glass ea	—	—	Solid		

RECEIPT LOGIN BY: hy RECEIPT REVIEWED BY: [signature]

Oilfield Environmental and Compliance
307 Roemer Way Suite 300, Santa Maria CA 93454
phone: (805) 922-4772 fax: (805) 925-3376 www.oecusa.com

Highway 33, McKittrick CA
phone: (661) 762-9143

CHAIN OF CUSTODY

Page 1 of 1

Company: Rincon Consultants, Inc.
Address: 790 East Santa Clara Street
City/State/ZIP: Ventura, CA 93001
Phone: 8056411000 Fax: 8056411072 E-mail: shicks@rinconcnsltts.com
Report To: Rincon Sampler: Shawn Decker
Send report via- FAX- ☐ PDF- ☒ Colt/LUFT EDF- ☐ EDD- ☐
Turnaround Time: 10 Days- ☐ 5 Days- ☐ 72 hr- ☐ 48 hr- ☐ 24 hr- ☒ ASAP- ☐

Project Name/#: 08-25430 145 State
Site: 145 State Street, Santa Barbara, CA

OEC Sample ID	Date/Time Sampled	Matrix	# of Cont.	Client Sample ID	Total Lead 6000/7000	Soaccp	TCLP Pb								Special Instructions:
1001715-1A	5-17-10/14:30	Soil	1	CS101	X	△	⊗								MDL
-2A	14:35			CS102	X	△	⊗								
-3A	14:40			CS103	X										
-4A	14:45			CS104	X	△	⊗								

(88) ADD ON 7/12/10 11:18

Relinquished By:	Date: 5-17-10	Time: 1505
Received By:	Date: 5/17/10	Time: 1505
Relinquished By:	Date: 5/17/10	Time: 1700
Received By:	Date: 5-17-10	Time: 1700
Relinquished By:	Date:	Time:
Received By:	Date:	Time:

Comments/PO#: Price per 145 State Quote

Appendix 7

Disposal Manifests

Please print or type. (Form designed for use on elite (12-pitch) typewriter.)

Form Approved. OMB No. 2050-0039

UNIFORM HAZARDOUS WASTE MANIFEST

1. Generator ID Number: CAC000365088
2. Page 1 of
3. Emergency Response Phone: (661) 746-1132
4. Manifest Tracking Number: 004744167 JJK

GENERATOR

5. Generator's Name and Mailing Address: City Of Santa Barbara, PO BOX 1990, Santa Barbara, CA 93102
Generator's Phone: (805) 641-1000 x 23
Generator's Site Address (if different than mailing address): 125 State Street, Santa Barbara, CA 93101

6. Transporter 1 Company Name: Perez & sons T Inc
U.S. EPA ID Number: CAR000170217

7. Transporter 2 Company Name:
U.S. EPA ID Number:

8. Designated Facility Name and Site Address: Clean Harbors Buttonwillow, 2300 West Lokern Road, Buttonwillow, CA 93206
Facility's Phone: (661) 762-6200
U.S. EPA ID Number: CAD982067276

9a. HM	9b. U.S. DOT Description (including Proper Shipping Name, Hazard Class, ID Number, and Packing Group (if any))	10. Containers No.	10. Containers Type	11. Total Quantity	12. Unit Wt./Vol.	13. Waste Codes
	1. Non, Non-RCRA Hazardous Waste, Solid, N/A	001	DT	00018	Y	611
	2.					
	3.					
	4.					

14. Special Handling Instructions and Additional Information
Profile #: CH420795E
Sales Order #: 7W2873366
VP-35055

15. **GENERATOR'S/OFFEROR'S CERTIFICATION:** I hereby declare that the contents of this consignment are fully and accurately described above by the proper shipping name, and are classified, packaged, marked and labeled/placarded, and are in all respects in proper condition for transport according to applicable international and national governmental regulations. If export shipment and I am the Primary Exporter, I certify that the contents of this consignment conform to the terms of the attached EPA Acknowledgment of Consent.
I certify that the waste minimization statement identified in 40 CFR 262.27(a) (if I am a large quantity generator) or (b) (if I am a small quantity generator) is true.

Generator's/Offeror's Printed/Typed Name: Lenen Aparicio
Signature: [signature]
Month / Day / Year: 23 / 76 / 10

INT'L

16. International Shipments ☐ Import to U.S. ☐ Export from U.S. Port of entry/exit:
Transporter signature (for exports only): Date leaving U.S.:

TRANSPORTER

17. Transporter Acknowledgment of Receipt of Materials
Transporter 1 Printed/Typed Name: Hector Perez
Signature: [signature]
Month / Day / Year: 05 / 05 / 10
Transporter 2 Printed/Typed Name:
Signature:
Month / Day / Year:

DESIGNATED FACILITY

18. Discrepancy
18a. Discrepancy Indication Space ☐ Quantity ☐ Type ☐ Residue ☐ Partial Rejection ☐ Full Rejection
Manifest Reference Number:
18b. Alternate Facility (or Generator)
U.S. EPA ID Number:
Facility's Phone:
18c. Signature of Alternate Facility (or Generator)
Month / Day / Year:

19. Hazardous Waste Report Management Method Codes (i.e., codes for hazardous waste treatment, disposal, and recycling systems)
1. H132
2.
3.
4.

20. Designated Facility Owner or Operator: Certification of receipt of hazardous materials covered by the manifest except as noted in Item 18a
Printed/Typed Name: Donald E Johns
Signature: [signature]
Month / Day / Year: 05 / 05 / 10

EPA Form 8700-22 (Rev. 3-05) Previous editions are obsolete.

TRANSPORTER'S COPY

NO. 191062

CLEANHARBORS BUTTONWILLOW, LLC
WEIGHMASTER CERTIFICATE

THIS IS TO CERTIFY that the following described commodity was weighed, measured, or counted by a weighmaster whose signature is on this certificate, who is a recognized authority of accuracy, as prescribed in Chapter 7 (commencing with Section12700) of Division 5 of the California Business and Professions Code, administered by the Division of Measurement Standards of the California Department of Food and Agiculture.

4:29 PM 05/05/10
REG. (57)
INBOUND 80860 lb

4:55 PM 05/05/10
REG. (57)

80860 lb GROSS
33340 lb TARE
47520 lb NET

WEIGHMASTER CLEANHARBORS BUTTONWILLOW, LLC

PROFILE NO.	CH420795B	GROSS WT. BY: DEPUTY	DATE 5/5/10
DISPOSAL LOCATION	35.3 23.8.05	TARE WT. BY: DEPUTY	DATE 050510
DRIVER'S NAME PRINTED	Hector Perez	WEIGHING LOCATION:	2500 W. LOKERN ROAD BUTTONWILLOW, CA 93206
DRIVER'S NAME SIGNATURE	Hector Perez	GENERATOR	City of SB
TRACTOR NO.	P8	TRANSPORTER	Perez
TRACTOR LIC. NO.	VP35055	MANIFEST NO.	004744167 JJK
TRAILER LIC. NO.	1AX41173	SERVICE ORDER NO.	762873366
BIN NUMBERS:		BIN TRACKING	

☒ END DUMP ☐ TRANSFER ☐ VACUUM ☐ VAN
☐ ROLL OFF - _____ ☐ FLAT BED ☐ _____

VIS	pH	SUL	CYA	OX	FL	FLASH	20%	
+							Y	
OTHER:								

IC	CR	PR	B.W. W.B.	LAB	SOLID BULK	WORK SHEET	LAND TRACK	W.T. SCAN	MAN-SCAN	RE-SCAN

DRUM NUMBER:

COMMENTS:

BIN DROP FULL:

MOVE BIN TO: DATE: BY:

REVISED (3/10)

Please print or type. (Form designed for use on elite (12-pitch) typewriter.)

Form Approved. OMB No. 2050-0039

UNIFORM HAZARDOUS WASTE MANIFEST

1. Generator ID Number: CAC000265048 8
2. Page 1 of
3. Emergency Response Phone: (661) 746-1132
4. Manifest Tracking Number: 004744168 JJK

GENERATOR

5. Generator's Name and Mailing Address: City Of Santa Barbara, PO BOX 1990, Santa Barbara, CA 93102
Generator's Phone: (805) 641-1000 x 23
Generator's Site Address (if different than mailing address): 125 State Street, Santa Barbara, CA 93101

6. Transporter 1 Company Name: Jim Trucking
U.S. EPA ID Number: CAR000159020

7. Transporter 2 Company Name:
U.S. EPA ID Number:

8. Designated Facility Name and Site Address: Clean Harbors Buttonwillow, 2500 West Lokern Road, Buttonwillow, CA 93206
Facility's Phone: (661) 762-6200
U.S. EPA ID Number: CAD982067276

9a. HM	9b. U.S. DOT Description (including Proper Shipping Name, Hazard Class, ID Number, and Packing Group (if any))	10. Containers No.	10. Containers Type	11. Total Quantity	12. Unit Wt./Vol.	13. Waste Codes
	1. None, Non-RCRA Hazardous Waste, Solid, N/A	001	DT	00018	Y	611
	2.					
	3.					
	4.					

14. Special Handling Instructions and Additional Information
Profile #: CH420795B
Sales Order #: 7W2873368

15. **GENERATOR'S/OFFEROR'S CERTIFICATION:** I hereby declare that the contents of this consignment are fully and accurately described above by the proper shipping name, and are classified, packaged, marked and labeled/placarded, and are in all respects in proper condition for transport according to applicable international and national governmental regulations. If export shipment and I am the Primary Exporter, I certify that the contents of this consignment conform to the terms of the attached EPA Acknowledgment of Consent.
I certify that the waste minimization statement identified in 40 CFR 262.27(a) (if I am a large quantity generator) or (b) (if I am a small quantity generator) is true.

Generator's/Offeror's Printed/Typed Name: [illegible] Signature: [illegible] Month 05 Day 03 Year 10

INT'L

16. International Shipments ☐ Import to U.S. ☐ Export from U.S. Port of entry/exit:
Transporter signature (for exports only): Date leaving U.S.:

TRANSPORTER

17. Transporter Acknowledgment of Receipt of Materials
Transporter 1 Printed/Typed Name: Jose Menjivar Signature: [illegible] Month 05 Day 05 Year 10
Transporter 2 Printed/Typed Name: Signature: [illegible] Month 05 Day 05 Year 10

DESIGNATED FACILITY

18. Discrepancy
18a. Discrepancy Indication Space ☐ Quantity ☐ Type ☐ Residue ☐ Partial Rejection ☐ Full Rejection
Manifest Reference Number:
18b. Alternate Facility (or Generator)
U.S. EPA ID Number
Facility's Phone:
18c. Signature of Alternate Facility (or Generator) Month Day Year

19. Hazardous Waste Report Management Method Codes (i.e., codes for hazardous waste treatment, disposal, and recycling systems)
1. H130 2. 3. 4.

20. Designated Facility Owner or Operator: Certification of receipt of hazardous materials covered by the manifest except as noted in Item 18a
Printed/Typed Name: Kenneth E. Johns Signature: [illegible] Month 05 Day 05 Year 10

EPA Form 8700-22 (Rev. 3-05) Previous editions are obsolete.

TRANSPORTER'S COPY

NO. 191051

CLEANHARBORS BUTTONWILLOW, LLC
WEIGHMASTER CERTIFICATE

THIS IS TO CERTIFY that the following described commodity was weighed, measured, or counted by a weighmaster whose signature is on this certificate, who is a recognized authority of accuracy, as prescribed in Chapter 7 (commencing with Section12700) of Division 5 of the California Business and Professions Code, administered by the Division of Measurement Standards of the California Department of Food and Agiculture.

2:33 PM 05/05/10
REG. (10)
INBOUND 85120 lb

2:50 PM 05/05/10
REG. (10)

85120 lb GROSS
31560 lb TARE
53560 lb NET

WEIGHMASTER CLEANHARBORS BUTTONWILLOW, LLC

PROFILE NO. CH120795B	GROSS WT. BY:	DEPUTY	DATE 05/4/10
DISPOSAL LOCATION 353 23-E-05	TARE WT. BY:	DEPUTY	DATE 050510
DRIVER'S NAME PRINTED Jose Menjivar	WEIGHING LOCATION:	2500 W. LOKERN ROAD BUTTONWILLOW, CA 93206	
DRIVER'S NAME SIGNATURE	GENERATOR	City of SB	
TRACTOR NO. 01	TRANSPORTER	JM Trucking	
TRACTOR LIC. NO. UP26534	MANIFEST NO.	004744168JJK	
TRAILER LIC. NO. 6775FS	SERVICE ORDER NO.	7W287336	
BIN NUMBERS:	BIN TRACKING		

☒ END DUMP ☐ TRANSFER ☐ VACUUM ☐ VAN

☐ ROLL OFF - _____ ☐ FLAT BED ☐ _____

VIS	pH	SUL	CYA	OX	FL	FLASH	20%	
–	8.74	–	–	–	–			
OTHER:								

IC	CR	PR	B.W. W.B.	LAB	SOLID BULK	WORK SHEET	LAND TRACK	W.T. SCAN	MAN-SCAN	RE-SCAN

DRUM NUMBER:

COMMENTS:

BIN DROP FULL:

MOVE BIN TO: DATE: BY:

REVISED (3/10)

0130 WT 00025

Please print or type. (Form designed for use on elite (12-pitch) typewriter.)

Form Approved. OMB No. 2050-0039

UNIFORM HAZARDOUS WASTE MANIFEST

1. Generator ID Number: CAC002650488
2. Page 1 of
3. Emergency Response Phone: (661) 746-1132
4. Manifest Tracking Number: **004744169 JJK**

5. Generator's Name and Mailing Address: City Of Santa Barbara, PO BOX 1990, Santa Barbara, CA 93102
Generator's Site Address (if different than mailing address): 123 State Street, Santa Barbara, CA 93101
Generator's Phone: (805) 441-1000 x 22

6. Transporter 1 Company Name: McDonald — U.S. EPA ID Number: CAD983616202

7. Transporter 2 Company Name — U.S. EPA ID Number:

8. Designated Facility Name and Site Address: Clean Harbors Buttonwillow, 2300 West Lokern Road, Buttonwillow, CA 93206
U.S. EPA ID Number: CAD980673276
Facility's Phone: (661) 762-6200

9a. HM	9b. U.S. DOT Description (including Proper Shipping Name, Hazard Class, ID Number, and Packing Group (if any))	10. Containers No.	10. Containers Type	11. Total Quantity	12. Unit Wt./Vol.	13. Waste Codes		
	1. Non, Non RCRA Hazardous Waste, Solid, NOS	001	DT	00012	Y	611		
	2.							
	3.							
	4.							

14. Special Handling Instructions and Additional Information
Profile #: CH42070-B
Sales Order #: 7772873388 25 85 38

15. **GENERATOR'S/OFFEROR'S CERTIFICATION:** I hereby declare that the contents of this consignment are fully and accurately described above by the proper shipping name, and are classified, packaged, marked and labeled/placarded, and are in all respects in proper condition for transport according to applicable international and national governmental regulations. If export shipment and I am the Primary Exporter, I certify that the contents of this consignment conform to the terms of the attached EPA Acknowledgment of Consent.
I certify that the waste minimization statement identified in 40 CFR 262.27(a) (if I am a large quantity generator) or (b) (if I am a small quantity generator) is true. 4823

Generator's/Offeror's Printed/Typed Name: Gene Appel CS — Signature: Gene Appel — Month 5 Day 5 Year 10

16. International Shipments ☐ Import to U.S. ☐ Export from U.S. Port of entry/exit:
Transporter signature (for exports only): Date leaving U.S.:

17. Transporter Acknowledgment of Receipt of Materials
Transporter 1 Printed/Typed Name: Nathan McDonald CS — Signature: McDonald — Month 5 Day 5 Year 10
Transporter 2 Printed/Typed Name — Signature — Month Day Year

18. Discrepancy
18a. Discrepancy Indication Space ☐ Quantity ☐ Type ☐ Residue ☐ Partial Rejection ☐ Full Rejection
Manifest Reference Number:
18b. Alternate Facility (or Generator) — U.S. EPA ID Number
Facility's Phone:
18c. Signature of Alternate Facility (or Generator) — Month Day Year

19. Hazardous Waste Report Management Method Codes (i.e., codes for hazardous waste treatment, disposal, and recycling systems)
1. H132 2. 3. 4.

20. Designated Facility Owner or Operator: Certification of receipt of hazardous materials covered by the manifest except as noted in Item 18a
Printed/Typed Name: Ronald E Johns — Signature: Ronald E Johns — Month 05 Day 05 Year 10

GENERATOR — INT'L — TRANSPORTER — DESIGNATED FACILITY

EPA Form 8700-22 (Rev. 3-05) Previous editions are obsolete.

TRANSPORTER'S COPY

NO. 191059

CLEANHARBORS BUTTONWILLOW, LLC
WEIGHMASTER CERTIFICATE

3:25 5/5/10
79570 lb Inbound

79520 lb gross
27870 lb Tare
51700 lb NET
3:36 5/5/10

THIS IS TO CERTIFY that the following described commodity was weighed, measured, or counted by a weighmaster whose signature is on this certificate, who is a recognized authority of accuracy, as prescribed in Chapter 7 (commencing with Section12700) of Division 5 of the California Business and Professions Code, administered by the Division of Measurement Standards of the California Department of Food and Agiculture.

WEIGHMASTER CLEANHARBORS BUTTONWILLOW, LLC

PROFILE NO. CH420795B	GROSS WT. BY:	DEPUTY	DATE 5/5/10
DISPOSAL LOCATION 35-3 23-8-05	TARE WT. BY	DEPUTY	DATE 050510
DRIVER'S NAME PRINTED Nathan McDonald	WEIGHING LOCATION:	2500 W. LOKERN ROAD BUTTONWILLOW, CA 93206	
DRIVER'S NAME SIGNATURE	GENERATOR City of SB		
TRACTOR NO. 1613C	TRANSPORTER NC McDonald		
TRACTOR LIC. NO. UP06304	MANIFEST NO. 004744169 JJK		
TRAILER LIC. NO. 4FW7157	SERVICE ORDER NO. 7W2873366		
BIN NUMBERS:	BIN TRACKING		

☑ END DUMP ☐ TRANSFER ☐ VACUUM ☐ VAN
☐ ROLL OFF - _____ ☐ FLAT BED ☐ _____

VIS	pH	SUL	CYA	OX	FL	FLASH	20%	
+	8.74	—	—	—	—			
OTHER:								

IC	CR	PR	B.W. W.B.	LAB	SOLID BULK	WORK SHEET	LAND TRACK	W.T. SCAN	MAN-SCAN	RE-SCAN

DRUM NUMBER:

COMMENTS:

BIN DROP FULL:

MOVE BIN TO: DATE: BY:

REVISED (3/10)

Please print or type. (Form designed for use on elite (12-pitch) typewriter.)

Form Approved. OMB No. 2050-0039

UNIFORM HAZARDOUS WASTE MANIFEST

1. Generator ID Number: CAC002650488
2. Page 1 of
3. Emergency Response Phone: (661) 746-1132
4. Manifest Tracking Number: 004744170 JJK

5. Generator's Name and Mailing Address: City Of Santa Barbara, PO BOX 1990, Santa Barbara, CA 93102
Generator's Phone: (805) 564-1090 x 23
Generator's Site Address (if different than mailing address): 123 State Street, Santa Barbara, CA 93101

6. Transporter 1 Company Name: D & S TRUCKING
U.S. EPA ID Number: CAD000045143

7. Transporter 2 Company Name:
U.S. EPA ID Number:

8. Designated Facility Name and Site Address: Clean Harbors Buttonwillow, 2500 West Lokern Road, Buttonwillow, CA 93206
Facility's Phone: (661) 762-6200
U.S. EPA ID Number: CAD980673276

9a. HM	9b. U.S. DOT Description (including Proper Shipping Name, Hazard Class, ID Number, and Packing Group (if any))	10. Containers No.	10. Containers Type	11. Total Quantity	12. Unit Wt./Vol.	13. Waste Codes
	1. Non Haz RCRA Hazardous Waste, Solid, N/A	001	DT	00010	Y	611
	2.					
	3.					
	4.					

14. Special Handling Instructions and Additional Information
Profile # CH4207252
Sales Order # TW2873366

15. **GENERATOR'S/OFFEROR'S CERTIFICATION:** I hereby declare that the contents of this consignment are fully and accurately described above by the proper shipping name, and are classified, packaged, marked and labeled/placarded, and are in all respects in proper condition for transport according to applicable international and national governmental regulations. If export shipment and I am the Primary Exporter, I certify that the contents of this consignment conform to the terms of the attached EPA Acknowledgment of Consent.
I certify that the waste minimization statement identified in 40 CFR 262.27(a) (if I am a large quantity generator) or (b) (if I am a small quantity generator) is true.

Generator's/Offeror's Printed/Typed Name: [illegible]
Signature: Cesar Aguirre
Month 5 Day 5 Year 10

16. International Shipments ☐ Import to U.S. ☐ Export from U.S. Port of entry/exit:
Transporter signature (for exports only): Date leaving U.S.:

17. Transporter Acknowledgment of Receipt of Materials
Transporter 1 Printed/Typed Name: JOSE SROA
Signature: [illegible]
Month 5 Day 5 Year 10

Transporter 2 Printed/Typed Name:
Signature:
Month Day Year

18. Discrepancy
18a. Discrepancy Indication Space ☐ Quantity ☐ Type ☐ Residue ☐ Partial Rejection ☐ Full Rejection
Manifest Reference Number:
18b. Alternate Facility (or Generator)
U.S. EPA ID Number:
Facility's Phone:
18c. Signature of Alternate Facility (or Generator)
Month Day Year

19. Hazardous Waste Report Management Method Codes (i.e., codes for hazardous waste treatment, disposal, and recycling systems)
1. H137
2.
3.
4.

20. Designated Facility Owner or Operator: Certification of receipt of hazardous materials covered by the manifest except as noted in Item 18a
Printed/Typed Name: Donald E Johns
Signature: [illegible]
Month 05 Day 05 Year 10

GENERATOR | INT'L | TRANSPORTER | DESIGNATED FACILITY

EPA Form 8700-22 (Rev. 3-05) Previous editions are obsolete.

TRANSPORTER'S COPY

3:05 PM 05/05/10
REG. (45)
INBOUND 76460 lb

NO. 191056

CLEANHARBORS BUTTONWILLOW, LLC
WEIGHMASTER CERTIFICATE

THIS IS TO CERTIFY that the following described commodity was weighed, measured, or counted by a weighmaster whose signature is on this certificate, who is a recognized authority of accuracy, as prescribed in Chapter 7 (commencing with Section12700) of Division 5 of the California Business and Professions Code, administered by the Division of Measurement Standards of the California Department of Food and Agiculture.

WEIGHMASTER CLEANHARBORS BUTTONWILLOW, LLC

PROFILE NO.	C1-420795B	GROSS WT. BY: DEPUTY	DATE 5/5/10
DISPOSAL LOCATION	35 3 23-E-05	TARE WT. BY: DEPUTY	DATE 050510
DRIVER'S NAME PRINTED	JOSE RON	WEIGHING LOCATION:	2500 W. LOKERN ROAD BUTTONWILLOW, CA 93206
DRIVER'S NAME SIGNATURE		GENERATOR	City of FSB
TRACTOR NO.	69	TRANSPORTER	D&S
TRACTOR LIC. NO.	UP15824	MANIFEST NO.	004744170JJK
TRAILER LIC. NO.	HD27792	SERVICE ORDER NO.	7628873366
BIN NUMBERS:		BIN TRACKING	

3:26 PM 05/05/10
REG. (45)

76460 lb GROSS
31700 lb TARE
44760 lb NET

☐ END DUMP ☐ TRANSFER ☐ VACUUM ☐ VAN
☐ ROLL OFF - _____ ☐ FLAT BED ☐ _____

VIS	pH	SUL	CYA	OX	FL	FLASH	20%	
+	8.22	–	–	~	~	~		
OTHER:								

IC	CR	PR	B.W. W.B.	LAB	SOLID BULK	WORK SHEET	LAND TRACK	W.T. SCAN	MAN-SCAN	RE-SCAN

DRUM NUMBER:

COMMENTS:

BIN DROP FULL:

MOVE BIN TO: DATE: BY:

REVISED (3/10)

459 UP 93612

Please print or type. (Form designed for use on elite (12-pitch) typewriter.)

Form Approved. OMB No. 2050-0039

UNIFORM HAZARDOUS WASTE MANIFEST

1. Generator ID Number: CAC000365048
2. Page 1 of
3. Emergency Response Phone: (661) 746-1132
4. Manifest Tracking Number: 004744171 JJK

GENERATOR

5. Generator's Name and Mailing Address: City Of Santa Barbara, PO BOX 1990, Santa Barbara, CA 93102
Generator's Phone: (805) 641-1000 x 23
Generator's Site Address (if different than mailing address): 123 State Street, Santa Barbara, CA 93101

6. Transporter 1 Company Name: CHP Express — U.S. EPA ID Number: CHI000018623

7. Transporter 2 Company Name — U.S. EPA ID Number:

8. Designated Facility Name and Site Address: Clean Harbors Buttonwillow, 2500 West Lokern Road, Buttonwillow, CA 93206 — U.S. EPA ID Number: CAD980673376
Facility's Phone: (661) 762-6200

9a. HM	9b. U.S. DOT Description (including Proper Shipping Name, Hazard Class, ID Number, and Packing Group (if any))	10. Containers No.	10. Containers Type	11. Total Quantity	12. Unit Wt./Vol.	13. Waste Codes
	1. None, Non-RCRA Hazardous Waste, Solid, N/A	001	DT	00018	Y	811
	2.					
	3.					
	4.					

14. Special Handling Instructions and Additional Information
Profile #: CH420795B
Sales Order #: 71W2873366

15. **GENERATOR'S/OFFEROR'S CERTIFICATION:** I hereby declare that the contents of this consignment are fully and accurately described above by the proper shipping name, and are classified, packaged, marked and labeled/placarded, and are in all respects in proper condition for transport according to applicable international and national governmental regulations. If export shipment and I am the Primary Exporter, I certify that the contents of this consignment conform to the terms of the attached EPA Acknowledgment of Consent.
I certify that the waste minimization statement identified in 40 CFR 262.27(a) (if I am a large quantity generator) or (b) (if I am a small quantity generator) is true.

Generator's/Offeror's Printed/Typed Name: Cesar Acevedo — Signature: [signature] — Month 5 Day 5 Year 10

INT'L

16. International Shipments ☐ Import to U.S. ☐ Export from U.S. Port of entry/exit:
Transporter signature (for exports only): Date leaving U.S.:

TRANSPORTER

17. Transporter Acknowledgment of Receipt of Materials
Transporter 1 Printed/Typed Name: Rosalio Padilla — Signature: [signature] — Month 5 Day 5 Year 10
Transporter 2 Printed/Typed Name — Signature — Month Day Year

DESIGNATED FACILITY

18. Discrepancy
18a. Discrepancy Indication Space ☐ Quantity ☐ Type ☐ Residue ☐ Partial Rejection ☐ Full Rejection
Manifest Reference Number:
18b. Alternate Facility (or Generator) — U.S. EPA ID Number
Facility's Phone:
18c. Signature of Alternate Facility (or Generator) — Month Day Year

19. Hazardous Waste Report Management Method Codes (i.e., codes for hazardous waste treatment, disposal, and recycling systems)
1. 2. 3. 4.

20. Designated Facility Owner or Operator: Certification of receipt of hazardous materials covered by the manifest except as noted in Item 18a
Printed/Typed Name: Ronald E Johns — Signature: [signature] — Month 05 Day 05 Year 10

EPA Form 8700-22 (Rev. 3-05) Previous editions are obsolete.

TRANSPORTER'S COPY

NO. 191049

CLEANHARBORS BUTTONWILLOW, LLC
WEIGHMASTER CERTIFICATE

THIS IS TO CERTIFY that the following described commodity was weighed, measured, or counted by a weighmaster whose signature is on this certificate, who is a recognized authority of accuracy, as prescribed in Chapter 7 (commencing with Section12700) of Division 5 of the California Business and Professions Code, administered by the Division of Measurement Standards of the California Department of Food and Agiculture.

2:12 PM 05/05/10
REG. (97)
INBOUND 83060 lb

2:31 PM 05/05/10
REG. (97)

83060 lb GROSS
33760 lb TARE
49300 lb NET

☑ END DUMP ☐ TRANSFER ☐ VACUUM ☐ VAN
☐ ROLL OFF - _____ ☐ FLAT BED ☐ _____

WEIGHMASTER CLEANHARBORS BUTTONWILLOW, LLC

PROFILE NO.	CH1420795 B	GROSS WT. BY: DEPUTY	DATE 05/05/10
DISPOSAL LOCATION	35-3 23-E-05	TARE WT. BY: DEPUTY	DATE 050510
DRIVER'S NAME PRINTED	Rosendo Partu	WEIGHING LOCATION:	2500 W. LOKERN ROAD BUTTONWILLOW, CA 93206
DRIVER'S NAME SIGNATURE		GENERATOR	City of SB
TRACTOR NO.	39	TRANSPORTER	LAP Express
TRACTOR LIC. NO.	UP 93612	MANIFEST NO.	004744171 JJK
TRAILER LIC. NO.	4JP1293	SERVICE ORDER NO.	7W 2873366
BIN NUMBERS:		BIN TRACKING	

VIS	pH	SUL	CYA	OX	FL	FLASH	20%	
4	8.24	–	–	–	–			

OTHER:

IC	CR	PR	B.W. W.B.	LAB	SOLID BULK	WORK SHEET	LAND TRACK	W.T. SCAN	MAN-SCAN	RE-SCAN

DRUM NUMBER:

COMMENTS:

BIN DROP FULL:

MOVE BIN TO: DATE: BY:

REVISED (3/10)

Please print or type. (Form designed for use on elite (12-pitch) typewriter.)

Form Approved. OMB No. 2050-0039

UNIFORM HAZARDOUS WASTE MANIFEST

1. Generator ID Number: CAC000305488
2. Page 1 of
3. Emergency Response Phone: (661) 746-1132
4. Manifest Tracking Number: 004744172 JJK

5. Generator's Name and Mailing Address: City Of Santa Barbara, PO BOX 1990, Santa Barbara, CA 93102
Generator's Phone: (805) 641-1000 x 23
Generator's Site Address (if different than mailing address): 125 State Street, Santa Barbara, CA 93101

6. Transporter 1 Company Name: S Lizarraga Trucking
U.S. EPA ID Number: CAK 000 200 667

7. Transporter 2 Company Name:
U.S. EPA ID Number:

8. Designated Facility Name and Site Address: Clean Harbors Buttonwillow, 2500 West Lokern Road, Buttonwillow, CA 93206
Facility's Phone: (661) 762-6200
U.S. EPA ID Number: CAD 980673276

9a. HM	9b. U.S. DOT Description (including Proper Shipping Name, Hazard Class, ID Number, and Packing Group (if any))	10. Containers No.	10. Containers Type	11. Total Quantity	12. Unit Wt./Vol.	13. Waste Codes		
	1. Non-Reg RCRA Hazardous Waste, Solid, N/A	001	DT	00016	Y	611		
	2.							
	3.							
	4.							

14. Special Handling Instructions and Additional Information
Profile #: CH430795E
Sales Order #: 7W2873366

15. **GENERATOR'S/OFFEROR'S CERTIFICATION:** I hereby declare that the contents of this consignment are fully and accurately described above by the proper shipping name, and are classified, packaged, marked and labeled/placarded, and are in all respects in proper condition for transport according to applicable international and national governmental regulations. If export shipment and I am the Primary Exporter, I certify that the contents of this consignment conform to the terms of the attached EPA Acknowledgment of Consent.
I certify that the waste minimization statement identified in 40 CFR 262.27(a) (if I am a large quantity generator) or (b) (if I am a small quantity generator) is true.

Generator's/Offeror's Printed/Typed Name: Carmen Aguilera
Signature:
Month 5 Day 5 Year 10

16. International Shipments ☐ Import to U.S. ☐ Export from U.S. Port of entry/exit:
Transporter signature (for exports only): Date leaving U.S.:

17. Transporter Acknowledgment of Receipt of Materials
Transporter 1 Printed/Typed Name: Alfredo Lizarraga
Signature:
Month 5 Day 5 Year 10
Transporter 2 Printed/Typed Name:
Signature:
Month Day Year

18. Discrepancy
18a. Discrepancy Indication Space ☐ Quantity ☐ Type ☐ Residue ☐ Partial Rejection ☐ Full Rejection
18b. Alternate Facility (or Generator) Manifest Reference Number:
U.S. EPA ID Number
Facility's Phone:
18c. Signature of Alternate Facility (or Generator)
Month Day Year

19. Hazardous Waste Report Management Method Codes (i.e., codes for hazardous waste treatment, disposal, and recycling systems)
1. H132 2. 3. 4.

20. Designated Facility Owner or Operator: Certification of receipt of hazardous materials covered by the manifest except as noted in Item 18a
Printed/Typed Name: Ronald F. Johns
Signature:
Month Day Year

GENERATOR | INT'L | TRANSPORTER | DESIGNATED FACILITY

EPA Form 8700-22 (Rev. 3-05) Previous editions are obsolete.

TRANSPORTER'S COPY

NO. 191050

CLEANHARBORS BUTTONWILLOW, LLC
WEIGHMASTER CERTIFICATE

THIS IS TO CERTIFY that the following described commodity was weighed, measured, or counted by a weighmaster whose signature is on this certificate, who is a recognized authority of accuracy, as prescribed in Chapter 7 (commencing with Section12700) of Division 5 of the California Business and Professions Code, administered by the Division of Measurement Standards of the California Department of Food and Agiculture.

2:16 PM 05/05/10
REG. (3)
INBOUND 83440 lb

2:41 PM 05/05/10
REG. (3)

83440 lb GROSS
33020 lb TARE
50420 lb NET

WEIGHMASTER CLEANHARBORS BUTTONWILLOW, LLC

PROFILE NO. CH420795 B	GROSS WT. BY:	DEPUTY	DATE 5/5/10
DISPOSAL LOCATION 35-3 23-E-05	TARE WT. BY:	DEPUTY	DATE 050510
DRIVER'S NAME PRINTED ALFREDO LIMON	WEIGHING LOCATION:	2500 W. LOKERN ROAD BUTTONWILLOW, CA 93206	
DRIVER'S NAME SIGNATURE	GENERATOR City SB		
TRACTOR NO. 58	TRANSPORTER S. Limon		
TRACTOR LIC. NO. 9E05998	MANIFEST NO. 004744172 JJK		
TRAILER LIC. NO. 4AP3194	SERVICE ORDER NO. 7W2873366		
BIN NUMBERS:	BIN TRACKING		

☒ END DUMP ☐ TRANSFER ☐ VACUUM ☐ VAN

☐ ROLL OFF - _____ ☐ FLAT BED ☐ _____

VIS	pH	SUL	CYA	OX	FL	FLASH	20%	
+	8.15	-	-	-	-			

OTHER:

IC	CR	PR	B.W. W.B.	LAB	SOLID BULK	WORK SHEET	LAND TRACK	W.T. SCAN	MAN-SCAN	RE-SCAN

DRUM NUMBER:

COMMENTS:

BIN DROP FULL:

MOVE BIN TO: DATE: BY:

REVISED (3/10)

Please print or type. (Form designed for use on elite (12-pitch) typewriter.) Form Approved. OMB No. 2050-0039

UNIFORM HAZARDOUS WASTE MANIFEST

1. Generator ID Number: A C 0 0 2 6 5 0 4 8 8
2. Page 1 of
3. Emergency Response Phone: (661) 746-1132
4. Manifest Tracking Number: 004744173 JJK

GENERATOR

5. Generator's Name and Mailing Address: City Of Santa Barbara, PO BOX 1990, Santa Barbara, CA 93102
Generator's Phone: (805) 641-1000 x 23
Generator's Site Address (if different than mailing address): 125 State Street, Santa Barbara, CA 93101

6. Transporter 1 Company Name: Pacheco transport
U.S. EPA ID Number: CAD000151902

7. Transporter 2 Company Name:
U.S. EPA ID Number:

8. Designated Facility Name and Site Address: Clean Harbors Buttonwillow, 2390 West Lokern Road, Buttonwillow, CA 93206
Facility's Phone: (661) 762-6200
U.S. EPA ID Number: CAD980675276

9a. HM	9b. U.S. DOT Description (including Proper Shipping Name, Hazard Class, ID Number, and Packing Group (if any))	10. Containers No.	10. Containers Type	11. Total Quantity	12. Unit Wt./Vol.	13. Waste Codes
	1. Non, Non-RCRA Hazardous Waste, Solid, N/A	001	DT	00018	Y	611
	2.					
	3.					
	4.					

14. Special Handling Instructions and Additional Information
Profile # CH420795B
Sales Order # 7W2873368

15. **GENERATOR'S/OFFEROR'S CERTIFICATION:** I hereby declare that the contents of this consignment are fully and accurately described above by the proper shipping name, and are classified, packaged, marked and labeled/placarded, and are in all respects in proper condition for transport according to applicable international and national governmental regulations. If export shipment and I am the Primary Exporter, I certify that the contents of this consignment conform to the terms of the attached EPA Acknowledgment of Consent.
I certify that the waste minimization statement identified in 40 CFR 262.27(a) (if I am a large quantity generator) or (b) (if I am a small quantity generator) is true.

Generator's/Offeror's Printed/Typed Name: Cesar Aguirio
Signature: Cesar Aguirio
Month 5 Day 5 Year 10

INT'L

16. International Shipments ☐ Import to U.S. ☐ Export from U.S. Port of entry/exit:
Transporter signature (for exports only): Date leaving U.S.:

TRANSPORTER

17. Transporter Acknowledgment of Receipt of Materials
Transporter 1 Printed/Typed Name: Ricardo Quintanilla
Signature:
Month 5 Day 5 Year 10
Transporter 2 Printed/Typed Name:
Signature:
Month Day Year

DESIGNATED FACILITY

18. Discrepancy
18a. Discrepancy Indication Space ☐ Quantity ☐ Type ☐ Residue ☐ Partial Rejection ☐ Full Rejection
Manifest Reference Number:
18b. Alternate Facility (or Generator)
U.S. EPA ID Number
Facility's Phone:
18c. Signature of Alternate Facility (or Generator)
Month Day Year

19. Hazardous Waste Report Management Method Codes (i.e., codes for hazardous waste treatment, disposal, and recycling systems)
1. 11132 2. 3. 4.

20. Designated Facility Owner or Operator: Certification of receipt of hazardous materials covered by the manifest except as noted in Item 18a
Printed/Typed Name: Teresa M Johns
Signature: Teresa M Johns
Month 05 Day 05 Year 10

EPA Form 8700-22 (Rev. 3-05) Previous editions are obsolete.

TRANSPORTER'S COPY

NO. 191052

CLEANHARBORS BUTTONWILLOW, LLC
WEIGHMASTER CERTIFICATE

2:40 PM 05/05/10
REG. (17)
INBOUND 86120 lb

THIS IS TO CERTIFY that the following described commodity was weighed, measured, or counted by a weighmaster whose signature is on this certificate, who is a recognized authority of accuracy, as prescribed in Chapter 7 (commencing with Section12700) of Division 5 of the California Business and Professions Code, administered by the Division of Measurement Standards of the California Department of Food and Agiculture.

WEIGHMASTER CLEANHARBORS BUTTONWILLOW, LLC

PROFILE NO. CH420795B	GROSS WT. BY:	DEPUTY	DATE 5/5/10
DISPOSAL LOCATION 35-3 23-E-05	TARE WT. BY:	DEPUTY	DATE 050510
DRIVER'S NAME PRINTED Ricardo Quintanilla	WEIGHING LOCATION:	2500 W. LOKERN ROAD BUTTONWILLOW, CA 93206	
DRIVER'S NAME SIGNATURE	GENERATOR	City of SB	
TRACTOR NO. 9193	TRANSPORTER	Pacheco	
TRACTOR LIC. NO. VP07911	MANIFEST NO.	004744173JJK	
TRAILER LIC. NO. 528-1FR	SERVICE ORDER NO.	762873360	
BIN NUMBERS:	BIN TRACKING		

3:00 PM 05/05/10
REG. (17)

86120 lb GROSS
31260 lb TARE
54860 lb NET

☑ END DUMP ☐ TRANSFER ☐ VACUUM ☐ VAN
☐ ROLL OFF - _____ ☐ FLAT BED ☐ _____

VIS	pH	SUL	CYA	OX	FL	FLASH	20%	

OTHER:

IC	CR	PR	B.W. W.B.	LAB	SOLID BULK	WORK SHEET	LAND TRACK	W.T. SCAN	MAN-SCAN	RE-SCAN

DRUM NUMBER:

COMMENTS:

BIN DROP FULL:

MOVE BIN TO: DATE: BY:

REVISED (3/10)

Please print or type. (Form designed for use on elite (12-pitch) typewriter.)

Form Approved. OMB No. 2050-0039

UNIFORM HAZARDOUS WASTE MANIFEST

1. Generator ID Number: CAC002650488
2. Page 1 of
3. Emergency Response Phone: (661) 746-1132
4. Manifest Tracking Number: 004744174 JJK

5. Generator's Name and Mailing Address: City Of Santa Barbara, PO BOX 1990, Santa Barbara, CA 93102
Generator's Phone: (805) 641-1005 x 23
Generator's Site Address (if different than mailing address): 123 State Street, Santa Barbara, CA 93101

6. Transporter 1 Company Name: H. Rodriguez Transportation
U.S. EPA ID Number: CAR000173518

7. Transporter 2 Company Name:
U.S. EPA ID Number:

8. Designated Facility Name and Site Address: Clean Harbors Buttonwillow, 2300 West Lokern Road, Buttonwillow, CA 93206
Facility's Phone: (661) 762-6200
U.S. EPA ID Number: CAD980673276

9a. HM	9b. U.S. DOT Description (including Proper Shipping Name, Hazard Class, ID Number, and Packing Group (if any))	10. Containers No.	10. Containers Type	11. Total Quantity	12. Unit Wt./Vol.	13. Waste Codes
	1. Non, Non-RCRA Hazardous Waste, Solid, N/A	001	DT	00018	Y	011
	2.					
	3.					
	4.					

14. Special Handling Instructions and Additional Information
Profile #: CH4207558
Sales Order #: 1145673565
Delivered TAB 12-8-09

15. **GENERATOR'S/OFFEROR'S CERTIFICATION:** I hereby declare that the contents of this consignment are fully and accurately described above by the proper shipping name, and are classified, packaged, marked and labeled/placarded, and are in all respects in proper condition for transport according to applicable international and national governmental regulations. If export shipment and I am the Primary Exporter, I certify that the contents of this consignment conform to the terms of the attached EPA Acknowledgment of Consent.
I certify that the waste minimization statement identified in 40 CFR 262.27(a) (if I am a large quantity generator) or (b) (if I am a small quantity generator) is true.

Generator's/Offeror's Printed/Typed Name: Jesse Mancio
Signature:
Month 5 Day 5 Year 10

16. International Shipments ☐ Import to U.S. ☐ Export from U.S. Port of entry/exit:
Transporter signature (for exports only): Date leaving U.S.:

17. Transporter Acknowledgment of Receipt of Materials
Transporter 1 Printed/Typed Name: Armando Rodriguez
Signature:
Month 5 Day 5 Year 10
Transporter 2 Printed/Typed Name: Arco's
Signature:
Month Day Year

18. Discrepancy
18a. Discrepancy Indication Space ☐ Quantity ☐ Type ☐ Residue ☐ Partial Rejection ☐ Full Rejection
Manifest Reference Number:
18b. Alternate Facility (or Generator)
U.S. EPA ID Number
Facility's Phone:
18c. Signature of Alternate Facility (or Generator)
Month Day Year

19. Hazardous Waste Report Management Method Codes (i.e., codes for hazardous waste treatment, disposal, and recycling systems)
1. H132 2. 3. 4.

20. Designated Facility Owner or Operator: Certification of receipt of hazardous materials covered by the manifest except as noted in Item 18a
Printed/Typed Name:
Signature:
Month 05 Day 05 Year 10

GENERATOR | INT'L | TRANSPORTER | DESIGNATED FACILITY

EPA Form 8700-22 (Rev. 3-05) Previous editions are obsolete.

TRANSPORTER'S COPY

NO. 191048

CLEANHARBORS BUTTONWILLOW, LLC
WEIGHMASTER CERTIFICATE

2:08 PM 05/05/10
REG. (91)
INBOUND 78700 lb

THIS IS TO CERTIFY that the following described commodity was weighed, measured, or counted by a weighmaster whose signature is on this certificate, who is a recognized authority of accuracy, as prescribed in Chapter 7 (commencing with Section12700) of Division 5 of the California Business and Professions Code, administered by the Division of Measurement Standards of the California Department of Food and Agiculture.

WEIGHMASTER CLEANHARBORS BUTTONWILLOW, LLC

2:28 PM 05/05/10
REG. (91)

78700 lb GROSS
28780 lb TARE
49920 lb NET

PROFILE NO. CH420795B	GROSS WT. BY:	DEPUTY	DATE 5/5/10
DISPOSAL LOCATION 35-3 23-8-05	TARE WT. BY:	DEPUTY	DATE 5/5/10
DRIVER'S NAME PRINTED Armando Rodriguez	WEIGHING LOCATION:	2500 W. LOKERN ROAD BUTTONWILLOW, CA 93206	
DRIVER'S NAME SIGNATURE	GENERATOR	City of SB	
TRACTOR NO. 007	TRANSPORTER	A ROD	
TRACTOR LIC. NO. 9B86963	MANIFEST NO.	004744174 JJK	
TRAILER LIC. NO. 1AV6204	SERVICE ORDER NO.	7W2873366	
BIN NUMBERS: E1	BIN TRACKING		

☒ END DUMP ☐ TRANSFER ☐ VACUUM ☐ VAN
☐ ROLL OFF - _____ ☐ FLAT BED ☐ _____

VIS	PH	SUL	CYA	OX	FL	FLASH	20%	
1	8	—	—	✓	✓			

OTHER:

IC	CR	PR	B.W. W.B.	LAB	SOLID BULK	WORK SHEET	LAND TRACK	W.T. SCAN	MAN. SCAN	RE. SCAN

DRUM NUMBER:
COMMENTS:
BIN DROP FULL:
MOVE BIN TO: DATE: BY:

REVISED (3/10)

Please print or type. (Form designed for use on elite (12-pitch) typewriter.)

Form Approved. OMB No. 2050-0039

UNIFORM HAZARDOUS WASTE MANIFEST

1. Generator ID Number: CAC082650488
2. Page 1 of
3. Emergency Response Phone: (661) 746-1132
4. Manifest Tracking Number: 004744175 JJK

5. Generator's Name and Mailing Address: City Of Santa Barbara, PO BOX 1990, Santa Barbara, CA 93102
Generator's Phone: (805) 641-1000 x 23
Generator's Site Address (if different than mailing address): 123 State Street, Santa Barbara, CA 93101

6. Transporter 1 Company Name: Corona Trucking
U.S. EPA ID Number: CAR000201871

7. Transporter 2 Company Name:
U.S. EPA ID Number:

8. Designated Facility Name and Site Address: Clean Harbors Buttonwillow, 2300 West Lokern Road, Buttonwillow, CA 93206
Facility's Phone: (661) 762-6200
U.S. EPA ID Number: CAD982073276

9a. HM	9b. U.S. DOT Description (including Proper Shipping Name, Hazard Class, ID Number, and Packing Group (if any))	10. Containers No.	10. Containers Type	11. Total Quantity	12. Unit Wt./Vol.	13. Waste Codes		
	1. Non-Non-RCRA Hazardous Waste, Solid, N/A	001	DT	00018	Y	611		
	2.							
	3.							
	4.							

14. Special Handling Instructions and Additional Information
Profile #: CH420795D
Sales Order #: 7W2873365

15. **GENERATOR'S/OFFEROR'S CERTIFICATION:** I hereby declare that the contents of this consignment are fully and accurately described above by the proper shipping name, and are classified, packaged, marked and labeled/placarded, and are in all respects in proper condition for transport according to applicable international and national governmental regulations. If export shipment and I am the Primary Exporter, I certify that the contents of this consignment conform to the terms of the attached EPA Acknowledgment of Consent.
I certify that the waste minimization statement identified in 40 CFR 262.27(a) (if I am a large quantity generator) or (b) (if I am a small quantity generator) is true.

Generator's/Offeror's Printed/Typed Name: Ceran Aparicio
Signature: Ceran Aparicio
Month 5 Day 5 Year 10

16. International Shipments ☐ Import to U.S. ☐ Export from U.S. Port of entry/exit:
Transporter signature (for exports only): Date leaving U.S.:

17. Transporter Acknowledgment of Receipt of Materials
Transporter 1 Printed/Typed Name: Victor Hugo Corona
Signature: Victor C.
Month 5 Day 5 Year 10
Transporter 2 Printed/Typed Name:
Signature:
Month Day Year

18. Discrepancy
18a. Discrepancy Indication Space ☐ Quantity ☐ Type ☐ Residue ☐ Partial Rejection ☐ Full Rejection
Manifest Reference Number:
18b. Alternate Facility (or Generator)
U.S. EPA ID Number:
Facility's Phone:
18c. Signature of Alternate Facility (or Generator)
Month Day Year

19. Hazardous Waste Report Management Method Codes (i.e., codes for hazardous waste treatment, disposal, and recycling systems)
1. H132 2. 3. 4.

20. Designated Facility Owner or Operator: Certification of receipt of hazardous materials covered by the manifest except as noted in Item 18a
Printed/Typed Name:
Signature:
Month 05 Day 05 Year 10

GENERATOR — INT'L — TRANSPORTER — DESIGNATED FACILITY

EPA Form 8700-22 (Rev. 3-05) Previous editions are obsolete.

TRANSPORTER'S COPY

NO. 191047

2:05 PM 05/05/10
REG. (90)
INBOUND 83000 lb

CLEANHARBORS BUTTONWILLOW, LLC
WEIGHMASTER CERTIFICATE

THIS IS TO CERTIFY that the following described commodity was weighed, measured, or counted by a weighmaster whose [illegible] is on this certificate, who is a recognized authority of accuracy, as prescribed in Chapter 7 (commencing with Section 12700) of [illegible] of the California Business and Professions Code, administered by the Division of Measurement Standards of the California Department of Food and Agiculture.

2:22 PM 05/05/10
REG. (90)

83000 lb GROSS
34760 lb TARE
48240 lb NET

WEIGHMASTER CLEANHARBORS BUTTONWILLOW, LLC

PROFILE NO.	CH 420795 B	GROSS WT. BY: DEPUTY	DATE 05/05/10
DISPOSAL LOCATION	33 3 23 E 05	TARE WT. BY: DEPUTY	DATE 05/05/10
DRIVER'S NAME PRINTED	Victor Hugo Corona	WEIGHING LOCATION	2500 W. LOKERN ROAD BUTTONWILLOW, CA 93206
DRIVER'S NAME SIGNATURE	[illegible]	GENERATOR	City of SB
TRACTOR NO.	005	TRANSPORTER	Corona
TRACTOR LIC. NO.	9E25790	MANIFEST NO.	004744175JJK
TRAILER LIC. NO.	4H4282 7	SERVICE ORDER NO.	7W2873366
BIN NUMBERS:		BIN TRACKING	

☒ END DUMP ☐ TRANSFER ☐ VACUUM ☐ VAN
☐ ROLL OFF - _____ ☐ FLAT BED ☐ _____

VIS	pH	SUL	CYA	OX	FL	FLASH	20%	
+	8.23	—	—	~	~			

OTHER:

IC	CR	PR	B.W. W.B.	LAB	SOLID BULK	WORK SHEET	LAND TRACK	W.T. SCAN	MAN SCAN	RE SCAN

DRUM NUMBER:

COMMENTS:

BIN DROP FULL:

MOVE BIN TO: DATE: BY:

REVISED (3/10)

Please print or type. (Form designed for use on elite (12-pitch) typewriter.)

Form Approved. OMB No. 2050-0039

UNIFORM HAZARDOUS WASTE MANIFEST

1. Generator ID Number: CAC000265048 8
2. Page 1 of
3. Emergency Response Phone: (800) 46-1132
4. Manifest Tracking Number: 004744176 JJK

5. Generator's Name and Mailing Address: City Of Santa Barbara, PO BOX 1990, Santa Barbara, CA 93102
Generator's Site Address (if different than mailing address): 123 State Street, Santa Barbara, CA 93101
Generator's Phone: (805) 641-1000 x23

6. Transporter 1 Company Name: EAVIS TRUCKING
U.S. EPA ID Number: CCR000199570

7. Transporter 2 Company Name:
U.S. EPA ID Number:

8. Designated Facility Name and Site Address: Clean Harbors Buttonwillow, 2500 West Lokern Road, Buttonwillow, CA 93206
U.S. EPA ID Number: CAD980675276
Facility's Phone: (661) 762-6200

9a. HM	9b. U.S. DOT Description (including Proper Shipping Name, Hazard Class, ID Number, and Packing Group (if any))	10. Containers No.	10. Containers Type	11. Total Quantity	12. Unit Wt./Vol.	13. Waste Codes		
	1. None, Non-RCRA Hazardous Waste, Solid, N/A	001	DT	00018	Y	611		
	2.							
	3.							
	4.							

14. Special Handling Instructions and Additional Information
Profile #: CH420795B
Sales Order #: TW2873366

15. **GENERATOR'S/OFFEROR'S CERTIFICATION:** I hereby declare that the contents of this consignment are fully and accurately described above by the proper shipping name, and are classified, packaged, marked and labeled/placarded, and are in all respects in proper condition for transport according to applicable international and national governmental regulations. If export shipment and I am the Primary Exporter, I certify that the contents of this consignment conform to the terms of the attached EPA Acknowledgment of Consent.
I certify that the waste minimization statement identified in 40 CFR 262.27(a) (if I am a large quantity generator) or (b) (if I am a small quantity generator) is true. 2503

Generator's/Offeror's Printed/Typed Name: Carmen Aguirre
Signature: Carmen Aguirre
Month 5 Day 5 Year 10

16. International Shipments ☐ Import to U.S. ☐ Export from U.S. Port of entry/exit:
Transporter signature (for exports only): Date leaving U.S.:

17. Transporter Acknowledgment of Receipt of Materials
Transporter 1 Printed/Typed Name: EDGARDO U PINEDA
Signature:
Month 5 Day 5 Year 10
Transporter 2 Printed/Typed Name:
Signature:
Month Day Year

18. Discrepancy
18a. Discrepancy Indication Space ☐ Quantity ☐ Type ☐ Residue ☐ Partial Rejection ☐ Full Rejection
Manifest Reference Number:

18b. Alternate Facility (or Generator)
U.S. EPA ID Number
Facility's Phone:

18c. Signature of Alternate Facility (or Generator)
Month Day Year

19. Hazardous Waste Report Management Method Codes (i.e., codes for hazardous waste treatment, disposal, and recycling systems)
1. H132 2. 3. 4.

20. Designated Facility Owner or Operator: Certification of receipt of hazardous materials covered by the manifest except as noted in Item 18a
Printed/Typed Name: Ronald F Johns
Signature:
Month 05 Day 05 Year 10

GENERATOR | TRANSPORTER | INT'L | DESIGNATED FACILITY

EPA Form 8700-22 (Rev. 3-05) Previous editions are obsolete.

TRANSPORTER'S COPY

NO. 191041

CLEANHARBORS BUTTONWILLOW, LLC
WEIGHMASTER CERTIFICATE

THIS IS TO CERTIFY that the following described commodity was weighed, measured, or counted by a weighmaster whose signature is on this certificate, who is a recognized authority of accuracy, as prescribed in Chapter 7 (commencing with Section12700) of Division 5 of the California Business and Professions Code, administered by the Division of Measurement Standards of the California Department of Food and Agiculture.

1:36 PM 05/05/10
REG. (71)
INBOUND 80800 lb

2:01 PM 05/05/10
REG. (71)
80800 lb GROSS
30740 lb TARE
50060 lb NET

WEIGHMASTER CLEANHARBORS BUTTONWILLOW, LLC

PROFILE NO. CH420795B	GROSS WT. BY	DEPUTY	DATE 5/5/10
DISPOSAL LOCATION 35.3 23-E-05	TARE WT. BY	DEPUTY	DATE 050510
DRIVER'S NAME PRINTED EDGARDO PINEDA	WEIGHING LOCATION:	2500 W. LOKERN ROAD BUTTONWILLOW, CA 93206	
DRIVER'S NAME SIGNATURE	GENERATOR	City of SB.	
TRACTOR NO. #001	TRANSPORTER	EDDY'S	
TRACTOR LIC. NO. 9D90608	MANIFEST NO.	004744176JJK	
TRAILER LIC. NO. 4H1M438	SERVICE ORDER NO.	7W287 3366	
BIN NUMBERS:	BIN TRACKING		

☑ END DUMP ☐ TRANSFER ☐ VACUUM ☐ VAN
☐ ROLL OFF - _____ ☐ FLAT BED ☐ _____

VIS	pH	SUL	CYA	OX	FL	FLASH	20%	
✓	8.12	–	–	2	✓			

OTHER:

IC	CR	PR	B.W. W.B.	LAB	SOLID BULK	WORK SHEET	LAND TRACK	W.T. SCAN	MAN-SCAN	RE-SCAN

DRUM NUMBER:

COMMENTS:

BIN DROP FULL:

MOVE BIN TO: DATE: BY:

REVISED (3/10)

Please print or type. (Form designed for use on elite (12-pitch) typewriter.)

Form Approved. OMB No. 2050-0039

UNIFORM HAZARDOUS WASTE MANIFEST

1. Generator ID Number: CAC000265048 8
2. Page 1 of
3. Emergency Response Phone: (661) 746-1132
4. Manifest Tracking Number: 004744177 JJK

5. Generator's Name and Mailing Address: City Of Santa Barbara, PO BOX 1990, Santa Barbara, CA 93102
Generator's Phone: (805) 641-1000 x 23
Generator's Site Address (if different than mailing address): 125 State Street, Santa Barbara, CA 93101

6. Transporter 1 Company Name: PAM TRUCKING
U.S. EPA ID Number: CAR 000196642

7. Transporter 2 Company Name:
U.S. EPA ID Number:

8. Designated Facility Name and Site Address: Clean Harbors Buttonwillow, 2300 West Lokern Road, Buttonwillow, CA 93206
Facility's Phone: (661) 762-6200
U.S. EPA ID Number: CAD 9 8 0 6 7 3 2 7 6

9a. HM	9b. U.S. DOT Description (including Proper Shipping Name, Hazard Class, ID Number, and Packing Group (if any))	10. Containers No.	10. Containers Type	11. Total Quantity	12. Unit Wt./Vol.	13. Waste Codes		
	1. Non-Haz, Non-RCRA Hazardous Waste, Solid, N/A	001	DT	00016	Y	611		
	2.							
	3.							
	4.							

14. Special Handling Instructions and Additional information
Profile #: CH420795B
Sales Order #: 7W2873366

15. **GENERATOR'S/OFFEROR'S CERTIFICATION:** I hereby declare that the contents of this consignment are fully and accurately described above by the proper shipping name, and are classified, packaged, marked and labeled/placarded, and are in all respects in proper condition for transport according to applicable international and national governmental regulations. If export shipment and I am the Primary Exporter, I certify that the contents of this consignment conform to the terms of the attached EPA Acknowledgment of Consent.
I certify that the waste minimization statement identified in 40 CFR 262.27(a) (if I am a large quantity generator) or (b) (if I am a small quantity generator) is true.

Generator's/Offeror's Printed/Typed Name: Cesar Acevedo
Signature: Cesar Acevedo
Month 5 Day 5 Year 10

GENERATOR

INT'L

16. International Shipments ☐ Import to U.S. ☐ Export from U.S. Port of entry/exit:
Transporter signature (for exports only): Date leaving U.S.:

TRANSPORTER

17. Transporter Acknowledgment of Receipt of Materials
Transporter 1 Printed/Typed Name: Pedro M. Soto
Signature: Pedro M Soto
Month 5 Day 5 Year 10
Transporter 2 Printed/Typed Name:
Signature:
Month Day Year

DESIGNATED FACILITY

18. Discrepancy
18a. Discrepancy Indication Space ☐ Quantity ☐ Type ☐ Residue ☐ Partial Rejection ☐ Full Rejection
Manifest Reference Number:
18b. Alternate Facility (or Generator)
U.S. EPA ID Number
Facility's Phone:
18c. Signature of Alternate Facility (or Generator)
Month Day Year

19. Hazardous Waste Report Management Method Codes (i.e., codes for hazardous waste treatment, disposal, and recycling systems)
1. H132 2. 3. 4.

20. Designated Facility Owner or Operator: Certification of receipt of hazardous materials covered by the manifest except as noted in Item 18a
Printed/Typed Name: Ronald E Johns
Signature: Ronald E Johns
Month 05 Day 05 Year 10

EPA Form 8700-22 (Rev. 3-05) Previous editions are obsolete.

TRANSPORTER'S COPY

NO. 191043

CLEANHARBORS BUTTONWILLOW, LLC
WEIGHMASTER CERTIFICATE

THIS IS TO CERTIFY that the following described commodity was weighed, measured, or counted by a weighmaster whose signature is on this certificate, who is a recognized authority of accuracy, as prescribed in Chapter 7 (commencing with Section12700) of Division 5 of the California Business and Professions Code, administered by the Division of Measurement Standards of the California Department of Food and Agiculture.

1:50 PM 05/05/10
REG. (76)
INBOUND 78380 lb

2:16 PM 05/05/10
REG. (76)
78380 lb GROSS
31880 lb TARE
46500 lb NET

WEIGHMASTER CLEANHARBORS BUTTONWILLOW, LLC

PROFILE NO.	CH420795 B	GROSS WT. BY: DEPUTY	DATE 5/5/10
DISPOSAL LOCATION	353-23-E-05	TARE WT. BY: DEPUTY	DATE 050510
DRIVER'S NAME PRINTED	Pedro A. Solelo	WEIGHING LOCATION:	2500 W. LOKERN ROAD BUTTONWILLOW, CA 93206
DRIVER'S NAME SIGNATURE	Pedro A Solelo	GENERATOR	City of SB
TRACTOR NO.	1	TRANSPORTER	PAM
TRACTOR LIC. NO.	EIPTRO	MANIFEST NO.	004744177 JJK
TRAILER LIC. NO.	4JK1299	SERVICE ORDER NO.	7W2873366
BIN NUMBERS:		BIN TRACKING	

☒ END DUMP ☐ TRANSFER ☐ VACUUM ☐ VAN
☐ ROLL OFF - _____ ☐ FLAT BED ☐ _____

VIS	pH	SUL	CYA	OX	FL	FLASH	20%	
+	8.42	–	–	✓	–			
OTHER:								

IC	CR	PR	B.W. W.B.	LAB	SOLID BULK	WORK SHEET	LAND TRACK	W.T. SCAN	MAN-SCAN	RE-SCAN
	✓									

DRUM NUMBER:

COMMENTS:

BIN DROP FULL:

MOVE BIN TO: DATE: BY:

REVISED (3/10)

Please print or type. (Form designed for use on elite (12-pitch) typewriter.)

Form Approved. OMB No. 2050-0039

UNIFORM HAZARDOUS WASTE MANIFEST

1. Generator ID Number: CAC002050488
2. Page 1 of
3. Emergency Response Phone: (661) 746-1132
4. Manifest Tracking Number: 004744178 JJK

5. Generator's Name and Mailing Address: City Of Santa Barbara, PO BOX 1990, Santa Barbara, CA 93102
Generator's Site Address (if different than mailing address): 125 State Street, Santa Barbara, CA 93101
Generator's Phone: (805) 641-1000 x 22

6. Transporter 1 Company Name: Rosas Trucking
U.S. EPA ID Number: CAR000175844

7. Transporter 2 Company Name:
U.S. EPA ID Number:

8. Designated Facility Name and Site Address: Clean Harbors Buttonwillow, 2300 West Lokern Road, Buttonwillow, CA 93206
U.S. EPA ID Number: CAD982067527 6
Facility's Phone: (661) 762-6200

9a. HM	9b. U.S. DOT Description (including Proper Shipping Name, Hazard Class, ID Number, and Packing Group (if any))	10. Containers No.	10. Containers Type	11. Total Quantity	12. Unit Wt./Vol.	13. Waste Codes
	1. Hom, Non-RCRA Hazardous Waste, Solid, N/A	001	DT	00018	Y	611
	2.					
	3.					
	4.					

14. Special Handling Instructions and Additional Information
Profile #: CH420795B
Sales Order #: TW2073366
P4 9061811

15. **GENERATOR'S/OFFEROR'S CERTIFICATION:** I hereby declare that the contents of this consignment are fully and accurately described above by the proper shipping name, and are classified, packaged, marked and labeled/placarded, and are in all respects in proper condition for transport according to applicable international and national governmental regulations. If export shipment and I am the Primary Exporter, I certify that the contents of this consignment conform to the terms of the attached EPA Acknowledgment of Consent.
I certify that the waste minimization statement identified in 40 CFR 262.27(a) (if I am a large quantity generator) or (b) (if I am a small quantity generator) is true.

Generator's/Offeror's Printed/Typed Name: Cemen Acevedo
Signature: Cemen Acevedo
Month 5 Day 5 Year 10

16. International Shipments ☐ Import to U.S. ☐ Export from U.S. Port of entry/exit:
Transporter signature (for exports only): Date leaving U.S.:

17. Transporter Acknowledgment of Receipt of Materials
Transporter 1 Printed/Typed Name: Miguel Reynoso
Signature: Miguel Reynoso
Month 5 Day 5 Year 10
Transporter 2 Printed/Typed Name:
Signature:
Month Day Year

18. Discrepancy
18a. Discrepancy Indication Space ☐ Quantity ☐ Type ☐ Residue ☐ Partial Rejection ☐ Full Rejection
Manifest Reference Number:

18b. Alternate Facility (or Generator)
U.S. EPA ID Number
Facility's Phone:

18c. Signature of Alternate Facility (or Generator)
Month Day Year

19. Hazardous Waste Report Management Method Codes (i.e., codes for hazardous waste treatment, disposal, and recycling systems)
1. 2. 3. 4.

20. Designated Facility Owner or Operator: Certification of receipt of hazardous materials covered by the manifest except as noted in Item 18a
Printed/Typed Name: Ronald E Johns
Signature: R E Johns
Month 05 Day 05 Year 10

GENERATOR | TRANSPORTER | INT'L | DESIGNATED FACILITY

EPA Form 8700-22 (Rev. 3-05) Previous editions are obsolete.

TRANSPORTER'S COPY

NO. 191036

CLEANHARBORS BUTTONWILLOW, LLC
WEIGHMASTER CERTIFICATE

1:16 PM 05/05/10
REG. (57)
INBOUND 79500 lb

THIS IS TO CERTIFY that the following described commodity was weighed, measured, or counted by a weighmaster whose signature is on this certificate, who is a recognized authority of accuracy, as prescribed in Chapter 7 (commencing with Section12700) of Division 5 of the California Business and Professions Code, administered by the Division of Measurement Standards of the California Department of Food and Agiculture.

WEIGHMASTER CLEANHARBORS BUTTONWILLOW, LLC

1:49 PM 05/05/10
REG. (57)

79500 lb GROSS
30480 lb TARE
49020 lb NET

PROFILE NO. CH420795 B	GROSS WT. BY	DEPUTY	DATE 5/5/10
DISPOSAL LOCATION 35.3 23-8 05	TARE WT. BY	DEPUTY	DATE 050510
DRIVER'S NAME PRINTED Miguel Reyno	WEIGHING LOCATION:	2500 W. LOKERN ROAD BUTTONWILLOW, CA 93206	
DRIVER'S NAME SIGNATURE Miguel Reyno	GENERATOR	City of SB	
TRACTOR NO. P4	TRANSPORTER	ROSAS	
TRACTOR LIC. NO. 9061811	MANIFEST NO.	004744178JJK	
TRAILER LIC. NO. 4DH8728	SERVICE ORDER NO.	7W2873366	
BIN NUMBERS:	BIN TRACKING		

☒ END DUMP ☐ TRANSFER ☐ VACUUM ☐ VAN
☐ ROLL OFF - _____ ☐ FLAT BED ☐ _____

VIS	pH	SUL	CYA	OX	FL	FLASH	20%	
1	8.31	-	-	-	-			
OTHER:								

IC	CR	PR	B.W. W.B.	LAB	SOLID BULK	WORK SHEET	LAND TRACK	W.T. SCAN	MAN-SCAN	RE-SCAN
								15 h		

DRUM NUMBER:

COMMENTS:

BIN DROP FULL:

MOVE BIN TO: DATE: BY:

REVISED (3/10)

IVCR TT40 L.I. 110516

Please print or type. (Form designed for use on elite (12-pitch) typewriter.)

Form Approved. OMB No. 2050-0039

UNIFORM HAZARDOUS WASTE MANIFEST

1. Generator ID Number: CAC 0 0 2 6 5 0 4 8 8
2. Page 1 of
3. Emergency Response Phone: (661) 746-1132
4. Manifest Tracking Number: **004744179 JJK**

5. Generator's Name and Mailing Address: City Of Santa Barbara, PO BOX 1990, Santa Barbara, CA 93102
Generator's Phone: (805) 641-1000 x23
Generator's Site Address (if different than mailing address): 123 State Street, Santa Barbara, CA 93101

6. Transporter 1 Company Name: Remedial Transportation Services
U.S. EPA ID Number: CAR 000181560

7. Transporter 2 Company Name:
U.S. EPA ID Number:

8. Designated Facility Name and Site Address: Clean Harbors Buttonwillow, 2300 West Lokern Road, Buttonwillow, CA 93206
Facility's Phone: (661) 762-6200
U.S. EPA ID Number: CAD 9 8 0 6 7 5 2 7 6

9a. HM	9b. U.S. DOT Description (including Proper Shipping Name, Hazard Class, ID Number, and Packing Group (if any))	10. Containers No.	10. Containers Type	11. Total Quantity	12. Unit Wt./Vol.	13. Waste Codes
	1. None, Non-RCRA Hazardous Waste, Solid, N/A	001	DT	00018	T	611
	2.					
	3.					
	4.					

14. Special Handling Instructions and Additional Information
Profile #: CH420795B
Sales Order #: 7W28733365

15. **GENERATOR'S/OFFEROR'S CERTIFICATION:** I hereby declare that the contents of this consignment are fully and accurately described above by the proper shipping name, and are classified, packaged, marked and labeled/placarded, and are in all respects in proper condition for transport according to applicable international and national governmental regulations. If export shipment and I am the Primary Exporter, I certify that the contents of this consignment conform to the terms of the attached EPA Acknowledgment of Consent.
I certify that the waste minimization statement identified in 40 CFR 262.27(a) (if I am a large quantity generator) or (b) (if I am a small quantity generator) is true.

Generator's/Offeror's Printed/Typed Name: Lenen Aparicio
Signature: Lenen Ap
Month 5 Day 5 Year 10

16. International Shipments ☐ Import to U.S. ☐ Export from U.S. Port of entry/exit:
Transporter signature (for exports only): Date leaving U.S.:

17. Transporter Acknowledgment of Receipt of Materials
Transporter 1 Printed/Typed Name: Jordan McGuillivray
Signature: Jordan Lee
Month 05 Day 05 Year 10
Transporter 2 Printed/Typed Name:
Signature:
Month Day Year

18. Discrepancy
18a. Discrepancy Indication Space ☐ Quantity ☐ Type ☐ Residue ☐ Partial Rejection ☐ Full Rejection
Manifest Reference Number:
18b. Alternate Facility (or Generator)
U.S. EPA ID Number
Facility's Phone:
18c. Signature of Alternate Facility (or Generator)
Month Day Year

19. Hazardous Waste Report Management Method Codes (i.e., codes for hazardous waste treatment, disposal, and recycling systems)
1. H132 2. 3. 4.

20. Designated Facility Owner or Operator: Certification of receipt of hazardous materials covered by the manifest except as noted in Item 18a
Printed/Typed Name: Jim House
Signature:
Month 05 Day 05 Year 10

GENERATOR | INT'L | TRANSPORTER | DESIGNATED FACILITY

EPA Form 8700-22 (Rev. 3-05) Previous editions are obsolete.

TRANSPORTER'S COPY

NO. 191040

CLEANHARBORS BUTTONWILLOW, LLC
WEIGHMASTER CERTIFICATE

1:33 PM 05/05/10
REG. (69)
IN9UUN0 79540 1b

THIS IS TO CERTIFY that the following described commodity was weighed, measured, or counted by a weighmaster whose signature is on this certificate, who is a recognized authority of accuracy, as prescribed in Chapter 7 (commencing with Section12700) of Division 5 of the California Business and Professions Code, administered by the Division of Measurement Standards of the California Department of Food and Agiculture.

1:51 PM 05/05/10
REG. (69)

79540 lb GROSS
31390 lb TARE
48160 lb NET

WEIGHMASTER CLEANHARBORS BUTTONWILLOW, LLC

PROFILE NO. CH420795B	GROSS WT. BY:	DEPUTY	DATE 5/5/10
DISPOSAL LOCATION 35.3 23-E-05	TARE WT. BY:	DEPUTY	DATE 5/5/10
DRIVER'S NAME PRINTED Jordan McWilliams	WEIGHING LOCATION:	2500 W. LOKERN ROAD BUTTONWILLOW, CA 93206	
DRIVER'S NAME SIGNATURE Jordan Lee	GENERATOR	City of SB	
TRACTOR NO. 26	TRANSPORTER	RTS	
TRACTOR LIC. NO. TP03176	MANIFEST NO.	00474417 9 JJK	
TRAILER LIC. NO. 4EK3814	SERVICE ORDER NO.	7W2873366	
BIN NUMBERS:	BIN TRACKING		

☒ END DUMP ☐ TRANSFER ☐ VACUUM ☐ VAN
☐ ROLL OFF - _____ ☐ FLAT BED ☐ _____

VIS	pH	SUL	CYA	OX	FL	FLASH	20%	
+	7.62	—	—	—	—			
OTHER:								

IC	CR	PR	B.W. W.B.	LAB	SOLID BULK	WORK SHEET	LAND TRACK	W.T. SCAN	MAN-SCAN	RE-SCAN

DRUM NUMBER:

COMMENTS:

BIN DROP FULL:

MOVE BIN TO: DATE: BY:

REVISED (3/10)

Please print or type. (Form designed for use on elite (12-pitch) typewriter.)

Form Approved. OMB No. 2050-0039

UNIFORM HAZARDOUS WASTE MANIFEST

1. Generator ID Number: CAC002654[illegible]
2. Page 1 of
3. Emergency Response Phone: (661) 746-1132
4. Manifest Tracking Number: 004744180 JJK

5. Generator's Name and Mailing Address
City Of Santa Barbara
PO BOX 1990
Santa Barbara, CA 93102
Generator's Phone: (805) 641-1000 x 23

Generator's Site Address (if different than mailing address)
123 State Street
Santa Barbara, CA 93101

6. Transporter 1 Company Name: REMEDIAL TRANSPORTATION SERVICE
U.S. EPA ID Number: CAR000181560

7. Transporter 2 Company Name
U.S. EPA ID Number

8. Designated Facility Name and Site Address
Clean Harbors Buttonwillow
2300 West Lokern Road
Buttonwillow, CA 93206
Facility's Phone: (661) 762-6200
U.S. EPA ID Number: CAD980675276

9a. HM	9b. U.S. DOT Description (including Proper Shipping Name, Hazard Class, ID Number, and Packing Group (if any))	10. Containers No.	10. Containers Type	11. Total Quantity	12. Unit Wt./Vol.	13. Waste Codes
	1. None, Non-RCRA Hazardous Waste, Solid, N/A	001	DT	00010	Y	611
	2.					
	3.					
	4.					

14. Special Handling Instructions and Additional Information
Profile #: CH420795B
Sales Order #: 7W2873366
R.24 TPO 3174

15. **GENERATOR'S/OFFEROR'S CERTIFICATION:** I hereby declare that the contents of this consignment are fully and accurately described above by the proper shipping name, and are classified, packaged, marked and labeled/placarded, and are in all respects in proper condition for transport according to applicable international and national governmental regulations. If export shipment and I am the Primary Exporter, I certify that the contents of this consignment conform to the terms of the attached EPA Acknowledgment of Consent.
I certify that the waste minimization statement identified in 40 CFR 262.27(a) (if I am a large quantity generator) or (b) (if I am a small quantity generator) is true.

Generator's/Offeror's Printed/Typed Name: Conan Agonoy
Signature: Conan Agonoy
Month 5 Day 5 Year 10

16. International Shipments ☐ Import to U.S. ☐ Export from U.S. Port of entry/exit:
Transporter signature (for exports only): Date leaving U.S.:

17. Transporter Acknowledgment of Receipt of Materials
Transporter 1 Printed/Typed Name: ANGELO CAQUIAS
Signature: Angelo Caquias
Month 5 Day 5 Year 10
Transporter 2 Printed/Typed Name
Signature
Month Day Year

18. Discrepancy
18a. Discrepancy Indication Space ☐ Quantity ☐ Type ☐ Residue ☐ Partial Rejection ☐ Full Rejection
Manifest Reference Number:
18b. Alternate Facility (or Generator)
U.S. EPA ID Number
Facility's Phone:
18c. Signature of Alternate Facility (or Generator)
Month Day Year

19. Hazardous Waste Report Management Method Codes (i.e., codes for hazardous waste treatment, disposal, and recycling systems)
1. H132 2. 3. 4.

20. Designated Facility Owner or Operator: Certification of receipt of hazardous materials covered by the manifest except as noted in Item 18a
Printed/Typed Name: Ian Houston
Signature: Ian Houston
Month 05 Day 05 Year 10

GENERATOR | INT'L | TRANSPORTER | DESIGNATED FACILITY

EPA Form 8700-22 (Rev. 3-05) Previous editions are obsolete.

TRANSPORTER'S COPY

NO. 191034

CLEANHARBORS BUTTONWILLOW, LLC
WEIGHMASTER CERTIFICATE

1:07 PM 05/05/10
REG. (54)
INBOUND 79860 lb

THIS IS TO CERTIFY that the following described commodity was weighed, measured, or counted by a weighmaster whose signature is on this certificate, who is a recognized authority of accuracy, as prescribed in Chapter 7 (commencing with Section12700) of Division 5 of the California Business and Professions Code, administered by the Division of Measurement Standards of the California Department of Food and Agiculture.

WEIGHMASTER CLEANHARBORS BUTTONWILLOW, LLC

PROFILE NO. C1142079 5B	GROSS WT. BY:	DEPUTY	DATE 5/5/10
DISPOSAL LOCATION 35 3 23-E 05	TARE WT. BY:	DEPUTY	DATE 050510
DRIVER'S NAME PRINTED ANGELO CAQUIAS	WEIGHING LOCATION:	2500 W. LOKERN ROAD BUTTONWILLOW, CA 93206	
DRIVER'S NAME SIGNATURE Angelo Caquias	GENERATOR	City of SB	
TRACTOR NO. R. 24	TRANSPORTER	RTS	
TRACTOR LIC. NO. TP0 3174	MANIFEST NO.	004744180JJK	
TRAILER LIC. NO. 4CY 6740	SERVICE ORDER NO.	7027873366	
BIN NUMBERS:	BIN TRACKING		

1:22 PM 05/05/10
REG. (54)

79860 lb GROSS
31420 lb TARE
48440 lb NET

☒ END DUMP ☐ TRANSFER ☐ VACUUM ☐ VAN
☐ ROLL OFF - _____ ☐ FLAT BED ☐ _____

VIS	pH	SUL	CYA	OX	FL	FLASH	20%	
+	8.58	–	–	–	–			

OTHER:

IC	CR	PR	B.W. W.B.	LAB	SOLID BULK	WORK SHEET	LAND TRACK	W.T. SCAN	MAN-SCAN	RE-SCAN

DRUM NUMBER:

COMMENTS:

BIN DROP FULL:

MOVE BIN TO: DATE: BY:

REVISED (3/10)

R-27 T20380

Please print or type. (Form designed for use on elite (12-pitch) typewriter.)

Form Approved. OMB No. 2050-0039

UNIFORM HAZARDOUS WASTE MANIFEST

1. Generator ID Number: CAC002650488
2. Page 1 of
3. Emergency Response Phone: (661) 746-1132
4. Manifest Tracking Number: 004744181 JJK

5. Generator's Name and Mailing Address: City Of Santa Barbara, PO BOX 1990, Santa Barbara, CA 93102
Generator's Phone: (805)641-1000 x 23
Generator's Site Address (if different than mailing address): 125 State Street, Santa Barbara, CA 93101

6. Transporter 1 Company Name: Remedial Transportation Services
U.S. EPA ID Number: CAR000181560

7. Transporter 2 Company Name
U.S. EPA ID Number

8. Designated Facility Name and Site Address: Clean Harbors Buttonwillow, 2300 West Lokern Road, Buttonwillow, CA 93206
Facility's Phone: (661) 762-6200
U.S. EPA ID Number: CAD980675276

9a. HM	9b: U.S. DOT Description (including Proper Shipping Name, Hazard Class, ID Number, and Packing Group (if any))	10. Containers No.	10. Containers Type	11. Total Quantity	12. Unit Wt./Vol.	13. Waste Codes
	1. None, Non-RCRA Hazardous Waste, Solid, N/A	001	DT	00018	Y	611
	2.					
	3.					
	4.					

14. Special Handling Instructions and Additional Information
Profile #: CH420795B
Sales Order #: 7W2873366

15. **GENERATOR'S/OFFEROR'S CERTIFICATION:** I hereby declare that the contents of this consignment are fully and accurately described above by the proper shipping name, and are classified, packaged, marked and labeled/placarded, and are in all respects in proper condition for transport according to applicable international and national governmental regulations. If export shipment and I am the Primary Exporter, I certify that the contents of this consignment conform to the terms of the attached EPA Acknowledgment of Consent.
I certify that the waste minimization statement identified in 40 CFR 262.27(a) (if I am a large quantity generator) or (b) (if I am a small quantity generator) is true.

Generator's/Offeror's Printed/Typed Name: Cesar Aguirio
Signature: Cesar Aguirio
Month 5 Day 5 Year 10

16. International Shipments ☐ Import to U.S. ☐ Export from U.S. Port of entry/exit:
Transporter signature (for exports only): Date leaving U.S.:

17. Transporter Acknowledgment of Receipt of Materials
Transporter 1 Printed/Typed Name: Jeremy Rayns
Signature
Month 5 Day 5 Year 10
Transporter 2 Printed/Typed Name
Signature
Month Day Year

18. Discrepancy
18a. Discrepancy Indication Space ☐ Quantity ☐ Type ☐ Residue ☐ Partial Rejection ☐ Full Rejection
Manifest Reference Number:
18b. Alternate Facility (or Generator)
U.S. EPA ID Number
Facility's Phone:
18c. Signature of Alternate Facility (or Generator)
Month Day Year

19. Hazardous Waste Report Management Method Codes (i.e., codes for hazardous waste treatment, disposal, and recycling systems)
1. 2. 3. 4.

20. Designated Facility Owner or Operator: Certification of receipt of hazardous materials covered by the manifest except as noted in Item 18a
Printed/Typed Name: Donald E Johns
Signature
Month 05 Day 05 Year 10

GENERATOR | INT'L | TRANSPORTER | DESIGNATED FACILITY

EPA Form 8700-22 (Rev. 3-05) Previous editions are obsolete.

TRANSPORTER'S COPY

NO. 191031

CLEANHARBORS BUTTONWILLOW, LLC
WEIGHMASTER CERTIFICATE

12:42 PM 05/05/10
REG. (45)
INBOUND 82680 lb

THIS IS TO CERTIFY that the following described commodity was weighed, measured, or counted by a weighmaster whose signature is on this certificate, who is a recognized authority of accuracy, as prescribed in Chapter 7 (commencing with Section12700) of Division 5 of the California Business and Professions Code, administered by the Division of Measurement Standards of the California Department of Food and Agiculture.

WEIGHMASTER CLEANHARBORS BUTTONWILLOW, LLC

12:59 PM 05/05/10
REG. (45)

82680 lb GROSS
31000 lb TARE
51680 lb NET

PROFILE NO. CH4207953	GROSS WT. BY [signature]	DEPUTY	DATE 5/5/10
DISPOSAL LOCATION 35-3 23-E-05	TARE WT. BY [signature]	DEPUTY	DATE 050510
DRIVER'S NAME PRINTED Jeremey Lewis	WEIGHING LOCATION:	2500 W. LOKERN ROAD BUTTONWILLOW, CA 93206	
DRIVER'S NAME SIGNATURE [signature]	GENERATOR CITY OF SANTA BARBARA		
TRACTOR NO. R-29	TRANSPORTER ICTS		
TRACTOR LIC. NO. T703180	MANIFEST NO. 004744181 JJK		
TRAILER LIC. NO. T-21	SERVICE ORDER NO. 7W2873366		
BIN NUMBERS:	BIN TRACKING		

☒ END DUMP ☐ TRANSFER ☐ VACUUM ☐ VAN
☐ ROLL OFF - _____ ☐ FLAT BED ☐ _____

VIS	pH	SUL	CYA	OX	FL	FLASH	20%	
+	8.41	—	—	—	—			
OTHER:								

IC	CR	PR	B.W. W.B.	LAB	SOLID BULK	WORK SHEET	LAND TRACK	W.T. SCAN	MAN-SCAN	RE-SCAN

DRUM NUMBER:

COMMENTS:

BIN DROP FULL:

MOVE BIN TO: DATE: BY:

REVISED (3/10)

R34 11 UP 17647

Please print or type. (Form designed for use on elite (12-pitch) typewriter.)

Form Approved. OMB No. 2050-0039

UNIFORM HAZARDOUS WASTE MANIFEST

1. Generator ID Number: CAC000265048
2. Page 1 of
3. Emergency Response Phone: (661) 746-1132
4. Manifest Tracking Number: 004744158 JJK

GENERATOR

5. Generator's Name and Mailing Address: City Of Santa Barbara, PO BOX 1990, Santa Barbara, CA 93102
Generator's Phone: (805) 641-1000 x 23
Generator's Site Address (if different than mailing address): 123 State Street, Santa Barbara, CA 93101

6. Transporter 1 Company Name: Remedial Transportation Services
U.S. EPA ID Number: CAR000181560

7. Transporter 2 Company Name:
U.S. EPA ID Number:

8. Designated Facility Name and Site Address: Clean Harbors Buttonwillow, 2500 West Lokern Road, Buttonwillow, CA 93206
Facility's Phone: (661) 762-6200
U.S. EPA ID Number: CAD 9 8 0 6 7 5 2 7 6

9a. HM	9b. U.S. DOT Description (including Proper Shipping Name, Hazard Class, ID Number, and Packing Group (if any))	10. Containers No.	10. Containers Type	11. Total Quantity	12. Unit Wt./Vol.	13. Waste Codes
	1. None, Non-RCRA Hazardous Waste, Solid, N/A	001	DT	00018	Y	611
	2.					
	3.					
	4.					

14. Special Handling Instructions and Additional Information
Profile #: CEH420795B
Sales Order #: TW2873366

15. **GENERATOR'S/OFFEROR'S CERTIFICATION:** I hereby declare that the contents of this consignment are fully and accurately described above by the proper shipping name, and are classified, packaged, marked and labeled/placarded, and are in all respects in proper condition for transport according to applicable international and national governmental regulations. If export shipment and I am the Primary Exporter, I certify that the contents of this consignment conform to the terms of the attached EPA Acknowledgment of Consent.
I certify that the waste minimization statement identified in 40 CFR 262.27(a) (if I am a large quantity generator) or (b) (if I am a small quantity generator) is true.

Generator's/Offeror's Printed/Typed Name: Carla Acuna
Signature: Carla Acuna
Month 5 Day 5 Year 10

INT'L

16. International Shipments: ☐ Import to U.S. ☐ Export from U.S. Port of entry/exit:
Transporter signature (for exports only): Date leaving U.S.:

TRANSPORTER

17. Transporter Acknowledgment of Receipt of Materials
Transporter 1 Printed/Typed Name: Allen Quinn
Signature: Allen Quinn
Month 5 Day 6 Year 10
Transporter 2 Printed/Typed Name:
Signature:
Month Day Year

DESIGNATED FACILITY

18. Discrepancy
18a. Discrepancy Indication Space ☐ Quantity ☐ Type ☐ Residue ☐ Partial Rejection ☐ Full Rejection
Manifest Reference Number:

18b. Alternate Facility (or Generator)
U.S. EPA ID Number
Facility's Phone:

18c. Signature of Alternate Facility (or Generator)
Month Day Year

19. Hazardous Waste Report Management Method Codes (i.e., codes for hazardous waste treatment, disposal, and recycling systems)
1. H132
2.
3.
4.

20. Designated Facility Owner or Operator: Certification of receipt of hazardous materials covered by the manifest except as noted in Item 18a
Printed/Typed Name: Ronald E Johns
Signature: Ronald E Johns
Month 05 Day 06 Year 10

EPA Form 8700-22 (Rev. 3-05) Previous editions are obsolete.

TRANSPORTER'S COPY

NO. 191095

CLEANHARBORS BUTTONWILLOW, LLC
WEIGHMASTER CERTIFICATE

1:50 PM 05/06/10
REG. (77)
INBOUND 79300 lb

THIS IS TO CERTIFY that the following described commodity was weighed, measured, or counted by a weighmaster whose signature is on this certificate, who is a recognized authority of accuracy, as prescribed in Chapter 7 (commencing with Section12700) of Division 5 of the California Business and Professions Code, administered by the Division of Measurement Standards of the California Department of Food and Agiculture.

WEIGHMASTER CLEANHARBORS BUTTONWILLOW, LLC

PROFILE NO. OH1207558	GROSS WT. BY: [illegible] DEPUTY	DATE 05-06-10
DISPOSAL LOCATION 35-3-22 F05	TARE WT. BY: R. L. Johns DEPUTY	DATE 050610
DRIVER'S NAME PRINTED Allan Quinn	WEIGHING LOCATION:	2500 W. LOKERN ROAD BUTTONWILLOW, CA 93206
DRIVER'S NAME SIGNATURE Allan Quinn	GENERATOR City of Santa Barbara	
TRACTOR NO. R34	TRANSPORTER R.T.S.	
TRACTOR LIC. NO. UP14647	MANIFEST NO. 004744158-JJK	
TRAILER LIC. NO. 2500FT	SERVICE ORDER NO. 7W2873366	
BIN NUMBERS:	BIN TRACKING	

2:10 PM 05/06/10
REG. (77)

79300 lb GROSS
30820 lb TARE
48480 lb NET

☑ END DUMP ☐ TRANSFER ☐ VACUUM ☐ VAN
☐ ROLL OFF - _____ ☐ FLAT BED ☐ _____

VIS	pH	SUL	CYA	OX	FL	FLASH	20%	
+	7.98	-	-		[illegible]			
OTHER:								

IC	CR	PR	B.W. W.B.	LAB	SOLID BULK	WORK SHEET	LAND TRACK	W.T. SCAN	MAN-SCAN	RE-SCAN

DRUM NUMBER:

COMMENTS:

BIN DROP FULL:

MOVE BIN TO: DATE: BY:

REVISED (3/10)

Please print or type. (Form designed for use on elite (12-pitch) typewriter.) Form Approved. OMB No. 2050-0039

UNIFORM HAZARDOUS WASTE MANIFEST

1. Generator ID Number: CAC002650488
2. Page 1 of
3. Emergency Response Phone: (661) 746-1132
4. Manifest Tracking Number: 004744159 JJK

5. Generator's Name and Mailing Address
City Of Santa Barbara
PO BOX 1990
Santa Barbara, CA 93102
Generator's Phone: (805) 641-1000 x 23

Generator's Site Address (if different than mailing address)
125 State Street
Santa Barbara, CA 93101

6. Transporter 1 Company Name: REMEDIAL TRANSPORTATION SERVICE
U.S. EPA ID Number: CAR000181560

7. Transporter 2 Company Name
U.S. EPA ID Number

8. Designated Facility Name and Site Address
Clean Harbors Buttonwillow
2300 West Lokern Road
Buttonwillow, CA 93206
Facility's Phone: (661) 762-6200
U.S. EPA ID Number: CAD983673276

9a. HM	9b. U.S. DOT Description (including Proper Shipping Name, Hazard Class, ID Number, and Packing Group (if any))	10. Containers No.	10. Containers Type	11. Total Quantity	12. Unit Wt./Vol.	13. Waste Codes
	1. Non, Non-RCRA Hazardous Waste, Solid, N/A	001	DT	00018	Y	611
	2.					
	3.					
	4.					

14. Special Handling Instructions and Additional Information
Profile # CH420795B
Sales Order # 7W2873366
R-24 TPO 3174

15. **GENERATOR'S/OFFEROR'S CERTIFICATION:** I hereby declare that the contents of this consignment are fully and accurately described above by the proper shipping name, and are classified, packaged, marked and labeled/placarded, and are in all respects in proper condition for transport according to applicable international and national governmental regulations. If export shipment and I am the Primary Exporter, I certify that the contents of this consignment conform to the terms of the attached EPA Acknowledgment of Consent.
I certify that the waste minimization statement identified in 40 CFR 262.27(a) (if I am a large quantity generator) or (b) (if I am a small quantity generator) is true.

Generator's/Offeror's Printed/Typed Name: Carlos Aguirre
Signature: Carlos Aguirre
Month 5 Day 5 Year 10

16. International Shipments ☐ Import to U.S. ☐ Export from U.S. Port of entry/exit:
Transporter signature (for exports only): Date leaving U.S.:

17. Transporter Acknowledgment of Receipt of Materials
Transporter 1 Printed/Typed Name: ANGELO CAQUIAS
Signature: Angelo Caquias
Month 5 Day 6 Year 10
Transporter 2 Printed/Typed Name
Signature
Month Day Year

18. Discrepancy
18a. Discrepancy Indication Space ☐ Quantity ☐ Type ☐ Residue ☐ Partial Rejection ☐ Full Rejection
Manifest Reference Number:

18b. Alternate Facility (or Generator)
U.S. EPA ID Number
Facility's Phone:

18c. Signature of Alternate Facility (or Generator)
Month Day Year

19. Hazardous Waste Report Management Method Codes (i.e., codes for hazardous waste treatment, disposal, and recycling systems)
1. H132 2. 3. 4.

20. Designated Facility Owner or Operator: Certification of receipt of hazardous materials covered by the manifest except as noted in Item 18a
Printed/Typed Name: Ronald E Johns
Signature: R E Johns
Month 05 Day 06 Year 10

GENERATOR — INT'L — TRANSPORTER — DESIGNATED FACILITY

EPA Form 8700-22 (Rev. 3-05) Previous editions are obsolete. **TRANSPORTER'S COPY**

NO. 191094

1:45 PM 05/06/10
REG. (76)
INBOUND 77380 lb

CLEANHARBORS BUTTONWILLOW, LLC
WEIGHMASTER CERTIFICATE

THIS IS TO CERTIFY that the following described commodity was weighed, measured, or counted by a weighmaster whose signature is on this certificate, who is a recognized authority of accuracy, as prescribed in Chapter 7 (commencing with Section12700) of Division 5 of the California Business and Professions Code, administered by the Division of Measurement Standards of the California Department of Food and Agiculture.

WEIGHMASTER CLEANHARBORS BUTTONWILLOW, LLC

PROFILE NO. CH4207958	GROSS WT. BY:	DEPUTY	DATE 050610
DISPOSAL LOCATION 35-3-22 F-05	TARE WT. BY:	DEPUTY	DATE 050616
DRIVER'S NAME PRINTED ANGELO CAQUIAS	WEIGHING LOCATION:	2500 W. LOKERN ROAD BUTTONWILLOW, CA 93206	
DRIVER'S NAME SIGNATURE Angelo Caquias	GENERATOR	City of Santa Barbara	
TRACTOR NO. R-24	TRANSPORTER	RTS	
TRACTOR LIC. NO. TPO 3174	MANIFEST NO.	004744155JK	
TRAILER LIC. NO. 4C46740	SERVICE ORDER NO.	7W2873366	
BIN NUMBERS:	BIN TRACKING		

2:03 PM 05/06/10
REG. (76)

77380 lb GROSS
31440 lb TARE
45940 lb NET

☒ END DUMP ☐ TRANSFER ☐ VACUUM ☐ VAN
☐ ROLL OFF - _____ ☐ FLAT BED ☐ _____

VIS	pH	SUL	CYA	OX	FL	FLASH	20%	
+	7.81	–	–		14	14		

OTHER:

IC	CR	PR	B.W. W.B.	LAB	SOLID BULK	WORK SHEET	LAND TRACK	W.T. SCAN	MAN-SCAN	RE-SCAN

DRUM NUMBER:

COMMENTS:

BIN DROP FULL:

MOVE BIN TO: DATE: BY:

REVISED (3/10)

Please print or type. (Form designed for use on elite (12-pitch) typewriter.) Form Approved. OMB No. 2050-0039

UNIFORM HAZARDOUS WASTE MANIFEST

1. Generator ID Number: CAC000265048 8
2. Page 1 of
3. Emergency Response Phone: (661) 746-1132
4. Manifest Tracking Number: 004744160 JJK

5. Generator's Name and Mailing Address: City Of Santa Barbara, PO BOX 1990, Santa Barbara, CA 93102
Generator's Phone: (805) 641-1000 x 23
Generator's Site Address (if different than mailing address): 123 State Street, Santa Barbara, CA 93101

6. Transporter 1 Company Name: Remedial Transportation Services
U.S. EPA ID Number: 000181560

7. Transporter 2 Company Name:
U.S. EPA ID Number:

8. Designated Facility Name and Site Address: Clean Harbors Buttonwillow, 2500 West Lokern Road, Buttonwillow, CA 93206
Facility's Phone: (661) 762-6200
U.S. EPA ID Number: CAD982067327 6

9a. HM	9b. U.S. DOT Description (including Proper Shipping Name, Hazard Class, ID Number, and Packing Group (if any))	10. Containers No.	10. Containers Type	11. Total Quantity	12. Unit Wt./Vol.	13. Waste Codes
	1. None, Non-RCRA Hazardous Waste, Solid, N/A	001	DT	00018	Y	811
	2.					
	3.					
	4.					

14. Special Handling Instructions and Additional Information
Profile #: CH420795B
Sales Order #: TW2273366

15. **GENERATOR'S/OFFEROR'S CERTIFICATION:** I hereby declare that the contents of this consignment are fully and accurately described above by the proper shipping name, and are classified, packaged, marked and labeled/placarded, and are in all respects in proper condition for transport according to applicable international and national governmental regulations. If export shipment and I am the Primary Exporter, I certify that the contents of this consignment conform to the terms of the attached EPA Acknowledgment of Consent.
I certify that the waste minimization statement identified in 40 CFR 262.27(a) (if I am a large quantity generator) or (b) (if I am a small quantity generator) is true.

Generator's/Offeror's Printed/Typed Name: Cesar Aguilar
Signature: Cesar Aguilar
Month 05 Day 06 Year 10

16. International Shipments ☐ Import to U.S. ☐ Export from U.S. Port of entry/exit:
Transporter signature (for exports only): Date leaving U.S.:

17. Transporter Acknowledgment of Receipt of Materials
Transporter 1 Printed/Typed Name: Jordan McWilliams
Signature: Jordan Lee
Month 05 Day 06 Year 10
Transporter 2 Printed/Typed Name:
Signature:
Month Day Year

18. Discrepancy
18a. Discrepancy Indication Space ☐ Quantity ☐ Type ☐ Residue ☐ Partial Rejection ☐ Full Rejection
Manifest Reference Number:
18b. Alternate Facility (or Generator)
U.S. EPA ID Number
Facility's Phone:
18c. Signature of Alternate Facility (or Generator)
Month Day Year

19. Hazardous Waste Report Management Method Codes (i.e., codes for hazardous waste treatment, disposal, and recycling systems)
1. H132 2. 3. 4.

20. Designated Facility Owner or Operator: Certification of receipt of hazardous materials covered by the manifest except as noted in Item 18a
Printed/Typed Name: Ronald E Johns
Signature: Ronald E Johns
Month 05 Day 06 Year 10

GENERATOR | INT'L | TRANSPORTER | DESIGNATED FACILITY

EPA Form 8700-22 (Rev. 3-05) Previous editions are obsolete.

TRANSPORTER'S COPY

NO. 191109

CLEANHARBORS BUTTONWILLOW, LLC
WEIGHMASTER CERTIFICATE

1:52 PM 05/06/10
REG. (83)
INBOUND 78940 lb

THIS IS TO CERTIFY that the following described commodity was weighed, measured, or counted by a weighmaster whose signature is on this certificate, who is a recognized authority of accuracy, as prescribed in Chapter 7 (commencing with Section12700) of Division 5 of the California Business and Professions Code, administered by the Division of Measurement Standards of the California Department of Food and Agiculture.

WEIGHMASTER CLEANHARBORS BUTTONWILLOW, LLC

PROFILE NO.	CH4207953	GROSS WT. BY:	DEPUTY / DATE 050620
DISPOSAL LOCATION	35-1-22-E 05	TARE WT. BY:	DEPUTY / DATE 050610
DRIVER'S NAME PRINTED	Jordan McQuillan	WEIGHING LOCATION:	2500 W. LOKERN ROAD BUTTONWILLOW, CA 93206
DRIVER'S NAME SIGNATURE	Jordan Lee	GENERATOR	City of Santa Barbara
TRACTOR NO.	26	TRANSPORTER	KTS
TRACTOR LIC. NO.	TP03176	MANIFEST NO.	CU4744160JJK
TRAILER LIC. NO.	4EK3814	SERVICE ORDER NO.	2W2873366
BIN NUMBERS:		BIN TRACKING	

2:13 PM 05/06/10
REG. (83)

78940 lb GROSS
30940 lb TARE
48000 lb NET

☒ END DUMP ☐ TRANSFER ☐ VACUUM ☐ VAN
☐ ROLL OFF - _____ ☐ FLAT BED ☐ _____

VIS	pH	SUL	CYA	OX	FL	FLASH	20%	
+							✓	
OTHER:								

IC	CR	PR	B.W. W.B.	LAB	SOLID BULK	WORK SHEET	LAND TRACK	W.T. SCAN	MAN-SCAN	RE-SCAN

DRUM NUMBER:

COMMENTS:

BIN DROP FULL:

MOVE BIN TO: DATE: BY:

REVISED (3/10)

Please print or type. (Form designed for use on elite (12-pitch) typewriter.)

Form Approved. OMB No. 2050-0039

UNIFORM HAZARDOUS WASTE MANIFEST

1. Generator ID Number: CAC000265048 8
2. Page 1 of
3. Emergency Response Phone: (661) 746-1132
4. Manifest Tracking Number: 004744161 JJK

GENERATOR

5. Generator's Name and Mailing Address: City Of Santa Barbara, PO BOX 1990, Santa Barbara, CA 93102
Generator's Phone: (805) 641-1000 x 23
Generator's Site Address (if different than mailing address): 125 State Street, Santa Barbara, CA 93101

6. Transporter 1 Company Name: Rosas Trucking
U.S. EPA ID Number: CAD000175844

7. Transporter 2 Company Name:
U.S. EPA ID Number:

8. Designated Facility Name and Site Address: Clean Harbors Buttonwillow, 2500 West Lokern Road, Buttonwillow, CA 93206
Facility's Phone: (661) 762-8200
U.S. EPA ID Number: CAD982067276

9a. HM	9b. U.S. DOT Description (including Proper Shipping Name, Hazard Class, ID Number, and Packing Group (if any))	10. Containers No.	10. Containers Type	11. Total Quantity	12. Unit Wt./Vol.	13. Waste Codes
	1. None, Non-RCRA Hazardous Waste, Solid, N/A	001	DT	00018	Y	611
	2.					
	3.					
	4.					

14. Special Handling Instructions and Additional Information
Profile # 3CH420795B
Sales Order # 7W2873366
84 9061811

15. **GENERATOR'S/OFFEROR'S CERTIFICATION:** I hereby declare that the contents of this consignment are fully and accurately described above by the proper shipping name, and are classified, packaged, marked and labeled/placarded, and are in all respects in proper condition for transport according to applicable international and national governmental regulations. If export shipment and I am the Primary Exporter, I certify that the contents of this consignment conform to the terms of the attached EPA Acknowledgment of Consent.
I certify that the waste minimization statement identified in 40 CFR 262.27(a) (if I am a large quantity generator) or (b) (if I am a small quantity generator) is true. 2532

Generator's/Offeror's Printed/Typed Name: Cenen Aparicio
Signature: Cenen Aparicio
Month: 05 Day: 05 Year: 10

INT'L

16. International Shipments ☐ Import to U.S. ☐ Export from U.S. Port of entry/exit:
Transporter signature (for exports only): Date leaving U.S.:

TRANSPORTER

17. Transporter Acknowledgment of Receipt of Materials
Transporter 1 Printed/Typed Name: Miguel Reynoso
Signature: Miguel Reynoso
Month: 5 Day: 6 Year: 10
Transporter 2 Printed/Typed Name:
Signature:
Month: Day: Year:

DESIGNATED FACILITY

18. Discrepancy
18a. Discrepancy Indication Space ☐ Quantity ☐ Type ☐ Residue ☐ Partial Rejection ☐ Full Rejection
Manifest Reference Number:
18b. Alternate Facility (or Generator)
U.S. EPA ID Number
Facility's Phone:
18c. Signature of Alternate Facility (or Generator)
Month: Day: Year:

19. Hazardous Waste Report Management Method Codes (i.e., codes for hazardous waste treatment, disposal, and recycling systems)
1. H132 2. 3. 4.

20. Designated Facility Owner or Operator: Certification of receipt of hazardous materials covered by the manifest except as noted in Item 18a
Printed/Typed Name: Donald E. Johns
Signature: Donald E. Johns
Month: 05 Day: 06 Year: 10

EPA Form 8700-22 (Rev. 3-05) Previous editions are obsolete.

TRANSPORTER'S COPY

NO. 191100

CLEANHARBORS BUTTONWILLOW, LLC
WEIGHMASTER CERTIFICATE

1:58 PM 05/06/10
REG. (90)
INBOUND 80780 lb

THIS IS TO CERTIFY that the following described commodity was weighed, measured, or counted by a weighmaster whose signature is on this certificate, who is a recognized authority of accuracy, as prescribed in Chapter 7 (commencing with Section12700) of Division 5 of the California Business and Professions Code, administered by the Division of Measurement Standards of the California Department of Food and Agiculture.

WEIGHMASTER CLEANHARBORS BUTTONWILLOW, LLC

PROFILE NO.	004207958	GROSS WT. BY: DEPUTY	DATE 05 06 10
DISPOSAL LOCATION	353-22 F05	TARE WT. BY: DEPUTY	DATE 050610
DRIVER'S NAME PRINTED	Miguel Reynoso	WEIGHING LOCATION:	2500 W. LOKERN ROAD BUTTONWILLOW, CA 93206
DRIVER'S NAME SIGNATURE	Miguel Reynoso	GENERATOR	City of Santa Barbara
TRACTOR NO.	P4	TRANSPORTER	Rosas
TRACTOR LIC. NO.	9D6184	MANIFEST NO.	004744161JJK
TRAILER LIC. NO.	4DH6728	SERVICE ORDER NO.	7W2873366
BIN NUMBERS:		BIN TRACKING	

2:29 PM 05/06/10
REG. (90)

80780 lb GROSS
30140 lb TARE
50640 lb NET

☒ END DUMP ☐ TRANSFER ☐ VACUUM ☐ VAN
☐ ROLL OFF - _____ ☐ FLAT BED ☐ _____

WS	pH	SUL	CYA	OX	FL	FLASH	20%	
+	7.98	-	-		N	N		
OTHER:								

IC	CR	PR	B.W. W.B.	LAB	SOLID BULK	WORK SHEET	LAND TRACK	W.T. SCAN	MAN-SCAN	RE-SCAN

DRUM NUMBER:

COMMENTS:

BIN DROP FULL:

MOVE BIN TO: DATE: BY:

REVISED (3/10)

Please print or type. (Form designed for use on elite (12-pitch) typewriter.)

Form Approved. OMB No. 2050-0039

UNIFORM HAZARDOUS WASTE MANIFEST

1. Generator ID Number: CAC002650488
2. Page 1 of
3. Emergency Response Phone: (661) 746-1132
4. Manifest Tracking Number: 004744162 JJK

5. Generator's Name and Mailing Address: City Of Santa Barbara, PO BOX 1990, Santa Barbara, CA 93102
Generator's Phone: (805) 641-1000 x 23
Generator's Site Address (if different than mailing address): 125 State Street, Santa Barbara, CA 93101

6. Transporter 1 Company Name: TICAS TRUCKING
U.S. EPA ID Number: CAL000244479

7. Transporter 2 Company Name:
U.S. EPA ID Number:

8. Designated Facility Name and Site Address: Clean Harbors Buttonwillow, 2500 West Lokern Road, Buttonwillow, CA 93206
Facility's Phone: (661) 762-6200
U.S. EPA ID Number: CAD982067276

9a. HM	9b. U.S. DOT Description (including Proper Shipping Name, Hazard Class, ID Number, and Packing Group (if any))	10. Containers No.	10. Containers Type	11. Total Quantity	12. Unit Wt./Vol.	13. Waste Codes
	1. None, Non RCRA Hazardous Waste, Solid, N/A	001	DT	00018	Y	N1
	2.					
	3.					
	4.					

14. Special Handling Instructions and Additional Information
Profile # CH42295B
Sales Order # TW2873366

15. **GENERATOR'S/OFFEROR'S CERTIFICATION:** I hereby declare that the contents of this consignment are fully and accurately described above by the proper shipping name, and are classified, packaged, marked and labeled/placarded, and are in all respects in proper condition for transport according to applicable international and national governmental regulations. If export shipment and I am the Primary Exporter, I certify that the contents of this consignment conform to the terms of the attached EPA Acknowledgment of Consent.
I certify that the waste minimization statement identified in 40 CFR 262.27(a) (if I am a large quantity generator) or (b) (if I am a small quantity generator) is true.

Generator's/Offeror's Printed/Typed Name: Cenen Agonias
Signature: Cenen Agonias
Month 5 Day 5 Year 10

16. International Shipments ☐ Import to U.S. ☐ Export from U.S. Port of entry/exit:
Transporter signature (for exports only): Date leaving U.S.:

17. Transporter Acknowledgment of Receipt of Materials
Transporter 1 Printed/Typed Name: Henry A Ticas
Signature:
Month 5 Day 6 Year 10

Transporter 2 Printed/Typed Name:
Signature:
Month Day Year

18. Discrepancy
18a. Discrepancy Indication Space ☐ Quantity ☐ Type ☐ Residue ☐ Partial Rejection ☐ Full Rejection
Manifest Reference Number:

18b. Alternate Facility (or Generator)
U.S. EPA ID Number
Facility's Phone:

18c. Signature of Alternate Facility (or Generator)
Month Day Year

19. Hazardous Waste Report Management Method Codes (i.e., codes for hazardous waste treatment, disposal, and recycling systems)
1. H132 2. 3. 4.

20. Designated Facility Owner or Operator: Certification of receipt of hazardous materials covered by the manifest except as noted in Item 18a
Printed/Typed Name: Ronald E. Johns
Signature:
Month 05 Day 06 Year 10

GENERATOR | INT'L | TRANSPORTER | DESIGNATED FACILITY

EPA Form 8700-22 (Rev. 3-05) Previous editions are obsolete.

TRANSPORTER'S COPY

NO. 191114

CLEANHARBORS BUTTONWILLOW, LLC
WEIGHMASTER CERTIFICATE

2:48 PM 05/06/10
REG. (55)
INBOUND 80660 lb

THIS IS TO CERTIFY that the following described commodity was weighed, measured, or counted by a weighmaster whose signature is on this certificate, who is a recognized authority of accuracy, as prescribed in Chapter 7 (commencing with Section12700) of Division 5 of the California Business and Professions Code, administered by the Division of Measurement Standards of the California Department of Food and Agiculture.

WEIGHMASTER CLEANHARBORS BUTTONWILLOW, LLC

PROFILE NO.	CH420795B	GROSS WT. BY:	DEPUTY DATE 05-06-10
DISPOSAL LOCATION	53 22 E05	TARE WT. BY:	DEPUTY DATE 050610
DRIVER'S NAME PRINTED	Henry A. Tica	WEIGHING LOCATION:	2500 W. LOKERN ROAD BUTTONWILLOW, CA 93206
DRIVER'S NAME SIGNATURE		GENERATOR	City of Santa Barbara
TRACTOR NO.	012	TRANSPORTER	Tica's
TRACTOR LIC. NO.	VP32545	MANIFEST NO.	001744162JJK
TRAILER LIC. NO.	4U1972	SERVICE ORDER NO.	2W2873366
BIN NUMBERS:		BIN TRACKING	

3:13 PM 05/06/10
REG. (55)

80660 lb GROSS
31020 lb TARE
49640 lb NET

Tons= 24.82

☒ END DUMP ☐ TRANSFER ☐ VACUUM ☐ VAN

☐ ROLL OFF - _____ ☐ FLAT BED ☐ _____

VIS	pH	SUL	CYA	OX	FL	FLASH	20%	
+	7.99	–	–		M	N		
OTHER:								

IC.	CR	PR	B.W. W.B.	LAB	SOLID BULK	WORK SHEET	LAND TRACK	W.T. SCAN	MAN-SCAN	RE-SCAN

DRUM NUMBER:

COMMENTS:

BIN DROP FULL:

MOVE BIN TO: DATE: BY:

REVISED (3/10)

Please print or type. (Form designed for use on elite (12-pitch) typewriter.) Form Approved. OMB No. 2050-0039

UNIFORM HAZARDOUS WASTE MANIFEST

1. Generator ID Number: CAC000265048
2. Page 1 of
3. Emergency Response Phone: (661) 746-1132
4. Manifest Tracking Number: 004744163 JJK

5. Generator's Name and Mailing Address: City Of Santa Barbara, PO BOX 1990, Santa Barbara, CA 93102
Generator's Phone: (805) 641-1000 x 23
Generator's Site Address (if different than mailing address): 120 State Street, Santa Barbara, CA 93101

6. Transporter 1 Company Name: EDDY'S TRUCKING
U.S. EPA ID Number: CAR000199520

7. Transporter 2 Company Name:
U.S. EPA ID Number:

8. Designated Facility Name and Site Address: Clean Harbors Buttonwillow, 2300 West Lokern Road, Buttonwillow, CA 93206
Facility's Phone: (661) 762-6200
U.S. EPA ID Number: CAD982067276

9a. HM	9b. U.S. DOT Description (including Proper Shipping Name, Hazard Class, ID Number, and Packing Group (if any))	10. Containers No.	10. Containers Type	11. Total Quantity	12. Unit Wt./Vol.	13. Waste Codes
	1. None, Non-RCRA Hazardous Waste, Solid, N/A	001	DT	00012	Y	681
	2.					
	3.					
	4.					

14. Special Handling Instructions and Additional Information
Profile #: CEI4207PSB
Sales Order #: 7W2873368

15. **GENERATOR'S/OFFEROR'S CERTIFICATION:** I hereby declare that the contents of this consignment are fully and accurately described above by the proper shipping name, and are classified, packaged, marked and labeled/placarded, and are in all respects in proper condition for transport according to applicable international and national governmental regulations. If export shipment and I am the Primary Exporter, I certify that the contents of this consignment conform to the terms of the attached EPA Acknowledgment of Consent.
I certify that the waste minimization statement identified in 40 CFR 262.27(a) (if I am a large quantity generator) or (b) (if I am a small quantity generator) is true.

Generator's/Offeror's Printed/Typed Name: Chris Adcock
Signature:
Month 5 Day 15 Year 10

16. International Shipments ☐ Import to U.S. ☐ Export from U.S. Port of entry/exit:
Transporter signature (for exports only): Date leaving U.S.:

17. Transporter Acknowledgment of Receipt of Materials
Transporter 1 Printed/Typed Name: EDUARDO PINDA
Signature:
Month 5 Day 16 Year 10
Transporter 2 Printed/Typed Name:
Signature:
Month Day Year

18. Discrepancy
18a. Discrepancy Indication Space ☐ Quantity ☐ Type ☐ Residue ☐ Partial Rejection ☐ Full Rejection
Manifest Reference Number:

18b. Alternate Facility (or Generator)
U.S. EPA ID Number
Facility's Phone:

18c. Signature of Alternate Facility (or Generator)
Month Day Year

19. Hazardous Waste Report Management Method Codes (i.e., codes for hazardous waste treatment, disposal, and recycling systems)
1. H152 2. 3. 4.

20. Designated Facility Owner or Operator: Certification of receipt of hazardous materials covered by the manifest except as noted in Item 18a
Printed/Typed Name: Manuel E. Jobe
Signature:
Month Day Year

GENERATOR | INT'L | TRANSPORTER | DESIGNATED FACILITY

EPA Form 8700-22 (Rev. 3-05) Previous editions are obsolete. **TRANSPORTER'S COPY**

NO. 191116

CLEANHARBORS BUTTONWILLOW, LLC
WEIGHMASTER CERTIFICATE

2:57 PM 05/06/10
REG. (60)
INBOUND 79240 lb

THIS IS TO CERTIFY that the following described commodity was weighed, measured, or counted by a weighmaster whose signature is on this certificate, who is a recognized authority of accuracy, as prescribed in Chapter 7 (commencing with Section12700) of Division 5 of the California Business and Professions Code, administered by the Division of Measurement Standards of the California Department of Food and Agiculture.

WEIGHMASTER CLEANHARBORS BUTTONWILLOW, LLC

3:19 PM 05/06/10
REG. (60)

79240 lb GROSS
30160 lb TARE
49080 lb NET

PROFILE NO.	CH42079553	GROSS WT. BY:	DEPUTY DATE 05 06 10
DISPOSAL LOCATION	35-22 E-05	TARE WT. BY:	DEPUTY DATE 050610
DRIVER'S NAME PRINTED	EDGARDO PRADA	WEIGHING LOCATION:	2500 W. LOKERN ROAD BUTTONWILLOW, CA 93206
DRIVER'S NAME SIGNATURE		GENERATOR	City of Santa Barbara
TRACTOR NO.	# 001	TRANSPORTER	Eddie
TRACTOR LIC. NO.	411M4938	MANIFEST NO.	CA4744163556
TRAILER LIC. NO.	9D90608	SERVICE ORDER NO.	2W2873366
BIN NUMBERS:		BIN TRACKING	

☒ END DUMP ☐ TRANSFER ☐ VACUUM ☐ VAN
☐ ROLL OFF - _____ ☐ FLAT BED ☐ _____

VIS	pH	SUL	CYA	OX	FL	FLASH	20%	
+							✓	
OTHER:								

IC	CR	PR	B.W. W.B.	LAB	SOLID BULK	WORK SHEET	LAND TRACK	W.T. SCAN	MAN-SCAN	RE-SCAN

DRUM NUMBER:

COMMENTS:

BIN DROP FULL:

MOVE BIN TO: DATE: BY:

REVISED (3/10)

Please print or type. (Form designed for use on elite (12-pitch) typewriter.)

Form Approved. OMB No. 2050-0039

UNIFORM HAZARDOUS WASTE MANIFEST

1. Generator ID Number: CAC000265048 9
2. Page 1 of
3. Emergency Response Phone: (661) 746-1132
4. Manifest Tracking Number: 004744165 JJK

5. Generator's Name and Mailing Address: City Of Santa Barbara, PO BOX 1990, Santa Barbara, CA 93102
Generator's Phone: (805) 691-1050 x23
Generator's Site Address (if different than mailing address): 125 State Street, Santa Barbara, CA 93101

6. Transporter 1 Company Name: Corona Trucking
U.S. EPA ID Number: CAR000201871

7. Transporter 2 Company Name:
U.S. EPA ID Number:

8. Designated Facility Name and Site Address: Clean Harbors Buttonwillow, 2500 West Lokern Road, Buttonwillow, CA 93206
Facility's Phone: (661) 762-6200
U.S. EPA ID Number: CAD 9 8 0 6 7 3 2 7 6

9a. HM	9b. U.S. DOT Description (including Proper Shipping Name, Hazard Class, ID Number, and Packing Group (if any))	10. Containers No.	10. Containers Type	11. Total Quantity	12. Unit Wt./Vol.	13. Waste Codes		
	1. Non, Non-RCRA Hazardous Waste, Solid, N/A	001	DT	00012	T	811		
	2.							
	3.							
	4.							

14. Special Handling Instructions and Additional Information
Profile # CH120793B
Sites Order # TW2873366

15. **GENERATOR'S/OFFEROR'S CERTIFICATION:** I hereby declare that the contents of this consignment are fully and accurately described above by the proper shipping name, and are classified, packaged, marked and labeled/placarded, and are in all respects in proper condition for transport according to applicable international and national governmental regulations. If export shipment and I am the Primary Exporter, I certify that the contents of this consignment conform to the terms of the attached EPA Acknowledgment of Consent.
I certify that the waste minimization statement identified in 40 CFR 262.27(a) (if I am a large quantity generator) or (b) (if I am a small quantity generator) is true.

Generator's/Offeror's Printed/Typed Name: Cesar Acevedo
Signature: Cesar Acevedo
Month 5 Day 5 Year 10

16. International Shipments ☐ Import to U.S. ☐ Export from U.S. Port of entry/exit:
Transporter signature (for exports only): Date leaving U.S.:

17. Transporter Acknowledgment of Receipt of Materials
Transporter 1 Printed/Typed Name: Victor Hugo Corona
Signature: Victor
Month 5 Day 6 Year 10

Transporter 2 Printed/Typed Name:
Signature:
Month Day Year

18. Discrepancy
18a. Discrepancy Indication Space ☐ Quantity ☐ Type ☐ Residue ☐ Partial Rejection ☐ Full Rejection
Manifest Reference Number:
18b. Alternate Facility (or Generator)
U.S. EPA ID Number:
Facility's Phone:
18c. Signature of Alternate Facility (or Generator)
Month Day Year

19. Hazardous Waste Report Management Method Codes (i.e., codes for hazardous waste treatment, disposal, and recycling systems)
1. H132 2. 3. 4.

20. Designated Facility Owner or Operator: Certification of receipt of hazardous materials covered by the manifest except as noted in Item 18a
Printed/Typed Name: Ronald E. Johns
Signature: Ronald E. Johns
Month 05 Day 06 Year 10

GENERATOR

INT'L

TRANSPORTER

DESIGNATED FACILITY

EPA Form 8700-22 (Rev. 3-05) Previous editions are obsolete.

TRANSPORTER'S COPY

NO. 191117

CLEANHARBORS BUTTONWILLOW, LLC
WEIGHMASTER CERTIFICATE

3:00 PM 05/06/10
REG. (64)
INBOUND 81460 lb

THIS IS TO CERTIFY that the following described commodity was weighed, measured, or counted by a weighmaster whose signature is on this certificate, who is a recognized authority of accuracy, as prescribed in Chapter 7 (commencing with Section12700) of Division 5 of the California Business and Professions Code, administered by the Division of Measurement Standards of the California Department of Food and Agiculture.

WEIGHMASTER CLEANHARBORS BUTTONWILLOW, LLC

PROFILE NO.	04120795 13	GROSS WT. BY: DEPUTY	DATE 05 06 10
DISPOSAL LOCATION	35 3-27 F05	TARE WT. BY: DEPUTY	DATE 050610
DRIVER'S NAME PRINTED	Victor Hugo Corona	WEIGHING LOCATION:	2500 W. LOKERN ROAD BUTTONWILLOW, CA 93206
DRIVER'S NAME SIGNATURE	Victor C.	GENERATOR	City of Santa Barbara
TRACTOR NO.	005	TRANSPORTER	CORMA
TRACTOR LIC. NO.	9E 25790	MANIFEST NO.	004774165556
TRAILER LIC. NO.	4HH2827	SERVICE ORDER NO.	2W2573366
BIN NUMBERS:		BIN TRACKING	

3:21 PM 05/06/10
REG. (64)

81460 lb GROSS
34640 lb TARE
46820 lb NET

☒ END DUMP ☐ TRANSFER ☐ VACUUM ☐ VAN
☐ ROLL OFF _____ ☐ FLAT BED ☐ _____

VIS	pH	SUL	CYA	OX	FL	FLASH	20%	
OTHER:								

IC	CR	PR	B.W. W.B.	LAB	SOLID BULK	WORK SHEET	LAND TRACK	W.T. SCAN	MAN-SCAN	RE-SCAN

DRUM NUMBER:

COMMENTS:

BIN DROP FULL:

MOVE BIN TO: DATE: BY:

REVISED (3/10)

Please print or type. (Form designed for use on elite (12-pitch) typewriter.)

Form Approved. OMB No. 2050-0039

UNIFORM HAZARDOUS WASTE MANIFEST

1. Generator ID Number: CA 0 0 2 6 5 0 4 0 6
2. Page 1 of
3. Emergency Response Phone: (661) 746-1132
4. Manifest Tracking Number: 004744166 JJK

5. Generator's Name and Mailing Address
City Of Santa Barbara
PO BOX 1990
Santa Barbara, CA 93102
Generator's Phone: (805) 641-1000 x 23

Generator's Site Address (if different than mailing address)
123 State Street
Santa Barbara, CA 93101

6. Transporter 1 Company Name: F + H TRUCKING
U.S. EPA ID Number: CAR000184812

7. Transporter 2 Company Name
U.S. EPA ID Number

8. Designated Facility Name and Site Address
Clean Harbors Buttonwillow
2500 West Lokern Road
Buttonwillow, CA 93206
Facility's Phone: (661) 762-6200
U.S. EPA ID Number: CAD 9 8 0 6 7 5 2 7 6

9a. HM	9b. U.S. DOT Description (including Proper Shipping Name, Hazard Class, ID Number, and Packing Group (if any))	10. Containers No.	10. Containers Type	11. Total Quantity	12. Unit Wt./Vol.	13. Waste Codes
	1. Non, Non-RCRA Hazardous Waste, Solid, N/A	001	DT	00018	Y	611
	2.					
	3.					
	4.					

14. Special Handling Instructions and Additional Information
Profile # CEH4207952
Sales Order # TW2873366
Lic. 9E3045 6

15. **GENERATOR'S/OFFEROR'S CERTIFICATION:** I hereby declare that the contents of this consignment are fully and accurately described above by the proper shipping name, and are classified, packaged, marked and labeled/placarded, and are in all respects in proper condition for transport according to applicable international and national governmental regulations. If export shipment and I am the Primary Exporter, I certify that the contents of this consignment conform to the terms of the attached EPA Acknowledgment of Consent.
I certify that the waste minimization statement identified in 40 CFR 262.27(a) (if I am a large quantity generator) or (b) (if I am a small quantity generator) is true. 72.94

Generator's/Offeror's Printed/Typed Name: Gene Acuna
Signature: Gene Acuna
Month 5 Day 5 Year 10

GENERATOR

INT'L

16. International Shipments ☐ Import to U.S. ☐ Export from U.S. Port of entry/exit:
Transporter signature (for exports only): Date leaving U.S.:

TRANSPORTER

17. Transporter Acknowledgment of Receipt of Materials
Transporter 1 Printed/Typed Name: Fredy A. Monroy
Signature: Fredy A. Monroy
Month 5 Day 6 Year 10
Transporter 2 Printed/Typed Name
Signature
Month Day Year

DESIGNATED FACILITY

18. Discrepancy
18a. Discrepancy Indication Space ☐ Quantity ☐ Type ☐ Residue ☐ Partial Rejection ☐ Full Rejection
Manifest Reference Number:
18b. Alternate Facility (or Generator)
U.S. EPA ID Number
Facility's Phone:
18c. Signature of Alternate Facility (or Generator)
Month Day Year

19. Hazardous Waste Report Management Method Codes (i.e., codes for hazardous waste treatment, disposal, and recycling systems)
1. H132
2.
3.
4.

20. Designated Facility Owner or Operator: Certification of receipt of hazardous materials covered by the manifest except as noted in Item 18a
Printed/Typed Name: Donald E Johns
Signature: Donald E Johns
Month 05 Day 06 Year 10

EPA Form 8700-22 (Rev. 3-05) Previous editions are obsolete.

TRANSPORTER'S COPY

NO. 191115

CLEANHARBORS BUTTONWILLOW, LLC
WEIGHMASTER CERTIFICATE

2:52 PM 05/06/10
REC. (57)
INBOUND 81720 lb

THIS IS TO CERTIFY that the following described commodity was weighed, measured, or counted by a weighmaster whose signature is on this certificate, who is a recognized authority of accuracy, as prescribed in Chapter 7 (commencing with Section12700) of Division 5 of the California Business and Professions Code, administered by the Division of Measurement Standards of the California Department of Food and Agiculture.

WEIGHMASTER CLEANHARBORS BUTTONWILLOW, LLC

3:15 PM 05/06/10
REC. (57)

81720 lb GROSS
30300 lb TARE
51420 lb NET

PROFILE NO.	CH42075SB	GROSS WT. BY: DEPUTY	DATE 5-06-10
DISPOSAL LOCATION	35-3-22 E 05	TARE WT. BY: DEPUTY	DATE 05-06-10
DRIVER'S NAME PRINTED	Fredy N. Monroy	WEIGHING LOCATION:	2500 W. LOKERN ROAD BUTTONWILLOW, CA 93206
DRIVER'S NAME SIGNATURE	Fredy N. Monroy	GENERATOR	City of Santa Barbara
TRACTOR NO.	007	TRANSPORTER	P.H
TRACTOR LIC. NO.	9E30456	MANIFEST NO.	004744166JJK
TRAILER LIC. NO.	4FC7984	SERVICE ORDER NO.	702873366
BIN NUMBERS:		BIN TRACKING	

☒ END DUMP ☐ TRANSFER ☐ VACUUM ☐ VAN
☐ ROLL OFF - _____ ☐ FLAT BED ☐ _____

VIS	pH	SUL	CYA	OX	FL	FLASH	20%	
+							Y	
OTHER:								

IC	CR	PR	B.W. W.B.	LAB	SOLID BULK	WORK SHEET	LAND TRACK	W.T. SCAN	MAN-SCAN	RE-SCAN

DRUM NUMBER:

COMMENTS:

BIN DROP FULL:

MOVE BIN TO: DATE: BY:

REVISED (3/10)

Please print or type. (Form designed for use on elite (12-pitch) typewriter)

Form Approved. OMB No. 2050-0039

UNIFORM HAZARDOUS WASTE MANIFEST

1. Generator ID Number: CAC002650488
2. Page 1 of
3. Emergency Response Phone: (661) 746-1132
4. Manifest Tracking Number: 004744152 JJK

5. Generator's Name and Mailing Address
City Of Santa Barbara
PO BOX 1990
Santa Barbara, CA 93102
Generator's Phone: (805) 641-1000 x 23

Generator's Site Address (if different than mailing address)
123 State Street
Santa Barbara, CA 93101

6. Transporter 1 Company Name: Santa Fe Trucking
U.S. EPA ID Number: CAR000168799

7. Transporter 2 Company Name
U.S. EPA ID Number

8. Designated Facility Name and Site Address
Clean Harbors Buttonwillow
2300 West Lokern Road
Buttonwillow, CA 93206
Facility's Phone: (661) 762-6200
U.S. EPA ID Number: FAD980675276

9a. HM	9b. U.S. DOT Description (including Proper Shipping Name, Hazard Class, ID Number, and Packing Group (if any))	10. Containers No.	10. Containers Type	11. Total Quantity	12. Unit Wt./Vol.	13. Waste Codes
	1. Non, Non-RCRA Hazardous Waste, Solid, N/A	001	DT	00018	Y	611
	2.					
	3.					
	4.					

14. Special Handling Instructions and Additional Information
Profile #: CH420795B
Sales Order #: TW2873366

15. **GENERATOR'S/OFFEROR'S CERTIFICATION:** I hereby declare that the contents of this consignment are fully and accurately described above by the proper shipping name, and are classified, packaged, marked and labeled/placarded, and are in all respects in proper condition for transport according to applicable international and national governmental regulations. If export shipment and I am the Primary Exporter, I certify that the contents of this consignment conform to the terms of the attached EPA Acknowledgment of Consent.
I certify that the waste minimization statement identified in 40 CFR 262.27(a) (if I am a large quantity generator) or (b) (if I am a small quantity generator) is true. 2511

Generator's/Offeror's Printed/Typed Name: Gene Arnold
Signature
Month Day Year: 05 07 10

GENERATOR

INT'L

16. International Shipments ☐ Import to U.S. ☐ Export from U.S. Port of entry/exit:
Transporter signature (for exports only): Date leaving U.S.:

TRANSPORTER

17. Transporter Acknowledgment of Receipt of Materials
Transporter 1 Printed/Typed Name: Santiago Ruiz
Signature
Month Day Year: 05 07 10
Transporter 2 Printed/Typed Name
Signature
Month Day Year

DESIGNATED FACILITY

18. Discrepancy
18a. Discrepancy Indication Space ☐ Quantity ☐ Type ☐ Residue ☐ Partial Rejection ☐ Full Rejection
Manifest Reference Number:
18b. Alternate Facility (or Generator)
U.S. EPA ID Number
Facility's Phone:
18c. Signature of Alternate Facility (or Generator)
Month Day Year

19. Hazardous Waste Report Management Method Codes (i.e., codes for hazardous waste treatment, disposal, and recycling systems)
1. H132 2. 3. 4.

20. Designated Facility Owner or Operator: Certification of receipt of hazardous materials covered by the manifest except as noted in Item 18a
Printed/Typed Name
Signature
Month Day Year

EPA Form 8700-22 (Rev. 3-05) Previous editions are obsolete.

TRANSPORTER'S COPY

NO. 191159

CLEANHARBORS BUTTONWILLOW, LLC
WEIGHMASTER CERTIFICATE

1:36 PM 05/07/10
REC. (55)
INBOUND 82100 lb

THIS IS TO CERTIFY that the following described commodity was weighed, measured, or counted by a weighmaster whose signature is on this certificate, who is a recognized authority of accuracy, as prescribed in Chapter 7 (commencing with Section12700) of Division 5 of the California Business and Professions Code, administered by the Division of Measurement Standards of the California Department of Food and Agiculture.

WEIGHMASTER CLEANHARBORS BUTTONWILLOW, LLC

PROFILE NO.	CA420 7553	GROSS WT. BY: DEPUTY	DATE 05 07 10
DISPOSAL LOCATION	35-3 22 E-05	TARE WT. BY: DEPUTY	DATE 05 07 10
DRIVER'S NAME PRINTED	Santiago Ruiz	WEIGHING LOCATION:	2500 W. LOKERN ROAD BUTTONWILLOW, CA 93206
DRIVER'S NAME SIGNATURE	Ruiz	GENERATOR	City of Santa Barbara
TRACTOR NO.	SFT2-T55	TRANSPORTER	Santa Fe
TRACTOR LIC. NO.	9E18117	MANIFEST NO.	004744152 JJK
TRAILER LIC. NO.	9E18117	SERVICE ORDER NO.	7W2873366
BIN NUMBERS:		BIN TRACKING	

1:56 PM 05/07/10
REC. (55)

82100 lb GROSS
31880 lb TARE
50220 lb NET

☒ END DUMP ☐ TRANSFER ☐ VACUUM ☐ VAN
☐ ROLL OFF - _____ ☐ FLAT BED ☐ _____

VIS	pH	SUL	CYA	OX	FL	FLASH	20%	
+	—	—	—	—	—	—	>	
OTHER:								

IC	CR	PR	B.W. W.B.	LAB	SOLID BULK	WORK SHEET	LAND TRACK	W.T. SCAN	MAN-SCAN	RE-SCAN

DRUM NUMBER:

COMMENTS:

BIN DROP FULL:

MOVE BIN TO: DATE: BY:

REVISED (3/10)

Please print or type. (Form designed for use on elite (12-pitch) typewriter.)

Form Approved. OMB No. 2050-0039

UNIFORM HAZARDOUS WASTE MANIFEST

1. Generator ID Number: C A C 0 0 2 6 5 0 4 8 8
2. Page 1 of
3. Emergency Response Phone: (661) 746-1132
4. Manifest Tracking Number: 00474415 3 JJK

5. Generator's Name and Mailing Address: City Of Santa Barbara, PO BOX 1990, Santa Barbara, CA 93102
Generator's Phone: (805) 641-1000 x 23
Generator's Site Address (if different than mailing address): 125 State Street, Santa Barbara, CA 93101

6. Transporter 1 Company Name: Lopez Transport
U.S. EPA ID Number: CAR 000 172914

7. Transporter 2 Company Name:
U.S. EPA ID Number:

8. Designated Facility Name and Site Address: Clean Harbors Buttonwillow, 2500 West Lokern Road, Buttonwillow, CA 93206
Facility's Phone: (661) 762-6200
U.S. EPA ID Number: C A D 9 8 0 6 7 5 2 7 6

9a. HM	9b. U.S. DOT Description (including Proper Shipping Name, Hazard Class, ID Number, and Packing Group (if any))	10. Containers No.	10. Containers Type	11. Total Quantity	12. Unit Wt./Vol.	13. Waste Codes
	1. None, Non-RCRA Hazardous Waste, Solid, N/A	001	DT	00018	Y	611
	2.					
	3.					
	4.					

14. Special Handling Instructions and Additional Information: #01 9D12638
Profile #: CH420795B
Sales Order #: 7W2873366

15. GENERATOR'S/OFFEROR'S CERTIFICATION: I hereby declare that the contents of this consignment are fully and accurately described above by the proper shipping name, and are classified, packaged, marked and labeled/placarded, and are in all respects in proper condition for transport according to applicable international and national governmental regulations. If export shipment and I am the Primary Exporter, I certify that the contents of this consignment conform to the terms of the attached EPA Acknowledgment of Consent.
I certify that the waste minimization statement identified in 40 CFR 262.27(a) (if I am a large quantity generator) or (b) (if I am a small quantity generator) is true.

Generator's/Offeror's Printed/Typed Name: Cenen Aparicio
Signature: Cenen Aparicio
Month 5 Day 7 Year 10

16. International Shipments ☐ Import to U.S. ☐ Export from U.S. Port of entry/exit:
Transporter signature (for exports only): Date leaving U.S.:

17. Transporter Acknowledgment of Receipt of Materials
Transporter 1 Printed/Typed Name: Jorge Lopez
Signature: Jorge Lopez
Month 5 Day 7 Year 10
Transporter 2 Printed/Typed Name:
Signature:
Month Day Year

18. Discrepancy
18a. Discrepancy Indication Space ☐ Quantity ☐ Type ☐ Residue ☐ Partial Rejection ☐ Full Rejection
Manifest Reference Number:
18b. Alternate Facility (or Generator)
U.S. EPA ID Number
Facility's Phone:
18c. Signature of Alternate Facility (or Generator)
Month Day Year

19. Hazardous Waste Report Management Method Codes (i.e., codes for hazardous waste treatment, disposal, and recycling systems)
1. H132 2. 3. 4.

20. Designated Facility Owner or Operator: Certification of receipt of hazardous materials covered by the manifest except as noted in Item 18a
Printed/Typed Name:
Signature:
Month Day Year 05 07 10

GENERATOR — INT'L — TRANSPORTER — DESIGNATED FACILITY

EPA Form 8700-22 (Rev. 3-05) Previous editions are obsolete.

DESIGNATED FACILITY TO DESTINATION STATE (IF REQUIRED)

NO. 191156

CLEANHARBORS BUTTONWILLOW, LLC
WEIGHMASTER CERTIFICATE

1:28 PM 05/07/10
REG. (41)
INBOUND 79940 lb

THIS IS TO CERTIFY that the following described commodity was weighed, measured, or counted by a weighmaster whose signature is on this certificate, who is a recognized authority of accuracy, as prescribed in Chapter 7 (commencing with Section 12700) of Division 5 of the California Business and Professions Code, administered by the Division of Measurement Standards of the California Department of Food and Agriculture.

WEIGHMASTER CLEANHARBORS BUTTONWILLOW, LLC

1:45 PM 05/07/10
REG. (41)

79940 lb GROSS
29920 lb TARE
50020 lb NET

PROFILE NO.	Cty20755P	GROSS WT. BY: DEPUTY	DATE 05 07
DISPOSAL LOCATION	35-3-22 E 05	TARE WT. BY: DEPUTY	DATE 05 07
DRIVER'S NAME PRINTED	Jorge lopez	WEIGHING LOCATION:	2500 W. LOKERN ROAD BUTTONWILLOW, CA 93206
DRIVER'S NAME SIGNATURE	Jorge Lopez	GENERATOR	City of Santa Ana
TRACTOR NO.	01	TRANSPORTER	Lopez
TRACTOR LIC. NO.	9D12638	MANIFEST NO.	004744153JJK
TRAILER LIC. NO.	TH	SERVICE ORDER NO.	2W2873366
BIN NUMBERS:		BIN TRACKING	

☒ END DUMP ☐ TRANSFER ☐ VACUUM ☐ VAN
☐ ROLL OFF - _____ ☐ FLAT BED ☐ _____

VIS	pH	SUL	CYA	OX	FL	FLASH	20%	
+	8.04	–	–		M	M		
OTHER:								

IC	CR	PR	B.W. W.B.	LAB	SOLID BULK	WORK SHEET	LAND TRACK	W.T. SCAN	MAN-SCAN	RE-SCAN
25	✓	✓			✓	✓		✓	✓	

DRUM NUMBER: 21173500

COMMENTS:

BIN DROP FULL:

MOVE BIN TO: DATE: BY:

REVISED 0/1

Please print or type. (Form designed for use on elite (12-pitch) typewriter.)

Form Approved. OMB No. 2050-0039

UNIFORM HAZARDOUS WASTE MANIFEST

1. Generator ID Number: CAC000350488
2. Page 1 of
3. Emergency Response Phone: (661) 746-1132
4. Manifest Tracking Number: 004744154 JJK

5. Generator's Name and Mailing Address: City Of Santa Barbara, PO BOX 1990, Santa Barbara, CA 93102
Generator's Phone: (805) 641-1000 x 23
Generator's Site Address (if different than mailing address): 125 State Street, Santa Barbara, CA 93101

6. Transporter 1 Company Name: Guzman & Trucking — U.S. EPA ID Number: CAD000171715

7. Transporter 2 Company Name — U.S. EPA ID Number:

8. Designated Facility Name and Site Address: Clean Harbors Buttonwillow, 2500 West Lokern Road, Buttonwillow, CA 93206
Facility's Phone: (661) 762-6200
U.S. EPA ID Number: CAD980673276

9a. HM	9b. U.S. DOT Description (including Proper Shipping Name, Hazard Class, ID Number, and Packing Group (if any))	10. Containers No.	10. Containers Type	11. Total Quantity	12. Unit Wt./Vol.	13. Waste Codes
	1. None, Non-RCRA Hazardous Waste, Solid, N/A	001	DT	00010	Y	611
	2.					
	3.					
	4.					

14. Special Handling Instructions and Additional Information
Profile #: CH49[illegible]95B
Sales Order #: [illegible]2873365

15. **GENERATOR'S/OFFEROR'S CERTIFICATION:** I hereby declare that the contents of this consignment are fully and accurately described above by the proper shipping name, and are classified, packaged, marked and labeled/placarded, and are in all respects in proper condition for transport according to applicable international and national governmental regulations. If export shipment and I am the Primary Exporter, I certify that the contents of this consignment conform to the terms of the attached EPA Acknowledgment of Consent.
I certify that the waste minimization statement identified in 40 CFR 262.27(a) (if I am a large quantity generator) or (b) (if I am a small quantity generator) is true.

Generator's/Offeror's Printed/Typed Name: Cenen Moreno — Signature: [signature] — Month 05 Day 07 Year 10

16. International Shipments ☐ Import to U.S. ☐ Export from U.S. Port of entry/exit:
Transporter signature (for exports only): Date leaving U.S.:

17. Transporter Acknowledgment of Receipt of Materials
Transporter 1 Printed/Typed Name: Angel D Guzman — Signature: Angel G — Month 05 Day 07 Year 10
Transporter 2 Printed/Typed Name — Signature — Month Day Year

18. Discrepancy
18a. Discrepancy Indication Space ☐ Quantity ☐ Type ☐ Residue ☐ Partial Rejection ☐ Full Rejection
Manifest Reference Number:

18b. Alternate Facility (or Generator) — U.S. EPA ID Number
Facility's Phone:

18c. Signature of Alternate Facility (or Generator) — Month Day Year

19. Hazardous Waste Report Management Method Codes (i.e., codes for hazardous waste treatment, disposal, and recycling systems)
1. H32 2. 3. 4.

20. Designated Facility Owner or Operator: Certification of receipt of hazardous materials covered by the manifest except as noted in Item 18a
Printed/Typed Name — Signature — Month Day Year

GENERATOR — INT'L — TRANSPORTER — DESIGNATED FACILITY

EPA Form 8700-22 (Rev. 3-05) Previous editions are obsolete.

TRANSPORTER'S COPY

NO. 191158

CLEANHARBORS BUTTONWILLOW, LLC
WEIGHMASTER CERTIFICATE

1:53 PM 05/07/10
REG. (46)
INBOUND 86160 lb

THIS IS TO CERTIFY that the following described commodity was weighed, measured, or counted by a weighmaster whose signature is on this certificate, who is a recognized authority of accuracy, as prescribed in Chapter 7 (commencing with Section12700) of Division 5 of the California Business and Professions Code, administered by the Division of Measurement Standards of the California Department of Food and Agiculture.

WEIGHMASTER CLEANHARBORS BUTTONWILLOW, LLC

PROFILE NO.	CA4207553	GROSS WT. BY: DEPUTY	DATE 5 07 10
DISPOSAL LOCATION	55-3-22 E 05	TARE WT. BY: DEPUTY	DATE 5/7/10
DRIVER'S NAME PRINTED	Paul O Cure	WEIGHING LOCATION:	2500 W. LOKERN ROAD BUTTONWILLOW, CA 93206
DRIVER'S NAME SIGNATURE	Paul O C	GENERATOR	City of Santa Barbara
TRACTOR NO.	1	TRANSPORTER	Guzman
TRACTOR LIC. NO.	9E15097	MANIFEST NO.	00474154 JRC
TRAILER LIC. NO.	4CT3012	SERVICE ORDER NO.	2N2873366
BIN NUMBERS:		BIN TRACKING	

1:52 PM 05/07/10
REG. (46)
86160 lb GROSS
32160 lb TARE
54000 lb NET

☒ END DUMP ☐ TRANSFER ☐ VACUUM ☐ VAN
☐ ROLL OFF - _____ ☐ FLAT BED ☐ _____

VIS	pH	SUL	CYA	OX	FL	FLASH	20%	
+	808	–	–		N	N		
OTHER:								

IC	CR	PR	B.W. W.B.	LAB	SOLID BULK	WORK SHEET	LAND TRACK	W.T. SCAN	MAN-SCAN	RE-SCAN

DRUM NUMBER:

COMMENTS:

BIN DROP FULL:

MOVE BIN TO: DATE: BY:

REVISED (3/10)

Please print or type. (Form designed for use on elite (12-pitch) typewriter.) Form Approved. OMB No. 2050-0039

UNIFORM HAZARDOUS WASTE MANIFEST

1. Generator ID Number: CAC000265048 8
2. Page 1 of
3. Emergency Response Phone: (661) 746-1132
4. Manifest Tracking Number: 004744155 JJK

5. Generator's Name and Mailing Address: City Of Santa Barbara, PO BOX 1990, Santa Barbara, CA 93102
Generator's Phone: (805) 641-1000 x 23
Generator's Site Address (if different than mailing address): 123 State Street, Santa Barbara, CA 93101

6. Transporter 1 Company Name: M & H TRUCKING
U.S. EPA ID Number: CAF000174706

7. Transporter 2 Company Name:
U.S. EPA ID Number:

8. Designated Facility Name and Site Address: Clean Harbors Buttonwillow, 2300 West Lokern Road, Buttonwillow, CA 93206
Facility's Phone: (661) 762-6200
U.S. EPA ID Number: CAD982067276

9a. HM	9b. U.S. DOT Description (including Proper Shipping Name, Hazard Class, ID Number, and Packing Group (if any))	10. Containers No.	10. Containers Type	11. Total Quantity	12. Unit Wt./Vol.	13. Waste Codes
	1. Non, Non-RCRA Hazardous Waste, Solid, NOS	001	DT	00018	Y	411
	2.					
	3.					
	4.					

14. Special Handling Instructions and Additional Information
Profile#: CH420795B
Sales Order #: 7W2873366

15. **GENERATOR'S/OFFEROR'S CERTIFICATION:** I hereby declare that the contents of this consignment are fully and accurately described above by the proper shipping name, and are classified, packaged, marked and labeled/placarded, and are in all respects in proper condition for transport according to applicable international and national governmental regulations. If export shipment and I am the Primary Exporter, I certify that the contents of this consignment conform to the terms of the attached EPA Acknowledgment of Consent.
I certify that the waste minimization statement identified in 40 CFR 262.27(a) (if I am a large quantity generator) or (b) (if I am a small quantity generator) is true.

Generator's/Offeror's Printed/Typed Name: Lenen Aparicio
Signature: Lenen Aparicio
Month 5 Day 5 Year 10

16. International Shipments ☐ Import to U.S. ☐ Export from U.S. Port of entry/exit:
Transporter signature (for exports only): Date leaving U.S.:

17. Transporter Acknowledgment of Receipt of Materials
Transporter 1 Printed/Typed Name: JESUS MARCOS
Signature:
Month 5 Day 07 Year 10
Transporter 2 Printed/Typed Name:
Signature:
Month Day Year

18. Discrepancy
18a. Discrepancy Indication Space ☐ Quantity ☐ Type ☐ Residue ☐ Partial Rejection ☐ Full Rejection
Manifest Reference Number:

18b. Alternate Facility (or Generator)
U.S. EPA ID Number
Facility's Phone:

18c. Signature of Alternate Facility (or Generator)
Month Day Year

19. Hazardous Waste Report Management Method Codes (i.e., codes for hazardous waste treatment, disposal, and recycling systems)
1. H132 2. 3. 4.

20. Designated Facility Owner or Operator: Certification of receipt of hazardous materials covered by the manifest except as noted in Item 18a
Printed/Typed Name:
Signature:
Month Day Year

GENERATOR — INT'L — TRANSPORTER — DESIGNATED FACILITY

EPA Form 8700-22 (Rev. 3-05) Previous editions are obsolete.

TRANSPORTER'S COPY

NO. 191157

CLEANHARBORS BUTTONWILLOW, LLC
WEIGHMASTER CERTIFICATE

1:30 PM 05/07/10
REG. (45)
INBOUND 83660 lb

THIS IS TO CERTIFY that the following described commodity was weighed, measured, or counted by a weighmaster whose signature is on this certificate, who is a recognized authority of accuracy, as prescribed in Chapter 7 (commencing with Section12700) of Division 5 of the California Business and Professions Code, administered by the Division of Measurement Standards of the California Department of Food and Agiculture.

WEIGHMASTER CLEANHARBORS BUTTONWILLOW, LLC

1:48 PM 05/07/10
REG. (45)

83660 lb GROSS
30120 lb TARE
53540 lb NET

PROFILE NO.	Ct4207955B	GROSS WT. BY: DEPUTY	DATE 05 07 10
DISPOSAL LOCATION	35-3-22 E 05	TARE WT. BY: DEPUTY	DATE 05 07 10
DRIVER'S NAME PRINTED	JESUS MIRELES	WEIGHING LOCATION:	2500 W. LOKERN ROAD BUTTONWILLOW, CA 93206
DRIVER'S NAME SIGNATURE		GENERATOR	City of Santa Barbara
TRACTOR NO.	24	TRANSPORTER	M. H
TRACTOR LIC. NO.	MBF28	MANIFEST NO.	CA4744155JK
TRAILER LIC. NO.	4DN4710	SERVICE ORDER NO.	7W2873366
BIN NUMBERS:		BIN TRACKING	

☒ END DUMP ☐ TRANSFER ☐ VACUUM ☐ VAN
☐ ROLL OFF - _____ ☐ FLAT BED ☐ _____

VIS	pH	SUL	CYA	OX	FL	FLASH	20%	
+	8.08	–	–		Y	N		
OTHER:								

IC	CR	PR	B.W. W.B.	LAB	SOLID BULK	WORK SHEET	LAND TRACK	W.T. SCAN	MAN-SCAN	RE-SCAN

DRUM NUMBER:

COMMENTS:

BIN DROP FULL:

MOVE BIN TO: DATE: BY:

REVISED (3/10)

Please print or type. (Form designed for use on elite (12-pitch) typewriter.) Form Approved. OMB No. 2050-0039

UNIFORM HAZARDOUS WASTE MANIFEST

1. Generator ID Number: CAC000265048 8
2. Page 1 of
3. Emergency Response Phone: (661) 746-1132
4. Manifest Tracking Number: 004744164 JJK

5. Generator's Name and Mailing Address
City Of Santa Barbara
PO BOX 1990
Santa Barbara, CA 93102
Generator's Phone: (805) 641-1000 x 23

Generator's Site Address (if different than mailing address)
123 State Street
Santa Barbara, CA 93101

6. Transporter 1 Company Name: REGIONAL TRANSPORTATION SERVICE
U.S. EPA ID Number: CAR000181560

7. Transporter 2 Company Name
U.S. EPA ID Number

8. Designated Facility Name and Site Address
Clean Harbors Buttonwillow
2300 West Lokern Road
Buttonwillow, CA 93206
Facility's Phone: (661) 762-6300
U.S. EPA ID Number: CAD983067276

9a. HM	9b. U.S. DOT Description (including Proper Shipping Name, Hazard Class, ID Number, and Packing Group (if any))	10. Containers No.	10. Containers Type	11. Total Quantity	12. Unit Wt./Vol.	13. Waste Codes
	1. None, Non-RCRA Hazardous Waste, Solid, N/A	001	DT	00010	T	611
	2.					
	3.					
	4.					

14. Special Handling Instructions and Additional Information
Profile #: CH420795B
Sales Order #: TW2873366
R-24 TPO 3174

15. **GENERATOR'S/OFFEROR'S CERTIFICATION:** I hereby declare that the contents of this consignment are fully and accurately described above by the proper shipping name, and are classified, packaged, marked and labeled/placarded, and are in all respects in proper condition for transport according to applicable international and national governmental regulations. If export shipment and I am the Primary Exporter, I certify that the contents of this consignment conform to the terms of the attached EPA Acknowledgment of Consent.
I certify that the waste minimization statement identified in 40 CFR 262.27(a) (if I am a large quantity generator) or (b) (if I am a small quantity generator) is true.

Generator's/Offeror's Printed/Typed Name: [illegible] Signature: [signature] Month 5 Day 5 Year 10

INT'L
16. International Shipments ☒ Import to U.S. ☐ Export from U.S. Port of entry/exit:
Transporter signature (for exports only): Date leaving U.S.:

TRANSPORTER
17. Transporter Acknowledgment of Receipt of Materials
Transporter 1 Printed/Typed Name: ANGELO CAQUIAS Signature: [signature] Month 5 Day 7 Year 10
Transporter 2 Printed/Typed Name: Signature: Month Day Year

DESIGNATED FACILITY
18. Discrepancy
18a. Discrepancy Indication Space ☐ Quantity ☐ Type ☐ Residue ☐ Partial Rejection ☐ Full Rejection
Manifest Reference Number:
18b. Alternate Facility (or Generator) U.S. EPA ID Number
Facility's Phone:
18c. Signature of Alternate Facility (or Generator) Month Day Year
19. Hazardous Waste Report Management Method Codes (i.e., codes for hazardous waste treatment, disposal, and recycling systems)
1. H132 2. 3. 4.
20. Designated Facility Owner or Operator: Certification of receipt of hazardous materials covered by the manifest except as noted in Item 18a
Printed/Typed Name: Ronald E Johns Signature: [signature] Month 05 Day 07 Year 10

EPA Form 8700-22 (Rev. 3-05) Previous editions are obsolete. **TRANSPORTER'S COPY**

NO. 191150

CLEANHARBORS BUTTONWILLOW, LLC
WEIGHMASTER CERTIFICATE

12:58 PM 05/07/10
REG. (94)
INBOUND 84020 lb

THIS IS TO CERTIFY that the following described commodity was weighed, measured, or counted by a weighmaster whose signature is on this certificate, who is a recognized authority of accuracy, as prescribed in Chapter 7 (commencing with Section12700) of Division 5 of the California Business and Professions Code, administered by the Division of Measurement Standards of the California Department of Food and Agiculture.

WEIGHMASTER CLEANHARBORS BUTTONWILLOW, LLC

PROFILE NO.	CH420795B	GROSS WT. BY: DEPUTY	DATE 05 07 20
DISPOSAL LOCATION	35-3-22 F-05	TARE WT. BY: DEPUTY	DATE 050710
DRIVER'S NAME PRINTED	ANGELO CAQUIAS	WEIGHING LOCATION:	2500 W. LOKERN ROAD BUTTONWILLOW, CA 93206
DRIVER'S NAME SIGNATURE	Angelo Caquias	GENERATOR	City Santa Barbara
TRACTOR NO.	R-24	TRANSPORTER	RTS
TRACTOR LIC. NO.	TPD 3174	MANIFEST NO.	004744164JJK
TRAILER LIC. NO.	4CY 6740	SERVICE ORDER NO.	7W2873366
BIN NUMBERS:		BIN TRACKING	

1:16 PM 05/07/10
REG. (94)

84020 lb GROSS
31060 lb TARE
52960 lb NET

☒ END DUMP ☐ TRANSFER ☐ VACUUM ☐ VAN
☐ ROLL OFF - _____ ☐ FLAT BED ☐ _____

VIS	pH	SUL	CYA	OX	FL	FLASH	20%	
+	7.86	–	–		M	M		
OTHER:								

IC	CR	PR	B.W. W.B.	LAB	SOLID BULK	WORK SHEET	LAND TRACK	W.T. SCAN	MAN-SCAN	RE-SCAN

DRUM NUMBER:

COMMENTS:

BIN DROP FULL:

MOVE BIN TO: DATE: BY:

REVISED (3/10)

Please print or type. (Form designed for use on elite (12-pitch) typewriter.)

Form Approved. OMB No. 2050-0039

UNIFORM HAZARDOUS WASTE MANIFEST

1. Generator ID Number: CAC000265048
2. Page 1 of
3. Emergency Response Phone: (661) 746-1132
4. Manifest Tracking Number: **004744145 JJK**

5. Generator's Name and Mailing Address
City Of Santa Barbara
PO BOX 1990
Santa Barbara, CA 93102
Generator's Phone: (805) 641-1000 x 23

Generator's Site Address (if different than mailing address)
125 State Street
Santa Barbara, CA 93101

6. Transporter 1 Company Name: Remedial Transportation Services
U.S. EPA ID Number: CAR 000181560

7. Transporter 2 Company Name
U.S. EPA ID Number

8. Designated Facility Name and Site Address
Clean Harbors Buttonwillow
2300 West Lokern Road
Buttonwillow, CA 93206
Facility's Phone: (661) 762-6200
U.S. EPA ID Number: CAD980675276

9a. HM	9b. U.S. DOT Description (including Proper Shipping Name, Hazard Class, ID Number, and Packing Group (if any))	10. Containers No.	10. Containers Type	11. Total Quantity	12. Unit Wt./Vol.	13. Waste Codes
	1. None, Non-RCRA Hazardous Waste, Solid, N/A	001	DT	00018	Y	611
	2.					
	3.					
	4.					

14. Special Handling Instructions and Additional Information
Profile #: CH420795B
Sales Order #: 70W2873366

15. **GENERATOR'S/OFFEROR'S CERTIFICATION:** I hereby declare that the contents of this consignment are fully and accurately described above by the proper shipping name, and are classified, packaged, marked and labeled/placarded, and are in all respects in proper condition for transport according to applicable international and national governmental regulations. If export shipment and I am the Primary Exporter, I certify that the contents of this consignment conform to the terms of the attached EPA Acknowledgment of Consent.
I certify that the waste minimization statement identified in 40 CFR 262.27(a) (if I am a large quantity generator) or (b) (if I am a small quantity generator) is true.

Generator's/Offeror's Printed/Typed Name: Cenen Aparizio
Signature: Cenen Aparizio
Month 05 Day 10 Year 10

16. International Shipments ☐ Import to U.S. ☐ Export from U.S. Port of entry/exit:
Transporter signature (for exports only): Date leaving U.S.:

17. Transporter Acknowledgment of Receipt of Materials
Transporter 1 Printed/Typed Name: Jordan McWilliams
Signature: Jordan McWilliams
Month 05 Day 10 Year 10
Transporter 2 Printed/Typed Name
Signature
Month Day Year

18. Discrepancy
18a. Discrepancy Indication Space ☐ Quantity ☐ Type ☐ Residue ☐ Partial Rejection ☐ Full Rejection
Manifest Reference Number:

18b. Alternate Facility (or Generator)
U.S. EPA ID Number
Facility's Phone:

18c. Signature of Alternate Facility (or Generator)
Month Day Year

19. Hazardous Waste Report Management Method Codes (i.e., codes for hazardous waste treatment, disposal, and recycling systems)
1. H132 2. 3. 4.

20. Designated Facility Owner or Operator: Certification of receipt of hazardous materials covered by the manifest except as noted in Item 18a
Printed/Typed Name: Ronald E Johns
Signature: Ronald E Johns
Month 05 Day 10 Year 10

GENERATOR | INT'L | TRANSPORTER | DESIGNATED FACILITY

EPA Form 8700-22 (Rev. 3-05) Previous editions are obsolete.

TRANSPORTER'S COPY

NO. 191214

CLEANHARBORS BUTTONWILLOW, LLC
WEIGHMASTER CERTIFICATE

3:21 PM 05/10/10
REG. (46)
INBOUND 77560 lb

THIS IS TO CERTIFY that the following described commodity was weighed, measured, or counted by a weighmaster whose signature is on this certificate, who is a recognized authority of accuracy, as prescribed in Chapter 7 (commencing with Section12700) of Division 5 of the California Business and Professions Code, administered by the Division of Measurement Standards of the California Department of Food and Agiculture.

WEIGHMASTER CLEANHARBORS BUTTONWILLOW, LLC

3:36 PM 05/10/10
REG. (46)

77560 lb GROSS
31300 lb TARE
46260 lb NET

PROFILE NO.	CH4207552	GROSS WT. BY: DEPUTY	DATE 051010
DISPOSAL LOCATION	35-3-20 E 05	TARE WT. BY: DEPUTY	DATE 051010
DRIVER'S NAME PRINTED	Jordan Lee	WEIGHING LOCATION:	2500 W. LOKERN ROAD BUTTONWILLOW, CA 93206
DRIVER'S NAME SIGNATURE	Jordan Lee	GENERATOR	City of Santa Barbara
TRACTOR NO.	26	TRANSPORTER	RTS
TRACTOR LIC. NO.	TP03176	MANIFEST NO.	CU4744145 JJK
TRAILER LIC. NO.	4EK4816	SERVICE ORDER NO.	2W2873366
BIN NUMBERS:		BIN TRACKING	

☒ END DUMP ☐ TRANSFER ☐ VACUUM ☐ VAN

☐ ROLL OFF - _____ ☐ FLAT BED ☐ _____

VIS	pH	SUL	CYA	OX	FL	FLASH	20%	
+							✓	
OTHER:								

IC	CR	PR	B.W. W.B.	LAB	SOLID BULK	WORK SHEET	LAND TRACK	W.T. SCAN	MAN-SCAN	RE-SCAN
✓										

DRUM NUMBER:

COMMENTS:

BIN DROP FULL:

MOVE BIN TO: DATE: BY:

REVISED (3/10)

Please print or type. (Form designed for use on elite (12-pitch) typewriter.)

Form Approved. OMB No. 2050-0039

UNIFORM HAZARDOUS WASTE MANIFEST

1. Generator ID Number: C A C 0 0 2 6 5 0 4 8 8
2. Page 1 of
3. Emergency Response Phone: (661) 746-1132
4. Manifest Tracking Number: 00474446 JJK

GENERATOR

5. Generator's Name and Mailing Address
City Of Santa Barbara
PO BOX 1990
Santa Barbara, CA 93102
Generator's Phone: (805) 641-1000 x 23

Generator's Site Address (if different than mailing address)
123 State Street
Santa Barbara, CA 93101

6. Transporter 1 Company Name: REMEDIAL TRANSPORTATION SERVICE
U.S. EPA ID Number: CAR000181520

7. Transporter 2 Company Name
U.S. EPA ID Number

8. Designated Facility Name and Site Address
Clean Harbors Buttonwillow
2500 West Lokern Road
Buttonwillow, CA 93206
Facility's Phone: (661) 762-6200
U.S. EPA ID Number: C A D 9 8 0 6 7 5 2 7 6

9a. HM	9b. U.S. DOT Description (including Proper Shipping Name, Hazard Class, ID Number, and Packing Group (if any))	10. Containers No.	10. Containers Type	11. Total Quantity	12. Unit Wt./Vol.	13. Waste Codes		
	1. Non, Non-RCRA Hazardous Waste, Solid, N/A	001	DT	00018	Y	611		
	2.							
	3.							
	4.							

14. Special Handling Instructions and Additional Information
Profile #: CH420795B
Sales Order #: 7W2073366
R-24 TP03174

15. **GENERATOR'S/OFFEROR'S CERTIFICATION:** I hereby declare that the contents of this consignment are fully and accurately described above by the proper shipping name, and are classified, packaged, marked and labeled/placarded, and are in all respects in proper condition for transport according to applicable international and national governmental regulations. If export shipment and I am the Primary Exporter, I certify that the contents of this consignment conform to the terms of the attached EPA Acknowledgment of Consent.
I certify that the waste minimization statement identified in 40 CFR 262.27(a) (if I am a large quantity generator) or (b) (if I am a small quantity generator) is true. 2503

Generator's/Offeror's Printed/Typed Name: Conan Aparicio
Signature: Conan Aparicio
Month 5 Day 10 Year 10

INT'L

16. International Shipments ☐ Import to U.S. ☐ Export from U.S. Port of entry/exit:
Transporter signature (for exports only): Date leaving U.S.:

TRANSPORTER

17. Transporter Acknowledgment of Receipt of Materials
Transporter 1 Printed/Typed Name: ANGELO CAPRIAS
Signature: Angelo Capriias
Month 5 Day 10 Year 10
Transporter 2 Printed/Typed Name
Signature
Month Day Year

DESIGNATED FACILITY

18. Discrepancy
18a. Discrepancy Indication Space ☐ Quantity ☐ Type ☐ Residue ☐ Partial Rejection ☐ Full Rejection
Manifest Reference Number:
18b. Alternate Facility (or Generator)
U.S. EPA ID Number
Facility's Phone:
18c. Signature of Alternate Facility (or Generator)
Month Day Year

19. Hazardous Waste Report Management Method Codes (i.e., codes for hazardous waste treatment, disposal, and recycling systems)
1. H132 2. 3. 4.

20. Designated Facility Owner or Operator: Certification of receipt of hazardous materials covered by the manifest except as noted in Item 18a
Printed/Typed Name: Ronald E Johns
Signature: Ronald E Johns
Month 05 Day 10 Year 10

EPA Form 8700-22 (Rev. 3-05) Previous editions are obsolete.

TRANSPORTER'S COPY

NO. 191212

CLEANHARBORS BUTTONWILLOW, LLC
WEIGHMASTER CERTIFICATE

2:52 PM 05/10/10
REG. (31)
INBOUND 81660 lb

THIS IS TO CERTIFY that the following described commodity was weighed, measured, or counted by a weighmaster whose signature is on this certificate, who is a recognized authority of accuracy, as prescribed in Chapter 7 (commencing with Section12700) of Division 5 of the California Business and Professions Code, administered by the Division of Measurement Standards of the California Department of Food and Agiculture.

WEIGHMASTER CLEANHARBORS BUTTONWILLOW, LLC

PROFILE NO.	0642075B	GROSS WT. BY:	DEPUTY DATE 05/10/10
DISPOSAL LOCATION	55-20-E-10	TARE WT. BY:	DEPUTY DATE 05/10/10
DRIVER'S NAME PRINTED	ANGELO CAQUIAS	WEIGHING LOCATION:	2500 W. LOKERN ROAD BUTTONWILLOW, CA 93206
DRIVER'S NAME SIGNATURE	Angelo Caquias	GENERATOR	City of Santa Barbara
TRACTOR NO.	R-24	TRANSPORTER	RTS
TRACTOR LIC. NO.	TPO 3174	MANIFEST NO.	004744465JK
TRAILER LIC. NO.	4C46740	SERVICE ORDER NO.	7W2873366
BIN NUMBERS:		BIN TRACKING	

3:15 PM 05/10/10
REG. (31)

81660 lb GROSS
31600 lb TARE
50060 lb NET

☒ END DUMP ☐ TRANSFER ☐ VACUUM ☐ VAN
☐ ROLL OFF - _____ ☐ FLAT BED ☐ _____

VIS	pH	SUL	CYA	OX	FL	FLASH	20%	
+							✓	

OTHER:

	CR	PR	B.W. W.B.	LAB	SOLID BULK	WORK SHEET	LAND TRACK	W.T. SCAN	MAN-SCAN	RE-SCAN

DRUM NUMBER:

COMMENTS:

BIN DROP FULL:

MOVE BIN TO: DATE: BY:

REVISED (3/10)

Please print or type. (Form designed for use on elite (12-pitch) typewriter.) Form Approved. OMB No. 2050-0039

UNIFORM HAZARDOUS WASTE MANIFEST

1. Generator ID Number: CAC002650408
2. Page 1 of
3. Emergency Response Phone: (661) 746-1132
4. Manifest Tracking Number: 004744147 JJK

5. Generator's Name and Mailing Address
City Of Santa Barbara
(805) 641-1000 PO BOX 1990
Generator's Phone: x 23 Santa Barbara, CA 93102

Generator's Site Address (if different than mailing address)
123 State Street
Santa Barbara, CA 93101

6. Transporter 1 Company Name: Remedial Transportation Services
U.S. EPA ID Number: CAR000181560

7. Transporter 2 Company Name
U.S. EPA ID Number

8. Designated Facility Name and Site Address
Clean Harbors Buttonwillow
2900 West Lokern Road
Facility's Phone: (661) 762-6200 Buttonwillow, CA 93206
U.S. EPA ID Number: CAD980673276

9a. HM	9b. U.S. DOT Description (including Proper Shipping Name, Hazard Class, ID Number, and Packing Group (if any))	10. Containers No.	10. Containers Type	11. Total Quantity	12. Unit Wt./Vol.	13. Waste Codes
	1. Non-Non-RCRA Hazardous Waste, Solid, NOS	001	DT	00015	T	611
	2.					
	3.					
	4.					

14. Special Handling Instructions and Additional Information
Profile #: CHA207958
Sales Order #: 7W2873366

15. **GENERATOR'S/OFFEROR'S CERTIFICATION:** I hereby declare that the contents of this consignment are fully and accurately described above by the proper shipping name, and are classified, packaged, marked and labeled/placarded, and are in all respects in proper condition for transport according to applicable international and national governmental regulations. If export shipment and I am the Primary Exporter, I certify that the contents of this consignment conform to the terms of the attached EPA Acknowledgment of Consent.
I certify that the waste minimization statement identified in 40 CFR 262.27(a) (if I am a large quantity generator) or (b) (if I am a small quantity generator) is true.

Generator's/Offeror's Printed/Typed Name: Cenen Aparicio
Signature: Cenen Aparicio
Month 5 Day 10 Year 10

16. International Shipments ☐ Import to U.S. ☐ Export from U.S. Port of entry/exit:
Transporter signature (for exports only): Date leaving U.S.:

17. Transporter Acknowledgment of Receipt of Materials
Transporter 1 Printed/Typed Name: Rodney Beard
Signature:
Month 3 Day 10 Year 10
Transporter 2 Printed/Typed Name
Signature
Month Day Year

18. Discrepancy
18a. Discrepancy Indication Space ☐ Quantity ☐ Type ☐ Residue ☐ Partial Rejection ☐ Full Rejection
Manifest Reference Number:

18b. Alternate Facility (or Generator)
U.S. EPA ID Number
Facility's Phone:

18c. Signature of Alternate Facility (or Generator)
Month Day Year

19. Hazardous Waste Report Management Method Codes (i.e., codes for hazardous waste treatment, disposal, and recycling systems)
1. H132 2. 3. 4.

20. Designated Facility Owner or Operator: Certification of receipt of hazardous materials covered by the manifest except as noted in Item 18a
Printed/Typed Name: Ronald E Johns
Signature:
Month 05 Day 10 Year 10

GENERATOR | INT'L | TRANSPORTER | DESIGNATED FACILITY

NO. 191210

CLEANHARBORS BUTTONWILLOW, LLC
WEIGHMASTER CERTIFICATE

2:37 PM 05/10/10
REG. (17)
INBOUND 85940 lb

THIS IS TO CERTIFY that the following described commodity was weighed, measured, or counted by a weighmaster whose signature is on this certificate, who is a recognized authority of accuracy, as prescribed in Chapter 7 (commencing with Section12700) of Division 5 of the California Business and Professions Code, administered by the Division of Measurement Standards of the California Department of Food and Agiculture.

WEIGHMASTER CLEANHARBORS BUTTONWILLOW, LLC

PROFILE NO. CH420795B	GROSS WT. BY:	DEPUTY	DATE 05-10-10
DISPOSAL LOCATION 353-20 E05	TARE WT. BY:	DEPUTY	DATE 051010
DRIVER'S NAME PRINTED Rodney Beard	WEIGHING LOCATION:	2500 W. LOKERN ROAD BUTTONWILLOW, CA 93206	
DRIVER'S NAME SIGNATURE	GENERATOR City of Santa Barbara		
TRACTOR NO. R40	TRANSPORTER RTS		
TRACTOR LIC. NO. UP45893	MANIFEST NO. 004744147JK		
TRAILER LIC. NO. T5	SERVICE ORDER NO. 7W2873366		
BIN NUMBERS:	BIN TRACKING		

3:05 PM 05/10/10
REG. (17)

85940 lb GROSS
33060 lb TARE
52880 lb NET

☑ END DUMP ☐ TRANSFER ☐ VACUUM ☐ VAN
☐ ROLL OFF - _____ ☐ FLAT BED ☐ _____

VIS	pH	SUL	CYA	OX	FL	FLASH	20%	
✓							✓	
OTHER:								

ICY	CR	PR	B.W. W.B.	LAB	SOLID BULK	WORK SHEET	LAND TRACK	W.T. SCAN	MAN-SCAN	RE-SCAN

DRUM NUMBER:

COMMENTS:

BIN DROP FULL:

MOVE BIN TO: DATE: BY:

REVISED (3/10)

Please print or type. (Form designed for use on elite (12-pitch) typewriter.) Form Approved

UNIFORM HAZARDOUS WASTE MANIFEST

1. Generator ID Number: CAC000265088
2. Page 1 of
3. Emergency Response Phone: (661) 746-1132
4. Manifest Tracking Number: 004744148 JJK

GENERATOR

5. Generator's Name and Mailing Address: City Of Santa Barbara, PO BOX 1990, Santa Barbara, CA 93102
Generator's Phone: (805) 641-1000 x 33
Generator's Site Address (if different than mailing address): 125 State Street, Santa Barbara, CA 93101

6. Transporter 1 Company Name: Remedial Transportation Service
U.S. EPA ID Number: CAR000181560

7. Transporter 2 Company Name:
U.S. EPA ID Number:

8. Designated Facility Name and Site Address: Clean Harbors Buttonwillow, 2500 West Lokern Road, Buttonwillow, CA 93206
Facility's Phone: (661) 762-6200
U.S. EPA ID Number: CAD980673276

9a. HM	9b. U.S. DOT Description (including Proper Shipping Name, Hazard Class, ID Number, and Packing Group (if any))	10. Containers No.	10. Containers Type	11. Total Quantity	12. Unit Wt./Vol.	13. Waste Codes
	1. Non-Haz, Non-RCRA Hazardous Waste, Solid, NOS	001	DT	00018	T	611
	2.					
	3.					
	4.					

14. Special Handling Instructions and Additional Information
Profile #: CEI420795B
Sales Order #: 7W2873363

15. **GENERATOR'S/OFFEROR'S CERTIFICATION:** I hereby declare that the contents of this consignment are fully and accurately described above by the proper shipping name, and are classified, packaged, marked and labeled/placarded, and are in all respects in proper condition for transport according to applicable international and national governmental regulations. If export shipment and I am the Primary Exporter, I certify that the contents of this consignment conform to the terms of the attached EPA Acknowledgment of Consent.
I certify that the waste minimization statement identified in 40 CFR 262.27(a) (if I am a large quantity generator) or (b) (if I am a small quantity generator) is true.

Generator's/Offeror's Printed/Typed Name: Conan Aparicio
Signature: Conan Aparicio
Month 5 Day 10 Year 10

INT'L

16. International Shipments ☐ Import to U.S. ☐ Export from U.S. Port of entry/exit:
Transporter signature (for exports only): Date leaving U.S.:

TRANSPORTER

17. Transporter Acknowledgment of Receipt of Materials
Transporter 1 Printed/Typed Name: Robert Beard
Signature:
Month 5 Day 10 Year 10
Transporter 2 Printed/Typed Name:
Signature:
Month Day Year

DESIGNATED FACILITY

18. Discrepancy
18a. Discrepancy Indication Space ☐ Quantity ☐ Type ☐ Residue ☐ Partial Rejection ☐ Full Rejection
Manifest Reference Number:
18b. Alternate Facility (or Generator)
U.S. EPA ID Number:
Facility's Phone:
18c. Signature of Alternate Facility (or Generator)
Month Day Year

19. Hazardous Waste Report Management Method Codes (i.e., codes for hazardous waste treatment, disposal, and recycling systems)
1. H132 2. 3. 4.

20. Designated Facility Owner or Operator: Certification of receipt of hazardous materials covered by the manifest except as noted in Item 18a
Printed/Typed Name: Donald E Johns
Signature:
Month 05 Day 10 Year 10

EPA Form 8700-22 (Rev. 3-05) Previous editions are obsolete.

TRANSPORTER'S COPY

NO. 191211

CLEANHARBORS BUTTONWILLOW, LLC
WEIGHMASTER CERTIFICATE

THIS IS TO CERTIFY that the following described commodity was weighed, measured, or counted by a weighmaster whose signature is on this certificate, who is a recognized authority of accuracy, as prescribed in Chapter 7 (commencing with Section12700) of Division 5 of the California Business and Professions Code, administered by the Division of Measurement Standards of the California Department of Food and Agiculture.

2:39 PM 05/10/10
REC. (28)
INBOUND 90840 lb

3:03 PM 05/10/10
REC. (28)

90840 lb GROSS
32380 lb TARE
58460 lb NET

WEIGHMASTER CLEANHARBORS BUTTONWILLOW, LLC

PROFILE NO.	CA420755B	GROSS WT. BY: DEPUTY	DATE 5/10/10
DISPOSAL LOCATION	35-7-20-E05	TARE WT. BY: DEPUTY	DATE 05/10/10
DRIVER'S NAME PRINTED	Robert Bell	WEIGHING LOCATION:	2500 W. LOKERN ROAD BUTTONWILLOW, CA 93206
DRIVER'S NAME SIGNATURE		GENERATOR	City of Santa Barbara
TRACTOR NO.	239	TRANSPORTER	RTS
TRACTOR LIC. NO.	UP45892	MANIFEST NO.	004744148JJK
TRAILER LIC. NO.	1 WB313	SERVICE ORDER NO.	2W2873366
BIN NUMBERS:		BIN TRACKING	

☐ END DUMP ☐ TRANSFER ☐ VACUUM ☐ VAN
☐ ROLL OFF - _____ ☐ FLAT BED ☐ _____

VIS	pH	SUL	CYA	OX	FL	FLASH	20%	
f								

OTHER:

IC	CR	PR	B.W. W.B.	LAB	SOLID BULK	WORK SHEET	LAND TRACK	W.T. SCAN	MAN-SCAN	RE-SCAN

DRUM NUMBER:

COMMENTS:

BIN DROP FULL:

MOVE BIN TO: DATE: BY:

REVISED (6/09)

F-33 UR4646

Please print or type. (Form designed for use on elite (12-pitch) typewriter.)

Form Approved. OMB No. 2050-0039

UNIFORM HAZARDOUS WASTE MANIFEST

1. Generator ID Number: CAC002650488
2. Page 1 of
3. Emergency Response Phone: (661) 746-1132
4. Manifest Tracking Number: **004744149 JJK**

5. Generator's Name and Mailing Address: City Of Santa Barbara, PO BOX 1990, Santa Barbara, CA 93102
Generator's Phone: (805) 641-1000 x 23
Generator's Site Address (if different than mailing address): 125 State Street, Santa Barbara, CA 93101

6. Transporter 1 Company Name: Remarsh Transportation Services
U.S. EPA ID Number: CAR000181560

7. Transporter 2 Company Name:
U.S. EPA ID Number:

8. Designated Facility Name and Site Address: Clean Harbors Buttonwillow, 2300 West Lokern Road, Buttonwillow, CA 93206
Facility's Phone: (661) 762-6200
U.S. EPA ID Number: CAD980675276

9a. HM	9b. U.S. DOT Description (including Proper Shipping Name, Hazard Class, ID Number, and Packing Group (if any))	10. Containers No.	10. Containers Type	11. Total Quantity	12. Unit Wt./Vol.	13. Waste Codes
	1. None, Non-RCRA Hazardous Waste, Solid, N/A	001	DT	00018	Y	611
	2.					
	3.					
	4.					

14. Special Handling Instructions and Additional Information
Profile #: CH420795B
Sales Order #: 7W2873366

15. **GENERATOR'S/OFFEROR'S CERTIFICATION:** I hereby declare that the contents of this consignment are fully and accurately described above by the proper shipping name, and are classified, packaged, marked and labeled/placarded, and are in all respects in proper condition for transport according to applicable international and national governmental regulations. If export shipment and I am the Primary Exporter, I certify that the contents of this consignment conform to the terms of the attached EPA Acknowledgment of Consent.
I certify that the waste minimization statement identified in 40 CFR 262.27(a) (if I am a large quantity generator) or (b) (if I am a small quantity generator) is true.

Generator's/Offeror's Printed/Typed Name: Gene Aparicio
Signature: Gene Aparicio
Month 5 Day 10 Year 10

INT'L

16. International Shipments ☐ Import to U.S. ☐ Export from U.S. Port of entry/exit:
Transporter signature (for exports only): Date leaving U.S.:

TRANSPORTER

17. Transporter Acknowledgment of Receipt of Materials
Transporter 1 Printed/Typed Name: Jeromy Rogers
Signature:
Month 5 Day 10 Year 10
Transporter 2 Printed/Typed Name:
Signature:
Month Day Year

DESIGNATED FACILITY

18. Discrepancy
18a. Discrepancy Indication Space ☐ Quantity ☐ Type ☐ Residue ☐ Partial Rejection ☐ Full Rejection
Manifest Reference Number:

18b. Alternate Facility (or Generator)
U.S. EPA ID Number
Facility's Phone:

18c. Signature of Alternate Facility (or Generator)
Month Day Year

19. Hazardous Waste Report Management Method Codes (i.e., codes for hazardous waste treatment, disposal, and recycling systems)
1. H132 2. 3. 4.

20. Designated Facility Owner or Operator: Certification of receipt of hazardous materials covered by the manifest except as noted in Item 18a
Printed/Typed Name: Manuel E. Jones
Signature:
Month 5 Day 10 Year 10

EPA Form 8700-22 (Rev. 3-05) Previous editions are obsolete.

TRANSPORTER'S COPY

NO. 191207

CLEANHARBORS BUTTONWILLOW, LLC
WEIGHMASTER CERTIFICATE

2:16 PM 05/10/10
REG. (76)
INBOUND 82480 lb

THIS IS TO CERTIFY that the following described commodity was weighed, measured, or counted by a weighmaster whose signature is on this certificate, who is a recognized authority of accuracy, as prescribed in Chapter 7 (commencing with Section12700) of Division 5 of the California Business and Professions Code, administered by the Division of Measurement Standards of the California Department of Food and Agiculture.

WEIGHMASTER CLEANHARBORS BUTTONWILLOW, LLC

PROFILE NO. CH420795B	GROSS WT. BY:	DEPUTY	DATE 051010
DISPOSAL LOCATION 353-20-F05	TARE WT. BY:	DEPUTY	DATE 051010
DRIVER'S NAME PRINTED Jeremey Reams	WEIGHING LOCATION:	2500 W. LOKERN ROAD BUTTONWILLOW, CA 93206	
DRIVER'S NAME SIGNATURE	GENERATOR City of Santa Barbara		
TRACTOR NO. R-33	TRANSPORTER ICTS		
TRACTOR LIC. NO. 4F14646	MANIFEST NO. 004744149JK		
TRAILER LIC. NO. 9T-56	SERVICE ORDER NO. 7W2873366		
BIN NUMBERS:	BIN TRACKING		

2:33 PM 05/10/10
REG. (76)

82480 lb GROSS
32120 lb TARE
50360 lb NET

☒ END DUMP ☐ TRANSFER ☐ VACUUM ☐ VAN
☐ ROLL OFF - _____ ☐ FLAT BED ☐ _____

VIS	pH	SUL	CYA	OX	FL	FLASH	20%	
X								
OTHER:								

IC	CR	PR	B.W. W.B.	LAB	SOLID BULK	WORK SHEET	LAND TRACK	W.T SCAN	MAN-SCAN	RE-SCAN

DRUM NUMBER:

COMMENTS:

BIN DROP FULL:

MOVE BIN TO: DATE: BY:

REVISED (3/10)

Please print or type. (Form designed for use on elite (12-pitch) typewriter.)

Form Approved. OMB No. 2050-0039

UNIFORM HAZARDOUS WASTE MANIFEST

1. Generator ID Number: CAC002650488
2. Page 1 of
3. Emergency Response Phone: (661) 746-1132
4. Manifest Tracking Number: 004744150 JJK

5. Generator's Name and Mailing Address
City Of Santa Barbara
PO BOX 1990
Santa Barbara, CA 93102
Generator's Phone: (805) 641-1000 x 23

Generator's Site Address (if different than mailing address)
125 State Street
Santa Barbara, CA 93101

6. Transporter 1 Company Name: Remedial Transportation Services
U.S. EPA ID Number: CAR000171560

7. Transporter 2 Company Name
U.S. EPA ID Number

8. Designated Facility Name and Site Address
Clean Harbors Buttonwillow
2300 West Lokern Road
Buttonwillow, CA 93206
Facility's Phone: (661) 762-6200
U.S. EPA ID Number: CAD982067236

9a. HM	9b. U.S. DOT Description (including Proper Shipping Name, Hazard Class, ID Number, and Packing Group (if any))	10. Containers No.	10. Containers Type	11. Total Quantity	12. Unit Wt./Vol.	13. Waste Codes
	1. Non-Regulated Hazardous Waste, Solid, N/A	001	DT	00018	Y	611
	2.					
	3.					
	4.					

14. Special Handling Instructions and Additional Information
Profile #: CH4207958
Sales Order #: 7W2873366

15. **GENERATOR'S/OFFEROR'S CERTIFICATION:** I hereby declare that the contents of this consignment are fully and accurately described above by the proper shipping name, and are classified, packaged, marked and labeled/placarded, and are in all respects in proper condition for transport according to applicable international and national governmental regulations. If export shipment and I am the Primary Exporter, I certify that the contents of this consignment conform to the terms of the attached EPA Acknowledgment of Consent.
I certify that the waste minimization statement identified in 40 CFR 262.27(a) (if I am a large quantity generator) or (b) (if I am a small quantity generator) is true.

Generator's/Offeror's Printed/Typed Name: Cenen Aguirio
Signature: Cenen Aguirio
Month 5 Day 10 Year 10

16. International Shipments
☒ Import to U.S. ☐ Export from U.S.
Port of entry/exit:
Transporter signature (for exports only):
Date leaving U.S.:

17. Transporter Acknowledgment of Receipt of Materials
Transporter 1 Printed/Typed Name: Chuck Dingle
Signature:
Month 5 Day 10 Year 10
Transporter 2 Printed/Typed Name
Signature
Month Day Year

18. Discrepancy
18a. Discrepancy Indication Space ☐ Quantity ☐ Type ☐ Residue ☐ Partial Rejection ☐ Full Rejection
Manifest Reference Number:

18b. Alternate Facility (or Generator)
U.S. EPA ID Number
Facility's Phone:

18c. Signature of Alternate Facility (or Generator)
Month Day Year

19. Hazardous Waste Report Management Method Codes (i.e., codes for hazardous waste treatment, disposal, and recycling systems)
1. H132 2. 3. 4.

20. Designated Facility Owner or Operator: Certification of receipt of hazardous materials covered by the manifest except as noted in Item 18a
Printed/Typed Name: Donald E Johns
Signature:
Month 05 Day 10 Year 10

GENERATOR | TRANSPORTER | INT'L | DESIGNATED FACILITY

EPA Form 8700-22 (Rev. 3-05) Previous editions are obsolete.

TRANSPORTER'S COPY

NO. 191199

CLEANHARBORS BUTTONWILLOW, LLC
WEIGHMASTER CERTIFICATE

1:42 PM 05/10/10
REG. (46)
INBOUND 84920 lb

THIS IS TO CERTIFY that the following described commodity was weighed, measured, or counted by a weighmaster whose signature is on this certificate, who is a recognized authority of accuracy, as prescribed in Chapter 7 (commencing with Section12700) of Division 5 of the California Business and Professions Code, administered by the Division of Measurement Standards of the California Department of Food and Agiculture.

WEIGHMASTER CLEANHARBORS BUTTONWILLOW, LLC

PROFILE NO.	CA4207555B	GROSS WT. BY:	DEPUTY DATE 051010
DISPOSAL LOCATION	35-3 20 E 05	TARE WT. BY:	DEPUTY DATE 051010
DRIVER'S NAME PRINTED	Chuck Dingle	WEIGHING LOCATION:	2500 W. LOKERN ROAD BUTTONWILLOW, CA 93206
DRIVER'S NAME SIGNATURE		GENERATOR	City of Santa Barbara
TRACTOR NO.	R-38	TRANSPORTER	RTS
TRACTOR LIC. NO.	UP45891	MANIFEST NO.	CUA7445150JJK
TRAILER LIC. NO.	6922FM	SERVICE ORDER NO.	2W2873366
BIN NUMBERS:		BIN TRACKING	

2:07 PM 05/10/10
REG. (46)

84920 lb GROSS
31700 lb TARE
53220 lb NET

☒ END DUMP ☐ TRANSFER ☐ VACUUM ☐ VAN
☐ ROLL OFF - _____ ☐ FLAT BED ☐ _____

VIS	pH	SUL	CYA	OX	FL	FLASH	20%	
+	7.92	–	—		N	+		
OTHER:								

IC	CR	PR	B.W. W.B.	LAB	SOLID BULK	WORK SHEET	LAND TRACK	W.T. SCAN	MAN-SCAN	RE-SCAN

DRUM NUMBER:

COMMENTS:

BIN DROP FULL:

MOVE BIN TO: DATE: BY:

REVISED (3/10)

T534 UPH617

Please print or type. (Form designed for use on elite (12-pitch) typewriter.)

Form Approved. OMB No. 2050-0039

UNIFORM HAZARDOUS WASTE MANIFEST

1. Generator ID Number: CAC002650488
2. Page 1 of
3. Emergency Response Phone: (661) 746-1132
4. Manifest Tracking Number: **004744151 JJK**

5. Generator's Name and Mailing Address: City Of Santa Barbara, PO BOX 1990, Santa Barbara, CA 93102
Generator's Phone: (805) 641-1000 x 23
Generator's Site Address (if different than mailing address): 125 State Street, Santa Barbara, CA 93101

6. Transporter 1 Company Name: Remedial Transportation Services
U.S. EPA ID Number: CAR000181560

7. Transporter 2 Company Name:
U.S. EPA ID Number:

8. Designated Facility Name and Site Address: Clean Harbors Buttonwillow, 2500 West Lokern Road, Buttonwillow, CA 93206
Facility's Phone: (661) 762-6200
U.S. EPA ID Number: CAD980673276

9a. HM	9b. U.S. DOT Description (including Proper Shipping Name, Hazard Class, ID Number, and Packing Group (if any))	10. Containers No.	10. Containers Type	11. Total Quantity	12. Unit Wt./Vol.	13. Waste Codes
	1. Nonregulated, Non-RCRA Hazardous Waste, Solid, N/A	001	DT	00018	Y	611
	2.					
	3.					
	4.					

14. Special Handling Instructions and Additional Information
Profile #: CE420703B
Sales Order #: 7W2873365

15. **GENERATOR'S/OFFEROR'S CERTIFICATION:** I hereby declare that the contents of this consignment are fully and accurately described above by the proper shipping name, and are classified, packaged, marked and labeled/placarded, and are in all respects in proper condition for transport according to applicable international and national governmental regulations. If export shipment and I am the Primary Exporter, I certify that the contents of this consignment conform to the terms of the attached EPA Acknowledgment of Consent.
I certify that the waste minimization statement identified in 40 CFR 262.27(a) (if I am a large quantity generator) or (b) (if I am a small quantity generator) is true.

Generator's/Offeror's Printed/Typed Name: Cenen Aparicio
Signature: Cenen Aparicio
Month 5 Day 10 Year 10

16. International Shipments ☐ Import to U.S. ☐ Export from U.S. Port of entry/exit:
Transporter signature (for exports only): Date leaving U.S.:

17. Transporter Acknowledgment of Receipt of Materials
Transporter 1 Printed/Typed Name: Allen Rosman
Signature: Allen Rosman
Month 5 Day 10 Year 10
Transporter 2 Printed/Typed Name:
Signature:
Month Day Year

18. Discrepancy
18a. Discrepancy Indication Space ☐ Quantity ☐ Type ☐ Residue ☐ Partial Rejection ☐ Full Rejection
Manifest Reference Number:

18b. Alternate Facility (or Generator)
U.S. EPA ID Number
Facility's Phone:

18c. Signature of Alternate Facility (or Generator)
Month Day Year

19. Hazardous Waste Report Management Method Codes (i.e., codes for hazardous waste treatment, disposal, and recycling systems)
1. H132 2. 3. 4.

20. Designated Facility Owner or Operator: Certification of receipt of hazardous materials covered by the manifest except as noted in Item 18a
Printed/Typed Name: Ronald E Johns
Signature: R E Johns
Month 05 Day 10 Year 10

GENERATOR — INT'L — TRANSPORTER — DESIGNATED FACILITY

EPA Form 8700-22 (Rev. 3-05) Previous editions are obsolete.

TRANSPORTER'S COPY

NO. 191198

1:38 PM 05/10/10
REG. (45)
INBOUND 80820 lb

CLEANHARBORS BUTTONWILLOW, LLC
WEIGHMASTER CERTIFICATE

THIS IS TO CERTIFY that the following described commodity was weighed, measured, or counted by a weighmaster whose signature is on this certificate, who is a recognized authority of accuracy, as prescribed in Chapter 7 (commencing with Section12700) of Division 5 of the California Business and Professions Code, administered by the Division of Measurement Standards of the California Department of Food and Agiculture.

WEIGHMASTER CLEANHARBORS BUTTONWILLOW, LLC

2:03 PM 05/10/10
REG. (45)

80820 lb GROSS
30720 lb TARE
50100 lb NET

PROFILE NO.	CH42075 5B	GROSS WT. BY:	DEPUTY / DATE 051010
DISPOSAL LOCATION	35-3-20-F05	TARE WT. BY:	DEPUTY / DATE 051010
DRIVER'S NAME PRINTED	Allen Collins	WEIGHING LOCATION:	2500 W. LOKERN ROAD BUTTONWILLOW, CA 93206
DRIVER'S NAME SIGNATURE	Allen Collins	GENERATOR	City of Santa Barbara
TRACTOR NO.	R34	TRANSPORTER	RTS
TRACTOR LIC. NO.	CP46477	MANIFEST NO.	004744151JK
TRAILER LIC. NO.	2500FT	SERVICE ORDER NO.	2V2873366
BIN NUMBERS:		BIN TRACKING	

☒ END DUMP ☐ TRANSFER ☐ VACUUM ☐ VAN
☐ ROLL OFF - _____ ☐ FLAT BED ☐ _____

VIS	pH	SUL	CYA	OX	FL	FLASH	20%	
+	7.86	–	–		M	M		
OTHER:								

IC	CR	PR	B.W. W.B.	LAB	SOLID BULK	WORK SHEET	LAND TRACK	W.T. SCAN	MAN-SCAN	RE-SCAN

DRUM NUMBER:

COMMENTS:

BIN DROP FULL:

MOVE BIN TO: DATE: BY:

REVISED (3/10)

R 05 1 PO 3115

Please print or type. (Form designed for use on elite (12-pitch) typewriter.)

Form Approved. OMB No. 2050-0039

UNIFORM HAZARDOUS WASTE MANIFEST

1. Generator ID Number: CAC002650488
2. Page 1 of
3. Emergency Response Phone: (661) 746-1132
4. Manifest Tracking Number: 004744156 JJK

5. Generator's Name and Mailing Address: City Of Santa Barbara, PO BOX 1990, Santa Barbara, CA 93102

Generator's Phone: (805) 641-1000 x 23

Generator's Site Address (if different than mailing address): 125 State Street, Santa Barbara, CA 93101

6. Transporter 1 Company Name: Remedial Transportation Services — U.S. EPA ID Number: CAR000181560

7. Transporter 2 Company Name — U.S. EPA ID Number:

8. Designated Facility Name and Site Address: Clean Harbors Buttonwillow, 2500 West Lokern Road, Buttonwillow, CA 93206 — U.S. EPA ID Number: CAD980673278

Facility's Phone: (661) 762-6200

9a. HM	9b. U.S. DOT Description (including Proper Shipping Name, Hazard Class, ID Number, and Packing Group (if any))	10. Containers No.	10. Containers Type	11. Total Quantity	12. Unit Wt./Vol.	13. Waste Codes
	1. None, Non-RCRA Hazardous Waste, Solid, N/A	001	DT	00018	Y	611
	2.					
	3.					
	4.					

14. Special Handling Instructions and Additional Information

Profile #: CH420795B
Sales Order #: TW2873166

15. **GENERATOR'S/OFFEROR'S CERTIFICATION:** I hereby declare that the contents of this consignment are fully and accurately described above by the proper shipping name, and are classified, packaged, marked and labeled/placarded, and are in all respects in proper condition for transport according to applicable international and national governmental regulations. If export shipment and I am the Primary Exporter, I certify that the contents of this consignment conform to the terms of the attached EPA Acknowledgment of Consent.
I certify that the waste minimization statement identified in 40 CFR 262.27(a) (if I am a large quantity generator) or (b) (if I am a small quantity generator) is true.

Generator's/Offeror's Printed/Typed Name: Cenen Aparicio — Signature: [signature] — Month 5 Day 5 Year 10

16. International Shipments ☐ Import to U.S. ☐ Export from U.S. Port of entry/exit:
Transporter signature (for exports only): Date leaving U.S.:

17. Transporter Acknowledgment of Receipt of Materials

Transporter 1 Printed/Typed Name: CARMEN MORAN — Signature: [signature] — Month 5 Day 10 Year 10

Transporter 2 Printed/Typed Name — Signature — Month Day Year

18. Discrepancy

18a. Discrepancy Indication Space ☐ Quantity ☐ Type ☐ Residue ☐ Partial Rejection ☐ Full Rejection

Manifest Reference Number:

18b. Alternate Facility (or Generator) — U.S. EPA ID Number

Facility's Phone:

18c. Signature of Alternate Facility (or Generator) — Month Day Year

19. Hazardous Waste Report Management Method Codes (i.e., codes for hazardous waste treatment, disposal, and recycling systems)

1. H132 2. 3. 4.

20. Designated Facility Owner or Operator: Certification of receipt of hazardous materials covered by the manifest except as noted in Item 18a

Printed/Typed Name: Ronald E. Johns — Signature: [signature] — Month 05 Day 10 Year 10

GENERATOR — INT'L — TRANSPORTER — DESIGNATED FACILITY

EPA Form 8700-22 (Rev. 3-05) Previous editions are obsolete.

TRANSPORTER'S COPY

NO. 191197

CLEANHARBORS BUTTONWILLOW, LLC
WEIGHMASTER CERTIFICATE

1:36 PM 05/10/10
REG. (41)
INBOUND 79820 lb

THIS IS TO CERTIFY that the following described commodity was weighed, measured, or counted by a weighmaster whose signature is on this certificate, who is a recognized authority of accuracy, as prescribed in Chapter 7 (commencing with Section12700) of Division 5 of the California Business and Professions Code, administered by the Division of Measurement Standards of the California Department of Food and Agiculture.

WEIGHMASTER CLEANHARBORS BUTTONWILLOW, LLC

PROFILE NO.	CH420795-B	GROSS WT. BY: DEPUTY	DATE 05 7010
DISPOSAL LOCATION	35-3-20-E05	TARE WT. BY: DEPUTY	DATE 051010
DRIVER'S NAME PRINTED	Carmen Morales	WEIGHING LOCATION:	2500 W. LOKERN ROAD BUTTONWILLOW, CA 93206
DRIVER'S NAME SIGNATURE	Carmen Morales	GENERATOR	City of Santa Barbara
TRACTOR NO.	R-25	TRANSPORTER	R.T.S.
TRACTOR LIC. NO.	TP03175	MANIFEST NO.	004744156 JJK
TRAILER LIC. NO.	4CY6736	SERVICE ORDER NO.	2873366
BIN NUMBERS:		BIN TRACKING	

1:53 PM 05/10/10
REG. (41)

79820 lb GROSS
31700 lb TARE
48120 lb NET

☒ END DUMP ☐ TRANSFER ☐ VACUUM ☐ VAN
☐ ROLL OFF - _____ ☐ FLAT BED ☐ _____

VIS	pH	SUL	CYA	OX	FL	FLASH	20%	
+	781	–	–		M	M		
OTHER:								

IC	CR	PR	B.W. W.B.	LAB	SOLID BULK	WORK SHEET	LAND TRACK	W.T. SCAN	MAN-SCAN	RE-SCAN

DRUM NUMBER:

COMMENTS:

BIN DROP FULL:

MOVE BIN TO: DATE: BY:

REVISED (3/10)

R43 U19243Y

Please print or type. (Form designed for use on elite (12-pitch) typewriter.) Form Approved. OMB No. 2050-0039

UNIFORM HAZARDOUS WASTE MANIFEST

1. Generator ID Number: CAC002650488
2. Page 1 of
3. Emergency Response Phone: (661) 746-1132
4. Manifest Tracking Number: 004744157 JJK

5. Generator's Name and Mailing Address
City Of Santa Barbara
PO BOX 1990
Santa Barbara, CA 93102
Generator's Phone: (805) 641-1000 x 23

Generator's Site Address (if different than mailing address)
123 State Street
Santa Barbara, CA 93101

6. Transporter 1 Company Name: RESIDUAL TRANSPORTATION SERVICES
U.S. EPA ID Number: CAT000181560

7. Transporter 2 Company Name
U.S. EPA ID Number

8. Designated Facility Name and Site Address
Clean Harbors Buttonwillow
2500 West Lokern Road
Buttonwillow, CA 93206
Facility's Phone: (661) 762-6200
U.S. EPA ID Number: CAD980673276

9a. HM	9b. U.S. DOT Description (including Proper Shipping Name, Hazard Class, ID Number, and Packing Group (if any))	10. Containers No.	10. Containers Type	11. Total Quantity	12. Unit Wt./Vol.	13. Waste Codes
	1. Non, Non-RCRA Hazardous Waste, Solid, N/A	001	DT	00018	Y	611
	2.					
	3.					
	4.					

14. Special Handling Instructions and Additional Information
Profile #: CH420795B
Sales Order #: 7W2873366

15. **GENERATOR'S/OFFEROR'S CERTIFICATION:** I hereby declare that the contents of this consignment are fully and accurately described above by the proper shipping name, and are classified, packaged, marked and labeled/placarded, and are in all respects in proper condition for transport according to applicable international and national governmental regulations. If export shipment and I am the Primary Exporter, I certify that the contents of this consignment conform to the terms of the attached EPA Acknowledgment of Consent.
I certify that the waste minimization statement identified in 40 CFR 262.27(a) (if I am a large quantity generator) or (b) (if I am a small quantity generator) is true.

Generator's/Offeror's Printed/Typed Name: Carmen Aguirre
Signature: Carmen Aguirre
Month 5 Day 5 Year 10

16. International Shipments ☐ Import to U.S. ☐ Export from U.S. Port of entry/exit:
Transporter signature (for exports only): Date leaving U.S.:

17. Transporter Acknowledgment of Receipt of Materials
Transporter 1 Printed/Typed Name: Juliio Alvarez
Signature:
Month 5 Day 10 Year 10
Transporter 2 Printed/Typed Name
Signature
Month Day Year

18. Discrepancy
18a. Discrepancy Indication Space ☐ Quantity ☐ Type ☐ Residue ☐ Partial Rejection ☐ Full Rejection
Manifest Reference Number:

18b. Alternate Facility (or Generator)
U.S. EPA ID Number
Facility's Phone:

18c. Signature of Alternate Facility (or Generator)
Month Day Year

19. Hazardous Waste Report Management Method Codes (i.e., codes for hazardous waste treatment, disposal, and recycling systems)
1. H132 2. 3. 4.

20. Designated Facility Owner or Operator: Certification of receipt of hazardous materials covered by the manifest except as noted in Item 18a
Printed/Typed Name: Ronald E Johns
Signature:
Month 05 Day 10 Year 10

GENERATOR | INT'L | TRANSPORTER | DESIGNATED FACILITY

NO. 191196

CLEANHARBORS BUTTONWILLOW, LLC
WEIGHMASTER CERTIFICATE

1:32 PM 05/10/10
REG. (31)
INBOUND 83680 lb

THIS IS TO CERTIFY that the following described commodity was weighed, measured, or counted by a weighmaster whose signature is on this certificate, who is a recognized authority of accuracy, as prescribed in Chapter 7 (commencing with Section12700) of Division 5 of the California Business and Professions Code, administered by the Division of Measurement Standards of the California Department of Food and Agiculture.

WEIGHMASTER CLEANHARBORS BUTTONWILLOW, LLC

1:49 PM 05/10/10
REG. (31)

83680 lb GROSS
31820 lb TARE
51860 lb NET

PROFILE NO.	CH #20795B	GROSS WT. BY: DEPUTY	DATE 51010
DISPOSAL LOCATION	35-3-20-F05	TARE WT. BY: DEPUTY	DATE 051010
DRIVER'S NAME PRINTED	Julian	WEIGHING LOCATION:	2500 W. LOKERN ROAD BUTTONWILLOW, CA 93206
DRIVER'S NAME SIGNATURE		GENERATOR	CITY OF S.B.
TRACTOR NO.	1243	TRANSPORTER	RTL
TRACTOR LIC. NO.	UP92454	MANIFEST NO.	004744157 JJK
TRAILER LIC. NO.	250 4FT	SERVICE ORDER NO.	7W2873366
BIN NUMBERS:		BIN TRACKING	

☑ END DUMP ☐ TRANSFER ☐ VACUUM ☐ VAN
☐ ROLL OFF - _____ ☐ FLAT BED ☐ _____

VIS	pH	SUL	CYA	OX	FL	FLASH	20%	
+	7.86	–	–		M	M		
OTHER:								

IC	CR	PR	B.W. W.B.	LAB	SOLID BULK	WORK SHEET	LAND TRACK	W.T. SCAN	MAN-SCAN	RE-SCAN

DRUM NUMBER:

COMMENTS:

BIN DROP FULL:

MOVE BIN TO: DATE: BY:

REVISED (3/10)

R04 UP 14647

Please print or type. (Form designed for use on elite (12-pitch) typewriter.)

Form Approved. OMB No. 2050-0039

UNIFORM HAZARDOUS WASTE MANIFEST

1. Generator ID Number: CAC002650488
2. Page 1 of
3. Emergency Response Phone: (661) 746-1132
4. Manifest Tracking Number: 004744142 JJK

5. Generator's Name and Mailing Address: City Of Santa Barbara, PO BOX 1990, Santa Barbara, CA 93102
Generator's Phone: (805) 641-1000 x 23
Generator's Site Address (if different than mailing address): 123 State Street, Santa Barbara, CA 93101

6. Transporter 1 Company Name: Remedial Transportation Services
U.S. EPA ID Number: CAF000174560

7. Transporter 2 Company Name:
U.S. EPA ID Number:

8. Designated Facility Name and Site Address: Clean Harbors Buttonwillow, 2500 West Lokern Road, Buttonwillow, CA 93206
Facility's Phone: (661) 762-6200
U.S. EPA ID Number: CAD980675276

9a. HM	9b. U.S. DOT Description (including Proper Shipping Name, Hazard Class, ID Number, and Packing Group (if any))	10. Containers No.	10. Containers Type	11. Total Quantity	12. Unit Wt./Vol.	13. Waste Codes
	1. None, Non RCRA Hazardous Waste, Solid, N/A	001	DT	00018	Y	611
	2.					
	3.					
	4.					

14. Special Handling Instructions and Additional Information
Profile #: CEH42079SB
Sales Order #: 7W3273366

15. **GENERATOR'S/OFFEROR'S CERTIFICATION:** I hereby declare that the contents of this consignment are fully and accurately described above by the proper shipping name, and are classified, packaged, marked and labeled/placarded, and are in all respects in proper condition for transport according to applicable international and national governmental regulations. If export shipment and I am the Primary Exporter, I certify that the contents of this consignment conform to the terms of the attached EPA Acknowledgment of Consent.
I certify that the waste minimization statement identified in 40 CFR 262.27(a) (if I am a large quantity generator) or (b) (if I am a small quantity generator) is true.

Generator's/Offeror's Printed/Typed Name: Cesar Aguirre
Signature: Cesar Aguirre
Month 5 Day 10 Year 10

16. International Shipments ☐ Import to U.S. ☐ Export from U.S. Port of entry/exit:
Transporter signature (for exports only): Date leaving U.S.:

17. Transporter Acknowledgment of Receipt of Materials
Transporter 1 Printed/Typed Name: Allen Quinn
Signature: Allen Quinn
Month 5 Day 11 Year 10
Transporter 2 Printed/Typed Name:
Signature:
Month Day Year

18. Discrepancy
18a. Discrepancy Indication Space ☐ Quantity ☐ Type ☐ Residue ☐ Partial Rejection ☐ Full Rejection
Manifest Reference Number:
18b. Alternate Facility (or Generator)
U.S. EPA ID Number
Facility's Phone:
18c. Signature of Alternate Facility (or Generator)
Month Day Year

19. Hazardous Waste Report Management Method Codes (i.e., codes for hazardous waste treatment, disposal, and recycling systems)
1. H132 2. 3. 4.

20. Designated Facility Owner or Operator: Certification of receipt of hazardous materials covered by the manifest except as noted in Item 18a
Printed/Typed Name:
Signature:
Month 05 Day 11 Year 10

GENERATOR — INT'L — TRANSPORTER — DESIGNATED FACILITY

EPA Form 8700-22 (Rev. 3-05) Previous editions are obsolete.

TRANSPORTER'S COPY

NO. 191241

CLEANHARBORS BUTTONWILLOW, LLC
WEIGHMASTER CERTIFICATE

12:45 PM 05/11/10
REG. (1)
INBOUND 83580 lb

THIS IS TO CERTIFY that the following described commodity was weighed, measured, or counted by a weighmaster whose signature is on this certificate, who is a recognized authority of accuracy, as prescribed in Chapter 7 (commencing with Section12700) of Division 5 of the California Business and Professions Code, administered by the Division of Measurement Standards of the California Department of Food and Agiculture.

WEIGHMASTER CLEANHARBORS BUTTONWILLOW, LLC

PROFILE NO.	CH420755B	GROSS WT. BY:	DEPUTY DATE 05-11-10
DISPOSAL LOCATION	55-3-20-605	TARE WT. BY:	DEPUTY DATE 05/11/10
DRIVER'S NAME PRINTED	Allan Quinn	WEIGHING LOCATION:	2500 W. LOKERN ROAD BUTTONWILLOW, CA 93206
DRIVER'S NAME SIGNATURE	Allan Quinn	GENERATOR	City of Santa Barbara
TRACTOR NO.	R34	TRANSPORTER	RTS
TRACTOR LIC. NO.	UP14647	MANIFEST NO	004744142JK
TRAILER LIC. NO.	2500FT	SERVICE ORDER NO.	2W2873366
BIN NUMBERS:		BIN TRACKING	

1:05 PM 05/11/10
REG. (1)

83580 lb GROSS
31420 lb TARE
52160 lb NET

☒ END DUMP ☐ TRANSFER ☐ VACUUM ☐ VAN
☐ ROLL OFF - _____ ☐ FLAT BED ☐ _____

VIS	pH	SUL	CYA	OX	FL	FLASH	20%	
+	781	–	–		+/+			
OTHER:								

IC	CR	PR	B.W. W.B.	LAB	SOLID BULK	WORK SHEET	LAND TRACK	W.T. SCAN	MAN-SCAN	RE-SCAN

DRUM NUMBER:

COMMENTS:

BIN DROP FULL:

MOVE BIN TO: DATE: BY:

REVISED (3/10)

1245 UP9245Y

Please print or type. (Form designed for use on elite (12-pitch) typewriter.)

Form Approved. OMB No. 2050-0039

UNIFORM HAZARDOUS WASTE MANIFEST

1. Generator ID Number: CAC002650488
2. Page 1 of
3. Emergency Response Phone: (661) 746-1132
4. Manifest Tracking Number: 004744143 JJK

5. Generator's Name and Mailing Address
City Of Santa Barbara
PO BOX 1990
Santa Barbara, CA 93102
Generator's Phone: (805) 641-1000 x 23

Generator's Site Address (if different than mailing address)
125 State Street
Santa Barbara, CA 93101

6. Transporter 1 Company Name: EMEDICAL TRANSPORTATION SERVICES
U.S. EPA ID Number: CAD000181560

7. Transporter 2 Company Name
U.S. EPA ID Number

8. Designated Facility Name and Site Address
Clean Harbors Buttonwillow
2500 West Lokern Road
Buttonwillow, CA 93206
Facility's Phone: (661) 762-6200
U.S. EPA ID Number: CAD980673276

9a. HM	9b. U.S. DOT Description (including Proper Shipping Name, Hazard Class, ID Number, and Packing Group (if any))	10. Containers No.	10. Containers Type	11. Total Quantity	12. Unit Wt./Vol.	13. Waste Codes
	1. None, Non-RCRA Hazardous Waste, Solid, N/A	001	DT	00015	Y	411
	2.					
	3.					
	4.					

14. Special Handling Instructions and Additional Information
Profile #: CH420795B
Sales Order #: 7W2873366

15. **GENERATOR'S/OFFEROR'S CERTIFICATION:** I hereby declare that the contents of this consignment are fully and accurately described above by the proper shipping name, and are classified, packaged, marked and labeled/placarded, and are in all respects in proper condition for transport according to applicable international and national governmental regulations. If export shipment and I am the Primary Exporter, I certify that the contents of this consignment conform to the terms of the attached EPA Acknowledgment of Consent.
I certify that the waste minimization statement identified in 40 CFR 262.27(a) (if I am a large quantity generator) or (b) (if I am a small quantity generator) is true.

Generator's/Offeror's Printed/Typed Name: Ceren Aparicio
Signature: Ceren Aparicio
Month 5 Day 10 Year 10

16. International Shipments ☐ Import to U.S. ☐ Export from U.S. Port of entry/exit:
Transporter signature (for exports only): Date leaving U.S.:

17. Transporter Acknowledgment of Receipt of Materials
Transporter 1 Printed/Typed Name: Jaime Salazar
Signature
Month 5 Day 10 Year 10
Transporter 2 Printed/Typed Name
Signature
Month Day Year

18. Discrepancy
18a. Discrepancy Indication Space ☐ Quantity ☐ Type ☐ Residue ☐ Partial Rejection ☐ Full Rejection
Manifest Reference Number:
18b. Alternate Facility (or Generator)
U.S. EPA ID Number
Facility's Phone:
18c. Signature of Alternate Facility (or Generator)
Month Day Year

19. Hazardous Waste Report Management Method Codes (i.e., codes for hazardous waste treatment, disposal, and recycling systems)
1. H132 2. 3. 4.

20. Designated Facility Owner or Operator: Certification of receipt of hazardous materials covered by the manifest except as noted in Item 18a
Printed/Typed Name
Signature
Month Day Year

GENERATOR | INT'L | TRANSPORTER | DESIGNATED FACILITY

EPA Form 8700-22 (Rev. 3-05) Previous editions are obsolete.

TRANSPORTER'S COPY

NO. 191245

CLEANHARBORS BUTTONWILLOW, LLC
WEIGHMASTER CERTIFICATE

1:05 PM 05/11/10
REG. (28)
INBOUND 84600 lb

THIS IS TO CERTIFY that the following described commodity was weighed, measured, or counted by a weighmaster whose signature is on this certificate, who is a recognized authority of accuracy, as prescribed in Chapter 7 (commencing with Section12700) of Division 5 of the California Business and Professions Code, administered by the Division of Measurement Standards of the California Department of Food and Agiculture.

WEIGHMASTER CLEANHARBORS BUTTONWILLOW, LLC

PROFILE NO.	CH420755B	GROSS WT. BY: DEPUTY	DATE 05/11/10
DISPOSAL LOCATION	35-3-20 F05	TARE WT. BY: DEPUTY	DATE 5/11/10
DRIVER'S NAME PRINTED	Lilian	WEIGHING LOCATION:	2500 W. LOKERN ROAD BUTTONWILLOW, CA 93206
DRIVER'S NAME SIGNATURE		GENERATOR	CITY OF S.B.
TRACTOR NO.	1243	TRANSPORTER	RTS
TRACTOR LIC. NO.	UP92454	MANIFEST NO.	CUA744143JJK
TRAILER LIC. NO.	250 4F.	SERVICE ORDER NO.	2W2873366
BIN NUMBERS:		BIN TRACKING	

1:23 PM 05/11/10
REG. (28)

84600 lb GROSS
32080 lb TARE
52520 lb NET

☒ END DUMP ☐ TRANSFER ☐ VACUUM ☐ VAN
☐ ROLL OFF - _____ ☐ FLAT BED ☐ _____

VIS	pH	SUL	CYA	OX	FL	FLASH	20%	
+	8.31	–	–		FL	FL		
OTHER:								

IC	CR	PR	B.W. W.B.	LAB	SOLID BULK	WORK SHEET	LAND TRACK	W.T. SCAN	MAN-SCAN	RE-SCAN

DRUM NUMBER:

COMMENTS:

BIN DROP FULL:

MOVE BIN TO: DATE: BY:

REVISED (3/10)

Please print or type. (Form designed for use on elite (12-pitch) typewriter.) Form Approved. OMB No. 2050-0039

UNIFORM HAZARDOUS WASTE MANIFEST

1. Generator ID Number: CAC002650488
2. Page 1 of
3. Emergency Response Phone: (661) 746-1132
4. Manifest Tracking Number: 004744144 JJK

GENERATOR

5. Generator's Name and Mailing Address: City Of Santa Barbara, PO BOX 1990, Santa Barbara, CA 93102
Generator's Phone: (805) 641-1000 x 23
Generator's Site Address (if different than mailing address): 125 State Street, Santa Barbara, CA 93101

6. Transporter 1 Company Name: Romero Transportation Services
U.S. EPA ID Number: CAD008181560

7. Transporter 2 Company Name:
U.S. EPA ID Number:

8. Designated Facility Name and Site Address: Clean Harbors Buttonwillow, 2500 West Lokern Road, Buttonwillow, CA 93206
Facility's Phone: (661) 762-6200
U.S. EPA ID Number: TAD980673274

9a. HM	9b. U.S. DOT Description (including Proper Shipping Name, Hazard Class, ID Number, and Packing Group (if any))	10. Containers No.	10. Containers Type	11. Total Quantity	12. Unit Wt./Vol.	13. Waste Codes
	1. None, Non-RCRA Hazardous Waste, Solid, N/A	001	DT	00018	Y	611
	2.					
	3.					
	4.					

14. Special Handling Instructions and Additional Information
Profile #: CH420795B
Sales Order #: 7W2873386

15. **GENERATOR'S/OFFEROR'S CERTIFICATION:** I hereby declare that the contents of this consignment are fully and accurately described above by the proper shipping name, and are classified, packaged, marked and labeled/placarded, and are in all respects in proper condition for transport according to applicable international and national governmental regulations. If export shipment and I am the Primary Exporter, I certify that the contents of this consignment conform to the terms of the attached EPA Acknowledgment of Consent.
I certify that the waste minimization statement identified in 40 CFR 262.27(a) (if I am a large quantity generator) or (b) (if I am a small quantity generator) is true.

Generator's/Offeror's Printed/Typed Name: Cesar Aparicio
Signature: [signature]
Month 5 Day 10 Year 10

INTL

16. International Shipments ☐ Import to U.S. ☐ Export from U.S. Port of entry/exit:
Transporter signature (for exports only): Date leaving U.S.:

TRANSPORTER

17. Transporter Acknowledgment of Receipt of Materials
Transporter 1 Printed/Typed Name: CARMEN MORAN
Signature: [signature]
Month 5 Day 11 Year 10
Transporter 2 Printed/Typed Name:
Signature:
Month Day Year

DESIGNATED FACILITY

18. Discrepancy
18a. Discrepancy Indication Space ☐ Quantity ☐ Type ☐ Residue ☐ Partial Rejection ☐ Full Rejection
Manifest Reference Number:
18b. Alternate Facility (or Generator)
U.S. EPA ID Number
Facility's Phone:
18c. Signature of Alternate Facility (or Generator)
Month Day Year

19. Hazardous Waste Report Management Method Codes (i.e., codes for hazardous waste treatment, disposal, and recycling systems)
1. H132 2. 3. 4.

20. Designated Facility Owner or Operator: Certification of receipt of hazardous materials covered by the manifest except as noted in Item 18a
Printed/Typed Name:
Signature:
Month 05 Day 11 Year 10

EPA Form 8700-22 (Rev. 3-05) Previous editions are obsolete. **TRANSPORTER'S COPY**

NO. 191246

CLEANHARBORS BUTTONWILLOW, LLC
WEIGHMASTER CERTIFICATE

1:09 PM 05/11/10
REG. (46)
INBOUND 81060 lb

THIS IS TO CERTIFY that the following described commodity was weighed, measured, or counted by a weighmaster whose signature is on this certificate, who is a recognized authority of accuracy, as prescribed in Chapter 7 (commencing with Section12700) of Division 5 of the California Business and Professions Code, administered by the Division of Measurement Standards of the California Department of Food and Agiculture.

WEIGHMASTER CLEANHARBORS BUTTONWILLOW, LLC

1:33 PM 05/11/10
REG. (46)

81060 lb GROSS
31920 lb TARE
49140 lb NET

PROFILE NO.	CH420795B	GROSS WT. BY: DEPUTY	DATE 05/11/10
DISPOSAL LOCATION	35-3-20-E-05	TARE WT. BY: DEPUTY	DATE 05/11/10
DRIVER'S NAME PRINTED	CARMEN MORAN	WEIGHING LOCATION:	2500 W. LOKERN ROAD BUTTONWILLOW, CA 93206
DRIVER'S NAME SIGNATURE	Carmen Moran	GENERATOR	City of Santa Barbara
TRACTOR NO.	R-05	TRANSPORTER	R.T.S.
TRACTOR LIC. NO.	TP03175	MANIFEST NO	004744142 JK
TRAILER LIC. NO.	4CY673L	SERVICE ORDER NO.	7W2873366
BIN NUMBERS:		BIN TRACKING	

☒ END DUMP ☐ TRANSFER ☐ VACUUM ☐ VAN
☐ ROLL OFF - _____ ☐ FLAT BED ☐ _____

VIS	pH	SUL	CYA	OX	FL	FLASH	20%	
+	8.17	-	-		M/M			
OTHER:								

IC	CR	PR	B.W. W.B.	LAB	SOLID BULK	WORK SHEET	LAND TRACK	W.T. SCAN	MAN-SCAN	RE-SCAN
								LSHZ		

DRUM NUMBER:

COMMENTS:

BIN DROP FULL:

MOVE BIN TO: DATE: BY:

REVISED (3/10)

D4 9D00982

Please print or type. (Form designed for use on elite (12-pitch) typewriter.)

Form Approved. OMB No. 2050-0039

UNIFORM HAZARDOUS WASTE MANIFEST

1. Generator ID Number: C A C 0 0 2 6 5 0 4 8 9
2. Page 1 of
3. Emergency Response Phone: (661) 746-1132
4. Manifest Tracking Number: 004744137 JJK

5. Generator's Name and Mailing Address: City Of Santa Barbara, PO BOX 1990, Santa Barbara CA 93102

Generator's Site Address (if different than mailing address): 125 State Street, Santa Barbara CA 93101

Generator's Phone: (805) 641-1000 x 23

6. Transporter 1 Company Name: DISOUZA TRACKING — U.S. EPA ID Number: CAD000180091

7. Transporter 2 Company Name — U.S. EPA ID Number:

8. Designated Facility Name and Site Address: Clean Harbors Buttonwillow, 2500 West Lokern Road, Buttonwillow, CA 93206 — U.S. EPA ID Number: CAD980675276

Facility's Phone: (661) 762-6200

No.	HM	9b. U.S. DOT Description (including Proper Shipping Name, Hazard Class, ID Number, and Packing Group (if any))	10. Containers No.	10. Containers Type	11. Total Quantity	12. Unit Wt./Vol.	13. Waste Codes		
1.		Non, Non-RCRA Hazardous Waste, Solid, N/A	001	D7	00018	Y	611		
2.									
3.									
4.									

14. Special Handling Instructions and Additional Information

Profile #: CH420795B
Sales Order #: TW2873366

15. GENERATOR'S/OFFEROR'S CERTIFICATION: I hereby declare that the contents of this consignment are fully and accurately described above by the proper shipping name, and are classified, packaged, marked and labeled/placarded, and are in all respects in proper condition for transport according to applicable international and national governmental regulations. If export shipment and I am the Primary Exporter, I certify that the contents of this consignment conform to the terms of the attached EPA Acknowledgment of Consent.
I certify that the waste minimization statement identified in 40 CFR 262.27(a) (if I am a large quantity generator) or (b) (if I am a small quantity generator) is true.

Generator's/Offeror's Printed/Typed Name: Cenen Aparicio — Signature: Cenen Aparicio — Month 5 Day 10 Year 10

16. International Shipments: ☐ Import to U.S. ☐ Export from U.S. — Port of entry/exit: — Date leaving U.S.:
Transporter signature (for exports only):

17. Transporter Acknowledgment of Receipt of Materials

Transporter 1 Printed/Typed Name: DANNY J SOUZA — Signature: — Month 5 Day 12 Year 10

Transporter 2 Printed/Typed Name — Signature — Month Day Year

18. Discrepancy

18a. Discrepancy Indication Space: ☐ Quantity ☐ Type ☐ Residue ☐ Partial Rejection ☐ Full Rejection

Manifest Reference Number:

18b. Alternate Facility (or Generator) — U.S. EPA ID Number

Facility's Phone:

18c. Signature of Alternate Facility (or Generator) — Month Day Year

19. Hazardous Waste Report Management Method Codes (i.e., codes for hazardous waste treatment, disposal, and recycling systems)

1. H132 2. 3. 4.

20. Designated Facility Owner or Operator: Certification of receipt of hazardous materials covered by the manifest except as noted in Item 18a

Printed/Typed Name — Signature — Month Day Year 05 12 10

GENERATOR — INT'L — TRANSPORTER — DESIGNATED FACILITY

EPA Form 8700-22 (Rev. 3-05) Previous editions are obsolete.

DESIGNATED FACILITY TO DESTINATION STATE (IF REQUIRED)

NO. 191298

CLEANHARBORS BUTTONWILLOW, LLC
WEIGHMASTER CERTIFICATE

1:32 PM 05/12/10
REC. (46)
INBOUND 86520 lb

THIS IS TO CERTIFY that the following described commodity was weighed, measured, or counted by a weighmaster whose signature is on this certificate, who is a recognized authority of accuracy, as prescribed in Chapter 7 (commencing with Section 12700) of Division 5 of the California Business and Professions Code, administered by the Division of Measurement Standards of the California Department of Food and Agriculture.

WEIGHMASTER CLEANHARBORS BUTTONWILLOW, LLC

1:54 PM 05/12/10
REC. (46)

86520 lb GROSS
30920 lb TARE
55600 lb NET

PROFILE NO.	CIT4207958	GROSS WT. BY: DEPUTY	DATE 05 7 20
DISPOSAL LOCATION	35-3-19-F05	TARE WT. BY: DEPUTY	DATE 5 7 20
DRIVER'S NAME PRINTED	DANNY Z SUZA	WEIGHING LOCATION:	2500 W. LOKERN ROAD BUTTONWILLOW, CA 93206
DRIVER'S NAME SIGNATURE	Danny Z Suza	GENERATOR	CITY OF SANTA BARBARA
TRACTOR NO.	D4	TRANSPORTER	D.Z. SUZA TRUCKING
TRACTOR LIC. NO.	9D00982	MANIFEST NO.	004744137 JK
TRAILER LIC. NO.	250-3FT	SERVICE ORDER NO.	2W287366
BIN NUMBERS:		BIN TRACKING	

☒ END DUMP ☐ TRANSFER ☐ VACUUM ☐ VAN
☐ ROLL OFF ☐ FLAT BED ☐

VIS	pH	SUL	CYA	OX	FL	FLASH	20%	
+								

OTHER:

IC	CR	PR	B.W. W.B.	LAB	SOLID BULK	WORK SHEET	LAND TRACK	W.T. SCAN	MAN-SCAN	RE-SCAN
41	RLJ	RLJ								

DRUM NUMBER: 2122977

COMMENTS:

BIN DROP FULL:

MOVE BIN TO: DATE: BY:

Please print or type. (Form designed for use on elite (12-pitch) typewriter.)

Form Approved. OMB No. 2050-0039

UNIFORM HAZARDOUS WASTE MANIFEST

1. Generator ID Number: CAC002353428
2. Page 1 of
3. Emergency Response Phone: (805) 564-5402
4. Manifest Tracking Number: 004744138 **JJK**

5. Generator's Name and Mailing Address: City Of Santa Barbara, PO Box 1990, Santa Barbara, CA 93102
Generator's Site Address (if different than mailing address): 1739 Cliff Drive, Santa Barbara, CA 93101
Generator's Phone: 963

6. Transporter 1 Company Name: FBR Trucking
U.S. EPA ID Number: CAR000180056

7. Transporter 2 Company Name:
U.S. EPA ID Number:

8. Designated Facility Name and Site Address: Clean Harbors Buttonwillow, 2500 West Lokern Road, Buttonwillow, CA 93206
U.S. EPA ID Number: CAD982484276
Facility's Phone: 661-764-6900

9a. HM	9b. U.S. DOT Description (including Proper Shipping Name, Hazard Class, ID Number, and Packing Group (if any))	10. Containers No.	10. Containers Type	11. Total Quantity	12. Unit Wt./Vol.	13. Waste Codes
	1. Waste Flammable Liquids, n.o.s. (Methanol), 9, UN3082, PG III	001	DT	00012	P	331
	2.					
	3.					
	4.					

14. Special Handling Instructions and Additional Information: TD17920

15. **GENERATOR'S/OFFEROR'S CERTIFICATION:** I hereby declare that the contents of this consignment are fully and accurately described above by the proper shipping name, and are classified, packaged, marked and labeled/placarded, and are in all respects in proper condition for transport according to applicable international and national governmental regulations. If export shipment and I am the Primary Exporter, I certify that the contents of this consignment conform to the terms of the attached EPA Acknowledgment of Consent.
I certify that the waste minimization statement identified in 40 CFR 262.27(a) (if I am a large quantity generator) or (b) (if I am a small quantity generator) is true.

Generator's/Offeror's Printed/Typed Name: Cesar Aguirre
Signature: [signature]
Month: 5 Day: 10 Year: 10

16. International Shipments ☐ Import to U.S. ☐ Export from U.S. Port of entry/exit:
Transporter signature (for exports only): Date leaving U.S.:

17. Transporter Acknowledgment of Receipt of Materials
Transporter 1 Printed/Typed Name: Alberto B Rodriguez
Signature: [signature]
Month: 5 Day: 10 Year: 10
Transporter 2 Printed/Typed Name:
Signature:
Month: Day: Year:

18. Discrepancy
18a. Discrepancy Indication Space ☐ Quantity ☐ Type ☐ Residue ☐ Partial Rejection ☐ Full Rejection
Manifest Reference Number:
18b. Alternate Facility (or Generator)
U.S. EPA ID Number:
Facility's Phone:
18c. Signature of Alternate Facility (or Generator)
Month: Day: Year:

19. Hazardous Waste Report Management Method Codes (i.e., codes for hazardous waste treatment, disposal, and recycling systems)
1. H132 2. 3. 4.

20. Designated Facility Owner or Operator: Certification of receipt of hazardous materials covered by the manifest except as noted in Item 18a
Printed/Typed Name:
Signature:
Month: Day: Year:

GENERATOR — INT'L — TRANSPORTER — DESIGNATED FACILITY

EPA Form 8700-22 (Rev. 3-05) Previous editions are obsolete.

TRANSPORTER'S COPY

NO. 191295

CLEANHARBORS BUTTONWILLOW, LLC
WEIGHMASTER CERTIFICATE

1:24 PM 05/12/10
REG. (17)
INBOUND 83040 lb

THIS IS TO CERTIFY that the following described commodity was weighed, measured, or counted by a weighmaster whose signature is on this certificate, who is a recognized authority of accuracy, as prescribed in Chapter 7 (commencing with Section12700) of Division 5 of the California Business and Professions Code, administered by the Division of Measurement Standards of the California Department of Food and Agiculture.

WEIGHMASTER CLEANHARBORS BUTTONWILLOW, LLC

1:38 PM 05/12/10
REG. (17)

83040 lb GROSS
32340 lb TARE
50700 lb NET

PROFILE NO.	CH420795B	GROSS WT. BY:	DEPUTY / DATE 05/12/10
DISPOSAL LOCATION	35-3-19-E05	TARE WT. BY:	DEPUTY / DATE 05/12/10
DRIVER'S NAME PRINTED	Filberto B Rodriguez	WEIGHING LOCATION:	2500 W. LOKERN ROAD BUTTONWILLOW, CA 93206
DRIVER'S NAME SIGNATURE	Filberto Barajas Rodriguez	GENERATOR	City of BB
TRACTOR NO.	007	TRANSPORTER	FBR
TRACTOR LIC. NO.	9D17920	MANIFEST NO.	CW474413 8JJK
TRAILER LIC. NO.	T#6	SERVICE ORDER NO.	2W28733366
BIN NUMBERS:		BIN TRACKING	

☒ END DUMP ☐ TRANSFER ☐ VACUUM ☐ VAN
☐ ROLL OFF - _____ ☐ FLAT BED ☐ _____

VIS	pH	SUL	CYA	OX	FL	FLASH	20%	
+	7.98	-	—		N	N		

OTHER:

IC	CR	PR	B.W. W.B.	LAB	SOLID BULK	WORK SHEET	LAND TRACK	W.T. SCAN	MAN-SCAN	RE-SCAN

DRUM NUMBER:

COMMENTS:

BIN DROP FULL:

MOVE BIN TO: DATE: BY:

REVISED (3/10)

Please print or type. (Form designed for use on elite (12-pitch) typewriter.)

Form Approved. OMB No. 2050-0039

UNIFORM HAZARDOUS WASTE MANIFEST

1. Generator ID Number: CAC002650488

2. Page 1 of

3. Emergency Response Phone: (661) 746-1132

4. Manifest Tracking Number: 004744139 JJK

5. Generator's Name and Mailing Address
City Of Santa Barbara
PO BOX 1990
Santa Barbara, CA 93102
Generator's Phone: (805) 641-1000 x 23

Generator's Site Address (if different than mailing address)
125 State Street
Santa Barbara, CA 93101

6. Transporter 1 Company Name: A. Zarate transport
U.S. EPA ID Number: CAR000180109

7. Transporter 2 Company Name
U.S. EPA ID Number

8. Designated Facility Name and Site Address
Clean Harbors Buttonwillow
2500 West Lokern Road
Buttonwillow, CA 93206
Facility's Phone: (661) 762-6200
U.S. EPA ID Number: CAD980675276

9a. HM	9b. U.S. DOT Description (including Proper Shipping Name, Hazard Class, ID Number, and Packing Group (if any))	10. Containers No.	10. Containers Type	11. Total Quantity	12. Unit Wt./Vol.	13. Waste Codes
	1. Non, Non-RCRA Hazardous Waste, Solid, N/A	001	DT	00018	Y	611
	2.					
	3.					
	4.					

14. Special Handling Instructions and Additional Information
Profile #: CH420795B
Sales Order #: 7W2873366

15. **GENERATOR'S/OFFEROR'S CERTIFICATION:** I hereby declare that the contents of this consignment are fully and accurately described above by the proper shipping name, and are classified, packaged, marked and labeled/placarded, and are in all respects in proper condition for transport according to applicable international and national governmental regulations. If export shipment and I am the Primary Exporter, I certify that the contents of this consignment conform to the terms of the attached EPA Acknowledgment of Consent.
I certify that the waste minimization statement identified in 40 CFR 262.27(a) (if I am a large quantity generator) or (b) (if I am a small quantity generator) is true. 8602

Generator's/Offeror's Printed/Typed Name: Cenen Apuzzio
Signature: Cenen Apuzzio
Month 5 Day 10 Year 10

16. International Shipments ☐ Import to U.S. ☐ Export from U.S. Port of entry/exit:
Transporter signature (for exports only): Date leaving U.S.:

17. Transporter Acknowledgment of Receipt of Materials
Transporter 1 Printed/Typed Name: Armando Zarate
Signature:
Month 5 Day 12 Year 10
Transporter 2 Printed/Typed Name
Signature
Month Day Year

18. Discrepancy
18a. Discrepancy Indication Space ☐ Quantity ☐ Type ☐ Residue ☐ Partial Rejection ☐ Full Rejection
Manifest Reference Number:

18b. Alternate Facility (or Generator)
U.S. EPA ID Number
Facility's Phone:

18c. Signature of Alternate Facility (or Generator)
Month Day Year

19. Hazardous Waste Report Management Method Codes (i.e., codes for hazardous waste treatment, disposal, and recycling systems)
1. H132 2. 3. 4.

20. Designated Facility Owner or Operator: Certification of receipt of hazardous materials covered by the manifest except as noted in Item 18a
Printed/Typed Name
Signature
Month 05 Day 12 Year 10

GENERATOR — INT'L — TRANSPORTER — DESIGNATED FACILITY

EPA Form 8700-22 (Rev. 3-05) Previous editions are obsolete.

TRANSPORTER'S COPY

NO. 191294

1:19 PM 05/12/10
REG. (10)
INBOUND 84000 lb

CLEANHARBORS BUTTONWILLOW, LLC
WEIGHMASTER CERTIFICATE

THIS IS TO CERTIFY that the following described commodity was weighed, measured, or counted by a weighmaster whose signature is on this certificate, who is a recognized authority of accuracy, as prescribed in Chapter 7 (commencing with Section12700) of Division 5 of the California Business and Professions Code, administered by the Division of Measurement Standards of the California Department of Food and Agiculture.

WEIGHMASTER CLEANHARBORS BUTTONWILLOW, LLC

1:35 PM 05/12/10
REG. (10)

84000 lb GROSS
31560 lb TARE
52440 lb NET

PROFILE NO.	CH420755B	GROSS WT. BY: DEPUTY	DATE 05-12-10
DISPOSAL LOCATION	35-3-25-E05	TARE WT. BY: DEPUTY	DATE 05-12-10
DRIVER'S NAME PRINTED	Armando Zarate	WEIGHING LOCATION:	2500 W. LOKERN ROAD BUTTONWILLOW, CA 93206
DRIVER'S NAME SIGNATURE		GENERATOR	City of SB
TRACTOR NO.	11	TRANSPORTER	A Zarate
TRACTOR LIC. NO.	9046327	MANIFEST NO.	004744139JJK
TRAILER LIC. NO.	I	SERVICE ORDER NO.	2N2873366
BIN NUMBERS:		BIN TRACKING	

☒ END DUMP ☐ TRANSFER ☐ VACUUM ☐ VAN
☐ ROLL OFF ☐ FLAT BED ☐

VIS	pH	SUL	CYA	OX	FL	FLASH	20%	
+	7.86	—	—		Y	F		

OTHER:

IC	CR	PR	B.W. W.B.	LAB	SOLID BULK	WORK SHEET	LAND TRACK	W.T. SCAN	MAN-SCAN	RE-SCAN

DRUM NUMBER:

COMMENTS:

BIN DROP FULL:

MOVE BIN TO: DATE: BY:

REVISED (3/10)

9D44597

Please print or type. (Form designed for use on elite (12-pitch) typewriter.)

Form Approved. OMB No. 2050-0039

UNIFORM HAZARDOUS WASTE MANIFEST

1. Generator ID Number: CA5 9 0 3 0 1 0 4 5 8
2. Page 1 of
3. Emergency Response Phone: [illegible]
4. Manifest Tracking Number: 004744140 **JJK**

5. Generator's Name and Mailing Address: City of Santa Barbara, PO BOX 1990, Santa Barbara, CA 93102
Generator's Site Address (if different than mailing address): 135 State Street, Santa Barbara, CA 93101
Generator's Phone: [illegible]

6. Transporter 1 Company Name: Gomez Trucking
U.S. EPA ID Number: CAR000171348

7. Transporter 2 Company Name:
U.S. EPA ID Number:

8. Designated Facility Name and Site Address: Clean Harbors Buttonwillow, 2500 West Lokern Road, Buttonwillow, CA 93206
U.S. EPA ID Number: CAD982069376
Facility's Phone: [illegible]

9a. HM	9b. U.S. DOT Description (including Proper Shipping Name, Hazard Class, ID Number, and Packing Group (if any))	10. Containers No.	10. Containers Type	11. Total Quantity	12. Unit Wt./Vol.	13. Waste Codes
	1. Waste, Non-RCRA Hazardous Waste, Solid, N.A.	001	DT	00010	P	612
	2.					
	3.					
	4.					

14. Special Handling Instructions and Additional Information
Profile #: [illegible]
Sales Order #: [illegible]

15. **GENERATOR'S/OFFEROR'S CERTIFICATION:** I hereby declare that the contents of this consignment are fully and accurately described above by the proper shipping name, and are classified, packaged, marked and labeled/placarded, and are in all respects in proper condition for transport according to applicable international and national governmental regulations. If export shipment and I am the Primary Exporter, I certify that the contents of this consignment conform to the terms of the attached EPA Acknowledgment of Consent.
I certify that the waste minimization statement identified in 40 CFR 262.27(a) (if I am a large quantity generator) or (b) (if I am a small quantity generator) is true.

Generator's/Offeror's Printed/Typed Name: Cesar Aguilar
Signature: [signature]
Month 5 Day 10 Year 10

GENERATOR

16. International Shipments ☒ Import to U.S. ☐ Export from U.S. Port of entry/exit:
Transporter signature (for exports only): Date leaving U.S.:

INT'L

17. Transporter Acknowledgment of Receipt of Materials
Transporter 1 Printed/Typed Name: Dinom Gomez
Signature: [signature]
Month 5 Day 10 Year 10
Transporter 2 Printed/Typed Name:
Signature:
Month Day Year

TRANSPORTER

18. Discrepancy
18a. Discrepancy Indication Space ☐ Quantity ☐ Type ☐ Residue ☐ Partial Rejection ☐ Full Rejection
Manifest Reference Number:
18b. Alternate Facility (or Generator)
U.S. EPA ID Number
Facility's Phone:
18c. Signature of Alternate Facility (or Generator)
Month Day Year

DESIGNATED FACILITY

19. Hazardous Waste Report Management Method Codes (i.e., codes for hazardous waste treatment, disposal, and recycling systems)
1. H132 2. 3. 4.

20. Designated Facility Owner or Operator: Certification of receipt of hazardous materials covered by the manifest except as noted in Item 18a
Printed/Typed Name:
Signature:
Month Day Year

EPA Form 8700-22 (Rev. 3-05) Previous editions are obsolete.

TRANSPORTER'S COPY

NO. 191291

CLEANHARBORS BUTTONWILLOW, LLC
WEIGHMASTER CERTIFICATE

1:00 PM 05/12/10
REG. (71)
INBOUND 86240 lb

THIS IS TO CERTIFY that the following described commodity was weighed, measured, or counted by a weighmaster whose signature is on this certificate, who is a recognized authority of accuracy, as prescribed in Chapter 7 (commencing with Section12700) of Division 5 of the California Business and Professions Code, administered by the Division of Measurement Standards of the California Department of Food and Agiculture.

WEIGHMASTER CLEANHARBORS BUTTONWILLOW, LLC

1:16 PM 05/12/10
REG. (71)

86240 lb GROSS
30300 lb TARE
55940 lb NET

PROFILE NO.	CH4207955B	GROSS WT. BY: DEPUTY	DATE 05-12-10
DISPOSAL LOCATION	35-3-15-E 205	TARE WT. BY: DEPUTY	DATE 5/12/10
DRIVER'S NAME PRINTED	Dinora Gomez	WEIGHING LOCATION:	2500 W. LOKERN ROAD BUTTONWILLOW, CA 93206
DRIVER'S NAME SIGNATURE	Dinora Gomez	GENERATOR	Citrofy SB
TRACTOR NO.	15	TRANSPORTER	Gomez
TRACTOR LIC. NO.	9D44397	MANIFEST NO.	004744140JJK
TRAILER LIC. NO.	4DA7311	SERVICE ORDER NO.	7W2873366
BIN NUMBERS:		BIN TRACKING	

☒ END DUMP ☐ TRANSFER ☐ VACUUM ☐ VAN
☐ ROLL OFF - _____ ☐ FLAT BED ☐ _____

VIS	pH	SUL	CYA	OX	FL	FLASH	20%	
+	8/11	—	—		M	M		
OTHER:								

IC	CR	PR	B.W. W.B.	LAB	SOLID BULK	WORK SHEET	LAND TRACK	W.T. SCAN	MAN-SCAN	RE-SCAN

DRUM NUMBER:

COMMENTS:

BIN DROP FULL:

MOVE BIN TO: DATE: BY:

REVISED (3/10)

Please print or type. (Form designed for use on elite (12-pitch) typewriter.)

Form Approved. OMB No. 2050-0039

UNIFORM HAZARDOUS WASTE MANIFEST

1. Generator ID Number: CAT080020464
2. Page 1 of
3. Emergency Response Phone: [illegible]
4. Manifest Tracking Number: 004744141 JJK

5. Generator's Name and Mailing Address: City Of Santa Barbara
[illegible] P.O. Box 1990
Generator's Phone: [illegible]
Santa Barbara, CA 93102

Generator's Site Address (if different than mailing address): 123 State Street
Santa Barbara, CA 93101

6. Transporter 1 Company Name: Gasper Trucking
U.S. EPA ID Number: CAR000173161

7. Transporter 2 Company Name:
U.S. EPA ID Number:

8. Designated Facility Name and Site Address: Clean Harbors Buttonwillow
2300 West Lokern Road
Buttonwillow, CA 93206
Facility's Phone: [illegible]
U.S. EPA ID Number: CAD008287324

9a. HM	9b. U.S. DOT Description (including Proper Shipping Name, Hazard Class, ID Number, and Packing Group (if any))	10. Containers No.	10. Containers Type	11. Total Quantity	12. Unit Wt./Vol.	13. Waste Codes
	1. Non-Reg RCRA Hazardous Waste, Solid, N.O.S.	001	DT	00017	P	011
	2.					
	3.					
	4.					

14. Special Handling Instructions and Additional Information
Profile # CH437958
Sales Order # 7043873366

15. **GENERATOR'S/OFFEROR'S CERTIFICATION:** I hereby declare that the contents of this consignment are fully and accurately described above by the proper shipping name, and are classified, packaged, marked and labeled/placarded, and are in all respects in proper condition for transport according to applicable international and national governmental regulations. If export shipment and I am the Primary Exporter, I certify that the contents of this consignment conform to the terms of the attached EPA Acknowledgment of Consent.
I certify that the waste minimization statement identified in 40 CFR 262.27(a) (if I am a large quantity generator) or (b) (if I am a small quantity generator) is true.

Generator's/Offeror's Printed/Typed Name: Cesar Aguirio
Signature: [illegible]
Month 5 Day 10 Year 10

16. International Shipments ☐ Import to U.S. ☐ Export from U.S. Port of entry/exit:
Transporter signature (for exports only): Date leaving U.S.:

17. Transporter Acknowledgment of Receipt of Materials
Transporter 1 Printed/Typed Name: Gasper Lopez
Signature: [illegible]
Month 5 Day 12 Year 10
Transporter 2 Printed/Typed Name:
Signature:
Month Day Year

18. Discrepancy
18a. Discrepancy Indication Space ☐ Quantity ☐ Type ☐ Residue ☐ Partial Rejection ☐ Full Rejection
Manifest Reference Number:
18b. Alternate Facility (or Generator)
U.S. EPA ID Number
Facility's Phone:
18c. Signature of Alternate Facility (or Generator)
Month Day Year

19. Hazardous Waste Report Management Method Codes (i.e., codes for hazardous waste treatment, disposal, and recycling systems)
1. H132 2. 3. 4.

20. Designated Facility Owner or Operator: Certification of receipt of hazardous materials covered by the manifest except as noted in Item 18a
Printed/Typed Name:
Signature:
Month 05 Day 12 Year 10

GENERATOR | INT'L | TRANSPORTER | DESIGNATED FACILITY

EPA Form 8700-22 (Rev. 3-05) Previous editions are obsolete.

TRANSPORTER'S COPY

NO. 191296

CLEANHARBORS BUTTONWILLOW, LLC
WEIGHMASTER CERTIFICATE

THIS IS TO CERTIFY that the following described commodity was weighed, measured, or counted by a weighmaster whose signature is on this certificate, who is a recognized authority of accuracy, as prescribed in Chapter 7 (commencing with Section12700) of Division 5 of the California Business and Professions Code, administered by the Division of Measurement Standards of the California Department of Food and Agiculture.

WEIGHMASTER CLEANHARBORS BUTTONWILLOW, LLC

PROFILE NO.	CH482079573	GROSS WT. BY:	DEPUTY	DATE 05
DISPOSAL LOCATION	35-3-19-F 105	TARE WT. BY:	DEPUTY	DATE 05
DRIVER'S NAME PRINTED	Gaspar Lopez	WEIGHING LOCATION:	2500 W. LOKERN ROAD BUTTONWILLOW, CA 93206	
DRIVER'S NAME SIGNATURE		GENERATOR	City of SB	
TRACTOR NO.	19	TRANSPORTER	Gaspar	
TRACTOR LIC. NO.	9DG2904	MANIFEST NO.	004741941 JJK	
TRAILER LIC. NO.	4AE7521	SERVICE ORDER NO.	7W2873366	
BIN NUMBERS:		BIN TRACKING		

☑ END DUMP ☐ TRANSFER ☐ VACUUM ☐ VAN

☐ ROLL OFF - _____ ☐ FLAT BED ☐ _____

VIS	pH	SUL	CYA	OX	FL	FLASH	20%	
4								
OTHER:								

IC	CR	PR	B.W. W.B.	LAB	SOLID BULK	WORK SHEET	LAND TRACK	W.T. SCAN	MAN-SCAN	RE-SCAN

DRUM NUMBER:

COMMENTS:

BIN DROP FULL:

MOVE BIN TO: DATE: BY:

REVISED (3/10)

Please print or type. (Form designed for use on elite (12-pitch) typewriter.)

Form Approved. OMB No. 2050-0039

UNIFORM HAZARDOUS WASTE MANIFEST

1. Generator ID Number: CAC000265048 8
2. Page 1 of
3. Emergency Response Phone: (661) 746-1132
4. Manifest Tracking Number: 004744134 JJK

5. Generator's Name and Mailing Address
City Of Santa Barbara
PO BOX 1990
Santa Barbara, CA 93102
Generator's Phone: (805) 641-1000 x 23

Generator's Site Address (if different than mailing address)
125 State Street
Santa Barbara, CA 93101

6. Transporter 1 Company Name: Santa Fe Trucking
U.S. EPA ID Number: CAR 000168 799

7. Transporter 2 Company Name
U.S. EPA ID Number

8. Designated Facility Name and Site Address
Clean Harbors Buttonwillow
2300 West Lokern Road
Buttonwillow, CA 93206
Facility's Phone: (661) 762-6200
U.S. EPA ID Number: CAD 980673276

9a. HM	9b. U.S. DOT Description (including Proper Shipping Name, Hazard Class, ID Number, and Packing Group (if any))	10. Containers No.	10. Containers Type	11. Total Quantity	12. Unit Wt./Vol.	13. Waste Codes		
	1. None, Non-RCRA Hazardous Waste, Solid, N/A	001	DT	00018	T	611		
	2.							
	3.							
	4.							

14. Special Handling Instructions and Additional Information
Profile #: CEH420795B
Sales Order #: 7W2873366

15. **GENERATOR'S/OFFEROR'S CERTIFICATION:** I hereby declare that the contents of this consignment are fully and accurately described above by the proper shipping name, and are classified, packaged, marked and labeled/placarded, and are in all respects in proper condition for transport according to applicable international and national governmental regulations. If export shipment and I am the Primary Exporter, I certify that the contents of this consignment conform to the terms of the attached EPA Acknowledgment of Consent.
I certify that the waste minimization statement identified in 40 CFR 262.27(a) (if I am a large quantity generator) or (b) (if I am a small quantity generator) is true.

Generator's/Offeror's Printed/Typed Name: Cemea Aparicio
Signature: Cemea Aparicio
Month: 5 Day: 10 Year: 10

16. International Shipments ☐ Import to U.S. ☐ Export from U.S. Port of entry/exit:
Transporter signature (for exports only): Date leaving U.S.:

17. Transporter Acknowledgment of Receipt of Materials
Transporter 1 Printed/Typed Name: Santa Fe
Signature
Month: 5 Day: 10 Year: 10
Transporter 2 Printed/Typed Name
Signature
Month Day Year

18. Discrepancy
18a. Discrepancy Indication Space ☐ Quantity ☐ Type ☐ Residue ☐ Partial Rejection ☐ Full Rejection
Manifest Reference Number:

18b. Alternate Facility (or Generator)
U.S. EPA ID Number
Facility's Phone:

18c. Signature of Alternate Facility (or Generator)
Month Day Year

19. Hazardous Waste Report Management Method Codes (i.e., codes for hazardous waste treatment, disposal, and recycling systems)
1. H132 2. 3. 4.

20. Designated Facility Owner or Operator: Certification of receipt of hazardous materials covered by the manifest except as noted in Item 18a
Printed/Typed Name
Signature
Month Day Year

GENERATOR | INT'L | TRANSPORTER | DESIGNATED FACILITY

EPA Form 8700-22 (Rev. 3-05) Previous editions are obsolete.

TRANSPORTER'S COPY

NO. 191414

CLEANHARBORS BUTTONWILLOW, LLC
WEIGHMASTER CERTIFICATE

THIS IS TO CERTIFY that the following described commodity was weighed, measured, or counted by a weighmaster whose signature is on this certificate, who is a recognized authority of accuracy, as prescribed in Chapter 7 (commencing with Section12700) of Division 5 of the California Business and Professions Code, administered by the Division of Measurement Standards of the California Department of Food and Agiculture.

WEIGHMASTER CLEANHARBORS BUTTONWILLOW, LLC

2:44 PM 05/14/10
REG. (9)
INBOUND 82800 lb

3:11 PM 05/14/10
REG. (9)

82800 lb GROSS
31660 lb TARE
51140 lb NET

PROFILE NO. CH4207955	GROSS WT. BY	DEPUTY	DATE 5/14/10
DISPOSAL LOCATION 35.3 19-F 06	TARE WT. BY	DEPUTY	DATE 05/14/10
DRIVER'S NAME PRINTED Santiago Ruiz	WEIGHING LOCATION:	2500 W. LOKERN ROAD BUTTONWILLOW, CA 93206	
DRIVER'S NAME SIGNATURE	GENERATOR City of SB		
TRACTOR NO. SF02	TRANSPORTER Santa FE		
TRACTOR LIC. NO. 9E18117	MANIFEST NO. 004744134 JJK		
TRAILER LIC. NO.	SERVICE ORDER NO. 7W287336 6		
BIN NUMBERS:	BIN TRACKING		

☑ END DUMP ☐ TRANSFER ☐ VACUUM ☐ VAN
☐ ROLL OFF ☐ FLAT BED ☐

VIS	pH	SUL	CYA	OX	FL	FLASH	20%	
1							1	
OTHER:								

IC	CR	PR	B.W. W.B.	LAB	SOLID BULK	WORK SHEET	LAND TRACK	W.T. SCAN	MAN-SCAN	RE-SCAN

DRUM NUMBER:

COMMENTS:

BIN DROP FULL:

MOVE BIN TO: DATE: BY:

REVISED (3/10)

P 1 P09176 1 of 66

Please print or type. (Form designed for use on elite (12-pitch) typewriter.)

Form Approved. OMB No. 2050-0039

UNIFORM HAZARDOUS WASTE MANIFEST

1. Generator ID Number: CAC002650488
2. Page 1 of
3. Emergency Response Phone: (661) 746-1132
4. Manifest Tracking Number: 004744135 JJK

5. Generator's Name and Mailing Address
City Of Santa Barbara
PO BOX 1990
Santa Barbara, CA 93102
Generator's Phone: (805) 641-1000 x 23

Generator's Site Address (if different than mailing address)
123 State Street
Santa Barbara, CA 93101

6. Transporter 1 Company Name: Remedial Transportation Services
U.S. EPA ID Number: CAT 000181560

7. Transporter 2 Company Name
U.S. EPA ID Number

8. Designated Facility Name and Site Address
Clean Harbors Buttonwillow
2300 West Lokern Road
Buttonwillow, CA 93206
Facility's Phone: (661) 762-6200
U.S. EPA ID Number: CAD983067376

9a. HM	9b. U.S. DOT Description (Including Proper Shipping Name, Hazard Class, ID Number, and Packing Group (if any))	10. Containers No.	10. Containers Type	11. Total Quantity	12. Unit Wt./Vol.	13. Waste Codes
	1. None, Non-RCRA Hazardous Waste, Solid, N/A	001	DT	00018	Y	611
	2.					
	3.					
	4.					

14. Special Handling Instructions and Additional Information
Profile # CH420795B
Sales Order # 7W2873366

15. **GENERATOR'S/OFFEROR'S CERTIFICATION:** I hereby declare that the contents of this consignment are fully and accurately described above by the proper shipping name, and are classified, packaged, marked and labeled/placarded, and are in all respects in proper condition for transport according to applicable international and national governmental regulations. If export shipment and I am the Primary Exporter, I certify that the contents of this consignment conform to the terms of the attached EPA Acknowledgment of Consent.
I certify that the waste minimization statement identified in 40 CFR 262.27(a) (if I am a large quantity generator) or (b) (if I am a small quantity generator) is true.

Generator's/Offeror's Printed/Typed Name: Carmen Aparicio
Signature: Carmen Aparicio
Month 05 Day 14 Year 10

16. International Shipments ☐ Import to U.S. ☐ Export from U.S. Port of entry/exit:
Transporter signature (for exports only): Date leaving U.S.:

17. Transporter Acknowledgment of Receipt of Materials
Transporter 1 Printed/Typed Name: Jordan Lee
Signature: Jordan Lee
Month 05 Day 14 Year 10
Transporter 2 Printed/Typed Name
Signature
Month Day Year

18. Discrepancy
18a. Discrepancy Indication Space ☐ Quantity ☐ Type ☐ Residue ☐ Partial Rejection ☐ Full Rejection
Manifest Reference Number:

18b. Alternate Facility (or Generator)
U.S. EPA ID Number
Facility's Phone:

18c. Signature of Alternate Facility (or Generator)
Month Day Year

19. Hazardous Waste Report Management Method Codes (i.e., codes for hazardous waste treatment, disposal, and recycling systems)
1. 2. 3. 4.

20. Designated Facility Owner or Operator: Certification of receipt of hazardous materials covered by the manifest except as noted in Item 18a
Printed/Typed Name: Ronald E Johns
Signature
Month Day Year

GENERATOR — INT'L — TRANSPORTER — DESIGNATED FACILITY

EPA Form 8700-22 (Rev. 3-05) Previous editions are obsolete.

TRANSPORTER'S COPY

NO. 191405

CLEANHARBORS BUTTONWILLOW, LLC
WEIGHMASTER CERTIFICATE

2:00 PM 05/14/10
REG. (9)
INBOUND 78720 lb

THIS IS TO CERTIFY that the following described commodity was weighed, measured, or counted by a weighmaster whose signature is on this certificate, who is a recognized authority of accuracy, as prescribed in Chapter 7 (commencing with Section12700) of Division 5 of the California Business and Professions Code, administered by the Division of Measurement Standards of the California Department of Food and Agiculture.

WEIGHMASTER CLEANHARBORS BUTTONWILLOW, LLC

2:20 PM 05/14/10
REG. (9)

78720 lb GROSS
31460 lb TARE
47260 lb NET

PROFILE NO.	CH1420795 13	GROSS WT. BY: DEPUTY	DATE 5/14/10
DISPOSAL LOCATION	35 3 19-F 06	TARE WT. BY: DEPUTY	DATE 051410
DRIVER'S NAME PRINTED	Jordan Lee	WEIGHING LOCATION:	2500 W. LOKERN ROAD BUTTONWILLOW, CA 93206
DRIVER'S NAME SIGNATURE	Jordan Lee	GENERATOR	city of SB
TRACTOR NO.	26	TRANSPORTER	RTS
TRACTOR LIC. NO.	TP03176	MANIFEST NO.	004744135JJK
TRAILER LIC. NO.	4FK3814	SERVICE ORDER NO.	7607873366
BIN NUMBERS:		BIN TRACKING	

☒ END DUMP ☐ TRANSFER ☐ VACUUM ☐ VAN
☐ ROLL OFF - _____ ☐ FLAT BED ☐ _____

VIS	pH	SUL	CYA	OX	FL	FLASH	20%	
+	—					—	✓	
OTHER:								

IC	CR	PR	B.W. W.B.	LAB	SOLID BULK	WORK SHEET	LAND TRACK	W.T. SCAN	MAN-SCAN	RE-SCAN

DRUM NUMBER:

COMMENTS:

BIN DROP FULL:

MOVE BIN TO: DATE: BY:

REVISED (3/10)

Please print or type. (Form designed for use on elite (12-pitch) typewriter.)

Form Approved. OMB No. 2050-0039

UNIFORM HAZARDOUS WASTE MANIFEST

1. Generator ID Number: CAC002650488
2. Page 1 of
3. Emergency Response Phone: (661) 746-1132
4. Manifest Tracking Number: 004744136 JJK

5. Generator's Name and Mailing Address
City Of Santa Barbara
PO BOX 1990
Santa Barbara, CA 93102
Generator's Phone: (805) 641-1000 x 23

Generator's Site Address (if different than mailing address)
123 State Street
Santa Barbara, CA 93101

6. Transporter 1 Company Name: REMEDIAL TRANSPORTATION SERVICE
U.S. EPA ID Number: CAR000181520

7. Transporter 2 Company Name
U.S. EPA ID Number

8. Designated Facility Name and Site Address
Clean Harbors Buttonwillow
2300 West Lokern Road
Buttonwillow, CA 93206
Facility's Phone: (661) 762-6200
U.S. EPA ID Number: CAD982067276

9a. HM	9b. U.S. DOT Description (including Proper Shipping Name, Hazard Class, ID Number, and Packing Group (if any))	10. Containers No.	10. Containers Type	11. Total Quantity	12. Unit Wt./Vol.	13. Waste Codes
	1. None, Non-RCRA Hazardous Waste, Solid, N/A	001	DT	00018	T	611
	2.					
	3. SLCC					
	4.					

14. Special Handling Instructions and Additional Information
R-24 TPO 3174
Profile #: CH420795B
Sales Order #: 7W2873360

15. **GENERATOR'S/OFFEROR'S CERTIFICATION:** I hereby declare that the contents of this consignment are fully and accurately described above by the proper shipping name, and are classified, packaged, marked and labeled/placarded, and are in all respects in proper condition for transport according to applicable international and national governmental regulations. If export shipment and I am the Primary Exporter, I certify that the contents of this consignment conform to the terms of the attached EPA Acknowledgment of Consent.
I certify that the waste minimization statement identified in 40 CFR 262.27(a) (if I am a large quantity generator) or (b) (if I am a small quantity generator) is true.

Generator's/Offeror's Printed/Typed Name: Cesar Aparicio
Signature: [signature]
Month 5 Day 10 Year 10

16. International Shipments ☐ Import to U.S. ☐ Export from U.S. Port of entry/exit:
Transporter signature (for exports only): Date leaving U.S.:

17. Transporter Acknowledgment of Receipt of Materials
Transporter 1 Printed/Typed Name: ANGELO CAQUIAS
Signature: [signature]
Month 5 Day 14 Year 10
Transporter 2 Printed/Typed Name
Signature
Month Day Year

18. Discrepancy
18a. Discrepancy Indication Space ☐ Quantity ☐ Type ☐ Residue ☐ Partial Rejection ☐ Full Rejection
Manifest Reference Number:

18b. Alternate Facility (or Generator)
U.S. EPA ID Number
Facility's Phone:

18c. Signature of Alternate Facility (or Generator)
Month Day Year

19. Hazardous Waste Report Management Method Codes (i.e., codes for hazardous waste treatment, disposal, and recycling systems)
1. H132
2.
3.
4.

20. Designated Facility Owner or Operator: Certification of receipt of hazardous materials covered by the manifest except as noted in Item 18a
Printed/Typed Name: Charles Terry
Signature: [signature]
Month 5 Day 4 Year 10

GENERATOR | INT'L | TRANSPORTER | DESIGNATED FACILITY

EPA Form 8700-22 (Rev. 3-05) Previous editions are obsolete.

TRANSPORTER'S COPY

NO. 191398

CLEANHARBORS BUTTONWILLOW, LLC
WEIGHMASTER CERTIFICATE

1:27 PM 05/14/10
REG. (2)
INBOUND 86780 lb

THIS IS TO CERTIFY that the following described commodity was weighed, measured, or counted by a weighmaster whose signature is on this certificate, who is a recognized authority of accuracy, as prescribed in Chapter 7 (commencing with Section12700) of Division 5 of the California Business and Professions Code, administered by the Division of Measurement Standards of the California Department of Food and Agiculture.

WEIGHMASTER CLEANHARBORS BUTTONWILLOW, LLC

1:49 PM 05/14/10
REG. (2)

86780 lb GROSS
31680 lb TARE
55100 lb NET

PROFILE NO. CHU120795 B	GROSS WT. BY:	DEPUTY	DATE 5/14/10
DISPOSAL LOCATION 35.3 19.F06	TARE WT. BY:	DEPUTY	DATE 05.14.10
DRIVER'S NAME PRINTED ANGELO CAQUIAS	WEIGHING LOCATION:	2500 W. LOKERN ROAD BUTTONWILLOW, CA 93206	
DRIVER'S NAME SIGNATURE Angelo Caquias	GENERATOR	City of SB	
TRACTOR NO. R 24	TRANSPORTER	RTS	
TRACTOR LIC. NO. TPO 3174	MANIFEST NO.	004744136JJK	
TRAILER LIC. NO. 4CY 6740	SERVICE ORDER NO.	7W2873366	
BIN NUMBERS:	BIN TRACKING		

☑ END DUMP ☐ TRANSFER ☐ VACUUM ☐ VAN

☐ ROLL OFF - _____ ☐ FLAT BED ☐ _____

VIS	pH	SUL	CYA	OX	FL	FLASH	20%	
1	6.47	-	-	-	-			
OTHER:								

IC	CR	PR	B.W. W.B.	LAB	SOLID BULK	WORK SHEET	LAND TRACK	W.T. SCAN	MAN-SCAN	RE-SCAN

DRUM NUMBER:

COMMENTS:

BIN DROP FULL:

MOVE BIN TO: DATE: BY:

REVISED (3/10)

1245 U170-01

Please print or type. (Form designed for use on elite (12-pitch) typewriter.) (661) 746-1132 Form Approved. OMB No. 2050-0039

UNIFORM HAZARDOUS WASTE MANIFEST

1. Generator ID Number: City Of Santa Barbara
2. Page 1 of
3. Emergency Response Phone
4. Manifest Tracking Number: 004741758 JJK

5. Generator's Name and Mailing Address: (805) 641-1000 x 23 — PO BOX 1990, Santa Barbara, CA 93102
Generator's Site Address (if different than mailing address): 123 State Street, Santa Barbara, CA 93101
Generator's Phone:

6. Transporter 1 Company Name: REMEDIAL TRANSPORTATION SERVICES — U.S. EPA ID Number: CAD000181560
7. Transporter 2 Company Name — U.S. EPA ID Number:

8. Designated Facility Name and Site Address: Clean Harbors Buttonwillow, 2300 West Lokern Road, (661) 762-6200, Buttonwillow, CA 93206 — U.S. EPA ID Number: CAD980673276
Facility's Phone:

9a. HM	9b. U.S. DOT Description (including Proper Shipping Name, Hazard Class, ID Number, and Packing Group (if any))	10. Containers No.	10. Containers Type	11. Total Quantity	12. Unit Wt./Vol.	13. Waste Codes
	1. None, Non-RCRA Hazardous Waste, Solid, N/A	001	DT	00015	Y	
	2.					
	3.					
	4.					

14. Special Handling Instructions and Additional Information
PO# 4500[illegible]
Sales Order # 7W2873366

15. **GENERATOR'S/OFFEROR'S CERTIFICATION:** I hereby declare that the contents of this consignment are fully and accurately described above by the proper shipping name, and are classified, packaged, marked and labeled/placarded, and are in all respects in proper condition for transport according to applicable international and national governmental regulations. If export shipment and I am the Primary Exporter, I certify that the contents of this consignment conform to the terms of the attached EPA Acknowledgment of Consent.
I certify that the waste minimization statement identified in 40 CFR 262.27(a) (if I am a large quantity generator) or (b) (if I am a small quantity generator) is true.

Generator's/Offeror's Printed/Typed Name: Cenen Aparicio — Signature: Cenen Aparicio — Month 5 Day 17 Year 10

GENERATOR

INT'L

16. International Shipments ☐ Import to U.S. ☐ Export from U.S. Port of entry/exit:
Transporter signature (for exports only): Date leaving U.S.:

TRANSPORTER

17. Transporter Acknowledgment of Receipt of Materials
Transporter 1 Printed/Typed Name: Julian Lozano — Signature: [signature] — Month 5 Day 17 Year 10
Transporter 2 Printed/Typed Name — Signature — Month Day Year

DESIGNATED FACILITY

18. Discrepancy
18a. Discrepancy Indication Space ☐ Quantity ☐ Type ☐ Residue ☐ Partial Rejection ☐ Full Rejection
Manifest Reference Number:
18b. Alternate Facility (or Generator) — U.S. EPA ID Number
Facility's Phone:
18c. Signature of Alternate Facility (or Generator) — Month Day Year

19. Hazardous Waste Report Management Method Codes (i.e., codes for hazardous waste treatment, disposal, and recycling systems)
1. H132 2. 3. 4.

20. Designated Facility Owner or Operator: Certification of receipt of hazardous materials covered by the manifest except as noted in Item 18a
Printed/Typed Name: Charles Terry — Signature: [signature] — Month 05 Day 17 Year 10

EPA Form 8700-22 (Rev. 3-05) Previous editions are obsolete. **TRANSPORTER'S COPY**

NO. 191488

CLEANHARBORS BUTTONWILLOW, LLC
WEIGHMASTER CERTIFICATE

4:25 PM 05/17/10
REG. (46)
INBOUND 76780 lb

THIS IS TO CERTIFY that the following described commodity was weighed, measured, or counted by a weighmaster whose signature is on this certificate, who is a recognized authority of accuracy, as prescribed in Chapter 7 (commencing with Section12700) of Division 5 of the California Business and Professions Code, administered by the Division of Measurement Standards of the California Department of Food and Agiculture.

WEIGHMASTER CLEANHARBORS BUTTONWILLOW, LLC

4:46 PM 05/17/10
REG. (46)

76780 lb GROSS
36440 lb TARE
40340 lb NET

PROFILE NO.	CH420755B	GROSS WT. BY	DEPUTY / DATE 5/17/10
DISPOSAL LOCATION	35.3 20-E.06	TARE WT. BY	DEPUTY / DATE 05-17-10
DRIVER'S NAME PRINTED	JULIAN	WEIGHING LOCATION:	2500 W. LOKERN ROAD BUTTONWILLOW, CA 93206
DRIVER'S NAME SIGNATURE		GENERATOR	City of SB
TRACTOR NO.	1243	TRANSPORTER	RTS
TRACTOR LIC. NO.	U192454	MANIFEST NO.	004741758 JJK
TRAILER LIC. NO.	250 4FT	SERVICE ORDER NO.	72873366
BIN NUMBERS:		BIN TRACKING	

☒ END DUMP ☐ TRANSFER ☐ VACUUM ☐ VAN
☐ ROLL OFF - _____ ☐ FLAT BED ☐ _____

VIS	pH	SUL	CYA	OX	FL	FLASH	20%	
✓						✓		

OTHER:

IC	CR	PR	B.W. W.B.	LAB	SOLID BULK	WORK SHEET	LAND TRACK	W.T. SCAN	MAN-SCAN	RE-SCAN

DRUM NUMBER:

COMMENTS:

BIN DROP FULL:

MOVE BIN TO: DATE: BY:

REVISED (3/10)

R34 UP1467

Please print or type. (Form designed for use on elite (12-pitch) typewriter.)

Form Approved. OMB No. 2050-0039

UNIFORM HAZARDOUS WASTE MANIFEST

1. Generator ID Number: CAC000265048

2. Page 1 of

3. Emergency Response Phone: (661) 746-1132

4. Manifest Tracking Number: 004744132 JJK

5. Generator's Name and Mailing Address: City Of Santa Barbara, PO BOX 1990, Santa Barbara, CA 93102

Generator's Site Address (if different than mailing address): 135 State Street, Santa Barbara, CA 93101

Generator's Phone: (805) 641-1000 x 23

6. Transporter 1 Company Name: Remedial Transportation Services

U.S. EPA ID Number: CAR000081560

7. Transporter 2 Company Name:

U.S. EPA ID Number:

8. Designated Facility Name and Site Address: Clean Harbors Buttonwillow, 2500 West Lokern Road, Buttonwillow, CA 93206

U.S. EPA ID Number: CAD980675276

Facility's Phone: (661) 762-6200

9a. HM	9b. U.S. DOT Description (including Proper Shipping Name, Hazard Class, ID Number, and Packing Group (if any))	10. Containers No.	10. Containers Type	11. Total Quantity	12. Unit Wt./Vol.	13. Waste Codes
	1. Non, Non-RCRA Hazardous Waste, Solid, N/A	001	DT	00018	Y	611
	2.					
	3.					
	4.					

14. Special Handling Instructions and Additional Information

Profile #: CEH420795B

Sales Order #: 7W2873365

15. **GENERATOR'S/OFFEROR'S CERTIFICATION:** I hereby declare that the contents of this consignment are fully and accurately described above by the proper shipping name, and are classified, packaged, marked and labeled/placarded, and are in all respects in proper condition for transport according to applicable international and national governmental regulations. If export shipment and I am the Primary Exporter, I certify that the contents of this consignment conform to the terms of the attached EPA Acknowledgment of Consent.
I certify that the waste minimization statement identified in 40 CFR 262.27(a) (if I am a large quantity generator) or (b) (if I am a small quantity generator) is true.

Generator's/Offeror's Printed/Typed Name: Chris Apostol

Signature: [signature]

Month 5 Day 10 Year 10

16. International Shipments ☐ Import to U.S. ☐ Export from U.S. Port of entry/exit:

Transporter signature (for exports only): Date leaving U.S.:

17. Transporter Acknowledgment of Receipt of Materials

Transporter 1 Printed/Typed Name: Allen Cuevas

Signature: [signature]

Month 5 Day 17 Year 10

Transporter 2 Printed/Typed Name:

Signature:

Month Day Year

18. Discrepancy

18a. Discrepancy Indication Space ☐ Quantity ☐ Type ☐ Residue ☐ Partial Rejection ☐ Full Rejection

Manifest Reference Number:

18b. Alternate Facility (or Generator)

U.S. EPA ID Number

Facility's Phone:

18c. Signature of Alternate Facility (or Generator)

Month Day Year

19. Hazardous Waste Report Management Method Codes (i.e., codes for hazardous waste treatment, disposal, and recycling systems)

1. H132 2. 3. 4.

20. Designated Facility Owner or Operator: Certification of receipt of hazardous materials covered by the manifest except as noted in Item 18a

Printed/Typed Name:

Signature:

Month Day Year

GENERATOR

INT'L

TRANSPORTER

DESIGNATED FACILITY

EPA Form 8700-22 (Rev. 3-05) Previous editions are obsolete.

TRANSPORTER'S COPY

NO. 191466

CLEANHARBORS BUTTONWILLOW, LLC
WEIGHMASTER CERTIFICATE

THIS IS TO CERTIFY that the following described commodity was weighed, measured, or counted by a weighmaster whose signature is on this certificate, who is a recognized authority of accuracy, as prescribed in Chapter 7 (commencing with Section12700) of Division 5 of the California Business and Professions Code, administered by the Division of Measurement Standards of the California Department of Food and Agiculture.

1:22 PM 05/17/10
REG. (17)
INBOUND 80400 lb

1:53 PM 05/17/10
REG. (17)
80400 lb GROSS
31360 lb TARE
49040 lb NET

WEIGHMASTER CLEANHARBORS BUTTONWILLOW, LLC

PROFILE NO.	CH420795B	GROSS WT. BY: DEPUTY	DATE 05/17/10
DISPOSAL LOCATION	35 3 20-E-06	TARE WT. BY: DEPUTY	DATE 05/17/10
DRIVER'S NAME PRINTED	Allan Cuna	WEIGHING LOCATION:	2500 W. LOKERN ROAD BUTTONWILLOW, CA 93206
DRIVER'S NAME SIGNATURE	Allan Cuna	GENERATOR	City of SB
TRACTOR NO.	R34	TRANSPORTER	RTS
TRACTOR LIC. NO.	UP14647	MANIFEST NO.	004744132JJK
TRAILER LIC. NO.	25CDFT	SERVICE ORDER NO.	7W2873366
BIN NUMBERS:		BIN TRACKING	

☑ END DUMP ☐ TRANSFER ☐ VACUUM ☐ VAN
☐ ROLL OFF - _____ ☐ FLAT BED ☐ _____

VIS	pH	SUL	CYA	OX	FL	FLASH	20%	
67	7.98	–	–	–	–			

OTHER:

IC	CR	PR	B.W. W.B.	LAB	SOLID BULK	WORK SHEET	LAND TRACK	W.T. SCAN	MAN-SCAN	RE-SCAN

DRUM NUMBER:

COMMENTS:

BIN DROP FULL:

MOVE BIN TO: DATE: BY:

REVISED (3/10)

Please print or type. (Form designed for use on elite (12-pitch) typewriter.) Form Approved. OMB No. 2050-0039

UNIFORM HAZARDOUS WASTE MANIFEST

1. Generator ID Number: CAC000265048 8
2. Page 1 of
3. Emergency Response Phone: (661) 746-1132
4. Manifest Tracking Number: 004744133 JJK

5. Generator's Name and Mailing Address: City Of Santa Barbara, PO BOX 1990, Santa Barbara, CA 93102
Generator's Phone: (805) 641-1000 x 23
Generator's Site Address (if different than mailing address): 123 State Street, Santa Barbara, CA 93101

6. Transporter 1 Company Name: REMEDIAL TRANSPORTATION SERVICE
U.S. EPA ID Number: CAR000181520

7. Transporter 2 Company Name:
U.S. EPA ID Number:

8. Designated Facility Name and Site Address: Clean Harbors Buttonwillow, 2300 West Lokern Road, Buttonwillow, CA 93206
Facility's Phone: (661) 763-6200
U.S. EPA ID Number: CAD982067276

9a. HM	9b. U.S. DOT Description (including Proper Shipping Name, Hazard Class, ID Number, and Packing Group (if any))	10. Containers No.	10. Containers Type	11. Total Quantity	12. Unit Wt./Vol.	13. Waste Codes		
	1. None, Non-RCRA Hazardous Waste, Solid, N/A	001	DT	00010	Y	611		
	2.							
	3.							
	4.							

14. Special Handling Instructions and Additional Information
Profile #: CEH20795B
Sales Order #: 7W2873366
R 24 TPO 3174

15. **GENERATOR'S/OFFEROR'S CERTIFICATION:** I hereby declare that the contents of this consignment are fully and accurately described above by the proper shipping name, and are classified, packaged, marked and labeled/placarded, and are in all respects in proper condition for transport according to applicable international and national governmental regulations. If export shipment and I am the Primary Exporter, I certify that the contents of this consignment conform to the terms of the attached EPA Acknowledgment of Consent.
I certify that the waste minimization statement identified in 40 CFR 262.27(a) (if I am a large quantity generator) or (b) (if I am a small quantity generator) is true.

Generator's/Offeror's Printed/Typed Name: Cenen Aparicio
Signature: Cenen Aparicio
Month Day Year: 5 10 10

16. International Shipments: ☐ Import to U.S. ☐ Export from U.S. Port of entry/exit:
Transporter signature (for exports only): Date leaving U.S.:

17. Transporter Acknowledgment of Receipt of Materials
Transporter 1 Printed/Typed Name: ANGELO CAQUIAS
Signature: Angelo Caquias
Month Day Year: 5 17 10
Transporter 2 Printed/Typed Name:
Signature:
Month Day Year:

18. Discrepancy
18a. Discrepancy Indication Space ☐ Quantity ☐ Type ☐ Residue ☐ Partial Rejection ☐ Full Rejection
Manifest Reference Number:

18b. Alternate Facility (or Generator)
U.S. EPA ID Number
Facility's Phone:

18c. Signature of Alternate Facility (or Generator)
Month Day Year

19. Hazardous Waste Report Management Method Codes (i.e., codes for hazardous waste treatment, disposal, and recycling systems)
1. H132
2.
3.
4.

20. Designated Facility Owner or Operator: Certification of receipt of hazardous materials covered by the manifest except as noted in Item 18a
Printed/Typed Name: Ronald E Johns
Signature: Ronald Johns
Month Day Year: 05 17 10

GENERATOR | INT'L | TRANSPORTER | DESIGNATED FACILITY

EPA Form 8700-22 (Rev. 3-05) Previous editions are obsolete.

TRANSPORTER'S COPY

NO. 191471

CLEANHARBORS BUTTONWILLOW, LLC
WEIGHMASTER CERTIFICATE

1:43 PM 05/17/10
REG. (46)
INBOUND 80420 lb

THIS IS TO CERTIFY that the following described commodity was weighed, measured, or counted by a weighmaster whose signature is on this certificate, who is a recognized authority of accuracy, as prescribed in Chapter 7 (commencing with Section12700) of Division 5 of the California Business and Professions Code, administered by the Division of Measurement Standards of the California Department of Food and Agiculture.

WEIGHMASTER CLEANHARBORS BUTTONWILLOW, LLC

2:00 PM 05/17/10
REG. (46)

80420 lb GROSS
31320 lb TARE
49100 lb NET

PROFILE NO.	CH420795B	GROSS WT. BY:	DEPUTY / DATE 5/17/10
DISPOSAL LOCATION	35.3 20-E-06	TARE WT. BY:	DEPUTY / DATE 051710
DRIVER'S NAME PRINTED	ANGELO AQUINAS	WEIGHING LOCATION:	2500 W. LOKERN ROAD BUTTONWILLOW, CA 93206
DRIVER'S NAME SIGNATURE	Angelo Aquinas	GENERATOR	City of SB
TRACTOR NO.	R24	TRANSPORTER	RTS
TRACTOR LIC. NO.	TP0 3174	MANIFEST NO.	004744133 JJK
TRAILER LIC. NO.	4C46740	SERVICE ORDER NO.	7W2873366
BIN NUMBERS:		BIN TRACKING	

☒ END DUMP ☐ TRANSFER ☐ VACUUM ☐ VAN
☐ ROLL OFF - _____ ☐ FLAT BED ☐ _____

VIS	pH	SUL	CYA	OX	FL	FLASH	20%	
+	—	—	—	—	—	—	Y	
OTHER:								

IC	CR	PR	B.W. W.B.	LAB	SOLID BULK	WORK SHEET	LAND TRACK	W.T. SCAN	MAN-SCAN	RE-SCAN

DRUM NUMBER:

COMMENTS:

BIN DROP FULL:

MOVE BIN TO: DATE: BY:

REVISED (3/10)

Please print or type. (Form designed for use on elite (12-pitch) typewriter.)

Form Approved. OMB No. 2050-0039

UNIFORM HAZARDOUS WASTE MANIFEST

1. Generator ID Number: CAC002650408
2. Page 1 of
3. Emergency Response Phone: (661) 746-1132
4. Manifest Tracking Number: 004741760 JJK

5. Generator's Name and Mailing Address
City Of Santa Barbara
PO BOX 1990
Santa Barbara, CA 93102
Generator's Phone: (805) 641-1000 x 23

Generator's Site Address (if different than mailing address)
123 State Street
Santa Barbara, CA 93101

6. Transporter 1 Company Name: Remedial Transportation Serv.
U.S. EPA ID Number: CAR000111560

7. Transporter 2 Company Name:
U.S. EPA ID Number:

8. Designated Facility Name and Site Address
Clean Harbors Buttonwillow
2500 West Lokern Road
Buttonwillow, CA 93206
Facility's Phone: (661) 762-6200
U.S. EPA ID Number: CAD980675276

9a. HM	9b. U.S. DOT Description (including Proper Shipping Name, Hazard Class, ID Number, and Packing Group (if any))	10. Containers No.	10. Containers Type	11. Total Quantity	12. Unit Wt./Vol.	13. Waste Codes
	1. None, Non-RCRA Hazardous Waste, Solid, N/A	001	DT	00016	Y	611
	2.					
	3.					
	4.					

14. Special Handling Instructions and Additional Information
Profile # CH4207 95B
Sales Order #: 7W2273366

15. **GENERATOR'S/OFFEROR'S CERTIFICATION:** I hereby declare that the contents of this consignment are fully and accurately described above by the proper shipping name, and are classified, packaged, marked and labeled/placarded, and are in all respects in proper condition for transport according to applicable international and national governmental regulations. If export shipment and I am the Primary Exporter, I certify that the contents of this consignment conform to the terms of the attached EPA Acknowledgment of Consent.
I certify that the waste minimization statement identified in 40 CFR 262.27(a) (if I am a large quantity generator) or (b) (if I am a small quantity generator) is true.

Generator's/Offeror's Printed/Typed Name: Cenen Aparicio
Signature: Cenen Aparicio
Month 05 Day 18 Year 10

16. International Shipments ☐ Import to U.S. ☐ Export from U.S. Port of entry/exit:
Transporter signature (for exports only): Date leaving U.S.:

17. Transporter Acknowledgment of Receipt of Materials
Transporter 1 Printed/Typed Name: Navarro Saucedo
Signature:
Month 05 Day 18 Year 10
Transporter 2 Printed/Typed Name:
Signature:
Month Day Year

18. Discrepancy
18a. Discrepancy Indication Space ☐ Quantity ☐ Type ☐ Residue ☐ Partial Rejection ☐ Full Rejection
Manifest Reference Number:
18b. Alternate Facility (or Generator)
U.S. EPA ID Number
Facility's Phone:
18c. Signature of Alternate Facility (or Generator)
Month Day Year

19. Hazardous Waste Report Management Method Codes (i.e., codes for hazardous waste treatment, disposal, and recycling systems)
1. H132 2. 3. 4.

20. Designated Facility Owner or Operator: Certification of receipt of hazardous materials covered by the manifest except as noted in Item 18a
Printed/Typed Name: Ronald E Johns
Signature:
Month 05 Day 18 Year 10

GENERATOR | INT'L | TRANSPORTER | DESIGNATED FACILITY

EPA Form 8700-22 (Rev. 3-05) Previous editions are obsolete.

TRANSPORTER'S COPY

NO. 191534

CLEANHARBORS BUTTONWILLOW, LLC
WEIGHMASTER CERTIFICATE

THIS IS TO CERTIFY that the following described commodity was weighed, measured, or counted by a weighmaster whose signature is on this certificate, who is a recognized authority of accuracy, as prescribed in Chapter 7 (commencing with Section12700) of Division 5 of the California Business and Professions Code, administered by the Division of Measurement Standards of the California Department of Food and Agiculture.

1:25 PM 05/18/10
REG. (71)
INBOUND 85400 lb

1:55 PM 05/18/10
REG. (71)

85400 lb GROSS
32060 lb TARE
53340 lb NET

☑ END DUMP ☐ TRANSFER ☐ VACUUM ☐ VAN
☐ ROLL OFF - _____ ☐ FLAT BED ☐ _____

WEIGHMASTER CLEANHARBORS BUTTONWILLOW, LLC

PROFILE NO. CH 420795B	GROSS WT. BY: [signature]	DEPUTY	DATE 5/18/10
DISPOSAL LOCATION 35 3 19 E 06	TARE WT. BY: [signature]	DEPUTY	DATE 051810
DRIVER'S NAME PRINTED M. Saucedo	WEIGHING LOCATION:	2500 W. LOKERN ROAD BUTTONWILLOW, CA 93206	
DRIVER'S NAME SIGNATURE M. Saucedo	GENERATOR	City of SB	
TRACTOR NO. R32	TRANSPORTER	RTS	
TRACTOR LIC. NO. UP14645	MANIFEST NO.	004741760 JJK	
TRAILER LIC. NO. 4DN4711	SERVICE ORDER NO.	7e2873366	
BIN NUMBERS:	BIN TRACKING		

VIS	pH	SUL	CYA	OX	FL	FLASH	20%	
+							✓	
OTHER:								

IC	CR	PR	B.W. W.B.	LAB	SOLID BULK	WORK SHEET	LAND TRACK	W.T. SCAN	MAN-SCAN	RE-SCAN
✓										

DRUM NUMBER:

COMMENTS:

BIN DROP FULL:

MOVE BIN TO: DATE: BY:

REVISED (3/10)

1245 U192454

Please print or type. (Form designed for use on elite (12-pitch) typewriter.) Form Approved. OMB No. 2050-0039

UNIFORM HAZARDOUS WASTE MANIFEST

1. Generator ID Number: CAC002650488
2. Page 1 of
3. Emergency Response Phone: (661) 746-1132
4. Manifest Tracking Number: 004741762 JJK

5. Generator's Name and Mailing Address
City Of Santa Barbara
PO BOX 1990
Santa Barbara, CA 93102
Generator's Phone: (805) 641-1000 x 23

Generator's Site Address (if different than mailing address)
123 State Street
Santa Barbara, CA 93101

6. Transporter 1 Company Name: DEWELL TRANSPORTATION SERVICES
U.S. EPA ID Number: CAD000185160

7. Transporter 2 Company Name
U.S. EPA ID Number

8. Designated Facility Name and Site Address
Clean Harbors Buttonwillow
2500 West Lokern Road
Buttonwillow, CA 93206
Facility's Phone: (661) 762-6200
U.S. EPA ID Number: CAD980673276

9a. HM	9b. U.S. DOT Description (including Proper Shipping Name, Hazard Class, ID Number, and Packing Group (if any))	10. Containers No.	10. Containers Type	11. Total Quantity	12. Unit Wt./Vol.	13. Waste Codes
	1. None, Non-RCRA Hazardous Waste, Solid, N/A	001	DT	00018	Y	811
	2.					
	3.					
	4.					

14. Special Handling Instructions and Additional Information
Profile # CBI420795B
Sales Order # 7307273366

15. **GENERATOR'S/OFFEROR'S CERTIFICATION:** I hereby declare that the contents of this consignment are fully and accurately described above by the proper shipping name, and are classified, packaged, marked and labeled/placarded, and are in all respects in proper condition for transport according to applicable international and national governmental regulations. If export shipment and I am the Primary Exporter, I certify that the contents of this consignment conform to the terms of the attached EPA Acknowledgment of Consent.
I certify that the waste minimization statement identified in 40 CFR 262.27(a) (if I am a large quantity generator) or (b) (if I am a small quantity generator) is true.

Generator's/Offeror's Printed/Typed Name: Cencia Aparicio
Signature: Cencia Aparicio
Month Day Year: 5 18 10

16. International Shipments ☐ Import to U.S. ☐ Export from U.S. Port of entry/exit:
Transporter signature (for exports only): Date leaving U.S.:

17. Transporter Acknowledgment of Receipt of Materials
Transporter 1 Printed/Typed Name: Julian Cazarez
Signature
Month Day Year: 5 18 10
Transporter 2 Printed/Typed Name
Signature
Month Day Year

18. Discrepancy
18a. Discrepancy Indication Space ☐ Quantity ☐ Type ☐ Residue ☐ Partial Rejection ☐ Full Rejection
Manifest Reference Number:
18b. Alternate Facility (or Generator) U.S. EPA ID Number
Facility's Phone:
18c. Signature of Alternate Facility (or Generator) Month Day Year

19. Hazardous Waste Report Management Method Codes (i.e., codes for hazardous waste treatment, disposal, and recycling systems)
1. H132 2. 3. 4.

20. Designated Facility Owner or Operator: Certification of receipt of hazardous materials covered by the manifest except as noted in Item 18a
Printed/Typed Name: Dr. Hose
Signature
Month Day Year: 05 18 10

GENERATOR | INT'L | TRANSPORTER | DESIGNATED FACILITY

EPA Form 8700-22 (Rev. 3-05) Previous editions are obsolete. **TRANSPORTER'S COPY**

NO. 191533

CLEANHARBORS BUTTONWILLOW, LLC
WEIGHMASTER CERTIFICATE

1:24 PM 05/18/10
REG. (69)
INBOUND 79660 lb

THIS IS TO CERTIFY that the following described commodity was weighed, measured, or counted by a weighmaster whose signature is on this certificate, who is a recognized authority of accuracy, as prescribed in Chapter 7 (commencing with Section12700) of Division 5 of the California Business and Professions Code, administered by the Division of Measurement Standards of the California Department of Food and Agiculture.

WEIGHMASTER CLEANHARBORS BUTTONWILLOW, LLC

1:47 PM 05/18/10
REG. (69)

79660 lb GROSS
32020 lb TARE
47640 lb NET

PROFILE NO. C1147079513	GROSS WT. BY:	DEPUTY	DATE 5/18/10
DISPOSAL LOCATION 35 3 19.8.06	TARE WT. BY:	DEPUTY	DATE 5/18/10
DRIVER'S NAME PRINTED	WEIGHING LOCATION:	2500 W. LOKERN ROAD BUTTONWILLOW, CA 93206	
DRIVER'S NAME SIGNATURE	GENERATOR	CITY OF S.B	
TRACTOR NO. 1243	TRANSPORTER	RTS	
TRACTOR LIC. NO. UP92454	MANIFEST NO.	004741762 JJK	
TRAILER LIC. NO. 2504FT	SERVICE ORDER NO.	7W2873366	
BIN NUMBERS:	BIN TRACKING		

☐ END DUMP ☐ TRANSFER ☐ VACUUM ☐ VAN
☐ ROLL OFF - _____ ☐ FLAT BED ☐ _____

VIS	pH	SUL	CYA	OX	FL	FLASH	20%	
1							1/	
OTHER:								

IC	CR	PR	B.W. W.B.	LAB	SOLID BULK	WORK SHEET	LAND TRACK	W.T. SCAN	MAN-SCAN	RE-SCAN

DRUM NUMBER:

COMMENTS:

BIN DROP FULL:

MOVE BIN TO: DATE: BY:

REVISED (3/10)

R 34 UP 19647

Please print or type. (Form designed for use on elite (12-pitch) typewriter.) Form Approved. OMB No. 2050-0039

UNIFORM HAZARDOUS WASTE MANIFEST

1. Generator ID Number: CAC000265048 8
2. Page 1 of
3. Emergency Response Phone: (661) 746-1132
4. Manifest Tracking Number: 004741764 JJK

5. Generator's Name and Mailing Address
City Of Santa Barbara
PO BOX 1990
Santa Barbara, CA 93102
Generator's Phone: (805) 641-1000 x 23

Generator's Site Address (if different than mailing address)
123 State Street
Santa Barbara, CA 93101

6. Transporter 1 Company Name: Rendel Transportation Services
U.S. EPA ID Number: CAR000181560

7. Transporter 2 Company Name
U.S. EPA ID Number

8. Designated Facility Name and Site Address
Clean Harbors Buttonwillow
2300 West Lokern Road
Buttonwillow, CA 93206
Facility's Phone: (661) 762-6200
U.S. EPA ID Number: CAD980673276

9a. HM	9b. U.S. DOT Description (including Proper Shipping Name, Hazard Class, ID Number, and Packing Group (if any))	10. Containers No.	10. Containers Type	11. Total Quantity	12. Unit Wt./Vol.	13. Waste Codes
	1. None, Non-RCRA Hazardous Waste, Solid, N/A	001	DT	00018	Y	611
	2.					
	3.					
	4.					

14. Special Handling Instructions and Additional Information
Profile #: CEH420795B
Sales Order #: 7W2873366

15. **GENERATOR'S/OFFEROR'S CERTIFICATION:** I hereby declare that the contents of this consignment are fully and accurately described above by the proper shipping name, and are classified, packaged, marked and labeled/placarded, and are in all respects in proper condition for transport according to applicable international and national governmental regulations. If export shipment and I am the Primary Exporter, I certify that the contents of this consignment conform to the terms of the attached EPA Acknowledgment of Consent.
I certify that the waste minimization statement identified in 40 CFR 262.27(a) (if I am a large quantity generator) or (b) (if I am a small quantity generator) is true.

Generator's/Offeror's Printed/Typed Name: Cenen Aparicio
Signature: Cenen Aparicio
Month 05 Day 18 Year 10

16. International Shipments ☐ Import to U.S. ☐ Export from U.S. Port of entry/exit:
Transporter signature (for exports only): Date leaving U.S.:

17. Transporter Acknowledgment of Receipt of Materials
Transporter 1 Printed/Typed Name: Allan Quiroz
Signature
Month 5 Day 18 Year 10
Transporter 2 Printed/Typed Name
Signature
Month Day Year

18. Discrepancy
18a. Discrepancy Indication Space ☐ Quantity ☐ Type ☐ Residue ☐ Partial Rejection ☐ Full Rejection
Manifest Reference Number:
18b. Alternate Facility (or Generator) U.S. EPA ID Number
Facility's Phone:
18c. Signature of Alternate Facility (or Generator) Month Day Year

19. Hazardous Waste Report Management Method Codes (i.e., codes for hazardous waste treatment, disposal, and recycling systems)
1. H132 2. 3. 4.

20. Designated Facility Owner or Operator: Certification of receipt of hazardous materials covered by the manifest except as noted in Item 18a
Printed/Typed Name
Signature
Month Day Year

GENERATOR — INT'L — TRANSPORTER — DESIGNATED FACILITY

EPA Form 8700-22 (Rev. 3-05) Previous editions are obsolete. **TRANSPORTER'S COPY**

NO. 191531

CLEANHARBORS BUTTONWILLOW, LLC
WEIGHMASTER CERTIFICATE

1:18 PM 05/18/10
REG. (60)
INBOUND 79940 lb

THIS IS TO CERTIFY that the following described commodity was weighed, measured, or counted by a weighmaster whose signature is on this certificate, who is a recognized authority of accuracy, as prescribed in Chapter 7 (commencing with Section12700) of Division 5 of the California Business and Professions Code, administered by the Division of Measurement Standards of the California Department of Food and Agiculture.

WEIGHMASTER CLEANHARBORS BUTTONWILLOW, LLC

1:43 PM 05/18/10
REG. (60)

79940 lb GROSS
31000 lb TARE
48940 lb NET

PROFILE NO. C11420795 B	GROSS WT. BY	DEPUTY	DATE 5/18/10
DISPOSAL LOCATION 35 3 19.8.06	TARE WT. BY	DEPUTY	DATE 5/18/10
DRIVER'S NAME PRINTED Allan Quinn	WEIGHING LOCATION:	2500 W. LOKERN ROAD BUTTONWILLOW, CA 93206	
DRIVER'S NAME SIGNATURE Allan Quinn	GENERATOR	City of Santa Barbara	
TRACTOR NO. R34	TRANSPORTER	RTS	
TRACTOR LIC. NO. UP14617	MANIFEST NO.	004741764 JJK	
TRAILER LIC. NO. 2500F7	SERVICE ORDER NO.	7W287 3366	
BIN NUMBERS:	BIN TRACKING		

☑ END DUMP ☐ TRANSFER ☐ VACUUM ☐ VAN
☐ ROLL OFF - _____ ☐ FLAT BED ☐ _____

VIS	pH	SUL	CYA	OX	FL	FLASH	20%	
+							✓	
OTHER:								

IC	CR	PR	B.W. W.B.	LAB	SOLID BULK	WORK SHEET	LAND TRACK	W.T. SCAN	MAN-SCAN	RE-SCAN

DRUM NUMBER:

COMMENTS:

BIN DROP FULL:

MOVE BIN TO: DATE: BY:

REVISED (3/10)

Please print or type. (Form designed for use on elite (12-pitch) typewriter.)

Form Approved. OMB No. 2050-0039

UNIFORM HAZARDOUS WASTE MANIFEST

1. Generator ID Number: CAC002850488
2. Page 1 of
3. Emergency Response Phone: (661) 746-1132
4. Manifest Tracking Number: **004744213 JJK**

5. Generator's Name and Mailing Address: City Of Santa Barbara, PO BOX 1990, Santa Barbara, CA 93102
Generator's Phone: (805) 641-1000 x 23
Generator's Site Address (if different than mailing address): 125 State Street, Santa Barbara, CA 93101

6. Transporter 1 Company Name: Horizon
U.S. EPA ID Number: CAD009075917

7. Transporter 2 Company Name:
U.S. EPA ID Number:

8. Designated Facility Name and Site Address: Clean Harbors Buttonwillow, 2700 West Lokern Road, Buttonwillow, CA 93206
Facility's Phone: (661) 762-6200
U.S. EPA ID Number: CAD980673276

9a. HM	9b. U.S. DOT Description (including Proper Shipping Name, Hazard Class, ID Number, and Packing Group (if any))	10. Containers No.	10. Containers Type	11. Total Quantity	12. Unit Wt./Vol.	13. Waste Codes		
	1. Waste, Non-RCRA Hazardous Waste, Solid, NOS	001	DT	00010	Y	611		
	2.							
	3.							
	4.							

14. Special Handling Instructions and Additional Information
Profile # CB42070SB
Sales Order# 7502233366

15. **GENERATOR'S/OFFEROR'S CERTIFICATION:** I hereby declare that the contents of this consignment are fully and accurately described above by the proper shipping name, and are classified, packaged, marked and labeled/placarded, and are in all respects in proper condition for transport according to applicable international and national governmental regulations. If export shipment and I am the Primary Exporter, I certify that the contents of this consignment conform to the terms of the attached EPA Acknowledgment of Consent.
I certify that the waste minimization statement identified in 40 CFR 262.27(a) (if I am a large quantity generator) or (b) (if I am a small quantity generator) is true.

Generator's/Offeror's Printed/Typed Name: Cesar Aguirre
Signature: Cesar Aguirre
Month 5 Day 15 Year 10

16. International Shipments ☐ Import to U.S. ☐ Export from U.S. Port of entry/exit:
Transporter signature (for exports only): Date leaving U.S.:

17. Transporter Acknowledgment of Receipt of Materials
Transporter 1 Printed/Typed Name: Manuel Perez
Signature:
Month 5 Day 15 Year 10
Transporter 2 Printed/Typed Name:
Signature:
Month Day Year

18. Discrepancy
18a. Discrepancy Indication Space ☐ Quantity ☐ Type ☐ Residue ☐ Partial Rejection ☐ Full Rejection
Manifest Reference Number:
18b. Alternate Facility (or Generator)
U.S. EPA ID Number
Facility's Phone:
18c. Signature of Alternate Facility (or Generator)
Month Day Year

19. Hazardous Waste Report Management Method Codes (i.e., codes for hazardous waste treatment, disposal, and recycling systems)
1. H137 2. 3. 4.

20. Designated Facility Owner or Operator: Certification of receipt of hazardous materials covered by the manifest except as noted in Item 18a
Printed/Typed Name: Ronald E Johns
Signature:
Month 05 Day 18 Year 10

GENERATOR | INT'L | TRANSPORTER | DESIGNATED FACILITY

EPA Form 8700-22 (Rev. 3-05) Previous editions are obsolete.

TRANSPORTER'S COPY

NO. 191537

CLEANHARBORS BUTTONWILLOW, LLC
WEIGHMASTER CERTIFICATE

1:41 PM 05/18/10
REC. (3)
INBOUND 82540 lb

THIS IS TO CERTIFY that the following described commodity was weighed, measured, or counted by a weighmaster whose signature is on this certificate, who is a recognized authority of accuracy, as prescribed in Chapter 7 (commencing with Section12700) of Division 5 of the California Business and Professions Code, administered by the Division of Measurement Standards of the California Department of Food and Agiculture.

WEIGHMASTER CLEANHARBORS BUTTONWILLOW, LLC

1:53 PM 05/18/10
REC. (3)
82540 lb GROSS
20540 lb TARE
62000 lb NET

PROFILE NO.	CH420795B	GROSS WT. BY	DEPUTY / DATE 5/18/10
DISPOSAL LOCATION	353 19-E-06	TARE WT. BY	DEPUTY / DATE 051810
DRIVER'S NAME PRINTED	Manuel Duran	WEIGHING LOCATION:	2500 W. LOKERN ROAD BUTTONWILLOW, CA 93206
DRIVER'S NAME SIGNATURE		GENERATOR	City of SB
TRACTOR NO.	427	TRANSPORTER	Duran
TRACTOR LIC. NO.	9D7229	MANIFEST NO.	004774RB JJK
TRAILER LIC. NO.	269-5 ET	SERVICE ORDER NO.	[illegible]
BIN NUMBERS:		BIN TRACKING	

☐ END DUMP ☐ TRANSFER ☐ VACUUM ☐ VAN
☐ ROLL OFF - _____ ☐ FLAT BED ☐ _____

VIS	pH	SUL	CYA	OX	FL	FLASH	20%	
OTHER:								

IC	CR	PR	B.W. W.B.	LAB	SOLID BULK	WORK SHEET	LAND TRACK	W.T. SCAN	MAN-SCAN	RE-SCAN

DRUM NUMBER:

COMMENTS:

BIN DROP FULL:

MOVE BIN TO: DATE: BY:

REVISED (3/10)

Please print or type. (Form designed for use on elite (12-pitch) typewriter.)

Form Approved. OMB No. 2050-0039

UNIFORM HAZARDOUS WASTE MANIFEST

1. Generator ID Number: CAL000165048
2. Page 1 of
3. Emergency Response Phone: (661) 746-1132
4. Manifest Tracking Number: 004744214 JJK

GENERATOR

5. Generator's Name and Mailing Address: City Of Santa Barbara, PO BOX 1990, Santa Barbara, CA 93102
Generator's Phone: (805) 641-1000 x 22
Generator's Site Address (if different than mailing address): 125 State Street, Santa Barbara, CA 93101

6. Transporter 1 Company Name: M & M TRANSPORT
U.S. EPA ID Number: CAL000178442

7. Transporter 2 Company Name:
U.S. EPA ID Number:

8. Designated Facility Name and Site Address: Clean Harbors Buttonwillow, 2500 West Lokern Road, Buttonwillow, CA 93206
Facility's Phone: (661) 762-6200
U.S. EPA ID Number: CAD 9 8 0 6 7 3 2 3 6

9a. HM	9b. U.S. DOT Description (including Proper Shipping Name, Hazard Class, ID Number, and Packing Group (if any))	10. Containers No.	10. Containers Type	11. Total Quantity	12. Unit Wt./Vol.	13. Waste Codes
	1. None, Non RCRA Hazardous Waste, Solid, N/A	001	DT	00013	Y	611
	2.					
	3.					
	4.					

14. Special Handling Instructions and Additional Information
Profile #[illegible]
Sales Order# TW2873366

15. **GENERATOR'S/OFFEROR'S CERTIFICATION:** I hereby declare that the contents of this consignment are fully and accurately described above by the proper shipping name, and are classified, packaged, marked and labeled/placarded, and are in all respects in proper condition for transport according to applicable international and national governmental regulations. If export shipment and I am the Primary Exporter, I certify that the contents of this consignment conform to the terms of the attached EPA Acknowledgment of Consent.
I certify that the waste minimization statement identified in 40 CFR 262.27(a) (if I am a large quantity generator) or (b) (if I am a small quantity generator) is true.

Generator's/Offeror's Printed/Typed Name: Efren Madrid
Signature:
Month: 5 Day: 19 Year: 10

INT'L

16. International Shipments ☒ Import to U.S. ☐ Export from U.S. Port of entry/exit:
Transporter signature (for exports only): Date leaving U.S.:

TRANSPORTER

17. Transporter Acknowledgment of Receipt of Materials
Transporter 1 Printed/Typed Name: MANUEL MAUZANO
Signature:
Month: 5 Day: 19 Year: 10
Transporter 2 Printed/Typed Name:
Signature:
Month: Day: Year:

DESIGNATED FACILITY

18. Discrepancy
18a. Discrepancy Indication Space ☐ Quantity ☐ Type ☐ Residue ☐ Partial Rejection ☐ Full Rejection
Manifest Reference Number:
18b. Alternate Facility (or Generator)
U.S. EPA ID Number:
Facility's Phone:
18c. Signature of Alternate Facility (or Generator)
Month: Day: Year:

19. Hazardous Waste Report Management Method Codes (i.e., codes for hazardous waste treatment, disposal, and recycling systems)
1. 2. 3. 4.

20. Designated Facility Owner or Operator: Certification of receipt of hazardous materials covered by the manifest except as noted in Item 18a
Printed/Typed Name: Ronald B Johns
Signature:
Month: 05 Day: 19 Year: 10

EPA Form 8700-22 (Rev. 3-05) Previous editions are obsolete.

TRANSPORTER'S COPY

NO. 191554

CLEANHARBORS BUTTONWILLOW, LLC
WEIGHMASTER CERTIFICATE

THIS IS TO CERTIFY that the following described commodity was weighed, measured, or counted by a weighmaster whose signature is on this certificate, who is a recognized authority of accuracy, as prescribed in Chapter 7 (commencing with Section12700) of Division 5 of the California Business and Professions Code, administered by the Division of Measurement Standards of the California Department of Food and Agiculture.

3:02 pm 05/18/10
REG. (4)
INBOUND 9460 1 b

3:24 pm 05/18/10
REG. (4)
34640 1b OSS
31720 1b RE
52920 1b T

PROFILE NO. CH42079 5B	WEIGHMASTER CLEANHARBORS BUTTONWILLOW, LLC
DISPOSAL LOCATION 35 3 19-8-06	GROSS WT. BY: DEPUTY DATE 5/18/10
DRIVER'S NAME PRINTED XMANUEL	TARE WT. BY: DEPUTY DATE 05/18/10
DRIVER'S NAME SIGNATURE	WEIGHING LOCATION: 2500 W. LOKERN ROAD BUTTONWILLOW, CA 93206
TRACTOR NO. 05	GENERATOR City of SB
TRACTOR LIC. NO. M5K68	TRANSPORTER M & M
TRAILER LIC. NO. 4ON4709	MANIFEST NO. 004744214JJK
BIN NUMBERS:	SERVICE ORDER NO. 7W287 3366
	BIN TRACKING

☒ END DUMP ☐ TRANSFER ☐ VACU VAN
☐ ROLL OFF _____ ☐ FLAT BED

VIS	pH	SUL	CYA	FL	FLASH	20%	
✓							

OTHER:

IC	CR	PR	B.W. W.B.	SOLID BULK	WORK SHEET	LAND TRACK	W.T. SCAN	MAN SCAN	RE SCAN

DRUM NUMBER:

COMMENTS:

BIN DROP FULL

MOVE BIN TO: DATE: BY:

R-32 4/21/2016

Please print or type. (Form designed for use on elite (12-pitch) typewriter.)

Form Approved. OMB No. 2050-0039

UNIFORM HAZARDOUS WASTE MANIFEST

1. Generator ID Number: CAC002650488
2. Page 1 of
3. Emergency Response Phone: (661) 746-1132
4. Manifest Tracking Number: **004744215 JJK**

5. Generator's Name and Mailing Address: City Of Santa Barbara, PO BOX 1990, Santa Barbara, CA 93102
Generator's Phone: (805) 641-1000 x 23
Generator's Site Address (if different than mailing address): 123 State Street, Santa Barbara, CA 93101

6. Transporter 1 Company Name: Remedial Transportation Services
U.S. EPA ID Number: CAF000118515

7. Transporter 2 Company Name:
U.S. EPA ID Number:

8. Designated Facility Name and Site Address: Clean Harbors Buttonwillow, 2300 West Lokern Road, Buttonwillow, CA 93206
Facility's Phone: (661) 762-6200
U.S. EPA ID Number: CAD980673276

9a. HM	9b. U.S. DOT Description (including Proper Shipping Name, Hazard Class, ID Number, and Packing Group (if any))	10. Containers No.	10. Containers Type	11. Total Quantity	12. Unit Wt./Vol.	13. Waste Codes		
	1. Non, Non-RCRA Hazardous Waste, Solid, N/A	001	DT	00018	Y	611		
	2.							
	3.							
	4.							

14. Special Handling Instructions and Additional Information
Profile # CH420795B
Sales Order# TW2873366

15. **GENERATOR'S/OFFEROR'S CERTIFICATION:** I hereby declare that the contents of this consignment are fully and accurately described above by the proper shipping name, and are classified, packaged, marked and labeled/placarded, and are in all respects in proper condition for transport according to applicable international and national governmental regulations. If export shipment and I am the Primary Exporter, I certify that the contents of this consignment conform to the terms of the attached EPA Acknowledgment of Consent.
I certify that the waste minimization statement identified in 40 CFR 262.27(a) (if I am a large quantity generator) or (b) (if I am a small quantity generator) is true.

Generator's/Offeror's Printed/Typed Name: Carlos Ramirez
Signature:
Month 5 Day 19 Year 10

16. International Shipments ☐ Import to U.S. ☐ Export from U.S. Port of entry/exit:
Transporter signature (for exports only): Date leaving U.S.:

17. Transporter Acknowledgment of Receipt of Materials
Transporter 1 Printed/Typed Name: Tony Kazins
Signature:
Month 5 Day 19 Year 10
Transporter 2 Printed/Typed Name:
Signature:
Month Day Year

18. Discrepancy
18a. Discrepancy Indication Space ☐ Quantity ☐ Type ☐ Residue ☐ Partial Rejection ☐ Full Rejection
Manifest Reference Number:
18b. Alternate Facility (or Generator)
U.S. EPA ID Number
Facility's Phone:
18c. Signature of Alternate Facility (or Generator)
Month Day Year

19. Hazardous Waste Report Management Method Codes (i.e., codes for hazardous waste treatment, disposal, and recycling systems)
1. H132 2. 3. 4.

20. Designated Facility Owner or Operator: Certification of receipt of hazardous materials covered by the manifest except as noted in Item 18a
Printed/Typed Name: Ronald E Johns
Signature:
Month 05 Day 19 Year 10

GENERATOR | INT'L | TRANSPORTER | DESIGNATED FACILITY

EPA Form 8700-22 (Rev. 3-05) Previous editions are obsolete.

TRANSPORTER'S COPY

NO. 191586

CLEANHARBORS BUTTONWILLOW, LLC
WEIGHMASTER CERTIFICATE

12:22 PM 05/19/10
REG. (4)
INBOUND 85360 lb

THIS IS TO CERTIFY that the following described commodity was weighed, measured, or counted by a weighmaster whose signature is on this certificate, who is a recognized authority of accuracy, as prescribed in Chapter 7 (commencing with Section12700) of Division 5 of the California Business and Professions Code, administered by the Division of Measurement Standards of the California Department of Food and Agiculture.

WEIGHMASTER CLEANHARBORS BUTTONWILLOW, LLC

12:38 PM 05/19/10
REG. (4)

85360 lb GROSS
31800 lb TARE
53560 lb NET

PROFILE NO. 0H4207958	GROSS WT. BY:	DEPUTY	DATE 5/19/10
DISPOSAL LOCATION 353 71-F.06	TARE WT. BY:	DEPUTY	DATE 5/19/10
DRIVER'S NAME PRINTED Jeremey Rains	WEIGHING LOCATION:	2500 W. LOKERN ROAD BUTTONWILLOW, CA 93206	
DRIVER'S NAME SIGNATURE	GENERATOR CITY of SANTA BARBARA		
TRACTOR NO. R-33	TRANSPORTER RTS		
TRACTOR LIC. NO. 4P19646	MANIFEST NO. 004744215 JJK		
TRAILER LIC. NO. T-56	SERVICE ORDER NO. 7W2873366		
BIN NUMBERS:	BIN TRACKING		

☑ END DUMP ☐ TRANSFER ☐ VACUUM ☐ VAN
☐ ROLL OFF - _____ ☐ FLAT BED ☐ _____

VIS	pH	SUL	CYA	OX	FL	FLASH	20%	
+	7.46	–	–	–	–			
OTHER:								

IC	CR	PR	B.W. W.B.	LAB	SOLID BULK	WORK SHEET	LAND TRACK	W.T. SCAN	MAN-SCAN	RE-SCAN

DRUM NUMBER:

COMMENTS:

BIN DROP FULL:

MOVE BIN TO: DATE: BY:

REVISED (3/10)

Please print or type. (Form designed for use on elite (12-pitch) typewriter.)

Form Approved. OMB No. 2050-0039

UNIFORM HAZARDOUS WASTE MANIFEST

1. Generator ID Number: CAC002650488
2. Page 1 of:
3. Emergency Response Phone: (800) 345-1132
4. Manifest Tracking Number: 004744216 JJK

5. Generator's Name and Mailing Address: City Of Santa Barbara, PO BOX 1990, Santa Barbara, CA 93102
Generator's Phone: (805) 641-1000 x 23
Generator's Site Address (if different than mailing address): 123 State Street, Santa Barbara, CA 93101

6. Transporter 1 Company Name: M & M TRANSPORT — U.S. EPA ID Number: CAD000088442

7. Transporter 2 Company Name — U.S. EPA ID Number:

8. Designated Facility Name and Site Address: Clean Harbors Buttonwillow, 2500 West Lokern Road, Buttonwillow, CA 93206
Facility's Phone: (661) 762-8100 — U.S. EPA ID Number: CAD 980675548

9a. HM	9b. U.S. DOT Description (including Proper Shipping Name, Hazard Class, ID Number, and Packing Group (if any))	10. Containers No.	10. Containers Type	11. Total Quantity	12. Unit Wt./Vol.	13. Waste Codes		
	1. Non RCRA Hazardous Waste, Solid, N.O.S.	001	DT	00015	Y	611		
	2.							
	3.							
	4.							

14. Special Handling Instructions and Additional Information
Profile # CHW0072E
Sales Order# 70787336

15. **GENERATOR'S/OFFEROR'S CERTIFICATION:** I hereby declare that the contents of this consignment are fully and accurately described above by the proper shipping name, and are classified, packaged, marked and labeled/placarded, and are in all respects in proper condition for transport according to applicable international and national governmental regulations. If export shipment and I am the Primary Exporter, I certify that the contents of this consignment conform to the terms of the attached EPA Acknowledgment of Consent.
I certify that the waste minimization statement identified in 40 CFR 262.27(a) (if I am a large quantity generator) or (b) (if I am a small quantity generator) is true.

Generator's/Offeror's Printed/Typed Name: Carlos Acuna — Signature: [signature] — Month 5 Day 19 Year 10

16. International Shipments ☐ Import to U.S. ☐ Export from U.S. Port of entry/exit:
Transporter signature (for exports only): Date leaving U.S.:

17. Transporter Acknowledgment of Receipt of Materials
Transporter 1 Printed/Typed Name: MANUEL MANZANO — Signature: [signature] — Month 5 Day 19 Year 10
Transporter 2 Printed/Typed Name — Signature — Month Day Year

18. Discrepancy
18a. Discrepancy Indication Space: ☐ Quantity ☐ Type ☐ Residue ☐ Partial Rejection ☐ Full Rejection
Manifest Reference Number:
18b. Alternate Facility (or Generator) — U.S. EPA ID Number
Facility's Phone:
18c. Signature of Alternate Facility (or Generator) — Month Day Year

19. Hazardous Waste Report Management Method Codes (i.e., codes for hazardous waste treatment, disposal, and recycling systems)
1. H132 2. 3. 4.

20. Designated Facility Owner or Operator: Certification of receipt of hazardous materials covered by the manifest except as noted in Item 18a
Printed/Typed Name: Donald E. Johns — Signature: [signature] — Month 05 Day 19 Year 10

GENERATOR — INT'L — TRANSPORTER — DESIGNATED FACILITY

EPA Form 8700-22 (Rev. 3-05) Previous editions are obsolete.

TRANSPORTER'S COPY

NO. 191628

CLEANHARBORS BUTTONWILLOW, LLC
WEIGHMASTER CERTIFICATE

3:32 PM 05/19/10
REG. (2)
INBOUND 82400 lb

THIS IS TO CERTIFY that the following described commodity was weighed, measured, or counted by a weighmaster whose signatures on this certificate, who is a recognized authority of accuracy, as prescribed in Chapter 7 (commencing with Section12700) of Division 5 of the California Business and Professions Code, administered by the Division of Measurement Standards of the California Department of Food and Agiculture.

WEIGHMASTER CLEANHARBORS BUTTONWILLOW, LLC

4:10 PM 05/19/10
REG. (2)

82400 lb GROSS
31280 lb TARE
51120 lb NET

PROFILE NO.	C1/420795B	GROSS WT BY: DEPUTY	DATE 5/19/10
DISPOSAL LOCATION	3S 3 22 5 06	TARE WT. BY: DEPUTY	DATE 05/19/10
DRIVER'S NAME PRINTED	MANUEL	WEIGHING LOCATION:	2500 W. LOKERN ROAD BUTTONWILLOW, CA 93206
DRIVER'S NAME SIGNATURE		GENERATOR	City of SB
TRACTOR NO.	05	TRANSPORTER	M & M
TRACTOR LIC. NO.	M5K68	MANIFEST NO.	004744216 JJK
TRAILER LIC. NO.	4DN4709	SERVICE ORDER NO.	7W287 3366
BIN NUMBERS:		BIN TRACKING	

☒ END DUMP ☐ TRANSFER ☐ VACUUM ☐ VAN
☐ ROLL OFF - _____ ☐ FLAT BED ☐ _____

VIS	pH	SUL	CYA	OX	FL	FLASH	20%	
+							Y	
OTHER:								

IC	CR	PR	B.W. W.B.	LAB	SOLID BULK	WORK SHEET	LAND TRACK	W.T. SCAN	MAN-SCAN	RE-SCAN

DRUM NUMBER:

COMMENTS:

BIN DROP FULL:

MOVE BIN TO: DATE: BY:

REVISED (3/10)

CHIQUITA CANYON LANDFILL
Weighed at:
CHIQUITA CANYON LANDFILL
29201 Henry Mayo Dr
Castaic, CA 91384

Deputy: D Landeros
BILL TO: 344
CLEAN HARBORS ENVIRONMENTAL

Vehicle ID: CH-R32
Reference:

Origin: SANTA BARBARA
DATE IN: 05/17/2010 TIME IN: 12:51:03
DATE OUT: 05/17/2010 TIME OUT: 12:51

INBOUND TICKET Number: 01-084360

MANUAL GROSS WT.	80140	LB
STORED TARE WT.	33200	LB
NET WEIGHT	46940	LB

Qty	Description	Amount
23.47	Soil - Non Hazardous	

X_____

(Driver Signature)

This is to certify that this load does not contain any hazardous materials, medical waste or liquids of any type.

WEIGHMASTER CERTIFICATE:

THIS IS TO CERTIFY that the following described commodity was weighed, measured, or counted by a weighmaster, whose signature is on this certificate, who is a recognized authority of accuracy, as prescribed by Chapter 7 (commencing with Section 12700) of Division 5 of the California Business and Professions Code), administered by the Division of Measurement Standards of the California Department of Food and Agriculture.

NON-HAZARDOUS WASTE MANIFEST	1. Generator ID Number	2. Page 1 of	3. Emergency Response Phone	4. Waste Tracking Number
	CAC000365048		(661) 746-1132	

5. Generator's Name and Mailing Address
City Of Santa Barbara
(805) 641-1000 PO BOX 1990
Generator's Phone: x 23 Santa Barbara, CA 93102

Generator's Site Address (if different than mailing address)
125 State Street
Santa Barbara, CA 93101

6. Transporter 1 Company Name: Remedial Transportation Serv. — U.S. EPA ID Number: CAR000181560

7. Transporter 2 Company Name — U.S. EPA ID Number:

8. Designated Facility Name and Site Address
Waste Connection Chiquita Landfill
29201 Henry Mayo Dr
Castaic Ca 91384
Facility's Phone: — U.S. EPA ID Number:

	9. Waste Shipping Name and Description	10. Containers No.	10. Containers Type	11. Total Quantity	12. Unit Wt./Vol.	
	1. Non Hazardous Soil	001	DT	00018	Y	
	2.					
	3.					
	4.					

13. Special Handling Instructions and Additional Information
Approval # CCL-10-020
Sales Order #: 71V2891850

14. GENERATOR'S/OFFEROR'S CERTIFICATION: I hereby declare that the contents of this consignment are fully and accurately described above by the proper shipping name, and are classified, packaged, marked and labeled/placarded, and are in all respects in proper condition for transport according to applicable international and governmental regulations.

Generator's/Offeror's Printed/Typed Name: Cenen Aparicio — Signature: Cenen Aparicio — Month 05 Day 17 Year 10

15. International Shipments ☐ Import to U.S. ☐ Export from U.S. Port of entry/exit:
Transporter Signature (for exports only): Date leaving U.S.:

16. Transporter Acknowledgment of Receipt of Materials
Transporter 1 Printed/Typed Name: Margarito Sucedo — Signature: M. Sucedo — Month 05 Day 17 Year 10
Transporter 2 Printed/Typed Name — Signature — Month Day Year

17. Discrepancy
17a. Discrepancy Indication Space ☐ Quantity ☐ Type ☐ Residue ☐ Partial Rejection ☐ Full Rejection
Manifest Reference Number:
17b. Alternate Facility (or Generator) — U.S. EPA ID Number
Facility's Phone:
17c. Signature of Alternate Facility (or Generator) — Month Day Year

18. Designated Facility Owner or Operator: Certification of receipt of materials covered by the manifest except as noted in Item 17a
Printed/Typed Name — Signature — Month Day Year

GENERATOR — INT'L — TRANSPORTER — DESIGNATED FACILITY

CHIQUITA CANYON .
Weighed at:
CHIQUITA CANYON LANDFILL
29201 Henry Mayo Dr
Castaic, CA 91384

Deputy: Rosa L
BILL TO: 344
CLEAN HARBORS ENVIRONMENTAL

Vehicle ID: CH-R32
Reference:

Origin: SANTA BARBARA
DATE IN: 05/17/2010 TIME IN: 15:50:04
DATE OUT: 05/17/2010 TIME OUT: 15:50

INBOUND TICKET Number: 01-084421

SCALE 3 GROSS WT.	84060	LB
STORED TARE WT.	33200	LB
NET WEIGHT	50860	LB

Qty	Description	Amount
25.43	Soil - Non Hazardous	

X_____

(Driver Signature)

This is to certify that this load does not contain any hazardous materials, medical waste or liquids of any type.

WEIGHMASTER CERTIFICATE:

THIS IS TO CERTIFY that the following described commodity was weighed, measured, or counted by a weighmaster, whose signature is on this certificate, who is a recognized authority of accuracy, as prescribed by Chapter 7 (commencing with Section 12700) of Division 5 of the California Business and Professions Code), administered by the Division of Measurement Standards of the California Department of Food and Agriculture.

NON-HAZARDOUS WASTE MANIFEST

1. Generator ID Number: CAC002650488
2. Page 1 of
3. Emergency Response Phone: (661) 746-1132
4. Waste Tracking Number

5. Generator's Name and Mailing Address: City Of Santa Barbara, PO BOX 1990, Santa Barbara, CA 93102
Generator's Phone: (805)641-1000 x 23
Generator's Site Address (if different than mailing address): 123 State Street, Santa Barbara, CA 93101

6. Transporter 1 Company Name: Remedial Transportation Serv.
U.S. EPA ID Number: CAR000K1560

7. Transporter 2 Company Name
U.S. EPA ID Number

8. Designated Facility Name and Site Address: Waste Connection Chiquita Landfill, 29201 Henry Mayo Dr, Castaic Ca 91384
U.S. EPA ID Number
Facility's Phone:

	9. Waste Shipping Name and Description	10. Containers No.	10. Containers Type	11. Total Quantity	12. Unit Wt./Vol.	
1.	Non Hazardous Soil	001	DT	00015	Y	
2.						
3.						
4.						

13. Special Handling Instructions and Additional Information
Approval # CCL-10-000
Sales Order #

14. **GENERATOR'S/OFFEROR'S CERTIFICATION:** I hereby declare that the contents of this consignment are fully and accurately described above by the proper shipping name, and are classified, packaged, marked and labeled/placarded, and are in all respects in proper condition for transport according to applicable international and governmental regulations.

Generator's/Offeror's Printed/Typed Name: Cenen Aparicio
Signature: Cenen Aparicio
Month 05 Day 17 Year 10

15. International Shipments ☐ Import to U.S. ☐ Export from U.S. Port of entry/exit:
Transporter Signature (for exports only): Date leaving U.S.:

16. Transporter Acknowledgment of Receipt of Materials

Transporter 1 Printed/Typed Name: Margarito Saucedo
Signature: M. Saucedo
Month 05 Day 17 Year 10

Transporter 2 Printed/Typed Name
Signature
Month Day Year

17. Discrepancy

17a. Discrepancy Indication Space ☐ Quantity ☐ Type ☐ Residue ☐ Partial Rejection ☐ Full Rejection

Manifest Reference Number:

17b. Alternate Facility (or Generator)
U.S. EPA ID Number
Facility's Phone:

17c. Signature of Alternate Facility (or Generator)
Month Day Year

18. Designated Facility Owner or Operator: Certification of receipt of materials covered by the manifest except as noted in Item 17a

Printed/Typed Name: Landers
Signature
Month 5 Day 17 Year 10

GENERATOR | INT'L | TRANSPORTER | DESIGNATED FACILITY

169-BLC-O 6 10498 (Rev. 9/09) COPY

CHIQUITA CANYON LANDFILL
Weighed at:
CHIQUITA CANYON LANDFILL
29201 Henry Mayo Dr
Castaic, CA 91384

Deputy: D Landeros
Deposit: D Landeros
BILL TO: 344
CLEAN HARBORS ENVIRONMENTAL

Vehicle ID: CH-R26
Reference:

Origin: SANTA BARBARA
DATE IN: 05/17/2010 TIME IN: 12:45:02
DATE OUT: 05/17/2010 TIME OUT: 12:53

INBOUND TICKET Number: 01-084357

MANUAL GROSS WT.	80140	LB
SCALE 1 TARE WT.	31160	LB
NET WEIGHT	48980	LB

Qty	Description	Amount
24.49	Soil - Non Hazardous	

X_____

(Driver Signature)

This is to certify that this load does not contain any hazardous materials, medical waste or liquids of any type.

WEIGHMASTER CERTIFICATE:

THIS IS TO CERTIFY that the following described commodity was weighed, measured, or counted by a weighmaster, whose signature is on this certificate, who is a recognized authority of accuracy, as prescribed by Chapter 7 (commencing with Section 12700) of Division 5 of the California Business and Professions Code), administered by the Division of Measurement Standards of the California Department of Food and Agriculture.

NON-HAZARDOUS WASTE MANIFEST	1. Generator ID Number 6 5 0 4 8 8	2. Page 1 of	3. Emergency Response Phone	4. Waste Tracking Number

GENERATOR

5. Generator's Name and Mailing Address
City Of Santa Barbara
PO BOX 1990
Santa Barbara, CA 93102
(805) 641-1000
x 23

Generator's Site Address (if different than mailing address)
123 State Street
Santa Barbara, CA 93101

Generator's Phone:

6. Transporter 1 Company Name: Remedial Transportation Services — U.S. EPA ID Number: CAR 000181560

7. Transporter 2 Company Name — U.S. EPA ID Number:

8. Designated Facility Name and Site Address
Waste Connection Chiquita Landfill
29201 Henry Mayo Dr
Castaic Ca 91384

U.S. EPA ID Number:

Facility's Phone:

	9. Waste Shipping Name and Description	10. Containers No.	10. Containers Type	11. Total Quantity	12. Unit Wt./Vol.	
1.	Non Hazardous Soil	001	DT	00018	Y	
2.						
3.						
4.						

13. Special Handling Instructions and Additional Information
Approval #CCL-10-100
Sales Order #:

14. **GENERATOR'S/OFFEROR'S CERTIFICATION:** I hereby declare that the contents of this consignment are fully and accurately described above by the proper shipping name, and are classified, packaged, marked and labeled/placarded, and are in all respects in proper condition for transport according to applicable international and governmental regulations.

Generator's/Offeror's Printed/Typed Name: Genen Aparicio — Signature: Genen Aparicio — Month 05 Day 17 Year 10

INT'L

15. International Shipments ☐ Import to U.S. ☐ Export from U.S. Port of entry/exit:
Transporter Signature (for exports only): Date leaving U.S.:

TRANSPORTER

16. Transporter Acknowledgment of Receipt of Materials

Transporter 1 Printed/Typed Name: Jordan Lee — Signature: Jordan Lee — Month 05 Day 17 Year 10

Transporter 2 Printed/Typed Name — Signature — Month Day Year

DESIGNATED FACILITY

17. Discrepancy

17a. Discrepancy Indication Space ☐ Quantity ☐ Type ☐ Residue ☐ Partial Rejection ☐ Full Rejection

Manifest Reference Number:

17b. Alternate Facility (or Generator) — U.S. EPA ID Number

Facility's Phone:

17c. Signature of Alternate Facility (or Generator) — Month Day Year

18. Designated Facility Owner or Operator: Certification of receipt of materials covered by the manifest except as noted in Item 17a

Printed/Typed Name: Landeros — Signature — Month 05 Day 17 Year 10

169-BLC-O 6 10498 (Rev. 9/09) COPY

CHIQUITA CANYON LANDFILL
Weighed at:
CHIQUITA CANYON LANDFILL
29201 Henry Mayo Dr
Castaic, CA 91384

Deputy: Rosa L
BILL TO: 344
CLEAN HARBORS ENVIRONMENTAL

Vehicle ID: CH-R26
Reference:

Origin: SANTA BARBARA
DATE IN: 05/17/2010 TIME IN: 16:07:07
DATE OUT: 05/17/2010 TIME OUT: 16:07

INBOUND TICKET Number: 01-084432

SCALE 3 GROSS WT.	80180	LB
STORED TARE WT.	31160	LB
NET WEIGHT	49020	LB

Qty	Description	Amount
24.51	Soil - Non Hazardous	

X_____

(Driver Signature)

This is to certify that this load does not contain any hazardous materials, medical waste or liquids of any type.

WEIGHMASTER CERTIFICATE:

THIS IS TO CERTIFY that the following described commodity was weighed, measured, or counted by a weighmaster, whose signature is on this certificate, who is a recognized authority of accuracy, as prescribed by Chapter 7 (commencing with Section 12700) of Division 5 of the California Business and Professions Code), administered by the Division of Measurement Standards of the California Department of Food and Agriculture.

Truck # 26 L.P. TPD3176 Trailer L.P. 4FKD314

NON-HAZARDOUS WASTE MANIFEST

1. Generator ID Number: CAC000365048 8
2. Page 1 of
3. Emergency Response Phone: (661) 746-1132
4. Waste Tracking Number:

5. Generator's Name and Mailing Address: City Of Santa Barbara, PO BOX 1990, Santa Barbara, CA 93102
Generator's Phone: (805) 641-1000 x 23
Generator's Site Address (if different than mailing address): 123 State Street, Santa Barbara, CA 93101

6. Transporter 1 Company Name: Remedial Transportation Services
U.S. EPA ID Number: CAT 000181560

7. Transporter 2 Company Name:
U.S. EPA ID Number:

8. Designated Facility Name and Site Address: Waste Connection Chiquita Landfill, 29201 Henry Mayo Dr, Castaic Ca 91384
Facility's Phone:
U.S. EPA ID Number:

	9. Waste Shipping Name and Description	10. Containers No.	10. Containers Type	11. Total Quantity	12. Unit Wt./Vol.	
1.	Non Hazardous Soil	001	DT	00013	T	
2.						
3.						
4.						

13. Special Handling Instructions and Additional Information
Approval # CCL-10-020
Sales Order # 7W2891850

14. **GENERATOR'S/OFFEROR'S CERTIFICATION:** I hereby declare that the contents of this consignment are fully and accurately described above by the proper shipping name, and are classified, packaged, marked and labeled/placarded, and are in all respects in proper condition for transport according to applicable international and governmental regulations.

Generator's/Offeror's Printed/Typed Name: Cemen Aparicio
Signature: [signature]
Month 05 Day 17 Year 10

15. International Shipments ☐ Import to U.S. ☐ Export from U.S. Port of entry/exit:
Transporter Signature (for exports only): Date leaving U.S.:

16. Transporter Acknowledgment of Receipt of Materials
Transporter 1 Printed/Typed Name: Jordan Lee
Signature: Jordan Lee
Month 05 Day 17 Year 10
Transporter 2 Printed/Typed Name:
Signature:
Month Day Year

17. Discrepancy
17a. Discrepancy Indication Space ☐ Quantity ☐ Type ☐ Residue ☐ Partial Rejection ☐ Full Rejection
Manifest Reference Number:
17b. Alternate Facility (or Generator)
U.S. EPA ID Number
Facility's Phone:
17c. Signature of Alternate Facility (or Generator)
Month Day Year

18. Designated Facility Owner or Operator: Certification of receipt of materials covered by the manifest except as noted in item 17a
Printed/Typed Name: [signature]
Signature: [signature]
Month Day Year 5 17 1

GENERATOR
INT'L
TRANSPORTER
DESIGNATED FACILITY

169-BLC-O 6 10498 (Rev. 9/09)

COP

Appendix 8

Compaction Test Report

Pacific
Materials
Laboratory
of Santa Barbara, Inc.

35-A South La Patera
Lane
P.O. Box 96
Goleta, CA 93116
Ph: (805) 964-6901

Santa Ynez
Ph: (805) 688-7587

FAX No: (805) 964-6239
E-mail: pml@pml.sbcoxmail.com

REPORT OF INTERIM COMPACTION TESTS

Client: Rincon Consultants, Inc.
Project: Excavation Backfill
Address: 125 State Street
Contractor:
Grading: RTS

Date of Issue: June 7, 2010
Lab No.: 88524-2
File No.: 10-13282-2
Test Date: May 20 - 24, 2010
Technician: John Winieski

In accordance with your request, please be advised the relative compaction of the subgrade soil and base at the subject project was determined by fifteen (15) density tests by the nuclear gauge test method. The Maximum Density-Optimum Moisture data used in determining the relative compaction was determined in the laboratory from soil samples using the ASTM D-1557 Method of Compaction. The results are tabulated below:

Type	Description	Maximum Density (pcf)	Optimum Moisture (%)
I	Yellow SAND Curve Points: (104.3 @ 18.0) (106.8 @ 15.0) (103.9 @ 11.0)	107.0	15

The test locations are shown on Enclosures A while the results of the In-Place Density Tests are tabulated below.

FIELD DENSITY SUMMARY (Nuclear Test Method ASTM D-2922)

Test No.	Date	Soil Type	Max Density (pcf)	Approximate Elevation* (ft)	Field Moisture Content (%)	Dry Density (pcf)	Relative Compaction (%)	Remarks
1	05/20/10	I	107.0	2' BFG	14.6	102.8	96.1	
2	05/20/10	I	107.0	4' BFG	13.9	102.0	95.3	
3	05/20/10	I	107.0	7' BFG	15.5	103.5	96.7	
4	05/20/10	I	107.0	1' BFG	16.0	104.1	97.3	
5	05/20/10	I	107.0	3' BFG	14.3	101.3	94.7	
6	05/20/10	I	107.0	5' BFG	14.0	101.7	95.0	
7	05/20/10	I	107.0	1' BFG	15.2	103.8	97.0	
8	05/20/10	I	107.0	2' BFG	16.3	103.0	96.3	
9	05/20/10	I	107.0	6' BFG	14.7	102.0	95.3	
10	05/21/10	I	107.0	1' BFG	15.5	102.3	95.6	
11	05/21/10	I	107.0	1' BFG	16.2	105.2	98.3	
12	05/21/10	I	107.0	1' BFG	15.0	100.4	93.8	
13	05/24/10	I	107.0	FG	14.3	102.4	95.7	
14	05/24/10	I	107.0	FG	13.5	103.5	96.7	
15	05/24/10	I	107.0	FG	15.6	102.6	95.9	

Tests were performed for the backfill of the excavated area on the south perimeter of the property. Based upon the observations and testing, it is the opinion of the undersigned that fill placement was performed in compliance with the recommendations of the soil report.

If you have any questions concerning this report, please do not hesitate to call. Thank you for the opportunity of providing this service.

Ronald J. Pike,
Geotechnical Engineer, G.E. 2291

cc: Penfield and Smith - Santa Barbara, Attn: Harper Lash, Fax (805) 966-9801
Solvang City Bldg. Dept, Attn: Tully Clifford, Fax (805) 693-1070

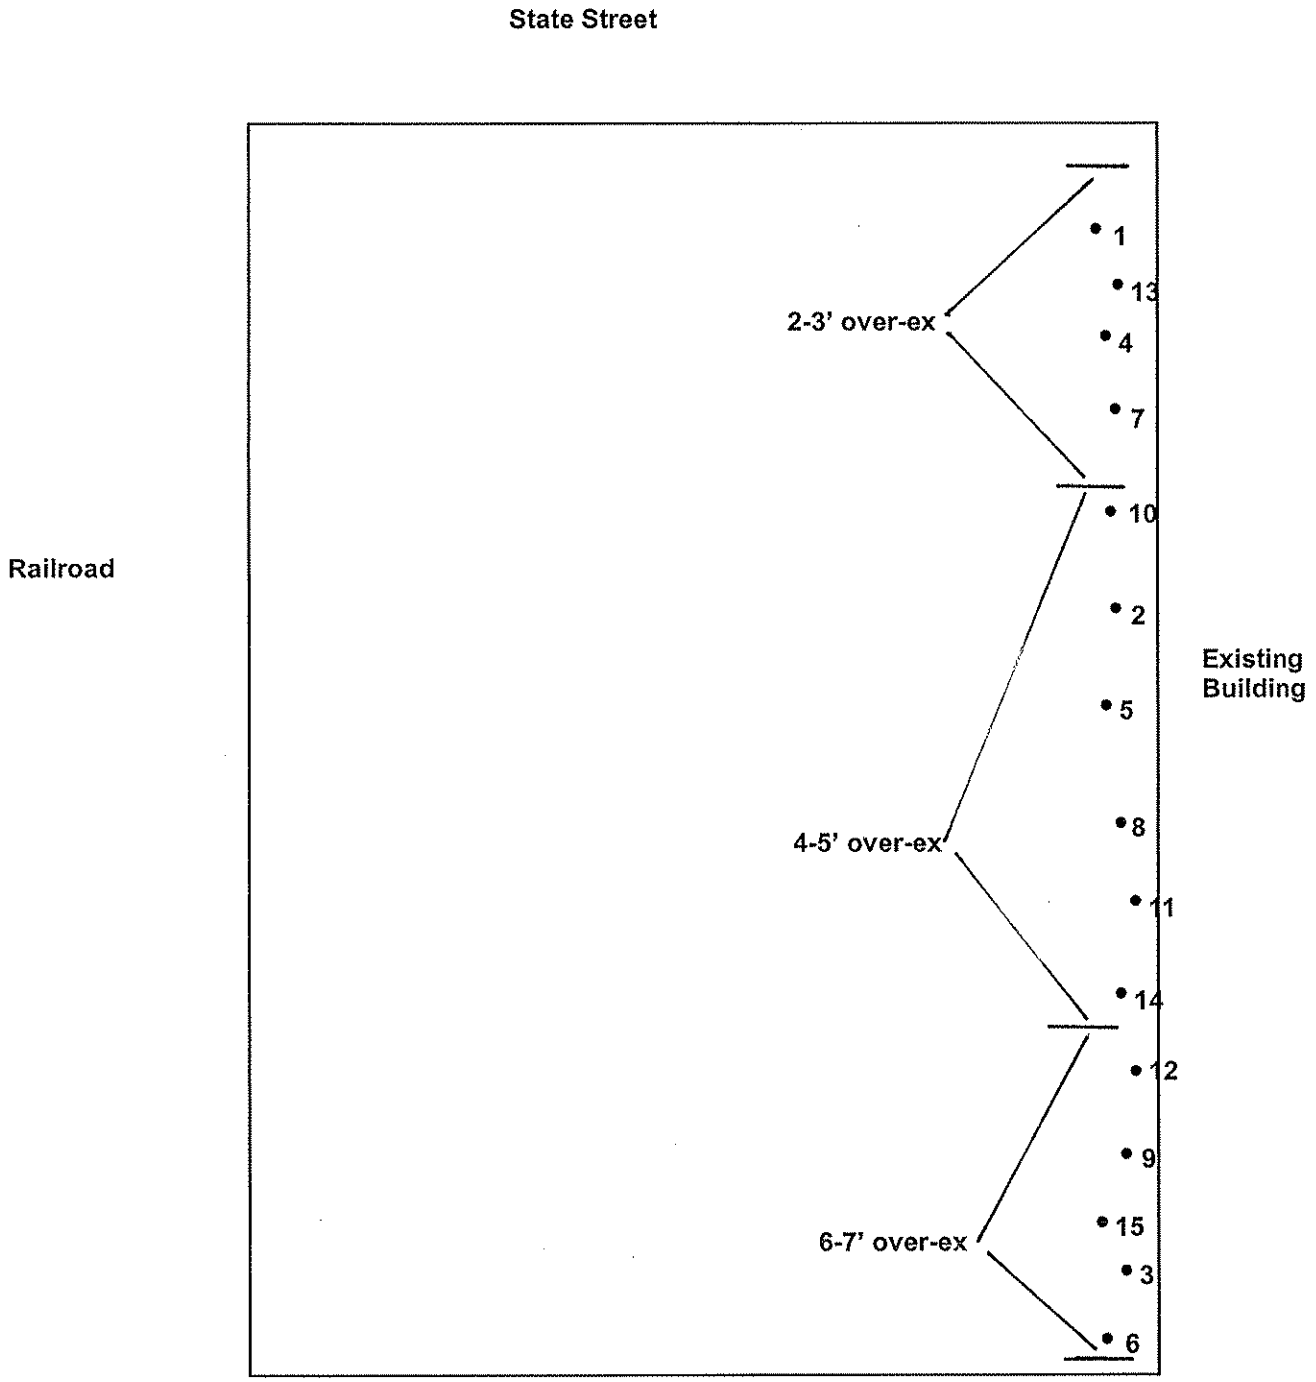

SITE PLAN

125 STATE STREET

N

Scale: none	Enclosure A Lab No.: 88524-2 File No.: 10-10-13282-2 June 7, 2010

Pacific Materials Laboratory, Inc.